RANGE ROVER SPORT Electrical Reference Library

- **INTRODUCTION**
  - Title Page
  - USING THIS PUBLICATION
  - HARNESS REPAIRS
  - FIBRE OPTICS
- **RIGHT-HAND DRIVE**
  - TABLE OF CIRCUIT OPTION CODES
  - C0004 Horn-RH
  - C0007 Switch-Bonnet
  - C0008 Pump-washer-front/ rear screen
  - C0009 Headlamp-LH
  - C0011 Headlamp-RH
  - C0026L Switch-Brake-fluid level
  - C0026R Switch-Brake-fluid level
  - C0030L Motor-Wiper-Windscreen
  - C0030R Motor-Wiper-Windscreen
  - C0040 Diagnostic socket
  - C0041 Lighting control switch
  - C0047L Main harness to instrument panel harness
  - C0047R Main harness to instrument panel harness
  - C0050 Sensor-Pad wear-Front-LH
  - C0052 Ignition coil-2 - PV8
  - C0053 Alternator-generator - PV8
  - C0053M Alternator-generator - DV6
  - C0056 Motor-Blower-Front
  - C0067 Main harness to instrument panel harness
  - C0074 Cigar lighter-illumination
  - C0075L Switch-Brake pedal
  - C0075R Switch-Brake pedal
  - C0076L Lamp-Footwell-Front-RH
  - C0076R Lamp-Footwell-Front-RH
  - C0077L Lamp-Footwell-Front-LH
  - C0077R Lamp-Footwell-Front-LH
  - C0081 Switch pack-Window lift
  - C0082L Clock spring
  - C0082R Clock spring
  - C0083 Main harness to instrument panel harness
  - C0084 Main harness to roof harness
  - C0087 Switch-Window-Passenger door
  - C0089 Cigar lighter
  - C0097 Motor-Seat height-Front
  - C0103A Sensor-Temperature-Pre-catalytic converter
  - C0103H Sensor-Temperature-Pre-catalytic converter
  - C0103M Sensor-Catalyst
  - C0114T Unit-Fuel Tank
  - C0119T Lamp-Load space-RH
  - C0121T Tail lamp unit-LH
  - C0122T Main harness to tailgate harness
  - C0125T Tail lamp unit-RH
  - C0128 Valve-Solenoid-Refrigerant - PV8
  - C0132 Sensor-Low pressure fuel
  - C0144T Main harness to tailgate harness
  - C0147 Sensor-Engine coolant-level
  - C0149 Sensor-MAF/IAT-Bank 1
  - C0150 Sensor-Knock-Bank 1-Front
  - C0152 Purge control valve - PV8
  - C0156 Ignition coil-1 - PV8

- C0168 Sensor-Crankshaft-position (CKP) - PV8
- C0168B Sensor-Crankshaft-position (CKP) - PV8
- C0168M Sensor-Crankshaft-position (CKP) - DV6
- C0169 Sensor-Engine coolant-temperature (ECT) - PV8
- C0169M Sensor-Engine coolant temperature (ECT) - DV6
- C0175 Unit-Electric throttle - PV8
- C0176M Sensor-Camshaft-position (CMP) - DV6
- C0178N Starter motor - DV6
- C0178R Starter motor - PV8
- C0179 Starter motor - PV8
- C0179M Starter motor - DV6
- C0182 Solenoid-Clutch-Compressor (A/C)
- C0184M Sensor-Temperature-Fuel rail - DV6
- C0186 Sensor-Temperature and Manifold-Absolute Pressure (TMAP)
- C0186M Sensor-Manifold Absolute-Pressure (MAP) - DV6
- C0187M Switch-Oil pressure - DV6
- C0189L ECU-Glow plug
- C0189R ECU-Glow plug
- C0190L ECU-Glow plug
- C0190R ECU-Glow plug
- C0192N Battery - DV6
- C0192R Battery - PV8
- C0193 TCM and Control Valve Body
- C0204 Pump 1-High pressure fuel
- C0205 Pump 2-High pressure fuel
- C0223L Instrument panel harness to main harness
- C0223R Instrument panel harness to main harness
- C0227 Lamp-Glove compartment
- C0229L Instrument panel harness to main harness
- C0229R Instrument panel harness to main harness
- C0230 Instrument cluster
- C0231L Instrument panel harness to main harness
- C0231R Instrument panel harness to main harness
- C0232L Clock-Analogue
- C0232R Clock-Analogue
- C0237B Heater-seat cushion
- C0246T Windshield RH heater element
- C0247T Windshield LH heater element
- C0251L Module-Air bag-Passenger
- C0251R Module-Air bag-Passenger
- C0256 Restraints Control Module (RCM)
- C0256A Restraints Control Module (RCM)
- C0257 Module-Air bag-Driver
- C0261L Module-Air bag-Passenger
- C0261R Module-Air bag-Passenger
- C0269 Sensor-Temperature-Differential oil
- C0272M Throttle-EGR-Inlet - DV6
- C0276 Ignition coil-3 - PV8
- C0278L Switch-Steering column-Wiper
- C0278R Switch-Steering column-Wiper
- C0304 Motor-Window-Rear
- C0309 RH rear surround sound speaker
- C0310 Speaker-Low range-Rear door
- C0311 LH rear surround sound speaker
- C0319 Mirror-Door
- C0355 Lamp-Interior-Front
- C0357 Lamp-Interior-Front
- C0358 Sensor-Volumetric
- C0369 Speaker-Mid range-Front door
- C0369L Center speaker
- C0369R Center speaker
- C0374L Clock spring
- C0374R Clock spring
- C0376 Main harness to chassis harness
- C0377T Main harness to chassis harness

- C0381 Heated rear window (HRW)
- C0382 Heated rear window (HRW)
- C0384 Tailgate harness to main harness
- C0388 Motor-Wiper-Rear screen
- C0390 Chassis harness to main harness
- C0391 Chassis harness to main harness
- C0396 Main harness to door harness
- C0397 Main harness to door harness
- C0398 Main harness to door harness
- C0399 Main harness to door harness
- C0400 Sensor-Parking aid-Inner-Front-LH
- C0401 Sensor-Parking aid-Inner-Front-RH
- C0402 Sensor-Parking aid-Outer-Front-LH
- C0403 Sensor-Parking aid-Outer-Front-RH
- C0406 Module-Air bag-Driver
- C0412 Sensor-Ambient air-temperature
- C0417 Sensor-Temperature-Evaporator
- C0419 Intake air door motor
- C0435 Main harness to rear door harness
- C0436 Main harness to rear door harness
- C0439 Door harness to main harness
- C0440 Door harness to main harness
- C0441 Motor-Door lock-Front
- C0442 Motor-Door-lock-Rear
- C0460 Main harness to door harness
- C0464 Main harness to door harness
- C0467 Main harness to instrument panel harness
- C0469L Instrument panel harness to main harness
- C0469R Instrument panel harness to main harness
- C0476 Glow plug
- C0477 Glow plug
- C0478 Glow plug
- C0479 Glow plug
- C0491T Amplifier-power
- C0492T Amplifier-power
- C0493T Amplifier-power
- C0502 Wheel speed Sensor-Rear-LH
- C0503 Wheel speed Sensor-Rear-RH
- C0506L ABS module
- C0506R ABS module
- C0513 Lamp-Fog-Front-RH
- C0514 Lamp-Fog-Front-LH
- C0516 Wheel speed Sensor-Front-LH
- C0517 Wheel speed Sensor-Front-RH
- C0518 Motor-Seat-recline-LH
- C0518 Motor-Seat-recline-LH
- C0520L Passive-sounder
- C0520R Passive-sounder
- C0522 Fuel injector-No.1 - PV8
- C0522M Fuel injector-No.1 - DV6
- C0523 Fuel injector-No.2 - PV8
- C0523M Fuel injector-No.2 - DV6
- C0524 Fuel injector-No.3 - PV8
- C0524M Fuel injector-No.3 - DV6
- C0525 Fuel injector-No.4 - PV8
- C0525M Fuel injector-No.4 - DV6
- C0526 Fuel injector-No.5 - PV8
- C0526M Fuel injector-No.5 - DV6
- C0527 Fuel injector-No.6 - PV8
- C0527M Fuel injector-No.6 - DV6
- C0528 Fuel injector-No.7 - PV8
- C0529 Fuel injector-No.8 - PV8
- C0531 Speaker-High range-Front door
- C0556L Ground point
- C0557 Ground point

- C0558L Ground point
- C0558R Ground point
- C0559L Ground point
- C0559R Ground point
- C0560L Ground point
- C0560R Ground point
- C0561T Ground point
- C0562R Ground point
- C0563L Ground point
- C0564 Ground point
- C0565T Ground point
- C0570L Junction-box engine
- C0570R Junction-box engine
- C0580 Junction box-Central
- C0581 Junction box-Central
- C0582 Junction box-Central
- C0583L Junction box-Central
- C0583R Junction box-Central
- C0584L Junction box-Central
- C0584R Junction box-Central
- C0585L Junction box-Central
- C0585R Junction box-Central
- C0586L Junction box-Central
- C0586R Junction box-Central
- C0610 Roof harness to main harness
- C0615 Switch-Tail door-open
- C0617 Motor-CDL-Tailgate-Upper
- C0620 Sensor-Washer fluid level
- C0632 Junction-box engine
- C0634 Engine control-module (ECM) - PV8
- C0635L Engine control-module (ECM) - PV8
- C0635R Engine control-module (ECM) - PV8
- C0642 Sensor-Heated oxygen-Post catalyst-Right bank 1
- C0644 Sensor-Heated oxygen-Pre catalyst-Left bank 2
- C0645 Sensor-Heated oxygen-Pre catalyst-Right bank 1
- C0646L Fan-E-box
- C0646R Fan-E-box
- C0647L Dynamic response module
- C0647R Dynamic response module
- C0656 Accelerometer-Lower
- C0657T Accelerometer-Upper
- C0658L Engine control-module (ECM) - DV6
- C0658R Engine control-module (ECM) - DV6
- C0659M Engine control-module (ECM) - DV6
- C0666L Sounder-Battery backed
- C0666R Sounder-Battery backed
- C0674T Receiver-Radio-frequency (RF)
- C0680 Speaker-High range-Rear door
- C0688 Speaker-Low range-Front door
- C0690T Motor-Security-Fuel flap
- C0698T Mirror-Electrochromic
- C0700A Switch pack-Center-console
- C0700B Switch pack-Center-console
- C0700L Switch pack-Center-console
- C0700R Switch pack-Center-console
- C0718 Motor-Seat-Recline-Driver
- C0718 Motor-Seat-Recline-Driver
- C0721 Motor-Seat-Forward-rearward
- C0732 Switch-Window-Rear
- C0735 Water in fuel sensor
- C0736 Mirror-Vanity-RH
- C0737 Mirror-Vanity-LH
- C0740 Motor-Window-Front
- C0751 Seat harness to main harness
- C0752 Seat harness to main harness

- C0755 Module-Heated seat-Front
- C0766 Instrument panel harness to A/C harness
- C0770 Valve block-Dynamic response
- C0771 Valve block-Dynamic response
- C0773 Switch pack-Seat
- C0775 Seat link harness to seat harness
- C0775 Seat link harness to seat harness
- C0780 Air supply unit
- C0781 Air supply unit
- C0784T Roof opening panel control module
- C0787L Sensor-Position-Accelerator pedal
- C0787R Sensor-Position-Accelerator pedal
- C0790L Sensor-Sunlight
- C0790R Sensor-Sunlight
- C0797 Air conditioning (A/C) harness to instrument panel harness
- C0803 Rear door harness to main harness
- C0804 Rear door harness to main harness
- C0807 Ground point
- C0809 Ground point
- C0810 Ground point
- C0811 Ground point
- C0812T Main harness to telematics harness
- C0820T Module-Video interface-Japan
- C0828 Pump-Power wash
- C0832A Lamp-High mounted stop
- C0862L Sensor-Steering-angle
- C0862R Sensor-Steering-angle
- C0867L Module-Air suspension
- C0867R Module-Air suspension
- C0868TA Main harness to console harness
- C0868TL Main harness to console harness
- C0868TR Main harness to console harness
- C0876T Main harness to trailer connector
- C0884 Sensor-Temperature/ Humidity
- C0897 Module-Navigation system-Asia
- C0898 Module-Navigation system-Asia
- C0899 Module-Navigation system-Asia
- C0903A Console harness to main harness
- C0903B Console harness to main harness
- C0903L Console harness to main harness
- C0903R Console harness to main harness
- C0904 Link harness to engine harness - PV8
- C0904B Link harness to engine harness - PV8
- C0908 Sensor-Heated oxygen-Post catalyst-Left bank 2
- C0909 Engine harness to link harness - PV8
- C0925 Fuel fired booster heater
- C0926 Fuel fired booster heater
- C0934 Heater-Washer-jet-LH
- C0942T Socket-Accessory-Rear
- C0946 Heater-Washer-jet-RH
- C0950 Sensor-Side impact-Front door
- C0957 Module-Parking aid
- C0958 Module-Parking aid
- C0961T Sensor-Rain-Ambient light
- C0962 Sensor-Occupancy-detection
- C0963 Sensor-Parking aid-Outer-Rear-LH
- C0964 Sensor-Parking aid-Inner-Rear-LH
- C0965 Sensor-Parking aid-Inner-Rear-RH
- C0966 Sensor-Parking aid-Outer-Rear-RH
- C0968 Sensor-Pad wear-Rear-RH
- C0974 Pump-Lumbar
- C0978 Lamp-Puddle-Front
- C0980 Lamp-Puddle-Rear
- C0999M Valve-Solenoid-Refrigerant - DV6
- C1000 Header-Connector

- C1111 Lamp-Map-LH
- C1112 Lamp-Map-RH
- C1165 Main harness to instrument panel harness
- C1166L Main harness to instrument panel harness
- C1166R Main harness to instrument panel harness
- C1167L Instrument panel harness to main harness
- C1167R Instrument panel harness to main harness
- C1168L Instrument panel harness to main harness
- C1168R Instrument panel harness to main harness
- C1170L Ground point
- C1170T Ground point
- C1184 Instrument panel harness to main harness
- C1185 Main harness to instrument panel harness
- C1254 Clock spring
- C1323 Capacitor - PV8
- C1339 Pump-Leak detection
- C1352 Sub-woofer
- C1355T Ground point
- C1381 Trailer pick-up (12N/12S)
- C1382 Trailer pick-up (12N/12S)
- C1388T Main harness to trailer connector
- C1389T Main harness to trailer connector
- C1390T Main harness to trailer connector
- C1393L Switch-Steering column-Lighting
- C1393R Switch-Steering column-Lighting
- C1396L Assembly-Steering column
- C1396R Assembly-Steering column
- C1398R Ground point
- C1401 Switch-Seat heat-Rear-LH
- C1403 Switch-Seat heat-Rear-RH
- C1408 Capacitor
- C1413 Ground point
- C1414 Trailer harness to main harness
- C1415 Trailer harness to main harness
- C1416 Trailer harness to main harness
- C1443L Sensor-Temperature-In-car
- C1443R Sensor-Temperature-In-car
- C1457 Module-Parking aid
- C1462 Lamp-Interior-Front
- C1465 Sensor-Pressure-Air Conditioning
- C1479T Air bag-Side curtain-LH
- C1480T Air bag-Side curtain-RH
- C1500 Glow plug
- C1501 Glow plug
- C1526M Engine harness to link harness
- C1527M Link harness to engine harness
- C1535L Ground point
- C1535R Ground point
- C1536 Ground point
- C1542 Module-Navigation system-Japan
- C1547L Ground point
- C1547M Ground point
- C1547R Ground point
- C1559 Sensor-Heated oxygen-Pre catalyst-Left bank 2
- C1559A Sensor-Oxygen-Pre catalyst
- C1598T GPS antenna
- C1599 Module-Navigation system-Japan
- C1600T Antenna-TV
- C1601T Antenna-TV
- C1602T Antenna-TV
- C1603T Antenna-TV
- C1610 Valve block-Dynamic response
- C1623TL Windshield RH heater element
- C1623TR Windshield RH heater element
- C1624T Windshield LH heater element

- C1629L Switch pack-Center Instrument panel
- C1629R Switch pack-Center Instrument panel
- C1637 Motor-Seat height-Front
- C1641 Battery
- C1649 Restraints Control Module (RCM)
- C1652 Sensor-Front impact-LH side
- C1653 Sensor-Front impact-RH side
- C1654T Sensor-Side impact-LH side-Rear
- C1655T Sensor-Side impact-RH side-Rear
- C1656L Sensor-Yaw Rate
- C1656R Sensor-Yaw Rate
- C1661 Ground point
- C1661 Ground point
- C1684T Reservoir control valve
- C1689 Reservoir control valve
- C1690 Valve block-Dynamic response
- C1692 Socket-Accessory-Center
- C1696T Sensor-Height-Front-LH
- C1697 Sensor-Height-Front-RH
- C1698 Sensor-Height-Rear-RH
- C1699 Sensor-Height-Rear-LH
- C1770 Ignition coil-4 - PV8
- C1771 Ignition coil-5 - PV8
- C1772 Ignition coil-6 - PV8
- C1773T Accelerometer-Rear left
- C1848T AM/FM diversity antenna amplifier
- C1855L Module-Control-Transfer case
- C1855M Module-Control-Transfer case
- C1855N Module-Control-Transfer case
- C1855P Module-Control-Transfer case
- C1855Q Module-Control-Transfer case
- C1855R Module-Control-Transfer case
- C1857L Module-Control-Transfer case
- C1857R Module-Control-Transfer case
- C1893N Alternator-generator - DV6 (3.0L)
- C1893R Alternator-generator - PV8
- C1947 Ground point
- C1948 Clock spring
- C1967 Ground point
- C1970 Ground point
- C1971 Ground point
- C1975 Lamp-Interior-Front
- C2003 PDC harness to main harness
- C2003T Trailer harness to main harness
- C2016 Module-Passenger door
- C2017 Module-Driver door
- C2018 Module-Rear Door
- C2025 Sensor-Speed control
- C2030L Module-Air suspension
- C2030R Module-Air suspension
- C2034 Valve-Water circuit-closure
- C2038A Solenoid-Power steering
- C2038B Solenoid-Power steering
- C2041 Heater-Steering wheel
- C2042 Main harness to rear seat harness
- C2043 Main harness to rear seat harness
- C2046T Fuel fired booster heater receiver
- C2053TA Main harness to console harness
- C2053TL Main harness to console harness
- C2053TR Main harness to console harness
- C2054A Console harness to main harness
- C2054B Console harness to main harness
- C2054L Console harness to main harness
- C2054R Console harness to main harness
- C2055L Module-Steering column lock

- C2055R Module-Steering column lock
- C2057 Module-Passenger door
- C2058 Module-Driver door
- C2084 Module-Heated seat-Rear
- C2087 Ignition coil-7 - PV8
- C2088 Ignition coil-8 - PV8
- C2099 Front control valve
- C2101 Rear control valve
- C2102T Amplifier-power
- C2104 Module-Navigation system-Japan
- C2105 Audio head unit
- C2106 Receiver-Television
- C2115 Audio head unit
- C2116T Rear seat entertainment module
- C2117 Receiver-Television
- C2126 Sensor-Side impact-LH side-Front
- C2127 Sensor-Side impact-RH side-Front
- C2128 Sensor-Safety belt tension
- C2130 LH air temperature door motor
- C2131 RH air temperature door motor
- C2133 Motor-air distribution-Feet / face
- C2134 Screen air distribution door motor
- C2138L Fan-E-box
- C2138R Fan-E-box
- C2147 Module-Steering-wheel-RH
- C2149A Rear seat harness to main harness
- C2149B Rear seat harness to main harness
- C2153L Integrated control panel-Lower
- C2153R Integrated control panel-Lower
- C2158T Module-Tuner-DAB
- C2160T Keyless vehicle module
- C2162T Rear differential control module
- C2163T Rear differential control module
- C2164T Rear differential control module
- C2165 Solenoid-Mode-selector
- C2165 Solenoid-Mode-selector
- C2165A Solenoid-Mode-selector
- C2167 Motor-Transfer box
- C2167 Motor-Transfer box
- C2167A Motor-Transfer box
- C2168 Actuator-Rear differential
- C2169 Sensor-Selector-position
- C2169 Sensor-Selector-position
- C2169A Sensor-Selector-position
- C2178 Module-Parking brake
- C2180A Switch-Electric-park brake
- C2180B Switch-Electric-park brake
- C2180L Switch-Electric-park brake
- C2180R Switch-Electric-park brake
- C2184L Switch pack-Steering-column motor
- C2184R Switch pack-Steering-column motor
- C2188L Dynamic response module
- C2188R Dynamic response module
- C2193L AFS control module
- C2193R AFS control module
- C2198 Initiator-Front-LH
- C2199 Initiator-Front-RH
- C2200 Initiator-Rear-LH
- C2201T Initiator-Rear-RH
- C2206 Module-Heated steering wheel
- C2209L Module-Immobiliser antenna
- C2209R Module-Immobiliser antenna
- C2218 Module-Navigation system-Japan
- C2219T AM/FM diversity antenna amplifier
- C2221 Instrument panel harness to ICE harness

- C2222T Module-Tuner-DAB/SDARS
- C2223T SDARS antenna
- C2225 Module-Navigation system-Japan
- C2226 AV input panel
- C2228 Receiver-Television
- C2229 Fuel fired booster heater receiver
- C2238L Instrument panel harness to engine compartment harness
- C2238R Instrument panel harness to engine compartment harness
- C2239R Instrument panel harness to engine compartment harness
- C2240L Engine compartment harness to instrument panel harness
- C2240R Engine compartment harness to instrument panel harness
- C2241R Engine compartment harness to instrument panel harness
- C2242L Main harness to engine compartment harness
- C2242R Main harness to engine compartment harness
- C2243L Main harness to engine compartment harness
- C2243R Main harness to engine compartment harness
- C2244L Engine compartment harness to main harness
- C2244R Engine compartment harness to main harness
- C2245L Engine compartment harness to main harness
- C2245R Engine compartment harness to main harness
- C2248T ICE harness to instrument panel harness
- C2249T ICE harness to instrument panel harness
- C2251M Sensor-Pressure-Fuel rail - DV6
- C2254M Actuator-EGR-Electric - DV6
- C2255M Actuator-EGR-Electric - DV6
- C2258 Sensor-Temperature and Manifold-Absolute Pressure (TMAP)
- C2260M Valve-Control-Fuel volume - DV6
- C2261M Valve-Control-Fuel pressure - DV6
- C2262 Active engine mounting solenoid
- C2266M Actuator-Vane VGT - DV6
- C2270 Viscous fan - DV6
- C2271 Module-Driver door
- C2272 Module-Passenger door
- C2274L Engine compartment harness to engine harness
- C2274R Engine compartment harness to engine harness
- C2277 Engine compartment harness to bumper harness
- C2278 Bumper harness to engine compartment harness
- C2281 Module-Blower-motor control-Front
- C2283 Module-Steering-wheel-LH
- C2284 Module-Steering-wheel-LH
- C2285 Module-Steering-wheel-RH
- C2287 Clock spring
- C2288 Module-Heated steering wheel
- C2289 Module-Heated steering wheel
- C2293 Engine compartment harness to chassis harness
- C2293A Engine compartment harness to chassis harness
- C2293B Engine compartment harness to chassis harness
- C2294T Chassis harness to engine compartment harness
- C2299 Module-Door handle
- C2301 Module-Rear door handle
- C2302 Module-Rear door latch
- C2312 Module-Door latch
- C2314 ICE harness to console harness
- C2315 Console harness to ICE harness
- C2320L Module-Air suspension
- C2320R Module-Air suspension
- C2321L Module-Air suspension
- C2321R Module-Air suspension
- C2363 Seat harness to main harness
- C2366H Transmission harness to engine compartment harness
- C2368 Main harness to seat harness
- C2369 Module-Fuel-pump driver
- C2373L Engine compartment harness to transmission harness
- C2373R Engine compartment harness to transmission harness
- C2374A Transmission harness to engine compartment harness

- C2374H Transmission harness to engine compartment harness
- C2374J Transmission harness to engine compartment harness
- C2378 Main harness to seat harness
- C2379 Seat harness to main harness
- C2381 Memory control module
- C2382 Memory control module
- C2394 Chassis harness to engine compartment harness
- C2396 Engine compartment harness to chassis harness
- C2409R Main harness to engine compartment harness
- C2410R Engine compartment harness to main harness
- C2411L Main harness to engine compartment harness
- C2412L Engine compartment harness to main harness
- C2414T Amplifier-Audio
- C2415T Amplifier-power
- C2428T Keyless vehicle module
- C2429T Keyless vehicle module
- C2433T Tailgate handle antenna
- C2443 Instrument panel harness to engine compartment harness
- C2444L Engine compartment harness to instrument panel harness
- C2453R Switch-Start-stop
- C2453TL Switch-Start-stop
- C2454 Sensor-MAF/IAT-Bank 2
- C2467 Sensor-Fuel rail-pressure
- C2490T Rear seat entertainment module
- C2491T Rear seat entertainment module
- C2527T Chassis harness to engine compartment harness
- C2528 Engine compartment harness to chassis harness
- C2554T FM antenna amplifier
- C2561 Ground point
- C2563 Ground point
- C2564 Ground point
- C2565 Ground point
- C2566 Ground point
- C2568T Ground point
- C2570T Ground point
- C2577T ICE harness to ICE link harness
- C2581 Engine compartment harness to glow plug harness
- C2583 Glow plug harness to engine compartment harness
- C2584 Glow plug harness to engine compartment harness
- C2590 Module-Trailer-Electric Brake
- C2597T Ground point
- C2598 Ground point
- C2601 Ground point
- C2602L Ground point
- C2602R Ground point
- C2603L Ground point
- C2603R Ground point
- C2606L Ground point
- C2606R Ground point
- C2610 Audio head unit
- C2615T ICE harness to ICE link harness
- C2616 ICE harness to ICE link harness
- C2617T ICE harness to instrument panel harness
- C2618 ICE harness to ICE link harness
- C2620 ICE link harness to ICE harness
- C2622 ICE harness to ICE link harness
- C2626L Ground point
- C2626R Ground point
- C2627L Ground point
- C2627R Ground point
- C2628L Ground point
- C2628R Ground point
- C2629L Ground point
- C2629R Ground point
- C2630L Ground point

- C2630R Ground point
- C2631L Ground point
- C2631R Ground point
- C2635 Ground point
- C2636 Module-Air bag-Driver
- C2637L Module-Air bag-Passenger
- C2637R Module-Air bag-Passenger
- C2638 Sensor-Pressure-mat
- C2639 ICE harness to instrument panel harness
- C2640 ICE link harness to USB link harness
- C2640L Instrument panel harness to ICE harness
- C2640R Instrument panel harness to ICE harness
- C2641L Clock spring
- C2641R Clock spring
- C2646 Ground point
- C2647T Ground point
- C2648T Ground point
- C2649T Ground point
- C2650L Ground point
- C2650R Ground point
- C2652 Ground point
- C2656L Lamp-Automatic gearbox-selector indicator
- C2656R Lamp-Automatic gearbox-selector indicator
- C2657L Lamp-Automatic gearbox-selector indicator
- C2657R Lamp-Automatic gearbox-selector indicator
- C2658TL Gearshift mechanism
- C2658TR Gearshift mechanism
- C2667 ICE harness to instrument panel harness
- C2674L Main harness to engine compartment harness
- C2674R Main harness to engine compartment harness
- C2675L Engine compartment harness to main harness
- C2675R Engine compartment harness to main harness
- C2677 Lamp-Side repeater-Front
- C2683 Pollution sensor
- C2692T Ground point
- C2695 Ground point
- C2696 Ground point
- C2700T Ground point
- C2702 Sub-woofer
- C2712 Ground point
- C2714 Ground point
- C2715T Ground point
- C2722 Sensor-Knock-Bank 1-Rear
- C2723 Sensor-Knock-Bank 2-Rear
- C2724 Engine harness to engine compartment harness
- C2725L Engine compartment harness to engine harness
- C2725R Engine compartment harness to engine harness
- C2727 Instrument panel harness to ICE harness
- C2729 ICE harness to instrument panel harness
- C2730 ICE harness to instrument panel harness
- C2731T Module-Video interface-Japan
- C2739T Main harness to tailgate harness
- C2740 Tailgate harness to main harness
- C2741 Sensor-Differential pressure
- C2741A Sensor-Differential pressure
- C2754T Main harness to console harness
- C2755 Link harness to seat harness
- C2758M Engine harness to transmission harness
- C2759M Transmission harness to engine harness
- C2759N Transmission harness to engine harness
- C2759P Transmission harness to engine harness
- C2759Q Transmission harness to engine harness
- C2761 Sensor-Mass air-flow (MAF)
- C2762 Sensor-Mass air-flow (MAF)
- C2770T Rear seat entertainment module

- C2771 Screen-Rear seat-entertainment
- C2772 Screen-Rear seat-entertainment
- C2773 Cool box
- C2789T SDARS antenna
- C2819L Touch screen display
- C2819R Touch screen display
- C2820 Touch screen display
- C2821 Touch screen display
- C2822 Touch screen display
- C2823 Touch screen display
- C2825 Touch screen display
- C2831 AV input panel
- C2837T Antenna-VICS
- C2846T Module-Video interface-Japan
- C2867 Instrument panel harness to ICE harness
- C2868 ICE harness to ICE link harness
- C2870M Sensor-Temperature-Air charge - DV6
- C2875T Receiver-Radio-frequency (RF)
- C2920T Ground point
- C2921T Ground point
- C2922T Ground point
- C2924T Ground point
- C2926L Ground point
- C2926R Ground point
- C2926T Ground point
- C2927 Ground point
- C2930 Motor-Seat-Tilt-Driver
- C2931 Motor-Seat-Tilt-Driver
- C2934L Ground point
- C2934M Ground point
- C2934R Ground point
- C2937T Relay-Trailer-Rear wiper
- C2946 Air bag-Side
- C2947 Pre-tensioner-Front
- C2948 Switch-Buckle
- C2949 Mat-Belt minder
- C2951 ICE harness to seat link harness
- C2952 ICE harness to seat harness
- C2953 Seat harness to ICE harness
- C2954 Seat link harness to ice harness
- C2955T Rear seat entertainment module
- C2959T Main harness to tailgate harness
- C2967 ICE link harness to ICE harness
- C2968 ICE harness to instrument panel harness
- C2970 ICE harness to instrument panel harness
- C2972T ICE harness to instrument panel harness
- C2973L Instrument panel harness to ICE harness
- C2973R Instrument panel harness to ICE harness
- C2974 ICE harness to instrument panel harness
- C2976T ICE harness to ICE link harness
- C2978T ICE harness to ICE link harness
- C2980T ICE harness to instrument panel harness
- C2987 Receiver-Television
- C2989T Module-SDARS
- C2992 Switch-Passenger-Air bag disable
- C2993 Seat harness to seat link harness
- C2994 Seat link harness to seat harness
- C2994 Seat link harness to seat harness
- C2996L Engine compartment harness to air conditioning harness
- C2996R Engine compartment harness to air conditioning harness
- C2997 Air conditioning (A/C) harness to engine compartment harness
- C2999L Ground point
- C2999R Ground point
- C3001 Ground point
- C3006 Pump-Supercharge-coolant

- C3007 Main harness to main harness
- C3008 Main harness to main harness
- C3009 Engine compartment harness to air suspension harness
- C3010 Air suspension harness to engine compartment harness
- C3016T Antenna-Loadspace-LHS
- C3017T Antenna-Loadspace-Center
- C3018T Antenna-Rear Cabin-Interior
- C3019TL Antenna-Front Cabin-Interior
- C3019TR Antenna-Front Cabin-Interior
- C3023TL Center console antenna-Front
- C3023TR Center console antenna-Front
- C3025 Seat harness to main harness
- C3026 Seat harness to main harness
- C3029L Module-Control-Transfer case
- C3029R Module-Control-Transfer case
- C3030 Seat harness to seat link harness
- C3034L Relay-Transit
- C3034R Relay-Transit
- C3046 Sensor-Knock-Bank 2-Front
- C3049 Water in fuel sensor
- C3049A Water in fuel sensor
- C3050 Sensor-Oil temperature-level
- C3050M Sensor-Oil quality and level
- C3058L Engine compartment harness to link harness
- C3058R Engine compartment harness to link harness
- C3069M Engine harness to engine compartment harness
- C3070L Engine compartment harness to engine harness
- C3070R Engine compartment harness to engine harness
- C3073A Sensor-Temperature-Catalytic converter-Downstream
- C3073H Sensor-Temperature-Catalytic converter-Downstream
- C3073M Sensor-Catalyst
- C3078 Solenoid-Damper-Front-LH
- C3079 Solenoid-Damper-Front-RH
- C3080 Solenoid-Damper-Rear-LH
- C3081 Solenoid-Damper Rear-RH
- C3087T Module-Damping-Continuously variable
- C3088T Module-Damping-Continuously variable
- C3092T ICE harness to ICE link harness
- C3095 Sensor-Height-Front-LH
- C3097 Heater-Seat backrest-Rear-RH
- C3110 Sensor-Seat position-Driver
- C3123L Relay-Transit
- C3123R Relay-Transit
- C3126 Engine compartment harness to link harness
- C3127 Link harness to engine compartment harness
- C3161 Viscous fan - PV8
- C3170 Lumbar pump-solenoid-Driver
- C3180L Module-Battery monitoring system
- C3180R Module-Battery monitoring system
- C3196 Ground point
- C3233M Solenoid-EGR cooling bypass
- C3270 Sensor-Temperature-DPF
- C3270A Sensor-Temperature-DPF-Intake
- C3271 Sensor-Temperature-DPF-Intake
- C3271A Sensor-Temperature-DPF-Intake
- C3275 ICE harness to instrument panel harness
- C3283L Tensioner-Safety belt-LH
- C3283R Tensioner-Safety belt-RH
- C3303 RFI suppression lead
- C3304 RFI suppression lead 2
- C3305 RFI suppression lead
- C3306 RFI suppression lead 2
- C3310R Ground point
- C3338 Module-Cameras
- C3339 Module-Cameras

- C3340 Module-Cameras
- C3342 Module-Cameras
- C3343 Module-Cameras
- C3344 Module-Cameras
- C3346 Module-Cameras
- C3347 Camera-Front-RH
- C3349 Camera-Front-LH
- C3351 Camera-Mirror-Door-RH
- C3353 Camera-Mirror-Door-LH
- C3359L Main harness to engine compartment harness
- C3359R Main harness to engine compartment harness
- C3360L Engine compartment harness to main harness
- C3360R Engine compartment harness to main harness
- C3381T Antenna-DAB
- C3383T Antenna-DAB
- C3386T ICE harness to seat link harness
- C3388T ICE harness to seat link harness
- C3392L Engine compartment harness to bumper harness
- C3392R Engine compartment harness to bumper harness
- C3393L Engine compartment harness to bumper harness
- C3393R Engine compartment harness to bumper harness
- C3394 Bumper harness to engine compartment harness
- C3395 Bumper harness to engine compartment harness
- C3398 Sensor-Pressure-Refrigerant
- C3417M Sensor-Boost air pressure
- C3418 Sensor-Outlet temperature-Fixed turbocharger
- C3418A Sensor-Outlet temperature-Fixed turbocharger
- C3419M Sensor-Valve position-Turbine intake
- C3421 Sensor-Height-Front-RH
- C3422 Sensor-Height-Rear-LH
- C3423 Sensor-Height-Rear-RH
- C3424L Engine compartment harness to transmission harness
- C3424R Engine compartment harness to transmission harness
- C3425A Transmission harness to engine compartment harness
- C3425L Transmission harness to engine compartment harness
- C3425M Transmission harness to engine compartment harness
- C3425N Transmission harness to engine compartment harness
- C3425P Transmission harness to engine compartment harness
- C3425Q Transmission harness to engine compartment harness
- C3425R Transmission harness to engine compartment harness
- C3426L Engine compartment harness to transmission harness
- C3426R Engine compartment harness to transmission harness
- C3427L Transmission harness to engine compartment harness
- C3427M Transmission harness to engine compartment harness
- C3427N Transmission harness to engine compartment harness
- C3427P Transmission harness to engine compartment harness
- C3427Q Transmission harness to engine compartment harness
- C3427R Transmission harness to engine compartment harness
- C3428 Engine compartment harness to link harness
- C3429 Air suspension harness to engine compartment harness
- C3430 Sensor-Height-Front-RH
- C3431 Fuel fired booster heater pump
- C3431A Fuel fired booster heater pump
- C3432 TCM and Control Valve Body
- C3432A TCM and Control Valve Body
- C3433T Accelerometer-Rear right
- C3434L Accelerometer-Front
- C3434R Accelerometer-Front
- C3442L Touch screen display
- C3442R Touch screen display
- C3461 Audio head unit
- C3462 Audio head unit
- C3470 Module-Climate Control
- C3471 Module-Climate Control
- C3472 Illumination-Door-Front

- C3474 LED-Door handle-Rear
- C3476 Engine compartment harness to glow plug harness
- C3478 Fan-Cooling-E box
- C3483 Sensor-Camshaft position-Bank 1-Intake
- C3484 Sensor-Camshaft position-Bank 1-Outlet
- C3485 Sensor-Camshaft position-Bank 2-Intake
- C3486 Sensor-Camshaft position-Bank 2-Outlet
- C3487 Valve-Manifold tuning
- C3488 Solenoid-Camshaft profile switching-bank 1
- C3489 Solenoid-Camshaft profile switching-bank 2
- C3490 Solenoid-VVT-Bank 1-Intake
- C3491 Solenoid-VVT-Bank 1-Exhaust
- C3492 Solenoid-VVT-Bank 2-Intake
- C3493 Solenoid-VVT-Bank 2-Exhaust
- C3501 VICS receiver
- C3503 Door harness to main harness
- C3504 Door harness to main harness
- C3505T Amplifier-Antenna
- C3507 Module-Driver door
- C3508 Module-Passenger door
- C3510 Module-Climate Control
- C3521A Selector-Automatic transmission
- C3521B Selector-Automatic transmission
- C3532M Solenoid-Boost air recirculation
- C3533M Solenoid-Boost air
- C3534M Solenoid-Turbine intake
- C3542 Module-Heated seat-Front
- C3543 Module-Heated seat-Front
- C3544 Upshift paddle switch
- C3545 Downshift paddle switch
- C3552 Sensor 1-Engine coolant temperature (ECT) - PV8
- C3554 Ground point
- C3555 Ground point
- C3556 Ground point
- C3557L Ground point
- C3557R Ground point
- C3560 Switch pack-Seat
- C3588 Ground point
- C3589 Ground point
- C3589 Ground point
- C3608 Ground point
- C3609 Ground point
- C3615 Docking station Remote control-Rear entertainment
- C3646 Front door harness to main harness
- C3714T Rear seat entertainment module
- C3715 Module-Headphone
- C3716 Audio head unit
- C3717 Receiver-Television
- C3720T Rear seat entertainment module
- C3721T Rear seat entertainment module
- C3733 Module-Powered tailgate
- C3734 Module-Powered tailgate
- C3735 Strut-Powered tailgate-LH
- C3736 Strut-Powered tailgate-RH
- C3737 Switch-Override-Inertia switch
- C3738 Module-Power close
- C3740 Module-Navigation system-Japan
- C3741 Tailgate harness to main harness
- C3742 Tailgate harness to main harness
- C3743 Camera-Rear view
- C3744 Lamp-High mounted stop
- C3755T ICE harness to link harness
- C3756 Link harness to ICE harness
- C3757 Link harness to link harness
- C3758 Link harness to link harness

- C3759T Module-Tuner-DAB
- C3760T Main harness to telematics harness
- C3761T Telematics harness to main harness
- C3770 AV input panel
- C3771 AV input panel
- C3775L Seat link harness to seat harness
- C3775R Seat harness to seat link harness
- C3776 Seat harness to seat link harness
- C3777L Seat link harness to seat harness
- C3777R Seat link harness to seat harness
- C3778 Seat harness to link harness
- C3779L Display link harness to seat link harness
- C3779R Seat link harness to seat harness
- C3780 Seat harness to seat link harness
- C3786 Audio head unit
- C3823 ICE link harness to USB link harness
- C3825T ICE harness to wireless headset harness
- C3826T Wireless headset harness to ICE harness

- **LEFT-HAND DRIVE**
  - TABLE OF CIRCUIT OPTION CODES
  - C0004 Horn-RH
  - C0007 Switch-Bonnet
  - C0008 Pump-washer-front/ rear screen
  - C0009 Headlamp-LH
  - C0011 Headlamp-RH
  - C0026L Switch-Brake-fluid level
  - C0026R Switch-Brake-fluid level
  - C0030L Motor-Wiper-Windscreen
  - C0030R Motor-Wiper-Windscreen
  - C0040 Diagnostic socket
  - C0041 Lighting control switch
  - C0047L Main harness to instrument panel harness
  - C0047R Main harness to instrument panel harness
  - C0050 Sensor-Pad wear-Front-LH
  - C0052 Ignition coil-2 - PV8
  - C0053 Alternator-generator - PV8
  - C0053M Alternator-generator - DV6
  - C0056 Motor-Blower-Front
  - C0067 Main harness to instrument panel harness
  - C0074 Cigar lighter-illumination
  - C0075L Switch-Brake pedal
  - C0075R Switch-Brake pedal
  - C0076L Lamp-Footwell-Front-RH
  - C0076R Lamp-Footwell-Front-RH
  - C0077L Lamp-Footwell-Front-LH
  - C0077R Lamp-Footwell-Front-LH
  - C0081 Switch pack-Window lift
  - C0082L Clock spring
  - C0082R Clock spring
  - C0083 Main harness to instrument panel harness
  - C0084 Main harness to roof harness
  - C0087 Switch-Window-Passenger door
  - C0089 Cigar lighter
  - C0097 Motor-Seat height-Front
  - C0103A Sensor-Temperature-Pre-catalytic converter
  - C0103H Sensor-Temperature-Pre-catalytic converter
  - C0103M Sensor-Catalyst
  - C0114T Unit-Fuel Tank
  - C0119T Lamp-Load space-RH
  - C0121T Tail lamp unit-LH
  - C0122T Main harness to tailgate harness
  - C0125T Tail lamp unit-RH
  - C0128 Valve-Solenoid-Refrigerant - PV8
  - C0132 Sensor-Low pressure fuel
  - C0144T Main harness to tailgate harness

- C0147 Sensor-Engine coolant-level
- C0149 Sensor-MAF/IAT-Bank 1
- C0150 Sensor-Knock-Bank 1-Front
- C0152 Purge control valve - PV8
- C0156 Ignition coil-1 - PV8
- C0168 Sensor-Crankshaft-position (CKP) - PV8
- C0168B Sensor-Crankshaft-position (CKP) - PV8
- C0168M Sensor-Crankshaft-position (CKP) - DV6
- C0169 Sensor-Engine coolant-temperature (ECT) - PV8
- C0169M Sensor-Engine coolant temperature (ECT) - DV6
- C0175 Unit-Electric throttle - PV8
- C0176M Sensor-Camshaft-position (CMP) - DV6
- C0178L Starter motor - PV8
- C0178M Starter motor - DV6
- C0179 Starter motor - PV8
- C0179M Starter motor - DV6
- C0182 Solenoid-Clutch-Compressor (A/C)
- C0184M Sensor-Temperature-Fuel rail - DV6
- C0186 Sensor-Temperature and Manifold-Absolute Pressure (TMAP)
- C0186M Sensor-Manifold Absolute-Pressure (MAP) - DV6
- C0187M Switch-Oil pressure - DV6
- C0189L ECU-Glow plug
- C0189R ECU-Glow plug
- C0190L ECU-Glow plug
- C0190R ECU-Glow plug
- C0192L Battery - PV8
- C0192M Battery - DV6
- C0193 TCM and Control Valve Body
- C0204 Pump 1-High pressure fuel
- C0205 Pump 2-High pressure fuel
- C0223L Instrument panel harness to main harness
- C0223R Instrument panel harness to main harness
- C0227 Lamp-Glove compartment
- C0229L Instrument panel harness to main harness
- C0229R Instrument panel harness to main harness
- C0230 Instrument cluster
- C0231L Instrument panel harness to main harness
- C0231R Instrument panel harness to main harness
- C0232L Clock-Analogue
- C0232R Clock-Analogue
- C0237B Heater-seat cushion
- C0246T Windshield RH heater element
- C0247T Windshield LH heater element
- C0251L Module-Air bag-Passenger
- C0251R Module-Air bag-Passenger
- C0256 Restraints Control Module (RCM)
- C0256A Restraints Control Module (RCM)
- C0257 Module-Air bag-Driver
- C0261L Module-Air bag-Passenger
- C0261R Module-Air bag-Passenger
- C0269 Sensor-Temperature-Differential oil
- C0272M Throttle-EGR-Inlet - DV6
- C0276 Ignition coil-3 - PV8
- C0278L Switch-Steering column-Wiper
- C0278R Switch-Steering column-Wiper
- C0304 Motor-Window-Rear
- C0309 RH rear surround sound speaker
- C0310 Speaker-Low range-Rear door
- C0311 LH rear surround sound speaker
- C0319 Mirror-Door
- C0355 Lamp-Interior-Front
- C0357 Lamp-Interior-Front
- C0358 Sensor-Volumetric
- C0369 Speaker-Mid range-Front door
- C0369L Center speaker

- C0369R Center speaker
- C0374L Clock spring
- C0374R Clock spring
- C0376 Main harness to chassis harness
- C0377T Main harness to chassis harness
- C0381 Heated rear window (HRW)
- C0382 Heated rear window (HRW)
- C0384 Tailgate harness to main harness
- C0388 Motor-Wiper-Rear screen
- C0390 Chassis harness to main harness
- C0391 Chassis harness to main harness
- C0396 Main harness to door harness
- C0397 Main harness to door harness
- C0398 Main harness to door harness
- C0399 Main harness to door harness
- C0400 Sensor-Parking aid-Inner-Front-LH
- C0401 Sensor-Parking aid-Inner-Front-RH
- C0402 Sensor-Parking aid-Outer-Front-LH
- C0403 Sensor-Parking aid-Outer-Front-RH
- C0406 Module-Air bag-Driver
- C0412 Sensor-Ambient air-temperature
- C0417 Sensor-Temperature-Evaporator
- C0419 Intake air door motor
- C0435 Main harness to rear door harness
- C0436 Main harness to rear door harness
- C0439 Door harness to main harness
- C0440 Door harness to main harness
- C0441 Motor-Door lock-Front
- C0442 Motor-Door-lock-Rear
- C0460 Main harness to door harness
- C0464 Main harness to door harness
- C0467 Main harness to instrument panel harness
- C0469L Instrument panel harness to main harness
- C0469R Instrument panel harness to main harness
- C0476 Glow plug
- C0477 Glow plug
- C0478 Glow plug
- C0479 Glow plug
- C0491T Amplifier-power
- C0492T Amplifier-power
- C0493T Amplifier-power
- C0499 Trailer pick-up (Europe 13-pin)
- C0502 Wheel speed Sensor-Rear-LH
- C0503 Wheel speed Sensor-Rear-RH
- C0506L ABS module
- C0506R ABS module
- C0513 Lamp-Fog-Front-RH
- C0514 Lamp-Fog-Front-LH
- C0516 Wheel speed Sensor-Front-LH
- C0517 Wheel speed Sensor-Front-RH
- C0518 Motor-Seat-recline-LH
- C0518 Motor-Seat-recline-LH
- C0520L Passive-sounder
- C0520R Passive-sounder
- C0522 Fuel injector-No.1 - PV8
- C0522M Fuel injector-No.1 - DV6
- C0523 Fuel injector-No.2 - PV8
- C0523M Fuel injector-No.2 - DV6
- C0524 Fuel injector-No.3 - PV8
- C0524M Fuel injector-No.3 - DV6
- C0525 Fuel injector-No.4 - PV8
- C0525M Fuel injector-No.4 - DV6
- C0526 Fuel injector-No.5 - PV8
- C0526M Fuel injector-No.5 - DV6
- C0527 Fuel injector-No.6 - PV8

- C0527M Fuel injector-No.6 - DV6
- C0528 Fuel injector-No.7 - PV8
- C0529 Fuel injector-No.8 - PV8
- C0531 Speaker-High range-Front door
- C0556L Ground point
- C0557 Ground point
- C0558L Ground point
- C0558R Ground point
- C0559L Ground point
- C0559R Ground point
- C0560L Ground point
- C0560R Ground point
- C0561T Ground point
- C0562R Ground point
- C0563L Ground point
- C0564 Ground point
- C0565T Ground point
- C0570L Junction-box engine
- C0570R Junction-box engine
- C0580 Junction box-Central
- C0581 Junction box-Central
- C0582 Junction box-Central
- C0583L Junction box-Central
- C0583R Junction box-Central
- C0584L Junction box-Central
- C0584R Junction box-Central
- C0585L Junction box-Central
- C0585R Junction box-Central
- C0586L Junction box-Central
- C0586R Junction box-Central
- C0610 Roof harness to main harness
- C0615 Switch-Tail door-open
- C0617 Motor-CDL-Tailgate-Upper
- C0620 Sensor-Washer fluid level
- C0632 Junction-box engine
- C0634 Engine control-module (ECM) - PV8
- C0635L Engine control-module (ECM) - PV8
- C0635R Engine control-module (ECM) - PV8
- C0642 Sensor-Heated oxygen-Post catalyst-Right bank 1
- C0644 Sensor-Heated oxygen-Pre catalyst-Left bank 2
- C0645 Sensor-Heated oxygen-Pre catalyst-Right bank 1
- C0646L Fan-E-box
- C0646R Fan-E-box
- C0647L Dynamic response module
- C0647R Dynamic response module
- C0656 Accelerometer-Lower
- C0657T Accelerometer-Upper
- C0658L Engine control-module (ECM) - DV6
- C0658R Engine control-module (ECM) - DV6
- C0659M Engine control-module (ECM) - DV6
- C0666L Sounder-Battery backed
- C0666R Sounder-Battery backed
- C0674T Receiver-Radio-frequency (RF)
- C0680 Speaker-High range-Rear door
- C0688 Speaker-Low range-Front door
- C0690T Motor-Security-Fuel flap
- C0698T Mirror-Electrochromic
- C0700A Switch pack-Center-console
- C0700B Switch pack-Center-console
- C0700L Switch pack-Center-console
- C0700R Switch pack-Center-console
- C0718 Motor-Seat-Recline-Driver
- C0718 Motor-Seat-Recline-Driver
- C0721 Motor-Seat-Forward-rearward
- C0732 Switch-Window-Rear

- C0735 Water in fuel sensor
- C0736 Mirror-Vanity-RH
- C0737 Mirror-Vanity-LH
- C0740 Motor-Window-Front
- C0751 Seat harness to main harness
- C0752 Seat harness to main harness
- C0755 Module-Heated seat-Front
- C0766 Instrument panel harness to A/C harness
- C0770 Valve block-Dynamic response
- C0771 Valve block-Dynamic response
- C0773 Switch pack-Seat
- C0775 Seat link harness to seat harness
- C0775 Seat link harness to seat harness
- C0780 Air supply unit
- C0781 Air supply unit
- C0784T Roof opening panel control module
- C0787L Sensor-Position-Accelerator pedal
- C0787R Sensor-Position-Accelerator pedal
- C0790L Sensor-Sunlight
- C0790R Sensor-Sunlight
- C0797 Air conditioning (A/C) harness to instrument panel harness
- C0803 Rear door harness to main harness
- C0804 Rear door harness to main harness
- C0807 Ground point
- C0809 Ground point
- C0810 Ground point
- C0811 Ground point
- C0812T Main harness to telematics harness
- C0820T Module-Video interface-Japan
- C0828 Pump-Power wash
- C0832A Lamp-High mounted stop
- C0862L Sensor-Steering-angle
- C0862R Sensor-Steering-angle
- C0867L Module-Air suspension
- C0867R Module-Air suspension
- C0868TA Main harness to console harness
- C0868TL Main harness to console harness
- C0868TR Main harness to console harness
- C0876T Main harness to trailer connector
- C0884 Sensor-Temperature/ Humidity
- C0897 Module-Navigation system-Asia
- C0898 Module-Navigation system-Asia
- C0899 Module-Navigation system-Asia
- C0903A Console harness to main harness
- C0903B Console harness to main harness
- C0903L Console harness to main harness
- C0903R Console harness to main harness
- C0904 Link harness to engine harness - PV8
- C0904B Link harness to engine harness - PV8
- C0908 Sensor-Heated oxygen-Post catalyst-Left bank 2
- C0909 Engine harness to link harness - PV8
- C0925 Fuel fired booster heater
- C0926 Fuel fired booster heater
- C0934 Heater-Washer-jet-LH
- C0942T Socket-Accessory-Rear
- C0946 Heater-Washer-jet-RH
- C0950 Sensor-Side impact-Front door
- C0957 Module-Parking aid
- C0958 Module-Parking aid
- C0961T Sensor-Rain-Ambient light
- C0962 Sensor-Occupancy-detection
- C0963 Sensor-Parking aid-Outer-Rear-LH
- C0964 Sensor-Parking aid-Inner-Rear-LH
- C0965 Sensor-Parking aid-Inner-Rear-RH
- C0966 Sensor-Parking aid-Outer-Rear-RH

- C0968 Sensor-Pad wear-Rear-RH
- C0974 Pump-Lumbar
- C0978 Lamp-Puddle-Front
- C0980 Lamp-Puddle-Rear
- C0999M Valve-Solenoid-Refrigerant - DV6
- C1000 Header-Connector
- C1111 Lamp-Map-LH
- C1112 Lamp-Map-RH
- C1165 Main harness to instrument panel harness
- C1166L Main harness to instrument panel harness
- C1166R Main harness to instrument panel harness
- C1167L Instrument panel harness to main harness
- C1167R Instrument panel harness to main harness
- C1168L Instrument panel harness to main harness
- C1168R Instrument panel harness to main harness
- C1170L Ground point
- C1170T Ground point
- C1184 Instrument panel harness to main harness
- C1185 Main harness to instrument panel harness
- C1254 Clock spring
- C1323 Capacitor - PV8
- C1339 Pump-Leak detection
- C1352 Sub-woofer
- C1355T Ground point
- C1388T Main harness to trailer connector
- C1389T Main harness to trailer connector
- C1390T Main harness to trailer connector
- C1393L Switch-Steering column-Lighting
- C1393R Switch-Steering column-Lighting
- C1396L Assembly-Steering column
- C1396R Assembly-Steering column
- C1398R Ground point
- C1401 Switch-Seat heat-Rear-LH
- C1403 Switch-Seat heat-Rear-RH
- C1408 Capacitor
- C1413 Ground point
- C1414 Trailer harness to main harness
- C1414 Trailer harness to main harness
- C1415 Trailer harness to main harness
- C1415 Trailer harness to main harness
- C1416 Trailer harness to main harness
- C1443L Sensor-Temperature-In-car
- C1443R Sensor-Temperature-In-car
- C1457 Module-Parking aid
- C1462 Lamp-Interior-Front
- C1465 Sensor-Pressure-Air Conditioning
- C1479T Air bag-Side curtain-LH
- C1480T Air bag-Side curtain-RH
- C1500 Glow plug
- C1501 Glow plug
- C1526M Engine harness to link harness
- C1527M Link harness to engine harness
- C1535L Ground point
- C1535R Ground point
- C1536 Ground point
- C1542 Module-Navigation system-Japan
- C1547L Ground point
- C1547M Ground point
- C1559 Sensor-Heated oxygen-Pre catalyst-Left bank 2
- C1559A Sensor-Oxygen-Pre catalyst
- C1598T GPS antenna
- C1599 Module-Navigation system-Japan
- C1600T Antenna-TV
- C1601T Antenna-TV
- C1602T Antenna-TV

- C1603T Antenna-TV
- C1610 Valve block-Dynamic response
- C1623TL Windshield RH heater element
- C1623TR Windshield RH heater element
- C1624T Windshield LH heater element
- C1629L Switch pack-Center Instrument panel
- C1629R Switch pack-Center Instrument panel
- C1637 Motor-Seat height-Front
- C1641 Battery
- C1649 Restraints Control Module (RCM)
- C1652 Sensor-Front impact-LH side
- C1653 Sensor-Front impact-RH side
- C1654T Sensor-Side impact-LH side-Rear
- C1655T Sensor-Side impact-RH side-Rear
- C1656L Sensor-Yaw Rate
- C1656R Sensor-Yaw Rate
- C1661 Ground point
- C1661 Ground point
- C1684T Reservoir control valve
- C1689 Reservoir control valve
- C1690 Valve block-Dynamic response
- C1692 Socket-Accessory-Center
- C1696T Sensor-Height-Front-LH
- C1697 Sensor-Height-Front-RH
- C1698 Sensor-Height-Rear-RH
- C1699 Sensor-Height-Rear-LH
- C1770 Ignition coil-4 - PV8
- C1771 Ignition coil-5 - PV8
- C1772 Ignition coil-6 - PV8
- C1773T Accelerometer-Rear left
- C1848T AM/FM diversity antenna amplifier
- C1855L Module-Control-Transfer case
- C1855M Module-Control-Transfer case
- C1855N Module-Control-Transfer case
- C1855P Module-Control-Transfer case
- C1855Q Module-Control-Transfer case
- C1855R Module-Control-Transfer case
- C1857L Module-Control-Transfer case
- C1857R Module-Control-Transfer case
- C1893L Alternator-generator - PV8
- C1893M Alternator-generator - DV6 (3.0L)
- C1947 Ground point
- C1948 Clock spring
- C1967 Ground point
- C1970 Ground point
- C1971 Ground point
- C1975 Lamp-Interior-Front
- C2003 PDC harness to main harness
- C2003T Trailer harness to main harness
- C2016 Module-Passenger door
- C2017 Module-Driver door
- C2018 Module-Rear Door
- C2025 Sensor-Speed control
- C2030L Module-Air suspension
- C2030R Module-Air suspension
- C2034 Valve-Water circuit-closure
- C2038A Solenoid-Power steering
- C2038B Solenoid-Power steering
- C2041 Heater-Steering wheel
- C2042 Main harness to rear seat harness
- C2043 Main harness to rear seat harness
- C2046T Fuel fired booster heater receiver
- C2053TA Main harness to console harness
- C2053TL Main harness to console harness
- C2053TR Main harness to console harness

- C2054A Console harness to main harness
- C2054B Console harness to main harness
- C2054L Console harness to main harness
- C2054R Console harness to main harness
- C2055L Module-Steering column lock
- C2055R Module-Steering column lock
- C2057 Module-Passenger door
- C2058 Module-Driver door
- C2084 Module-Heated seat-Rear
- C2087 Ignition coil-7 - PV8
- C2088 Ignition coil-8 - PV8
- C2099 Front control valve
- C2101 Rear control valve
- C2102T Amplifier-power
- C2104 Module-Navigation system-Japan
- C2105 Audio head unit
- C2106 Receiver-Television
- C2115 Audio head unit
- C2116T Rear seat entertainment module
- C2117 Receiver-Television
- C2126 Sensor-Side impact-LH side-Front
- C2127 Sensor-Side impact-RH side-Front
- C2128 Sensor-Safety belt tension
- C2130 LH air temperature door motor
- C2131 RH air temperature door motor
- C2133 Motor-air distribution-Feet / face
- C2134 Screen air distribution door motor
- C2138L Fan-E-box
- C2138R Fan-E-box
- C2147 Module-Steering-wheel-RH
- C2149A Rear seat harness to main harness
- C2149B Rear seat harness to main harness
- C2153L Integrated control panel-Lower
- C2153R Integrated control panel-Lower
- C2158T Module-Tuner-DAB
- C2160T Keyless vehicle module
- C2162T Rear differential control module
- C2163T Rear differential control module
- C2164T Rear differential control module
- C2165 Solenoid-Mode-selector
- C2165 Solenoid-Mode-selector
- C2165A Solenoid-Mode-selector
- C2167 Motor-Transfer box
- C2167 Motor-Transfer box
- C2167A Motor-Transfer box
- C2168 Actuator-Rear differential
- C2169 Sensor-Selector-position
- C2169 Sensor-Selector-position
- C2169A Sensor-Selector-position
- C2178 Module-Parking brake
- C2180A Switch-Electric-park brake
- C2180B Switch-Electric-park brake
- C2180L Switch-Electric-park brake
- C2180R Switch-Electric-park brake
- C2184L Switch pack-Steering-column motor
- C2184R Switch pack-Steering-column motor
- C2188L Dynamic response module
- C2188R Dynamic response module
- C2193L AFS control module
- C2193R AFS control module
- C2198 Initiator-Front-LH
- C2199 Initiator-Front-RH
- C2200 Initiator-Rear-LH
- C2201T Initiator-Rear-RH
- C2206 Module-Heated steering wheel

- C2209L Module-Immobiliser antenna
- C2209R Module-Immobiliser antenna
- C2218 Module-Navigation system-Japan
- C2219T AM/FM diversity antenna amplifier
- C2221 Instrument panel harness to ICE harness
- C2222T Module-Tuner-DAB/SDARS
- C2223T SDARS antenna
- C2225 Module-Navigation system-Japan
- C2226 AV input panel
- C2228 Receiver-Television
- C2229 Fuel fired booster heater receiver
- C2238L Instrument panel harness to engine compartment harness
- C2238R Instrument panel harness to engine compartment harness
- C2239R Instrument panel harness to engine compartment harness
- C2240L Engine compartment harness to instrument panel harness
- C2240R Engine compartment harness to instrument panel harness
- C2241R Engine compartment harness to instrument panel harness
- C2242L Main harness to engine compartment harness
- C2242R Main harness to engine compartment harness
- C2243L Main harness to engine compartment harness
- C2243R Main harness to engine compartment harness
- C2244L Engine compartment harness to main harness
- C2244R Engine compartment harness to main harness
- C2245L Engine compartment harness to main harness
- C2245R Engine compartment harness to main harness
- C2248T ICE harness to instrument panel harness
- C2249T ICE harness to instrument panel harness
- C2251M Sensor-Pressure-Fuel rail - DV6
- C2254M Actuator-EGR-Electric - DV6
- C2255M Actuator-EGR-Electric - DV6
- C2258 Sensor-Temperature and Manifold-Absolute Pressure (TMAP)
- C2260M Valve-Control-Fuel volume - DV6
- C2261M Valve-Control-Fuel pressure - DV6
- C2262 Active engine mounting solenoid
- C2266M Actuator-Vane VGT - DV6
- C2270 Viscous fan - DV6
- C2271 Module-Driver door
- C2272 Module-Passenger door
- C2274L Engine compartment harness to engine harness
- C2274R Engine compartment harness to engine harness
- C2277 Engine compartment harness to bumper harness
- C2278 Bumper harness to engine compartment harness
- C2281 Module-Blower-motor control-Front
- C2283 Module-Steering-wheel-LH
- C2284 Module-Steering-wheel-LH
- C2285 Module-Steering-wheel-RH
- C2287 Clock spring
- C2288 Module-Heated steering wheel
- C2289 Module-Heated steering wheel
- C2293 Engine compartment harness to chassis harness
- C2293A Engine compartment harness to chassis harness
- C2293B Engine compartment harness to chassis harness
- C2294T Chassis harness to engine compartment harness
- C2299 Module-Door handle
- C2301 Module-Rear door handle
- C2302 Module-Rear door latch
- C2312 Module-Door latch
- C2314 ICE harness to console harness
- C2315 Console harness to ICE harness
- C2320L Module-Air suspension
- C2320R Module-Air suspension
- C2321L Module-Air suspension
- C2321R Module-Air suspension
- C2363 Seat harness to main harness
- C2366H Transmission harness to engine compartment harness

- C2368 Main harness to seat harness
- C2369 Module-Fuel-pump driver
- C2373L Engine compartment harness to transmission harness
- C2373R Engine compartment harness to transmission harness
- C2374A Transmission harness to engine compartment harness
- C2374H Transmission harness to engine compartment harness
- C2374J Transmission harness to engine compartment harness
- C2378 Main harness to seat harness
- C2379 Seat harness to main harness
- C2381 Memory control module
- C2382 Memory control module
- C2394 Chassis harness to engine compartment harness
- C2396 Engine compartment harness to chassis harness
- C2409R Main harness to engine compartment harness
- C2410R Engine compartment harness to main harness
- C2411L Main harness to engine compartment harness
- C2412L Engine compartment harness to main harness
- C2414T Amplifier-Audio
- C2415T Amplifier-power
- C2428T Keyless vehicle module
- C2429T Keyless vehicle module
- C2433T Tailgate handle antenna
- C2443 Instrument panel harness to engine compartment harness
- C2444L Engine compartment harness to instrument panel harness
- C2453R Switch-Start-stop
- C2453TL Switch-Start-stop
- C2454 Sensor-MAF/IAT-Bank 2
- C2467 Sensor-Fuel rail-pressure
- C2490T Rear seat entertainment module
- C2491T Rear seat entertainment module
- C2527T Chassis harness to engine compartment harness
- C2528 Engine compartment harness to chassis harness
- C2554T FM antenna amplifier
- C2561 Ground point
- C2563 Ground point
- C2564 Ground point
- C2565 Ground point
- C2566 Ground point
- C2568T Ground point
- C2570T Ground point
- C2577T ICE harness to ICE link harness
- C2581 Engine compartment harness to glow plug harness
- C2583 Glow plug harness to engine compartment harness
- C2584 Glow plug harness to engine compartment harness
- C2586 Trailer pick-up (NAS 7-pin)
- C2586 Trailer pick-up (NAS 7-pin)
- C2587 Trailer pick-up (NAS 7-pin)
- C2590 Module-Trailer-Electric Brake
- C2597T Ground point
- C2598 Ground point
- C2601 Ground point
- C2602L Ground point
- C2602R Ground point
- C2603L Ground point
- C2603R Ground point
- C2606L Ground point
- C2606R Ground point
- C2610 Audio head unit
- C2615T ICE harness to ICE link harness
- C2616 ICE harness to ICE link harness
- C2617T ICE harness to instrument panel harness
- C2618 ICE harness to ICE link harness
- C2620 ICE link harness to ICE harness
- C2622 ICE harness to ICE link harness
- C2626L Ground point

- C2626R Ground point
- C2627L Ground point
- C2627R Ground point
- C2628L Ground point
- C2628R Ground point
- C2629L Ground point
- C2629R Ground point
- C2630L Ground point
- C2630R Ground point
- C2631L Ground point
- C2631R Ground point
- C2635 Ground point
- C2636 Module-Air bag-Driver
- C2637L Module-Air bag-Passenger
- C2637R Module-Air bag-Passenger
- C2638 Sensor-Pressure-mat
- C2639 ICE harness to instrument panel harness
- C2640 ICE link harness to USB link harness
- C2640L Instrument panel harness to ICE harness
- C2640R Instrument panel harness to ICE harness
- C2641L Clock spring
- C2641R Clock spring
- C2646 Ground point
- C2647T Ground point
- C2648T Ground point
- C2649T Ground point
- C2650L Ground point
- C2650R Ground point
- C2652 Ground point
- C2656L Lamp-Automatic gearbox-selector indicator
- C2656R Lamp-Automatic gearbox-selector indicator
- C2657L Lamp-Automatic gearbox-selector indicator
- C2657R Lamp-Automatic gearbox-selector indicator
- C2658TL Gearshift mechanism
- C2658TR Gearshift mechanism
- C2667 ICE harness to instrument panel harness
- C2674L Main harness to engine compartment harness
- C2674R Main harness to engine compartment harness
- C2675L Engine compartment harness to main harness
- C2675R Engine compartment harness to main harness
- C2677 Lamp-Side repeater-Front
- C2683 Pollution sensor
- C2692T Ground point
- C2695 Ground point
- C2696 Ground point
- C2700T Ground point
- C2702 Sub-woofer
- C2712 Ground point
- C2714 Ground point
- C2715T Ground point
- C2722 Sensor-Knock-Bank 1-Rear
- C2723 Sensor-Knock-Bank 2-Rear
- C2724 Engine harness to engine compartment harness
- C2725L Engine compartment harness to engine harness
- C2725R Engine compartment harness to engine harness
- C2727 Instrument panel harness to ICE harness
- C2729 ICE harness to instrument panel harness
- C2730 ICE harness to instrument panel harness
- C2731T Module-Video interface-Japan
- C2739T Main harness to tailgate harness
- C2740 Tailgate harness to main harness
- C2741 Sensor-Differential pressure
- C2741A Sensor-Differential pressure
- C2754T Main harness to console harness
- C2755 Link harness to seat harness

- C2758M Engine harness to transmission harness
- C2759M Transmission harness to engine harness
- C2759N Transmission harness to engine harness
- C2759P Transmission harness to engine harness
- C2759Q Transmission harness to engine harness
- C2761 Sensor-Mass air-flow (MAF)
- C2762 Sensor-Mass air-flow (MAF)
- C2770T Rear seat entertainment module
- C2771 Screen-Rear seat-entertainment
- C2772 Screen-Rear seat-entertainment
- C2773 Cool box
- C2789T SDARS antenna
- C2819L Touch screen display
- C2819R Touch screen display
- C2820 Touch screen display
- C2821 Touch screen display
- C2822 Touch screen display
- C2823 Touch screen display
- C2825 Touch screen display
- C2831 AV input panel
- C2837T Antenna-VICS
- C2846T Module-Video interface-Japan
- C2867 Instrument panel harness to ICE harness
- C2868 ICE harness to ICE link harness
- C2870M Sensor-Temperature-Air charge - DV6
- C2875T Receiver-Radio-frequency (RF)
- C2920T Ground point
- C2921T Ground point
- C2922T Ground point
- C2924T Ground point
- C2926L Ground point
- C2926R Ground point
- C2926T Ground point
- C2927 Ground point
- C2930 Motor-Seat-Tilt-Driver
- C2931 Motor-Seat-Tilt-Driver
- C2934L Ground point
- C2934M Ground point
- C2937T Relay-Trailer-Rear wiper
- C2946 Air bag-Side
- C2947 Pre-tensioner-Front
- C2948 Switch-Buckle
- C2949 Mat-Belt minder
- C2951 ICE harness to seat link harness
- C2952 ICE harness to seat harness
- C2953 Seat harness to ICE harness
- C2954 Seat link harness to ice harness
- C2955T Rear seat entertainment module
- C2959T Main harness to tailgate harness
- C2967 ICE link harness to ICE harness
- C2968 ICE harness to instrument panel harness
- C2970 ICE harness to instrument panel harness
- C2972T ICE harness to instrument panel harness
- C2973L Instrument panel harness to ICE harness
- C2973R Instrument panel harness to ICE harness
- C2974 ICE harness to instrument panel harness
- C2976T ICE harness to ICE link harness
- C2978T ICE harness to ICE link harness
- C2980T ICE harness to instrument panel harness
- C2987 Receiver-Television
- C2989T Module-SDARS
- C2992 Switch-Passenger-Air bag disable
- C2993 Seat harness to seat link harness
- C2994 Seat link harness to seat harness
- C2994 Seat link harness to seat harness

- C2996L Engine compartment harness to air conditioning harness
- C2996R Engine compartment harness to air conditioning harness
- C2997 Air conditioning (A/C) harness to engine compartment harness
- C2999L Ground point
- C2999R Ground point
- C3001 Ground point
- C3006 Pump-Supercharge-coolant
- C3007 Main harness to main harness
- C3008 Main harness to main harness
- C3009 Engine compartment harness to air suspension harness
- C3010 Air suspension harness to engine compartment harness
- C3016T Antenna-Loadspace-LHS
- C3017T Antenna-Loadspace-Center
- C3018T Antenna-Rear Cabin-Interior
- C3019TL Antenna-Front Cabin-Interior
- C3019TR Antenna-Front Cabin-Interior
- C3023TL Center console antenna-Front
- C3023TR Center console antenna-Front
- C3025 Seat harness to main harness
- C3026 Seat harness to main harness
- C3029L Module-Control-Transfer case
- C3029R Module-Control-Transfer case
- C3030 Seat harness to seat link harness
- C3034L Relay-Transit
- C3034R Relay-Transit
- C3046 Sensor-Knock-Bank 2-Front
- C3049 Water in fuel sensor
- C3049A Water in fuel sensor
- C3050 Sensor-Oil temperature-level
- C3050M Sensor-Oil quality and level
- C3058L Engine compartment harness to link harness
- C3058R Engine compartment harness to link harness
- C3069M Engine harness to engine compartment harness
- C3070L Engine compartment harness to engine harness
- C3070R Engine compartment harness to engine harness
- C3073A Sensor-Temperature-Catalytic converter-Downstream
- C3073H Sensor-Temperature-Catalytic converter-Downstream
- C3073M Sensor-Catalyst
- C3078 Solenoid-Damper-Front-LH
- C3079 Solenoid-Damper-Front-RH
- C3080 Solenoid-Damper-Rear-LH
- C3081 Solenoid-Damper Rear-RH
- C3087T Module-Damping-Continuously variable
- C3088T Module-Damping-Continuously variable
- C3092T ICE harness to ICE link harness
- C3095 Sensor-Height-Front-LH
- C3097 Heater-Seat backrest-Rear-RH
- C3110 Sensor-Seat position-Driver
- C3123L Relay-Transit
- C3123R Relay-Transit
- C3126 Engine compartment harness to link harness
- C3127 Link harness to engine compartment harness
- C3161 Viscous fan - PV8
- C3170 Lumbar pump-solenoid-Driver
- C3180L Module-Battery monitoring system
- C3180R Module-Battery monitoring system
- C3196 Ground point
- C3233M Solenoid-EGR cooling bypass
- C3270 Sensor-Temperature-DPF
- C3270A Sensor-Temperature-DPF-Intake
- C3271 Sensor-Temperature-DPF-Intake
- C3271A Sensor-Temperature-DPF-Intake
- C3275 ICE harness to instrument panel harness
- C3283L Tensioner-Safety belt-LH
- C3283R Tensioner-Safety belt-RH

- C3303 RFI suppression lead
- C3304 RFI suppression lead 2
- C3305 RFI suppression lead
- C3306 RFI suppression lead 2
- C3310R Ground point
- C3338 Module-Cameras
- C3339 Module-Cameras
- C3340 Module-Cameras
- C3342 Module-Cameras
- C3343 Module-Cameras
- C3344 Module-Cameras
- C3346 Module-Cameras
- C3347 Camera-Front-RH
- C3349 Camera-Front-LH
- C3351 Camera-Mirror-Door-RH
- C3353 Camera-Mirror-Door-LH
- C3359L Main harness to engine compartment harness
- C3359R Main harness to engine compartment harness
- C3360L Engine compartment harness to main harness
- C3360R Engine compartment harness to main harness
- C3381T Antenna-DAB
- C3383T Antenna-DAB
- C3386T ICE harness to seat link harness
- C3388T ICE harness to seat link harness
- C3392L Engine compartment harness to bumper harness
- C3392R Engine compartment harness to bumper harness
- C3393L Engine compartment harness to bumper harness
- C3393R Engine compartment harness to bumper harness
- C3394 Bumper harness to engine compartment harness
- C3395 Bumper harness to engine compartment harness
- C3398 Sensor-Pressure-Refrigerant
- C3417M Sensor-Boost air pressure
- C3418 Sensor-Outlet temperature-Fixed turbocharger
- C3418A Sensor-Outlet temperature-Fixed turbocharger
- C3419M Sensor-Valve position-Turbine intake
- C3421 Sensor-Height-Front-RH
- C3422 Sensor-Height-Rear-LH
- C3423 Sensor-Height-Rear-RH
- C3424L Engine compartment harness to transmission harness
- C3424R Engine compartment harness to transmission harness
- C3425A Transmission harness to engine compartment harness
- C3425L Transmission harness to engine compartment harness
- C3425M Transmission harness to engine compartment harness
- C3425N Transmission harness to engine compartment harness
- C3425P Transmission harness to engine compartment harness
- C3425Q Transmission harness to engine compartment harness
- C3425R Transmission harness to engine compartment harness
- C3426L Engine compartment harness to transmission harness
- C3426R Engine compartment harness to transmission harness
- C3427L Transmission harness to engine compartment harness
- C3427M Transmission harness to engine compartment harness
- C3427N Transmission harness to engine compartment harness
- C3427P Transmission harness to engine compartment harness
- C3427Q Transmission harness to engine compartment harness
- C3427R Transmission harness to engine compartment harness
- C3428 Engine compartment harness to link harness
- C3429 Air suspension harness to engine compartment harness
- C3430 Sensor-Height-Front-RH
- C3431 Fuel fired booster heater pump
- C3431A Fuel fired booster heater pump
- C3432 TCM and Control Valve Body
- C3432A TCM and Control Valve Body
- C3433T Accelerometer-Rear right
- C3434L Accelerometer-Front
- C3434R Accelerometer-Front

- C3442L Touch screen display
- C3442R Touch screen display
- C3461 Audio head unit
- C3462 Audio head unit
- C3470 Module-Climate Control
- C3471 Module-Climate Control
- C3472 Illumination-Door-Front
- C3474 LED-Door handle-Rear
- C3476 Engine compartment harness to glow plug harness
- C3478 Fan-Cooling-E box
- C3483 Sensor-Camshaft position-Bank 1-Intake
- C3484 Sensor-Camshaft position-Bank 1-Outlet
- C3485 Sensor-Camshaft position-Bank 2-Intake
- C3486 Sensor-Camshaft position-Bank 2-Outlet
- C3487 Valve-Manifold tuning
- C3488 Solenoid-Camshaft profile switching-bank 1
- C3489 Solenoid-Camshaft profile switching-bank 2
- C3490 Solenoid-VVT-Bank 1-Intake
- C3491 Solenoid-VVT-Bank 1-Exhaust
- C3492 Solenoid-VVT-Bank 2-Intake
- C3493 Solenoid-VVT-Bank 2-Exhaust
- C3501 VICS receiver
- C3503 Door harness to main harness
- C3504 Door harness to main harness
- C3505T Amplifier-Antenna
  li> C3507 Module-Driver door
- C3508 Module-Passenger door
- C3510 Module-Climate Control
- C3521A Selector-Automatic transmission
- C3521B Selector-Automatic transmission
- C3532M Solenoid-Boost air recirculation
- C3533M Solenoid-Boost air
- C3534M Solenoid-Turbine intake
- C3542 Module-Heated seat-Front
- C3543 Module-Heated seat-Front
- C3544 Upshift paddle switch
- C3545 Downshift paddle switch
- C3552 Sensor 1-Engine coolant temperature (ECT) - PV8
- C3554 Ground point
- C3555 Ground point
- C3556 Ground point
- C3557L Ground point
- C3557R Ground point
- C3560 Switch pack-Seat
- C3588 Ground point
- C3589 Ground point
- C3589 Ground point
- C3608 Ground point
- C3609 Ground point
- C3615 Docking station Remote control-Rear entertainment
- C3646 Front door harness to main harness
- C3714T Rear seat entertainment module
- C3715 Module-Headphone
- C3716 Audio head unit
- C3717 Receiver-Television
- C3720T Rear seat entertainment module
- C3721T Rear seat entertainment module
- C3733 Module-Powered tailgate
- C3734 Module-Powered tailgate
- C3735 Strut-Powered tailgate-LH
- C3736 Strut-Powered tailgate-RH
- C3737 Switch-Override-Inertia switch
- C3738 Module-Power close
- C3740 Module-Navigation system-Japan
- C3741 Tailgate harness to main harness

- C3742 Tailgate harness to main harness
- C3743 Camera-Rear view
- C3744 Lamp-High mounted stop
- C3755T ICE harness to link harness
- C3756 Link harness to ICE harness
- C3757 Link harness to link harness
- C3758 Link harness to link harness
- C3759T Module-Tuner-DAB
- C3760T Main harness to telematics harness
- C3761T Telematics harness to main harness
- C3770 AV input panel
- C3771 AV input panel
- C3775L Seat link harness to seat harness
- C3775R Seat harness to seat link harness
- C3776 Seat harness to seat link harness
- C3777L Seat link harness to seat harness
- C3777R Seat link harness to seat harness
- C3778 Seat harness to link harness
- C3779L Display link harness to seat link harness
- C3779R Seat link harness to seat harness
- C3780 Seat harness to seat link harness
- C3786 Audio head unit
- C3823 ICE link harness to USB link harness
- C3825T ICE harness to wireless headset harness
- C3826T Wireless headset harness to ICE harness

RANGE ROVER SPORT

VIN: 717166 >

Electrical Reference Library (7b)

JLR 16 23 21_7E

Published by Jaguar Land Rover Limited

© Jaguar Land Rover Limited 2012-2013

While every effort is made to ensure accuracy, design changes to the vehicle may be made in the period between the completion of this publication and the introduction of vehicles. All rights reserved. No part of this publication may be reproduced, stored in a retrieval system or transmitted in any form, electronic, mechanical, recording or other means without prior written permission from Jaguar Land Rover Limited. Paper copies of this document are uncontrolled, always refer to the electronic source material for the latest information.

USING THIS PUBLICATION

HEALTH AND SAFETY

Always follow health and safety guidelines, specifically the Electrical Precautions detailed in the Workshop Manual.

Important

The information provided in this publication is for use only by competent, qualified auto-electricians. Good product knowledge is assumed, as well as the ability to access and use recommended test equipment and other reference material provided.

Test equipment and other reference material

The information in this publication should be used in conjunction with the recommended test equipment; refer to Workshop Manual. Other reference material includes: Electrical Wiring Diagrams (EWD), Electrical Revision Documents (ERD), Technical Service Bulletins (TSB) and the Workshop Manual.

Battery disconnection and reconnection

It is imperative that any information relating to battery disconnection and reconnection is followed; refer to the appropriate sections in the Workshop Manual.

Fault diagnosis

Always use the recommended test equipment and test procedures for correct and reliable fault diagnosis; refer to the appropriate sections in the Workshop Manual.

NOTE: Before starting electrical checks on the vehicle, ensure that relevant mechanical functions operate satisfactorily; refer to the appropriate section of the Workshop Manual.

Abbreviations and acronyms

Abbreviation	Description
ABS	Anti-lock braking system
AUTO	Automatic transmission
AVI	Audio video input
BBUS	Battery backed-up sounder
BJB	Battery junction box
BSM	Blind spot monitoring
CAN	Controller area network
CJB	Central junction box
CVD	Continuously variable damping
D4	Diesel engine - Straight-four
DAB	Digital audio broadcasting
DBJB	Dual-battery junction box
DPF	Diesel particulate filter
DSC	Dynamic stability control
DTC	Diagnostic trouble code
DV6	Diesel engine - V6
DV8	Diesel engine - V8
EJB	Engine junction box
EGR	Exhaust gas recirculation

FFBH	Fuel fired booster heater
GPS	Global positioning system
HID	High intensity discharge
HLD	High level definition
HS CAN	High speed controller area network bus
LF	Low frequency
LH	Left hand
LHD	Left hand drive
LIN	Local interconnect network
MMM	Navigation system module
MOST	Media orientated system transport
M/S	Manual/sport
MS CAN	Medium speed controller area network bus
NA	Naturally aspirated
NAS	North American specification
PDC	Park distance control
PV6	Petrol engine - V6
PV8	Petrol engine - V8
PV8NA	Naturally aspirated engine - V8
PV8SC	Super charged engine - V8
RF	Radio frequency
RH	Right hand
RHD	Right hand drive
SAI	Secondary air injection
SCL	Steering column locking
SDARS	Satellite digital audio radio service
SRS	Supplemental restraint system
TCM	Transmission control module
TMC	Traffic message channel
TPMS	Tire pressure monitoring system
TV	Television
UK	United Kingdom
USB	Universal serial bus
VICS	Vehicle information and communication system

Wire colour codes

The following list contains wire colour codes used on the vehicle harnesses.

Code	Colour
BK or B	Black
GN or G	Green
PK or K	Pink
LG	Light green
BN or N	Brown
OG or O	Orange
VT or P	Purple
RD or R	Red

GY or S	Grey (Slate)
T	Transparent
BU or U	Blue
WH or W	White
YE or Y	Yellow

Connector number suffix

To provide more accurate connector information, in some instances, a suffix has been added to the connector that identifies the vehicle harness derivative; refer to the Connector number suffix table below.

Note: The suffix does not always appear on the circuit. Take care to use the correct circuits appropriate to the vehicle under scrutiny.

Connector number suffix table

Code	Derivative	Detail
A	PV6	Gasoline V6
B	PV8NA	Gasoline V8 naturally aspirated
C	DV6 or DV6EU3	Diesel V6 (EU3 compliant)
D	PV8SC	Gasoline V8 super charged
E	DV8	Diesel V8
F	D4	Diesel (in-line 4)
G	D6	Diesel (in-line 6)
H	DV6EU4L	Diesel V6 (EU4 compliant, left-hand drive)
J	DV6EU4R	Diesel V6 (EU4 compliant, right-hand drive)
K	DV8R	Diesel V8 (right-hand drive)
L	LHD	Left-hand drive
P	PETROL	Gasoline
Q	DIESEL	Diesel
R	RHD	Right-hand drive

Connector details

A page is dedicated to each connector, with the information presented in a standard format. Connector information comprises:

- **Connector Designation –** The designated reference, prefixed 'C'.
- **CONNECTOR HOUSING SERVICEABLE –** The part identified is available through the normal parts ordering process.
- **CONNECTOR HOUSING NOT SERVICEABLE –** The part identified is not available.
- **Description –** Usually derived from the component to which the connection is made.
- **Location –** Used in conjunction with the photograph to indicate the location of the connector.
  Note: References to the LH or RH side given in this document are made when viewing the vehicle from the rear.
- **Qualifier –** For some connectors it is not possible to represent all possible conditions. An image may show a left-hand condition, the right-hand condition may be similar and is identified as such using a Qualifier, for example: LHD condition illustrated.
- **Location Image –** Shows the location of the subject connector. For convenience, some images identify more than one connector.
  Note: Images do not necessarily represent the optimum method for accessing a connector, always refer to the appropriate Service Repair Operation within the Workshop Manual before attempting to access a connector.
- **Face View –** An outline of the connector housing, viewed from the front, showing pin numbers (if applicable).
- **Part No. –** The part number as it appears on the harness drawing (if applicable).
- **Colour –** If applicable, the colour of the connector housing is shown. NATURAL is used to describe connectors with a clear/translucent plastic finish.
- **Gender –** If applicable, identifies the gender of the connector pins (NOT the housing) as Male or Female. Generally, connectors mating directly into a component have Female pins.

- **Type –** Generic connector group.
- **Cavities –** Identifies the number of cavities within the connector.
- **Wire Chart (Pin-out table) –** A five column table, giving details of each wire within the connector:

Sample Wire Chart and Service Repair Kit Information

The five columns provides specific wiring information related to each connector.

1. **Cav:** The connector pin (cavity) number.
   NOTE: Wires may not be fitted to all cavities.
2. **CSA:** The cross sectional area of the wire in mm^2.
3. **Col:** The colour of wire populating the connector pin.
4. **Cct:** Identifies the model or option which uses the wire. 'ALL' means applicable to all models in the range fitted with the feature or system in question. In instances where different models, features or systems require different colour wires to be fitted in a cavity, each instance of the cavity is included in the pin-out table.
5. **Destn:** The destination of the wire.

The last seven columns provide Service Repair Kit (SRK) information where applicable.

NOTE: When the seven columns are not shown, no SRK is available for that particular connector.

If a connector uses more than one type of terminal (pin), more than one service repair kit may be required.

1. **Pre-Terminated Lead:** Pre-terminated leads (connector pins with 90mm wire 'pig tails').
2. **Extract Tool:** Connector pin extractor tools.
3. **Crimpers:** Terminal applicator tool.
4. **Wire Stripper:** Wire cutter/stripper.
5. **Heat Shrink Sleeve:** Adhesive-lined heat-shrink sleeving.
6. **Ident Sleeve:** Wire colour identification sleeves.
7. **Splice:** Splice connectors.

Wire chart and service repair kit information

Cav	CSA	Col	Cct	Destn	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	4.50	N	2	C0571-3	418-549-11	418-612	418-116A	418-117	418-104	418-112	418-107
2	4.50	N	6	C0571-5	-	-	-	-	-	-	-

Wire chart only

Cav	CSA	Col	Cct	Destn
1	4.50	N	2	C0571-3
2	4.50	N	6	C0571-5

HARNESS REPAIRS

Repair Methods

CAUTION: Do not attempt to repair any part of a wiring harness unless appropriate training has been received. Refer to the Workshop Manual, Section 418-02, Wiring Harnesses, DESCRIPTION AND OPERATION.

FIBRE OPTICS

General

The fibre optic system installed uses Media Oriented Systems Transport (MOST), which is a multimedia network, optimized for automotive applications. Its design allows it to provide a low-overhead and low-cost interface for the simplest of devices, such as microphones and speakers. More intelligent devices can automatically determine the features and functions provided by all other devices on the network and establish sophisticated control mechanisms without distracting the driver.

Under normal installation conditions the system is robust and failures should not occur. However, since the optical fibres convey data using infra-red light, it is vital the passage of light down the fibre is unobstructed. Obstruction of infra-red light can be caused by:

- Contamination of the fibre ends.
- Damage to the fibre ends.
- Bending, kinking or damaging the cable.

NOTE: Fibres damaged by kinking or exposure of the optical core due to abrasion must be replaced.

Handling

Take special care to avoid damage or contamination when handling or working in the vicinity of fibre optic cables and connectors.

NOTE: Damage or contamination includes scratches to the cable ends and pollution caused by dust, dirt, oil or moisture.

CAUTION: When handling fibre optic cables cleanliness is of paramount importance. The fibre ends should not be touched even with clean bare hands as the natural oils deposited from the skin may penetrate the fibre or may cause dirt to adhere to the fibre end.

System malfunctions and unnecessary warranty claims can be minimised by following these guidelines:

- After disconnection of any cables, carefully install appropriate dust caps to protect the mating faces of the connectors from damage or contamination.
- Avoid introducing tight bends (less than 30mm radius) or kinks into the fibre optic cable during service or repair. Tight bends or kinks could impair operation, cause immediate system failure, or future system failure.
- Avoid excessive force, strain or stress on the fibres and connectors, especially permanent stress after reinstallation.

TABLE OF CIRCUIT OPTION CODES

The following table contains a list of circuit (Cct) reference numbers against a description of the applicable model or option. This information should be used in conjunction with the connector pin-out tables to determine the wire configuration of the vehicle under test.

Cct	Model or Option
3	2 DOOR
4	3 DOOR
5	4 DOOR
6	4/5 DOOR
13	ACCESSORY SOCKET
19L	AIRCON HI-LINE
19R	AIRCON HI-LINE
21L	AIRCON REAR
21R	AIRCON REAR
22	ANTI-THEFT ALARM
26	ARC V8
28L	TRANSMISSION AUTO
28R	TRANSMISSION AUTO
41	CDL INCLUDING SUPERLOCKING
41L	CDL INCLUDING SUPERLOCKING
41R	CDL INCLUDING SUPERLOCKING
43L	CIGAR LIGHTER
43R	CIGAR LIGHTER
57	DIAGNOSTIC SOCKET
57L	DIAGNOSTIC SOCKET
57R	DIAGNOSTIC SOCKET
68	PARKING AID REAR
90L	WIPERS & WASHERS FRONT
90R	WIPERS & WASHERS FRONT
93	FOG LAMPS FRONT
93L	FOG LAMPS FRONT
93R	FOG LAMPS FRONT
97	FUEL BURNING HEATER
97L	FUEL BURNING HEATER
97R	FUEL BURNING HEATER
107L	HEADLAMP LEVEL (MANUAL)
107R	HEADLAMP LEVEL (MANUAL)
109L	HEATED FRONT SCREEN
109R	HEATED FRONT SCREEN
113	HEATED WASHER JETS-FRONT
113L	HEATED WASHER JETS-FRONT
113R	HEATED WASHER JETS-FRONT
124	ICE - HIGH LINE
124L	ICE - HIGH LINE
124R	ICE - HIGH LINE
125	ICE - LOW LINE
125L	ICE - LOW LINE
125R	ICE - LOW LINE
131	INSTRUMENTS
134	INTERIOR LAMPS

134L	INTERIOR LAMPS
134R	INTERIOR LAMPS
139L	LHD VEHICLES
162	NO NAS
162L	NO NAS
171	PARKING AID
171L	PARKING AID
171R	PARKING AID
183L	POWERWASH
183R	POWERWASH
193L	WIPERS & WASHERS REAR
193R	WIPERS & WASHERS REAR
200R	RHD VEHICLES
204	SEAT HEAT
204L	SEAT HEAT
204R	SEAT HEAT
207	SEAT MEMORY
207L	SEAT MEMORY
207R	SEAT MEMORY
216	SRS
216L	SRS
216R	SRS
227	SUNROOF
244	VANITY MIRROR ILLUM
245	VARIABLE DAMPING
245L	VARIABLE DAMPING
245R	VARIABLE DAMPING
252	ENGINE MANAGEMENT PETROL
252L	ENGINE MANAGEMENT PETROL
252R	ENGINE MANAGEMENT PETROL
254	ENGINE MANAGEMENT DIESEL
254L	ENGINE MANAGEMENT DIESEL
254R	ENGINE MANAGEMENT DIESEL
277	LH REAR DOOR
278	RH REAR DOOR
281	ENGINE MANAGEMENT PETROL V6
281L	ENGINE MANAGEMENT V6
281R	ENGINE MANAGEMENT V6
282	ENGINE MANAGEMENT PETROL V8
282L	ENGINE MANAGEMENT V8
282R	ENGINE MANAGEMENT V8
309	PARKING AID FRONT
309L	PARKING AID FRONT
309R	PARKING AID FRONT
310	TELEVISION
319L	NAS
374	SUPERCHARGED
374L	SUPERCHARGED
374R	SUPERCHARGED
377L	LAMPS-DRIVING-AUXILIARY
377R	LAMPS-DRIVING-AUXILIARY
395	ELECTRIC PARK BRAKE

400	CORNERING LAMPS
400L	CORNERING LAMPS
400R	CORNERING LAMPS
401	REAR DIFFERENTIAL LOCK
404	ADAPTIVE FRONT LIGHTING
404L	ADAPTIVE FRONT LIGHTING
404R	ADAPTIVE FRONT LIGHTING
405	ADAPTIVE CRUISE CONTROL
405L	ADAPTIVE CRUISE CONTROL
405R	ADAPTIVE CRUISE CONTROL
406L	STEERING COLUMN ADJUST MEMORY
406R	STEERING COLUMN ADJUST MEMORY
407	ARC-SINGLE CHANNEL
407L	ARC-SINGLE CHANNEL
407R	ARC-SINGLE CHANNEL
409L	STEERING ANGLE SENSOR
409R	STEERING ANGLE SENSOR
410	PASSIVE ENTRY
413L	SLIP CONTROL
413R	SLIP CONTROL
419	4 CORNER AIR SUSPENSION
419L	4 CORNER AIR SUSPENSION
419R	4 CORNER AIR SUSPENSION
420	ICE PREMIUM
423L	NO 4 CORNER AIR SUSPENSION
424	COOLER BOX
425	REAR SEAT ENTERTAINMENT
430L	LIGHTING SWITCH
430R	LIGHTING SWITCH
439	POWER SEATS COMMON
448	NO REAR DIFFERENTIAL LOCK
452	MOST ICE
459	AIRBAG POWER SEAT
478L	HI-ICE/PREM-ICE-COMMON
478R	HI-ICE/PREM-ICE-COMMON
479	POWER LUMBAR-MEMORY
480	POWER LUMBAR-NON MEMORY
481	DRIVER DOOR
482	PASSENGER DOOR
493	INTERIOR LAMPS LH REAR DOOR
494	FBH-PROGRAMMABLE-PETROL
499	LEGACY ALL CCT
502	INTERIOR LAMPS RH REAR DOOR
522	4CAS NO LOCKING REAR DIFF
568	NAV-JAPAN
572	SEAT HEAT REAR
572L	SEAT HEAT REAR
572R	SEAT HEAT REAR
591L	TYRE PRESSURE MONITORING
591R	TYRE PRESSURE MONITORING
592	SEAT HEAT REAR 65
672	DRIVER DOOR-LHD

673	PASSENGER DOOR-LHD
674	DRIVER DOOR-RHD
675	PASSENGER DOOR-RHD
695	ENGINE MANAGEMENT DIESEL V6
706	TV + RSE
713	AIR TEMP CONTROL COMMON
729L	DIESEL V6 EU4
729R	DIESEL V6 EU4
757	RSE NO TELEVISION
777L	STEERING COLUMN LOCK
777R	STEERING COLUMN LOCK
784	PROXIMITY CAMERA
784L	PROXIMITY CAMERA
784R	PROXIMITY CAMERA
787	LH FRONT DOOR
788	RH FRONT DOOR
790L	RSE MEMORY/POWER SEATS
790R	RSE MEMORY/POWER SEATS
797	DIESEL V6 2.7L
797L	DIESEL V6 2.7L
797R	DIESEL V6 2.7L
798	DIESEL V6 3.0L
798L	DIESEL V6 3.0L
798R	DIESEL V6 3.0L
799	POWER TAILGATE-UPPER
801L	HEATED STEERING WHEEL
801R	HEATED STEERING WHEEL
805	DIESEL 2.7L + 3.0L
805L	DIESEL 2.7L + 3.0L
805R	DIESEL 2.7L + 3.0L
807L	DIESEL V6 3.0L + PETROL PV8
807R	DIESEL V6 3.0L + PETROL PV8
808	AIR SUSPENSION L319 NO VARIABLE DAMPING
808L	AIR SUSPENSION L319 NO VARIABLE DAMPING
809	AIR SUSPENSION L320 NO VARIABLE DAMPING
809L	AIR SUSPENSION L320 NO VARIABLE DAMPING
809R	AIR SUSPENSION L320 NO VARIABLE DAMPING
811	PASSIVE ENTRY LEFT DOOR
812	PASSIVE ENTRY RIGHT DOOR
815L	FBH DIESEL 3.0L
815R	FBH DIESEL 3.0L
816L	FBH DIESEL 2.7L
816R	FBH DIESEL 2.7L
819L	DPF DIESEL V6 2.7L
819R	DPF DIESEL V6 2.7L
822L	ACC PETROL
825	STEERING SOLENOID
825L	STEERING SOLENOID
825R	STEERING SOLENOID


826	4CAS NO VARIABLE DAMPING
827	AMBIENT LIGHTING
827L	AMBIENT LIGHTING
827R	AMBIENT LIGHTING
831R	ACC NO ARC
834	KNEE BOLSTER
885L	SEAT HEAT FRONT
885R	SEAT HEAT FRONT
920L	SLIP CONTROL L319
920R	SLIP CONTROL L319
921L	SLIP CONTROL L320
921R	SLIP CONTROL L320
922L	HLDF
922R	HLDF
928	ADAPTIVE FRONT LIGHTING OR MANUAL HEADLIGHT LEVEL
931	DAB ANTENNA-FIXED ROOF
932	DAB ANTENNA-GLASS ROOF
951R	AIRSUS NO ARC
953R	ARC + AIRSUS
979L	NO CVD NO REAR DIFFERENTIAL LOCK
980	REAR DIFFERENTIAL LOCK NO CVD
982	DIESEL V6 3.0L 8 SPEED
982L	DIESEL V6 3.0L 8 SPEED
982R	DIESEL V6 3.0L 8 SPEED
983	DIESEL V6 3.0L 8 SPEED DPF
983L	DIESEL V6 3.0L 8 SPEED DPF
983R	DIESEL V6 3.0L 8 SPEED DPF
984L	DIESEL V6 3.0L 8 SPEED FBH
984R	DIESEL V6 3.0L 8 SPEED FBH
986L	AUTO TRANSMISSION-6 SPEED
986R	AUTO TRANSMISSION-6 SPEED
989	NAVIGATION + TV OR RSE
990	NAVIGATION - TV OR RSE
991	DIESEL V6 3.0L 6 SPEED DPF
991L	DIESEL V6 3.0L 6 SPEED DPF
991R	DIESEL V6 3.0L 6 SPEED DPF
993	DIESEL V6 3.0L 6 SPEED
993L	DIESEL V6 3.0L 6 SPEED
993R	DIESEL V6 3.0L 6 SPEED
994L	DIESEL V6 3.0L 6 SPEED FBH
994R	DIESEL V6 3.0L 6 SPEED FBH
995L	DIESEL V6 3.0L + ACC
996L	DIESEL V6 3.0L + ADAPTIVE FRONT LIGHTING NO ACC
997R	DIESEL V6 3.0L + ADAPTIVE FRONT LIGHTING
998R	DIESEL V6 3.0L NO ADAPTIVE FRONT LIGHTING
999L	PETROL + ADAPTIVE FRONT LIGHTING NO ACC
1000R	PETROL + ADAPTIVE FRONT LIGHTING
1004L	NO ARC
1005R	NO ARC NO ACC

1006L	DIESEL V6 2.7L + ADAPTIVE FRONT LIGHTING
1006R	DIESEL V6 2.7L + ADAPTIVE FRONT LIGHTING
1007L	DIESEL V6 2.7L NO ADAPTIVE FRONT LIGHTING
1007R	DIESEL V6 2.7L NO ADAPTIVE FRONT LIGHTING
1009L	PETROL NO ACC NO AFS
1010L	DIESEL V6 3.0L NO ACC NO AFS
1011	ASIAN NAV
1011L	ASIAN NAV
1011R	ASIAN NAV
1018	LO LINE DAB FIXED ROOF
1019	LO LINE DAB GLASS ROOF
1020	LOW LINE USB
1021	HIGH LINE USB
1022	LOW LINE DAB
1031	DIVERSITY ANTENNA FM
1048L	ICE HIGH LINE NO VICS OR ASIA NAV
1048R	ICE HIGH LINE NO VICS OR ASIA NAV
1052	SDARS or DAB or Television or Asia Nav or Japan Nav
1054	NO JAPAN NO RSE
1057	JAPAN/ASIA NAVIGATION + TV - RSE
ALL	ALL VEHICLE
EN_RX	5 0L AJ133 N/A
EN_RY	5.0L AJ133 S/C

Click here to print

Connector: C0004

CONNECTOR HOUSING NOT SERVICEABLE

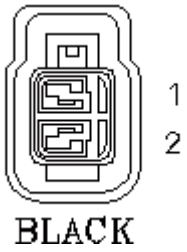

Part No.: YPC500750

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Horn-RH

Location: In front of radiator

Qualifier:

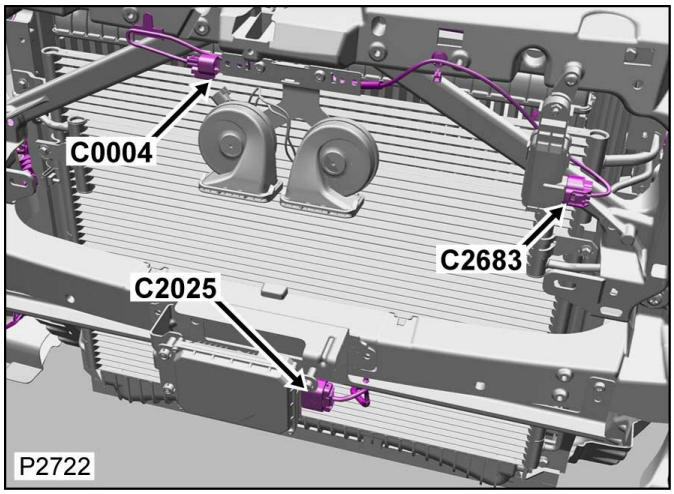


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	B	139L	C0570L	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
1	1.5	B	200R	C0570R	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	B	499	S/JOINT SJ877	418-587-09	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C0007

CONNECTOR HOUSING NOT SERVICEABLE

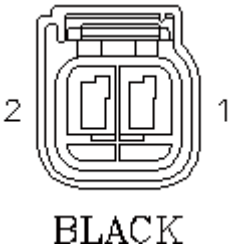

Part No.: YPC800380

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Switch-Bonnet

Location: Front RH side of engine compartment

Qualifier:

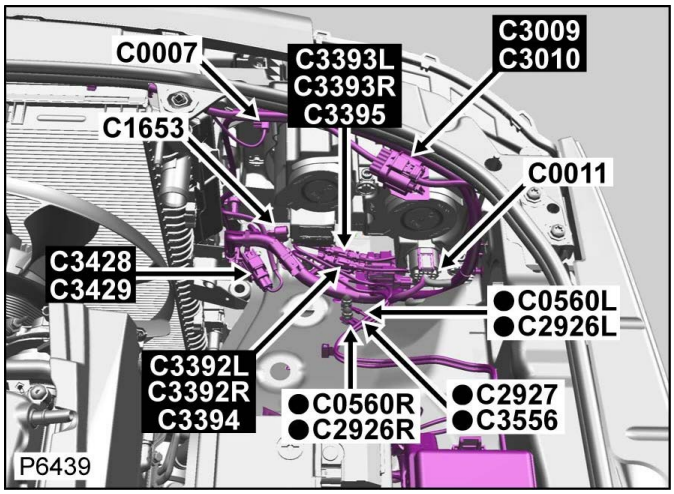

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	B	139L	C0584L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.35	B	200R	C0584R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	499	S/JOINT SJ877	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0008**

CONNECTOR HOUSING SERVICEABLE



BLACK

Part No.: YPC902970

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Pump-washer-front/ rear screen

Location: Behind LH front fender splash shield

Qualifier:

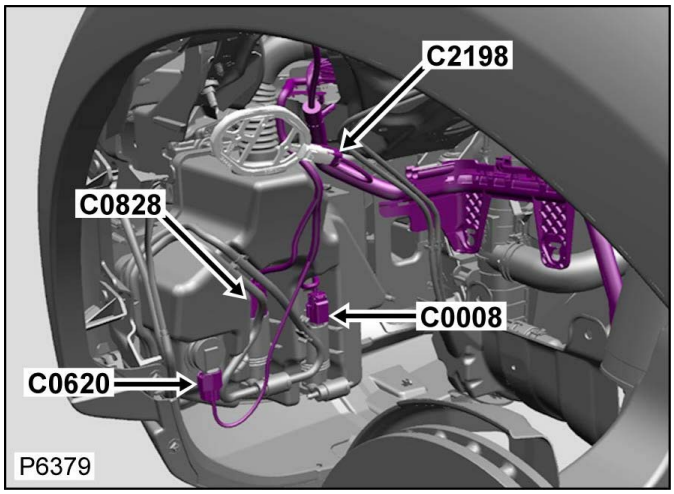

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	BO	139L	C0583L	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
1	1.5	BO	200R	C0583R	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	OB	139L	C0583L	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	OB	200R	C0583R	418-587-09	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: **C0009**

CONNECTOR HOUSING SERVICEABLE

Description: **Headlamp-LH**

Location: **Behind LH headlamp**

Qualifier:

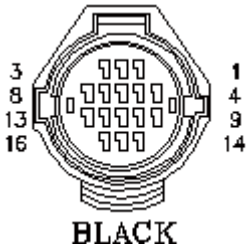


BLACK

Part No.: **YPC800820**

Colour: **BLACK**

Cavities: **16WY**

Harness: **ENGINE COMPARTMENT HARNESS**

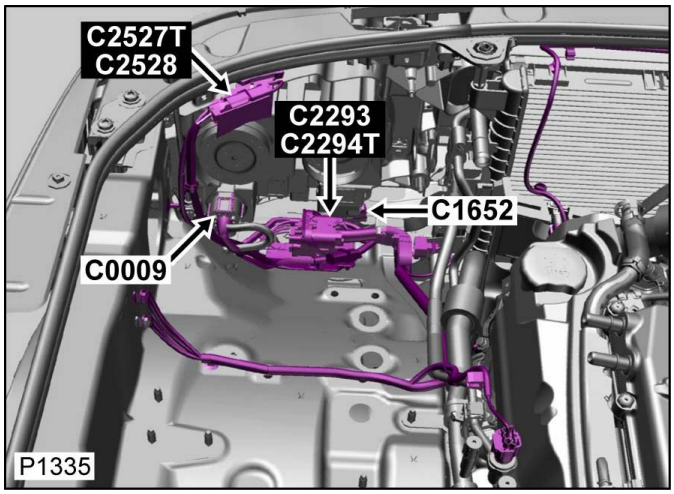

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	B	499	S/JOINT SJ879	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
2	1.0	RB	499	S/JOINT SJ943	-	-	-	-	-	-	-
3	1.5	GR	139L	C0583L	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	GR	200R	C0583R	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
4	1.5	R	400L	C0583L	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
4	1.5	R	400R	C0583R	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
5	0.5	P	928	S/JOINT SJ443	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	B	928	S/JOINT SJ879	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	YN	107L	S/JOINT SJ180	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	R	404	S/JOINT SJ444	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	YN	107R	S/JOINT SJ1180	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	GO	139L	C0583L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	GO	200R	C0583R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
9	1.5	B	499	S/JOINT SJ879	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
10	1.5	US	139L	C0583L	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
10	1.5	US	200R	C0583R	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
11	1.5	UK	139L	C0583L	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
11	1.5	UK	200R	C0583R	418-587-09	-	418-116A	418-117	418-104	418-113	418-108

12	1.5	B	499	S/JOINT SJ879	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
13	0.35	R	404L	S/JOINT SJ442	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
13	0.35	R	404R	S/JOINT SJ1142	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	RB	404L	C0583L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	RB	404R	C0583R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
15	0.5	B	404	S/JOINT SJ879	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
16	1.5	B	400	S/JOINT SJ879	418-587-09	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C0011

CONNECTOR HOUSING SERVICEABLE

Description: Headlamp-RH

Location: Front RH side of engine compartment

Qualifier:

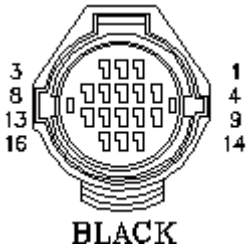


BLACK

Part No.: YPC800820

Colour: BLACK

Cavities: 16WY

Harness: ENGINE COMPARTMENT HARNESS

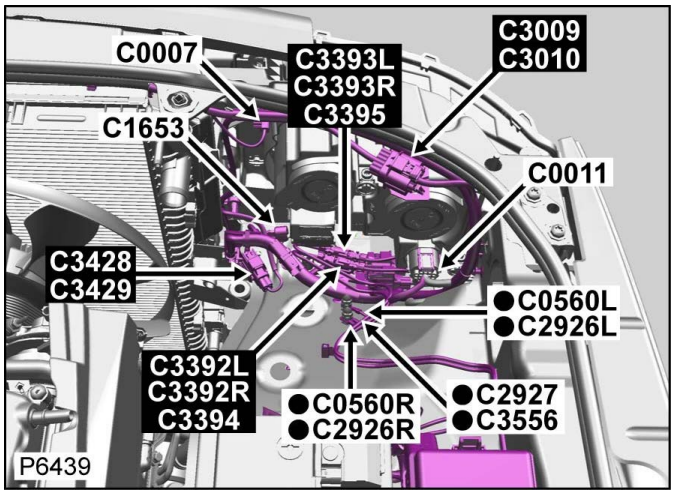

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	B	499	S/JOINT SJ878	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
2	1.0	RO	499	S/JOINT SJ942	-	-	-	-	-	-	-
3	1.5	GW	139L	C0583L	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	GW	200R	C0583R	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
4	1.5	R	400L	C0583L	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
4	1.5	R	400R	C0583R	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
5	0.5	P	928	S/JOINT SJ443	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	B	928	S/JOINT SJ878	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	R	404	S/JOINT SJ444	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	YN	107L	S/JOINT SJ180	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	YN	107R	S/JOINT SJ1180	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	GO	139L	C0583L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	GO	200R	C0583R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
9	1.5	B	499	S/JOINT SJ878	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
10	1.5	UB	139L	C0583L	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
10	1.5	UB	200R	C0583R	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
11	1.5	UO	139L	C0583L	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
11	1.5	UO	200R	C0583R	418-587-09	-	418-116A	418-117	418-104	418-113	418-108

12	1.5	B	499	S/JOINT SJ878	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
13	0.35	R	404L	S/JOINT SJ442	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
13	0.35	R	404R	S/JOINT SJ1142	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	RO	404L	C0583L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	RO	404R	C0583R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
15	0.5	B	404	S/JOINT SJ878	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
16	1.5	B	400	S/JOINT SJ878	418-587-09	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: **C0026L**

CONNECTOR HOUSING SERVICEABLE

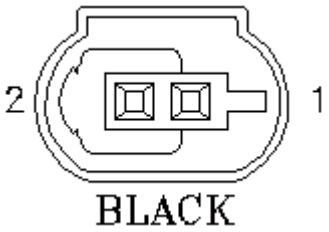

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Switch-Brake-fluid level

Location: Rear LH side of engine compartment

Qualifier:

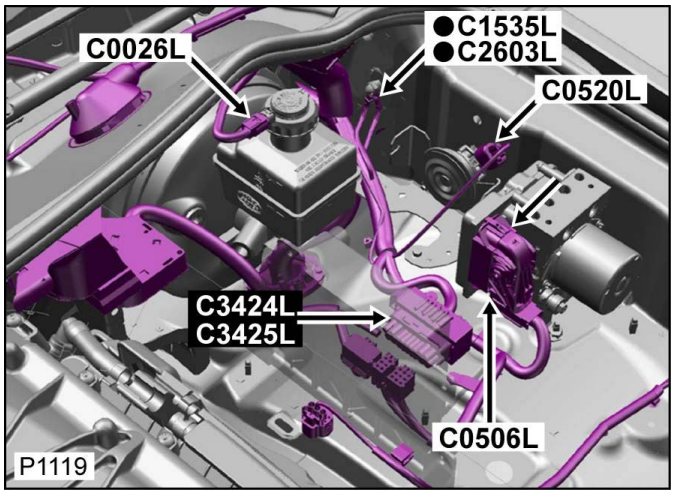


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	SP	139L	C0584L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	B	139L	S/JOINT SJ171	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0026R**

CONNECTOR HOUSING SERVICEABLE

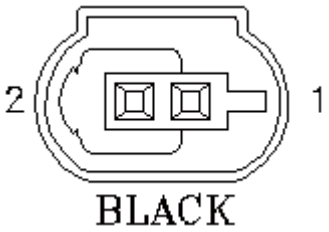

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Switch-Brake-fluid level

Location: Rear RH side of engine compartment

Qualifier:

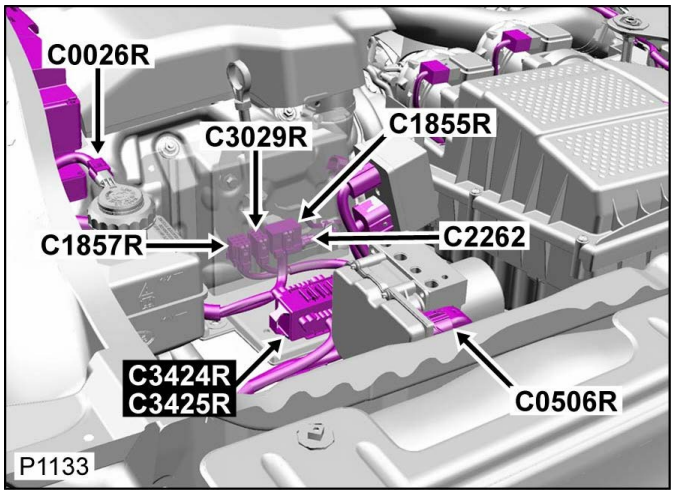

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	SP	200R	C0584R	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	200R	S/JOINT SJ173	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C0030L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Motor-Wiper-Windscreen

Location: Behind air intake plenum

Qualifier:

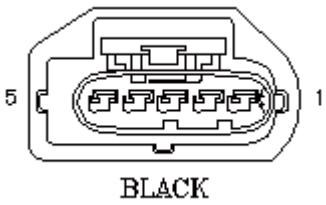

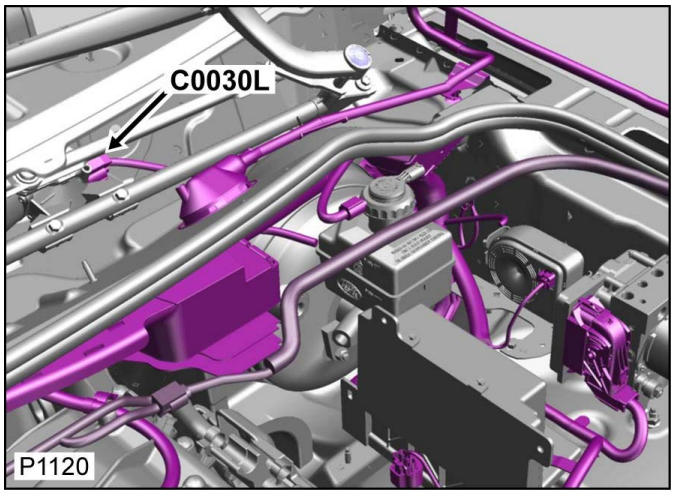

Part No.: YPC501150

Colour: BLACK

Cavities: 5WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WG	139L	C0584L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
3	2.5	B	139L	S/JOINT SJ171	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
4	2.5	ULG	139L	C0570L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
5	2.5	RLG	139L	C0570L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: **C0030R**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Motor-Wiper-Windscreen

Location: Behind air intake plenum

Qualifier:

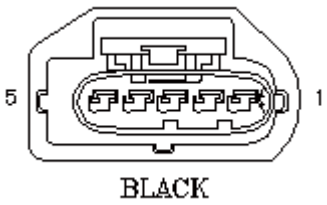

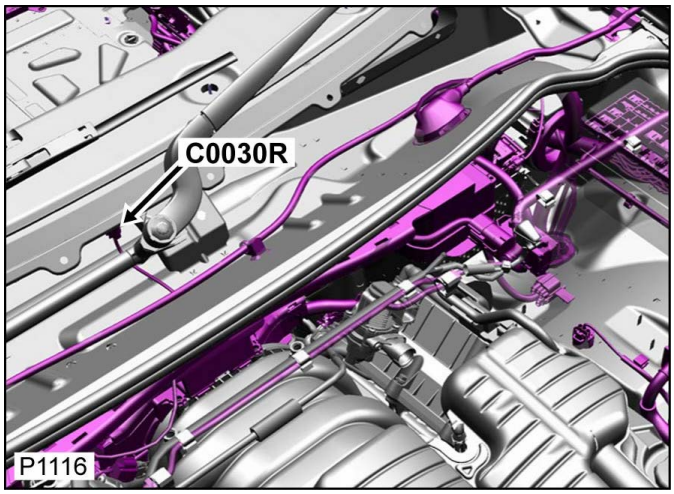

Part No.: YPC501150

Colour: BLACK

Cavities: 5WY

Harness: ENGINE COMPARTMENT HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	RLG	200R	C0570R	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	ULG	200R	C0570R	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
3	2.5	B	200R	S/JOINT SJ171	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
5	0.5	WG	200R	C0584R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0040**

CONNECTOR HOUSING SERVICEABLE

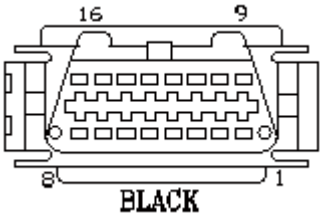

Part No.: YPC107920

Colour: BLACK


Cavities: 16WY

Harness: FACIA COMPOSITE HARNESS

Description: Diagnostic socket

Location: Driver footwell

Qualifier: LHD illustrated RHD similar

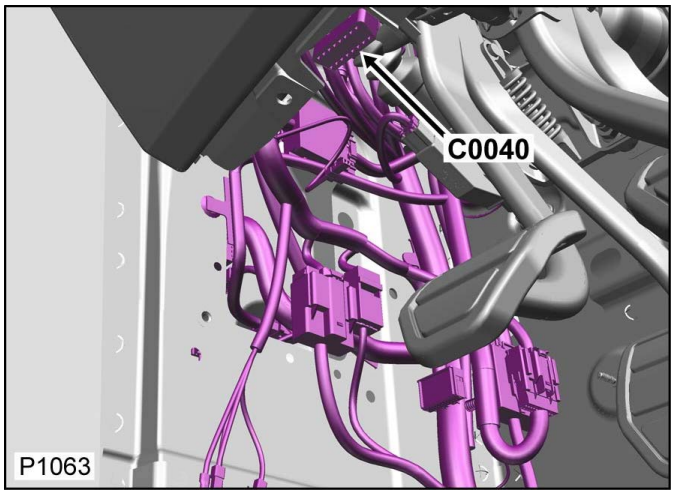


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	LGR	139L	C2238L
1	0.5	LGR	200R	C2239R
3	0.35	YW	57	S/JOINT SJ730
4	0.5	B	57L	C2627L
4	0.5	B	57R	C2627R
5	0.5	B	57L	C2628L
5	0.5	B	57R	C2628R
6	0.35	YN	57	S/JOINT SJ851
9	0.35	R	139L	C2443
9	0.35	R	200R	C2238R
11	0.35	YU	57	S/JOINT SJ731
12	0.5	G	252L	C2238L
12	0.5	G	252R	C2239R
13	0.5	N	252L	C2238L
13	0.5	N	252R	C2239R
14	0.35	YB	57	S/JOINT SJ861
16	0.5	RY	57	C0582

Click here to print

Connector: C0041

CONNECTOR HOUSING NOT SERVICEABLE

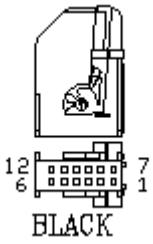

Part No.: YPC111790

Colour: BLACK


Cavities: 12WY

Harness: FACIA COMPOSITE HARNESS

Description: Lighting control switch

Location: Behind driver side of Instrument panel

Qualifier:

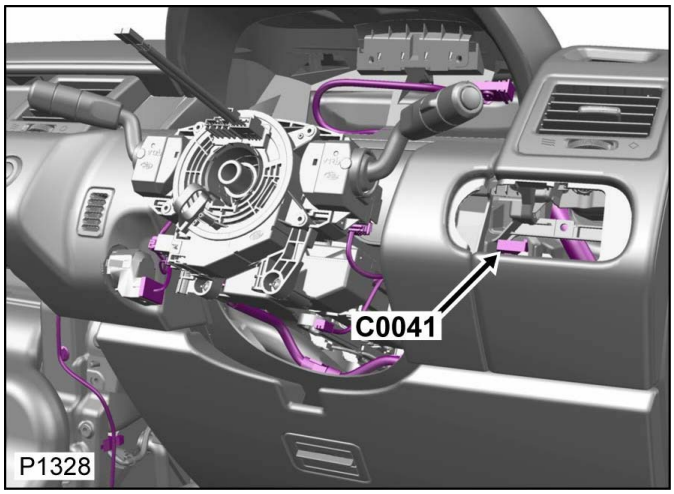

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	RN	499	S/JOINT SJ117	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.35	RO	499	C0580	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
3	0.5	R	499	C0580	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.35	YN	430L	C2443	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.35	YN	430R	C2238R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
6	0.5	GB	499	S/JOINT SJ199	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
7	0.5	B	499	S/JOINT SJ660	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
8	0.35	Y	499	C0580	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
9	0.35	RW	499	C0580	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
11	0.35	RO	499	C0580	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0047L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to instrument panel harness

Location: LH 'A' post

Qualifier:



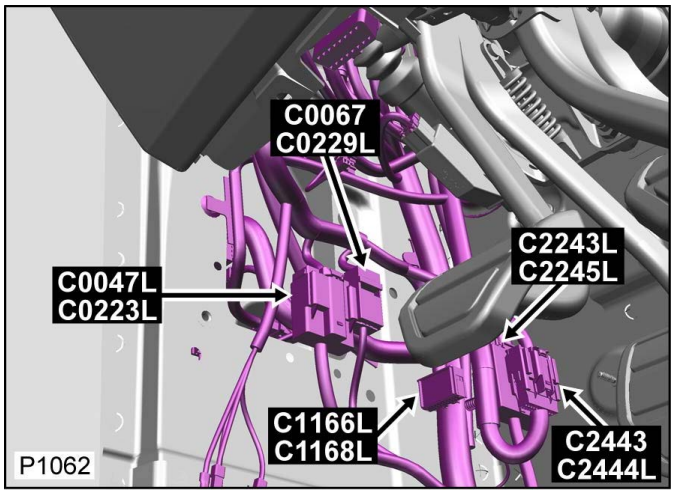

Part No.: YPC911790

Colour: LIGHT GREY

Cavities: 12WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	RW	139L	S/JOINT SJ17	-	-	-	-	-	-	-
2	0.5	GK	139L	S/JOINT SJ14	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
3	1.5	G	125SL	C0396	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
4	1.5	GW	125SL	C0396	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
9	1.5	OG	139SL	S/JOINT SJ396S	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
9	1.5	OG	139TL	S/JOINT SJ396T	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
10	1.5	RB	13SL	C0868S	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
11	1.5	G	125SL	C0435	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
12	1.5	GW	125SL	C0435	418-411-16	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C0047R

CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to instrument panel harness

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated




Part No.: YPC911790

Colour: LIGHT GREY

Cavities: 12WY

Harness: CABIN HARNESS

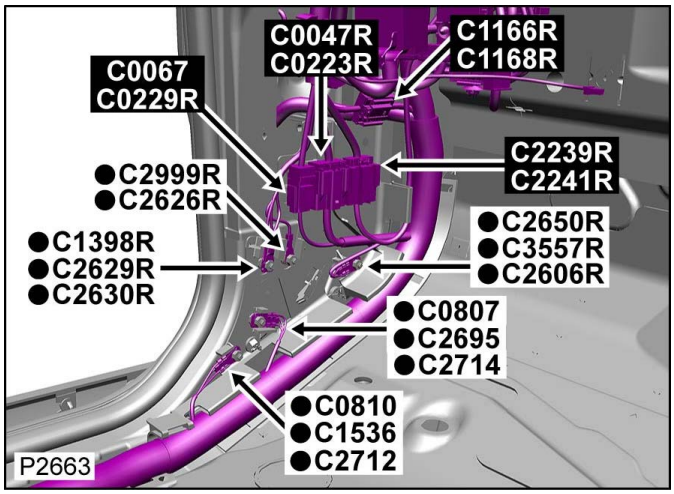


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	LGW	200R	C0084	-	-	-	-	-	-	-
2	1.5	OG	200SR	S/JOINT SJ396S	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	OG	200TR	S/JOINT SJ396T	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
3	0.35	BR	245TR	C3087T	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	RU	216R	C1649	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	RY	216R	C0256	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
6	0.35	G	216SR	C1649	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
7	1.5	G	125SR	C0396	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
8	1.5	GW	125SR	C0396	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
9	1.5	G	125SR	C0435	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
10	1.5	GW	125SR	C0435	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
11	0.5	G	200R	S/JOINT SJ224	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
12	2.5	NR	200TR	C2959T	418-411-16	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: **C0050**

CONNECTOR HOUSING NOT SERVICEABLE

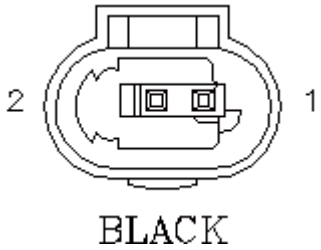

Part No.: YPC800100

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Sensor-Pad wear-Front-LH

Location: Behind LH front fender splash shield

Qualifier:

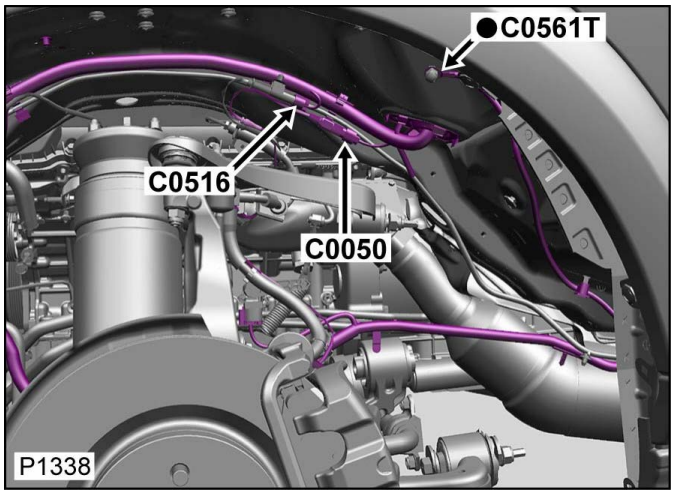


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	R	499	C2293	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	499	S/JOINT SJ171	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0052

CONNECTOR HOUSING NOT SERVICEABLE

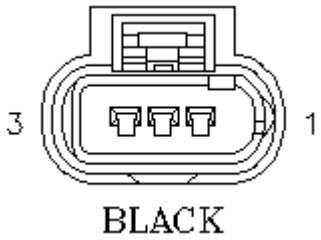

Part No.: YPC913370

Colour: BLACK


Cavities: 3WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Ignition coil-2 - PV8

Location: Top of engine - LH side

Qualifier:

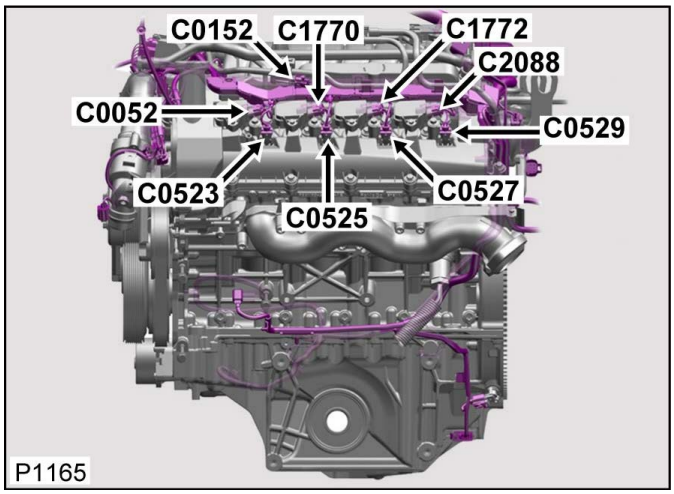


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	WN	ALL	C0634
2	0.5	B	ALL	S/JOINT PIS21
3	0.5	W	ALL	S/JOINT PIS27

Click here to print

Connector: C0053

CONNECTOR HOUSING NOT SERVICEABLE

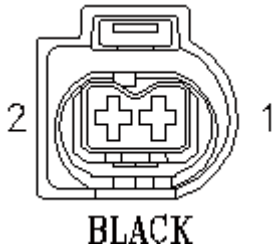

Part No.: YPC908520

Colour: BLACK


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Alternator-generator - PV8

Location: RH side of engine

Qualifier:

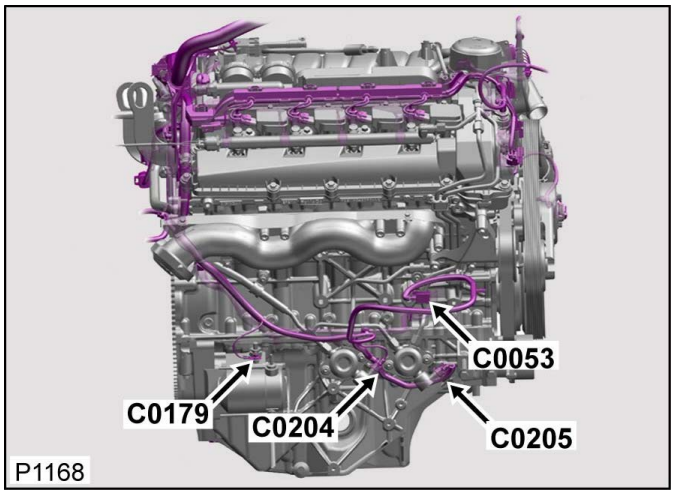


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	UN	ALL	C0634

Click here to print

Connector: **C0053M**

CONNECTOR HOUSING NOT SERVICEABLE

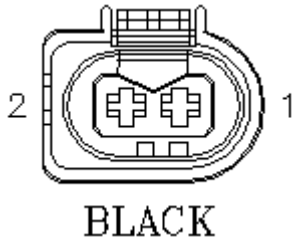

Part No.: YPC913000

Colour: BLACK


Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Alternator-generator - DV6

Location: RH side of engine

Qualifier:

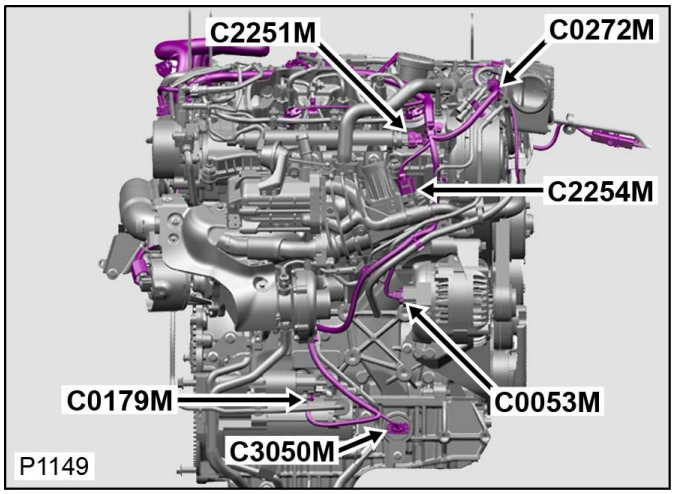


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	UN	798	C3069M	418-549-18	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0056

CONNECTOR HOUSING NOT SERVICEABLE

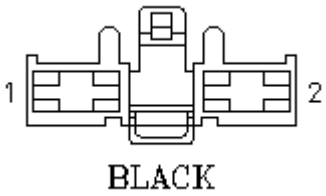

Part No.: YPC909270

Colour: BLACK


Cavities: 2WY

Harness: ATC RHD HARNESS

Description: Motor-Blower-Front

Location: Climate control assembly-Passenger side

Qualifier:

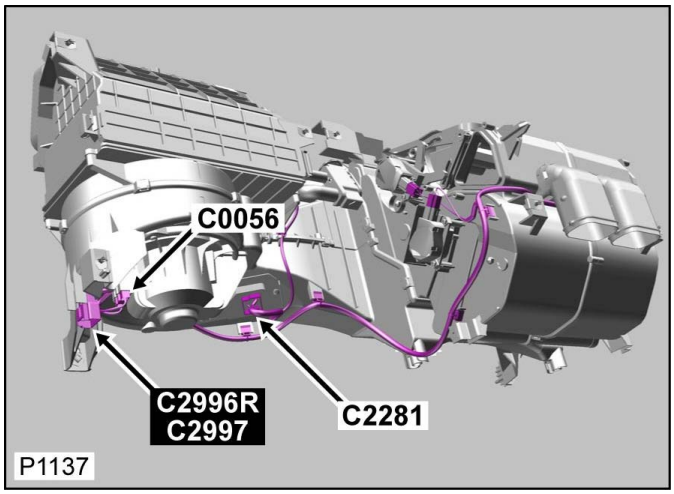


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	499	C2281
2	4.0	W	499	C2997

Click here to print

Connector: C0067

CONNECTOR HOUSING NOT SERVICEABLE

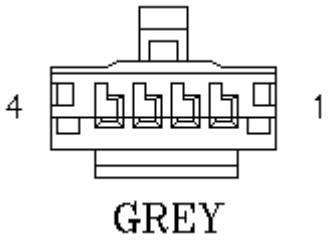

Part No.: YPC800360

Colour: GREY


Cavities: 4WY

Harness: CABIN HARNESS

Description: Main harness to instrument panel harness

Location: LH 'A' post

Qualifier:

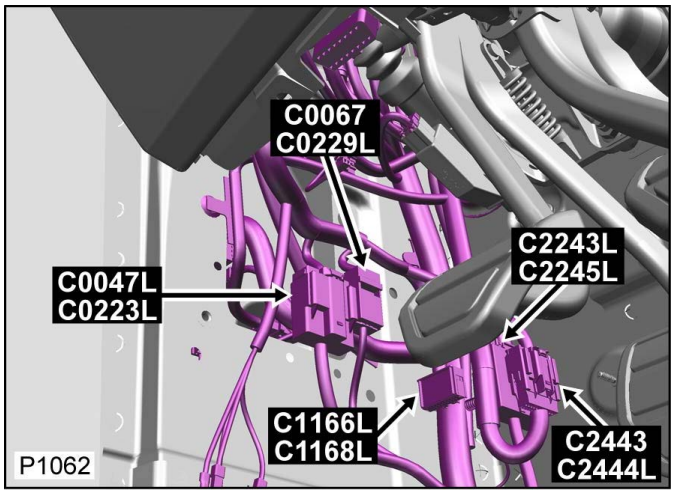


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	RY	216L	C1649
1	0.5	BU	216R	C1649
2	0.5	R	216L	C1649
2	0.5	GU	216R	C1649
3	0.5	RG	216L	C1649
3	0.5	BR	216R	C1649
4	0.5	RB	216L	C1649
4	0.5	GO	216R	C1649

Click here to print

Connector: C0074

CONNECTOR HOUSING NOT SERVICEABLE

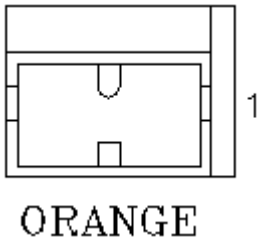

Part No.: YPC900800

Colour: ORANGE


Cavities: 1WY

Harness: CONSOLE FRONT HARNESS

Description: Cigar lighter-illumination

Location: Beneath center console RH side

Qualifier: LHD condition illustrated

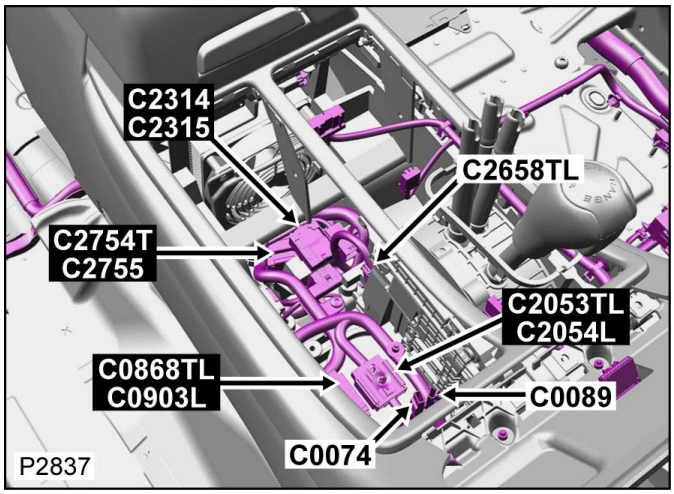

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	RN	43L	S/JOINT SJ322	418-549-44	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	RN	43R	S/JOINT SJ322	418-549-44	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0075L

CONNECTOR HOUSING SERVICEABLE



Part No.: YPC901420

Colour: NATURAL


Cavities: 4WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Switch-Brake pedal

Location: Driver footwell

Qualifier:

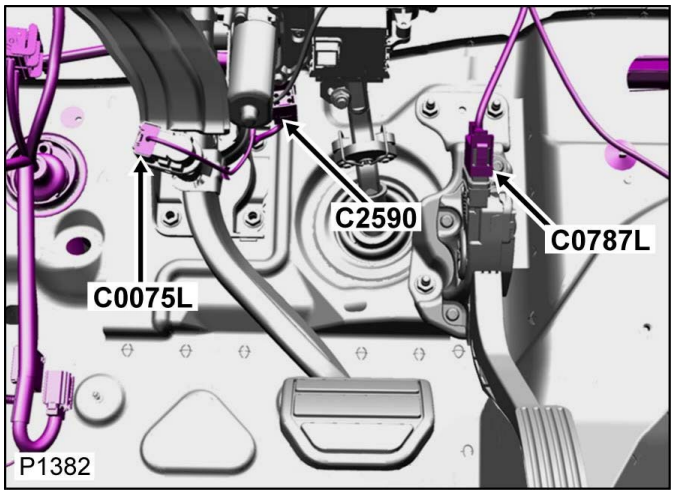

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GP	139L	S/JOINT SJ814	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	UR	139L	S/JOINT SJ174	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	B	139L	S/JOINT SJ171	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	PY	139L	C2412L	418-411-46	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0075R**

CONNECTOR HOUSING SERVICEABLE



Part No.: YPC901420

Colour: NATURAL


Cavities: 4WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Switch-Brake pedal

Location: Driver footwell

Qualifier:

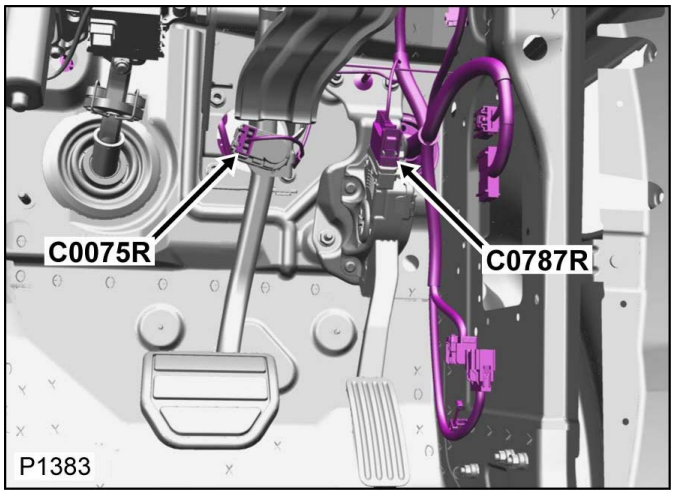


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GP	200R	S/JOINT SJ1814	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	UR	200R	S/JOINT SJ1174	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	B	200R	S/JOINT SJ173	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	PY	200R	C2410R	418-411-46	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0076L**

CONNECTOR HOUSING SERVICEABLE

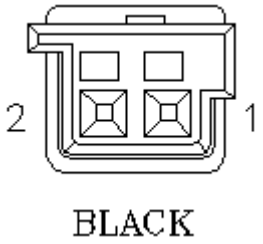

BLACK

Part No.: YPC802690

Colour: BLACK


Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Description: Lamp-Footwell-Front-RH

Location: Behind RH closing panel

Qualifier:

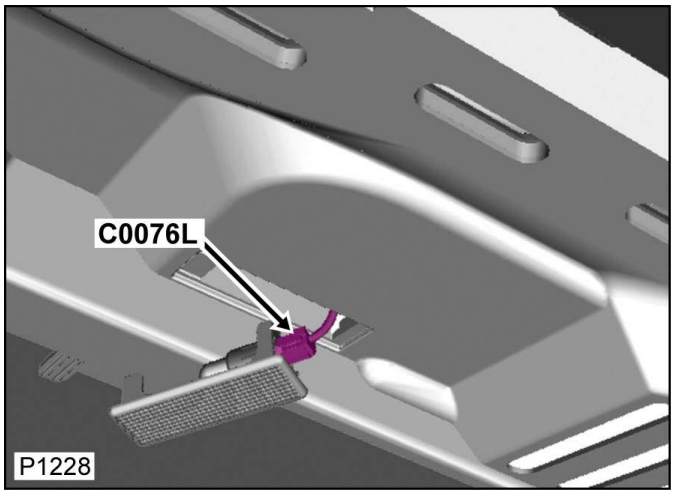


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	134L	S/JOINT SJ660	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.75	P	134L	S/JOINT SJ740	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: **C0076R**

CONNECTOR HOUSING SERVICEABLE

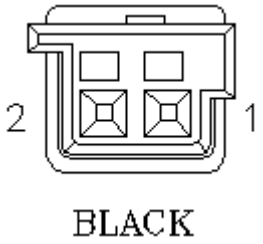

Part No.: YPC802690

Colour: BLACK


Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Description: Lamp-Footwell-Front-RH

Location: Behind RH closing panel

Qualifier:

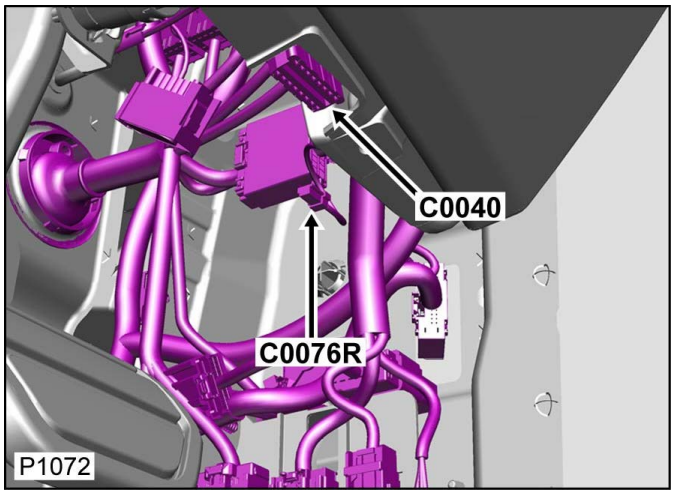


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	134R	S/JOINT SJ660	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.75	P	134R	S/JOINT SJ740	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: **C0077L**

CONNECTOR HOUSING SERVICEABLE

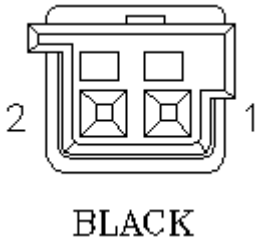

BLACK

Part No.: YPC802690

Colour: BLACK


Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Description: Lamp-Footwell-Front-LH

Location: Behind LH closing panel

Qualifier:

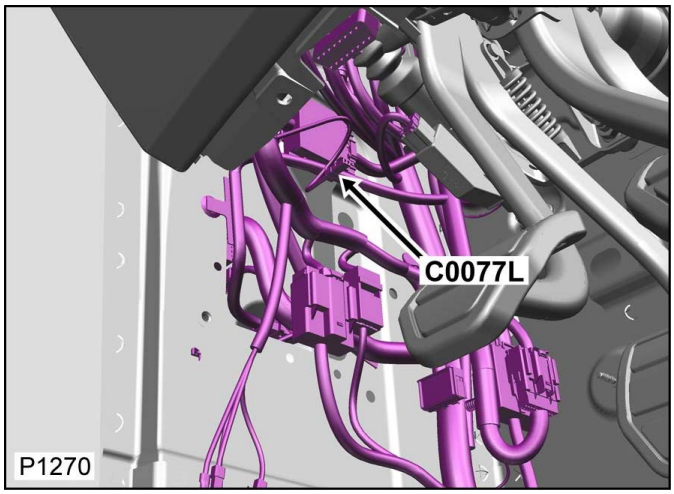


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	134L	S/JOINT SJ662	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.75	P	134L	S/JOINT SJ740	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: **C0077R**

CONNECTOR HOUSING SERVICEABLE

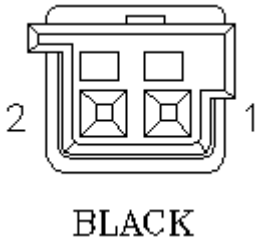

BLACK

Part No.: YPC802690

Colour: BLACK


Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Description: Lamp-Footwell-Front-LH

Location: Behind LH closing panel

Qualifier:

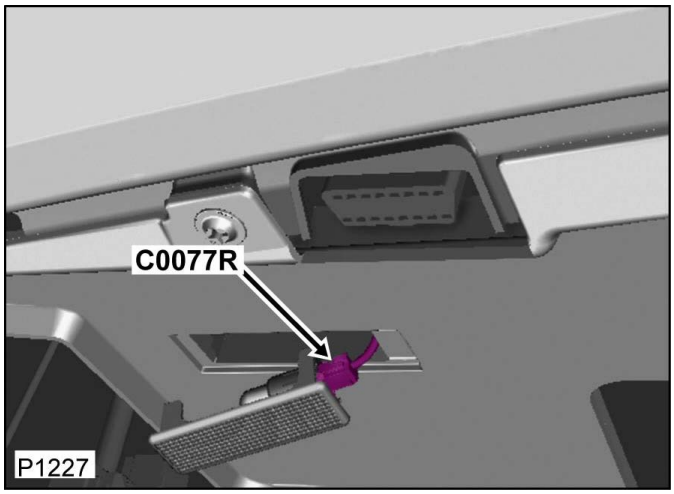


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	134R	S/JOINT SJ662	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.75	P	134R	S/JOINT SJ740	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0081

CONNECTOR HOUSING NOT SERVICEABLE

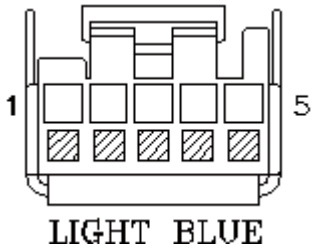

Part No.: YPC10314

Colour: LIGHT BLUE


Cavities: 5WY

Harness: DOORS FRONT HARNESS

Description: Switch pack-Window lift

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated

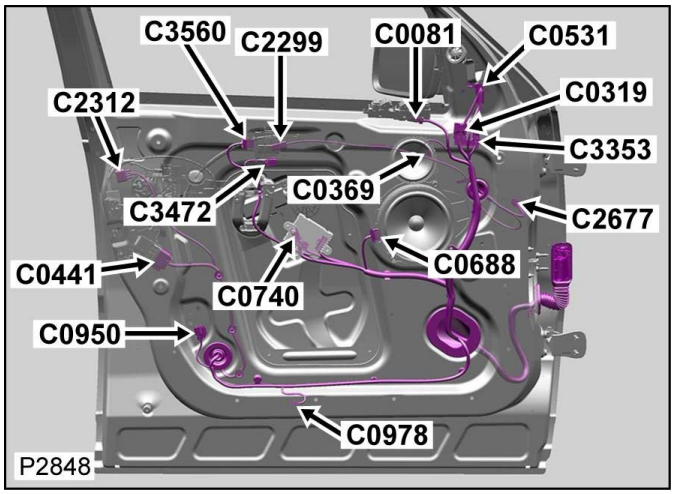


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	NG	481	S/JOINT SJ2024	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	481	S/JOINT SJ19	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	B	481	S/JOINT SJ840	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0082L

CONNECTOR HOUSING NOT SERVICEABLE

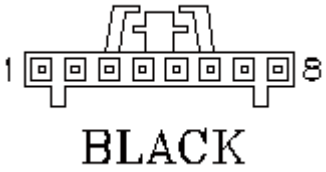

BLACK

Part No.: YPC800520

Colour: BLACK


Cavities: 8WY

Harness: FACIA COMPOSITE HARNESS

Description: Clock spring

Location: Behind steering column cowl LH side

Qualifier:

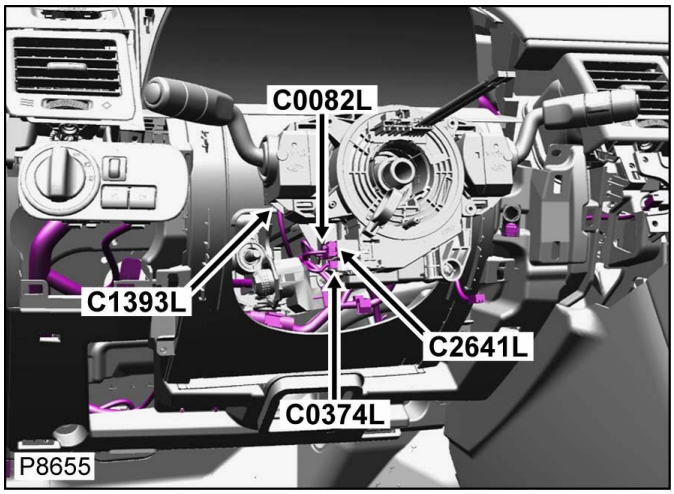

Wire Chart

CAV	CSA	COL	CCT	DESTN
2	0.35	WS	139L	C0230
3	0.35	NG	139L	C2238L
4	0.35	SR	922L	C2819L
4	0.35	SR	125L	C2515L
5	0.35	WS	124L	S/JOINT SJ132
5	0.35	WS	125L	C0581
6	0.35	B	139L	S/JOINT SJ663L
7	0.35	SB	125L	C2515L
7	0.35	B	124L	C2819L
8	0.35	GB	139L	C0582

Click here to print


Connector: C0082R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Clock spring

Location: Behind steering column cowl LH side

Qualifier:

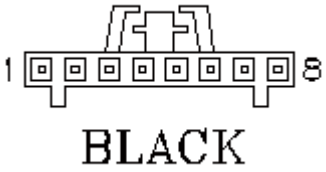

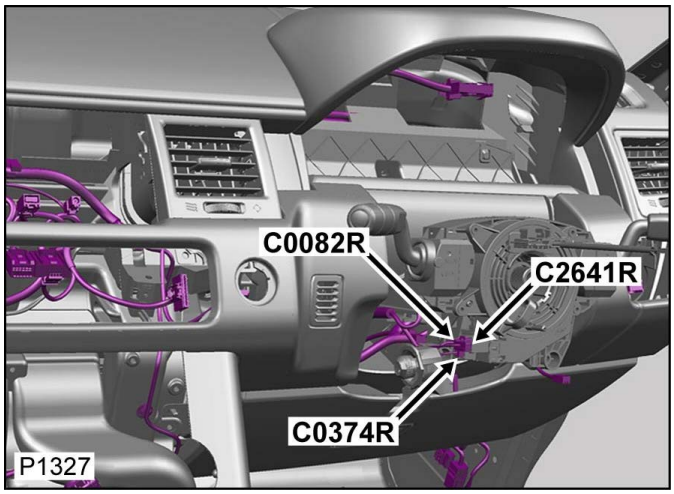

Part No.: YPC800520

Colour: BLACK

Cavities: 8WY

Harness: FACIA COMPOSITE HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
2	0.35	WS	200R	C0230
3	0.35	NG	200R	C2238R
4	0.35	SR	922R	C2819R
4	0.35	SR	125R	C2515R
5	0.35	WS	124R	S/JOINT SJ132
5	0.35	WS	125R	C0581
6	0.35	B	200R	S/JOINT SJ663R
7	0.35	SB	125R	C2515R
7	0.35	B	124R	C2819R
8	0.35	GB	200R	C0582

Click here to print

Connector: **C0083**

CONNECTOR HOUSING NOT SERVICEABLE

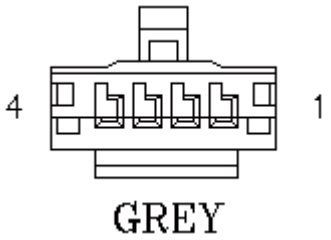

Part No.: YPC800360

Colour: GREY


Cavities: 4WY

Harness: CABIN HARNESS

Description: Main harness to instrument panel harness

Location: Base of RH 'A' post

Qualifier: LHD condition illustrated

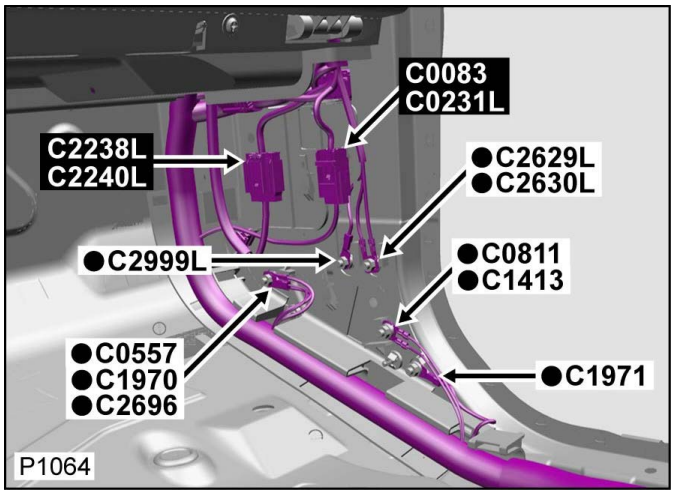


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	BU	216L	C1649
1	0.5	RY	216R	C1649
2	0.5	GU	216L	C1649
2	0.5	R	216R	C1649
3	0.5	BR	216L	C1649
3	0.5	RG	216R	C1649
4	0.5	GO	216L	C1649
4	0.5	RB	216R	C1649

Click here to print

Connector: **C0084**

CONNECTOR HOUSING SERVICEABLE

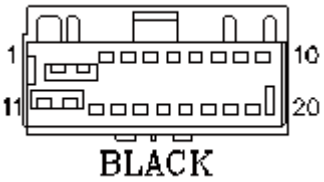

Part No.: YPC901760

Colour: BLACK


Cavities: 20WY

Harness: CABIN HARNESS

Description: Main harness to roof harness

Location: RH 'A' post

Qualifier:

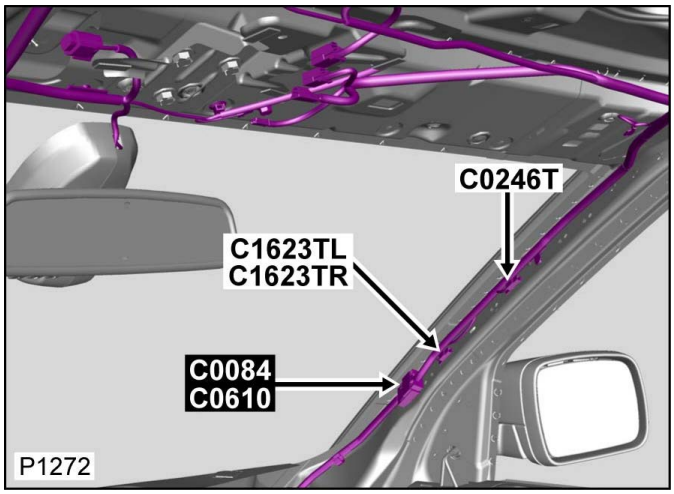

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	B	134S	S/JOINT SJ276	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
1	1.5	NY	420T	C0492T	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
2	1.5	B	499S	S/JOINT SJ276	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
2	1.5	WG	420T	C0492T	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	OY	227S	C0784S	418-587-04	-	418-116A	418-117	-	418-112	418-107
3	0.5	OY	227T	C0784T	418-587-04	-	418-116A	418-117	-	418-112	418-107
5	0.5	RN	499	S/JOINT SJ52	418-587-04	-	418-116A	418-117	-	418-112	418-107
6	0.75	LGW	134L	C0467	418-587-04	-	418-116A	418-117	-	418-112	418-107
6	0.75	LGW	200R	C0047R	418-587-04	-	418-116A	418-117	-	418-112	418-107
7	0.75	P	134	S/JOINT SJ38	418-587-04	-	418-116A	418-117	-	418-112	418-107
8	0.75	B	134T	S/JOINT SJ276	418-587-04	-	418-116A	418-117	-	418-112	418-107
9	0.5	OR	810S	C2160S	418-587-04	-	418-116A	418-117	-	418-112	418-107
10	0.5	OS	810S	C2160S	418-587-04	-	418-116A	418-117	-	418-112	418-107
11	0.35	SP	810S	C2160S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
11	1.5	NU	420T	C0492T	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
12	0.35	SY	810S	C2160S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
12	1.5	NW	420T	C0492T	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
13	0.5	GB	227S	C0784S	418-587-04	-	418-116A	418-117	-	418-112	418-107

14	0.5	RU	22	S/JOINT SJ206	418-587-04	-	418-116A	418-117	-	418-112	418-107
15	0.5	G	499	S/JOINT SJ869	418-587-04	-	418-116A	418-117	-	418-112	418-107
16	0.5	PU	134	C1165	418-587-04	-	418-116A	418-117	-	418-112	418-107
17	0.5	B	499	C1165	418-587-04	-	418-116A	418-117	-	418-112	418-107
18	0.5	R	499	C1165	418-587-04	-	418-116A	418-117	-	418-112	418-107
20	0.5	GW	227S	C0784S	418-587-04	-	418-116A	418-117	-	418-112	418-107
20	0.5	GW	227T	C0784T	418-587-04	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0087

CONNECTOR HOUSING NOT SERVICEABLE

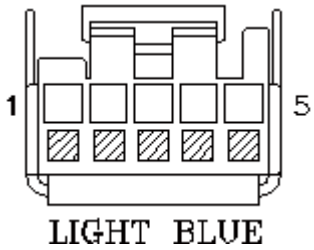

Part No.: YPC10314

Colour: LIGHT BLUE


Cavities: 5WY

Harness: DOORS FRONT HARNESS

Description: Switch-Window-Passenger door

Location: Behind passenger door trim panel

Qualifier: LHD condition illustrated

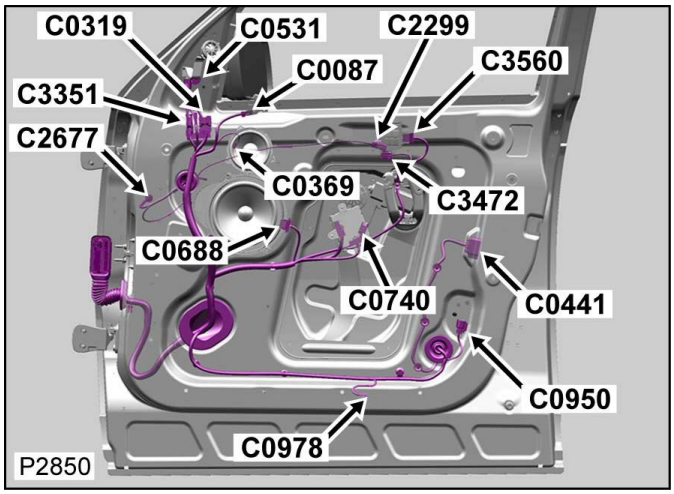


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	482	S/JOINT SJ841	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.35	NY	673	C2016	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.35	NY	675	C2272	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.35	GO	673	C2016	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.35	GO	675	C2272	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	G	673	C2016	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	G	675	C2272	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0089

CONNECTOR HOUSING NOT SERVICEABLE

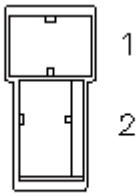

BLACK

Part No.: AFU3199

Colour: BLACK


Cavities: 2WY

Harness: CONSOLE FRONT HARNESS

Description: Cigar lighter

Location: Beneath center console RH side

Qualifier: LHD condition illustrated

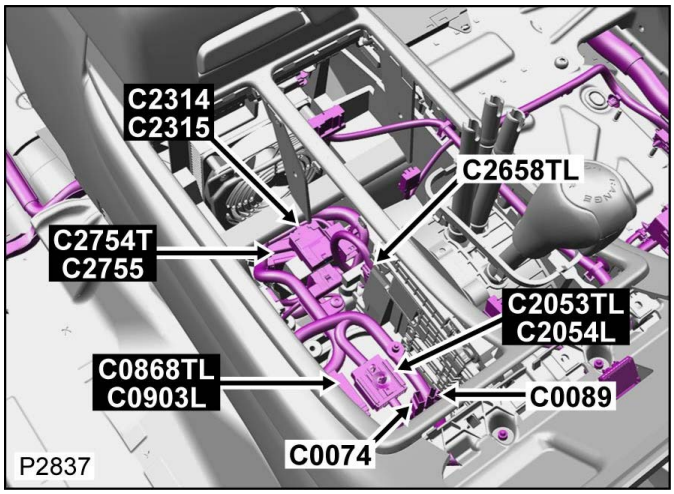


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	B	43L	S/JOINT SJ323	418-549-43	-	418-116A	418-117	-	418-113	418-108
1	1.5	B	43R	S/JOINT SJ323	418-549-43	-	418-116A	418-117	-	418-113	418-108
2	1.5	LGW	986L	C0903L	418-549-43	-	418-116A	418-117	-	418-113	418-108
2	1.5	LGW	982L	C0903A	418-549-43	-	418-116A	418-117	-	418-113	418-108
2	1.5	LGW	986R	C0903R	418-549-43	-	418-116A	418-117	-	418-113	418-108
2	1.5	LGW	982R	C0903B	418-549-43	-	418-116A	418-117	-	418-113	418-108

Click here to print

Connector: C0097

CONNECTOR HOUSING NOT SERVICEABLE

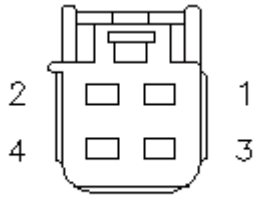

LIGHT GREY

Part No.: YPC500570

Colour: LIGHT GREY


Cavities: 4WY

Harness: SEAT FRONT HARNESS

Description: Motor-Seat height-Front

Location: Beneath front seat

Qualifier:

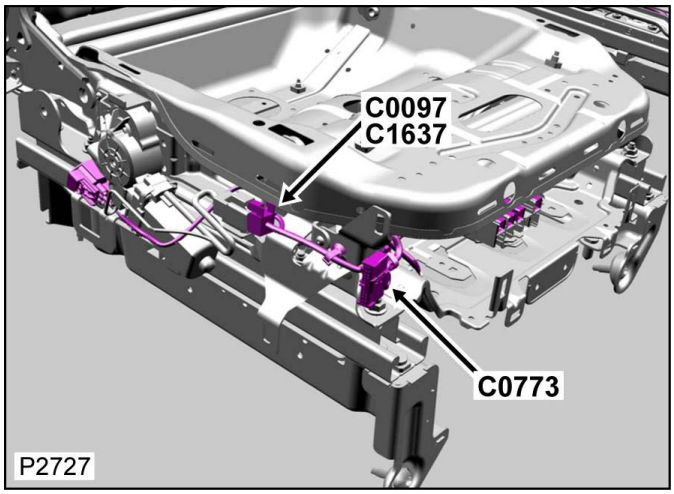


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	Y	207	C2381	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	G	207	C2381	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
3	0.35	RU	207	C2382	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	K	207	C2382	418-411-46	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0103A**

CONNECTOR HOUSING SERVICEABLE

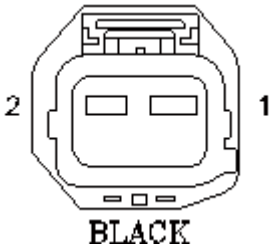

Part No.: YPC500550

Colour: BLACK


Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Temperature-Pre-catalytic converter

Location: LH side of gearbox

Qualifier:

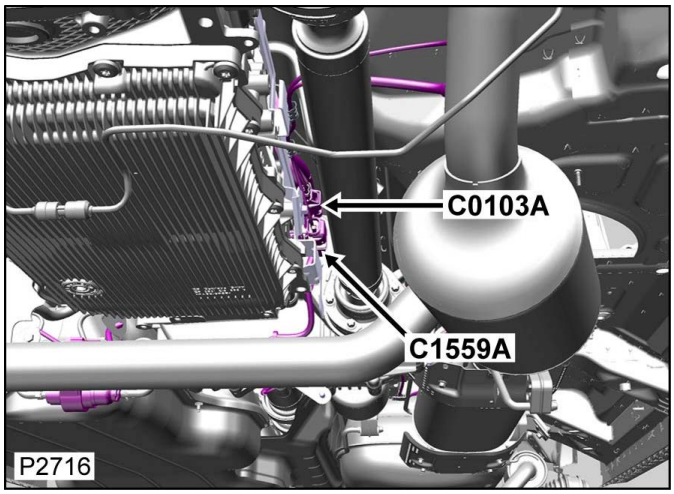


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	N	982L	C2759P	-	-	-	-	-	-	-
1	0.5	N	982R	C2759Q	-	-	-	-	-	-	-
2	0.75	PN	982L	C2759P	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	PN	982R	C2759Q	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0103H**

CONNECTOR HOUSING SERVICEABLE

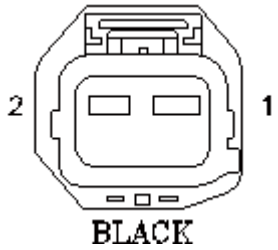

Part No.: YPC500550

Colour: BLACK


Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Temperature-Pre-catalytic converter

Location: LH side of gearbox

Qualifier:

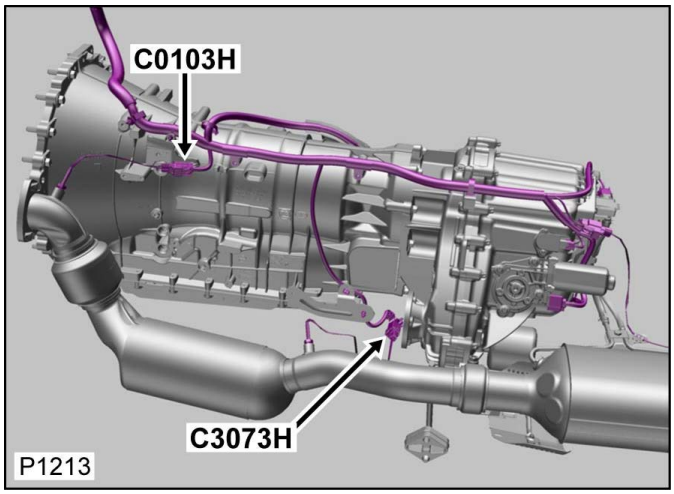


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WR	819L	C2759H	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	WR	819R	C2759J	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	NW	819L	S/JOINT SJ6806	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	NW	819R	S/JOINT SJ6806	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0103M**

CONNECTOR HOUSING SERVICEABLE

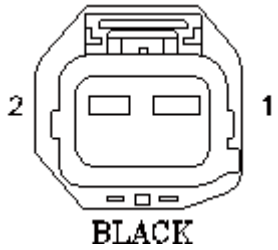

Part No.: YPC500550

Colour: BLACK


Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Catalyst

Location: LH side of gearbox

Qualifier:

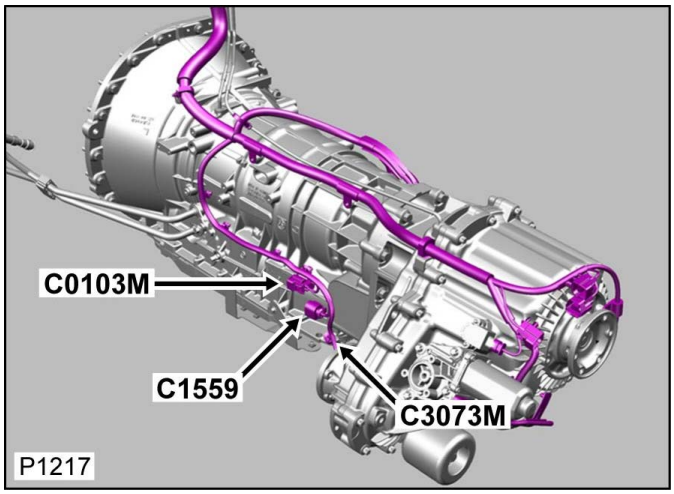

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	N	993L	C2759M	-	-	-	-	-	-	-
1	0.5	N	993R	C2759N	-	-	-	-	-	-	-
2	0.75	PN	993L	C2759M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	PB	993R	C2759N	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: **C0114T**


CONNECTOR HOUSING SERVICEABLE

Description: Unit-Fuel Tank

Location: Above fuel tank

Qualifier:

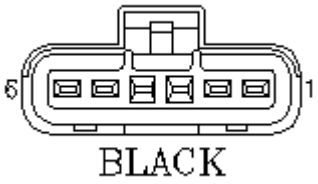

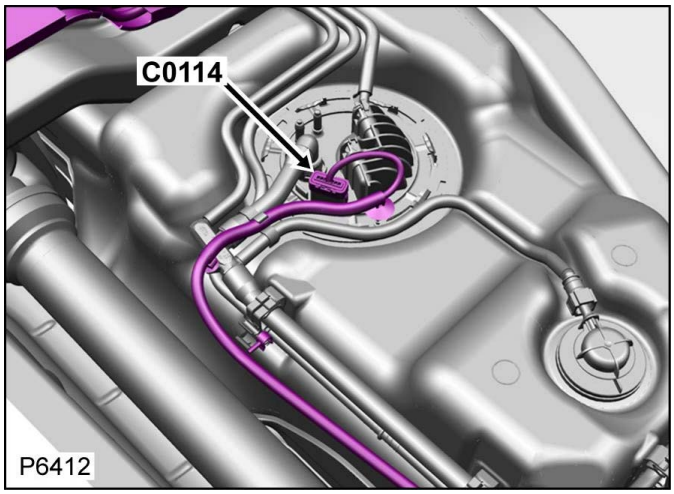

Part No.: YPC803510

Colour: BLACK

Cavities: 6WY

Harness: CHASSIS HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	BK	99T	C0390	418-411-58	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	WR	99T	C0390	418-411-58	-	418-116A	418-117	418-104	418-112	418-107
3	2.5	B	499T	S/JOINT SJ2	-	-	-	-	-	-	-
4	2.5	WP	499T	S/JOINT SJ1	-	-	-	-	-	-	-
5	0.75	B	499T	C0390	418-411-58	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	WU	99T	C0390	418-411-58	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0119T**

CONNECTOR HOUSING SERVICEABLE

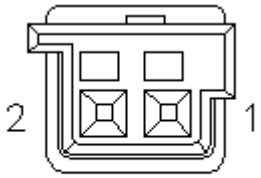

BLACK

Part No.: YPC802690

Colour: BLACK


Cavities: 2WY

Harness: CABIN HARNESS

Description: Lamp-Load space-RH

Location: RH 'D' post

Qualifier:

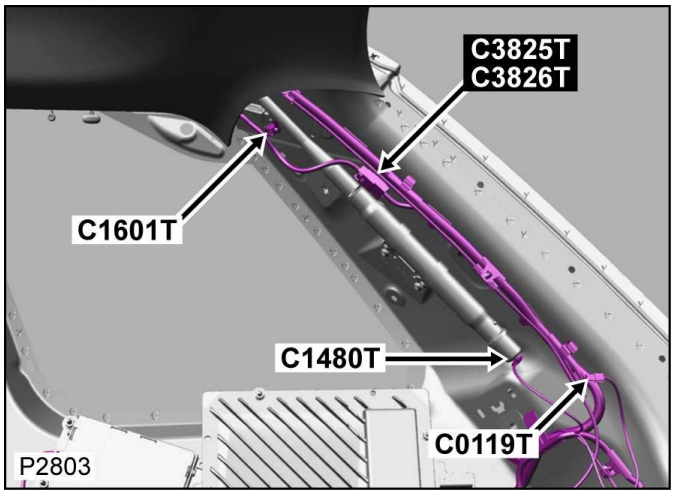

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	134T	C1170T	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.75	P	134TL	S/JOINT SJ38	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.75	P	134TR	S/JOINT SJ38	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: **C0121T**

CONNECTOR HOUSING SERVICEABLE



Part No.: YPC900900

Colour: DARK GREY


Cavities: 6WY

Harness: CABIN HARNESS

Description: Tail lamp unit-LH

Location: LH rear of vehicle

Qualifier:

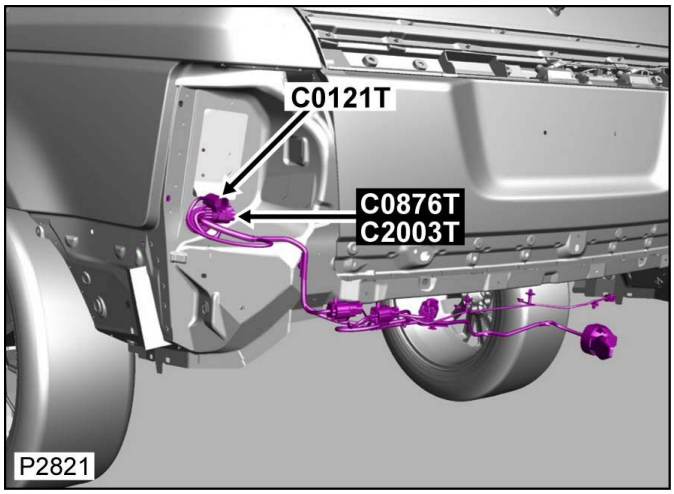

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	GP	139TL	C0585L	-	-	-	-	-	-	-
1	0.75	GP	200TR	C0585R	-	-	-	-	-	-	-
2	1.5	GN	499T	S/JOINT SJ7	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	GR	139TL	C0585L	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	GR	200TR	C0585R	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
4	1.0	RB	499T	S/JOINT SJ22T	-	-	-	-	-	-	-
5	1.5	B	499T	S/JOINT SJ8	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
6	1.5	RY	139TL	C0585L	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
6	1.5	RY	200TR	C0585R	418-411-18	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C0122T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to tailgate harness

Location: Rear of headlining

Qualifier:

No connector face
Geen connector-vooraanzicht
Pas de face de connecteur
Kein diagramm
Senza faccia connettore
Sem imagen dos pinos da ficha
No hay cara de conector

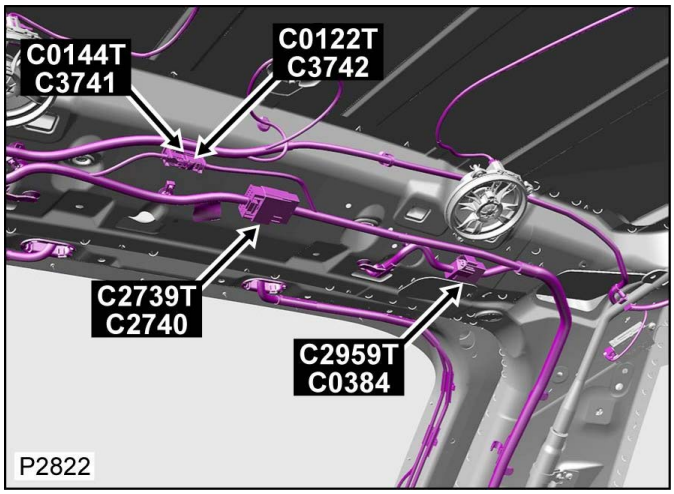

Part No.: XUD815720

Colour: NO COLOUR

Cavities: 4WY

Harness: CABIN HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	W	784T	C3346
2	0.5	W	784T	C3346
3	0.5	W	784T	C3346
4	0.5	R	784T	C3346

Click here to print

Connector: **C0125T**

CONNECTOR HOUSING SERVICEABLE



Part No.: YPC900900

Colour: DARK GREY


Cavities: 6WY

Harness: CABIN HARNESS

Description: Tail lamp unit-RH

Location: RH rear of vehicle

Qualifier:

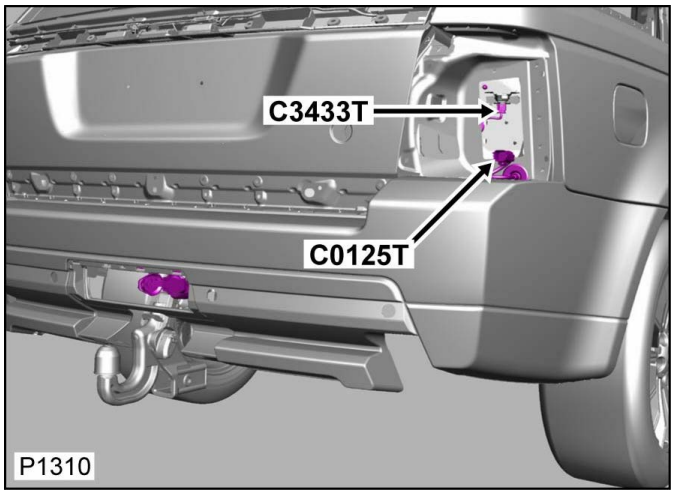

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	GP	139TL	C0585L	-	-	-	-	-	-	-
1	0.75	GP	200TR	C0585R	-	-	-	-	-	-	-
2	1.5	GN	499T	S/JOINT SJ7	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	GW	139TL	C0585L	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	GW	200TR	C0585R	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
4	1.0	RO	139TL	C2411L	-	-	-	-	-	-	-
4	1.0	RO	200TR	C2243R	-	-	-	-	-	-	-
5	1.5	B	499T	C1355T	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
6	1.5	RY	139TL	C0585L	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
6	1.5	RY	200TR	C0585R	418-411-18	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C0128

CONNECTOR HOUSING NOT SERVICEABLE

Description: Valve-Solenoid-Refrigerant - PV8

Location: LH side of engine

Qualifier:

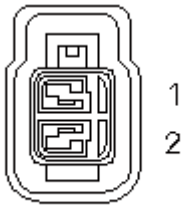


Part No.: YPC500750

Colour: BLACK

Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

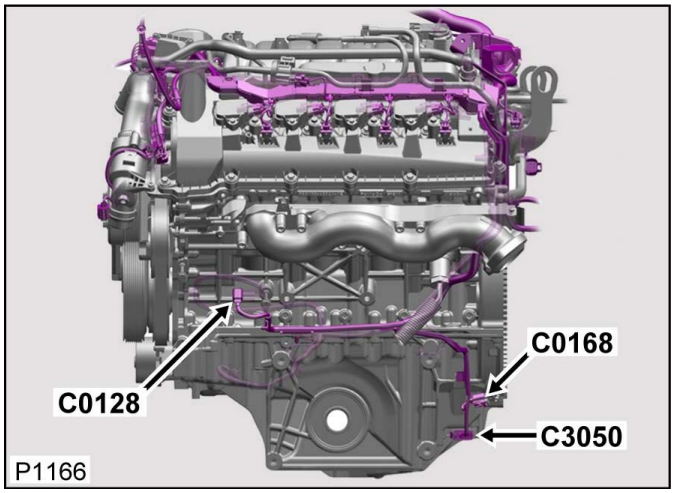


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	S	(LRR)	C2724	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	1.0	P	(LRR)	C2724	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0132

CONNECTOR HOUSING NOT SERVICEABLE

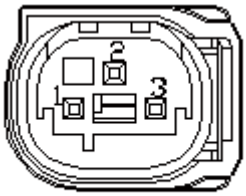

BLACK

Part No.: YPC802330

Colour: BLACK


Cavities: 3WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Sensor-Low pressure fuel

Location: Rear RH side of engine

Qualifier:

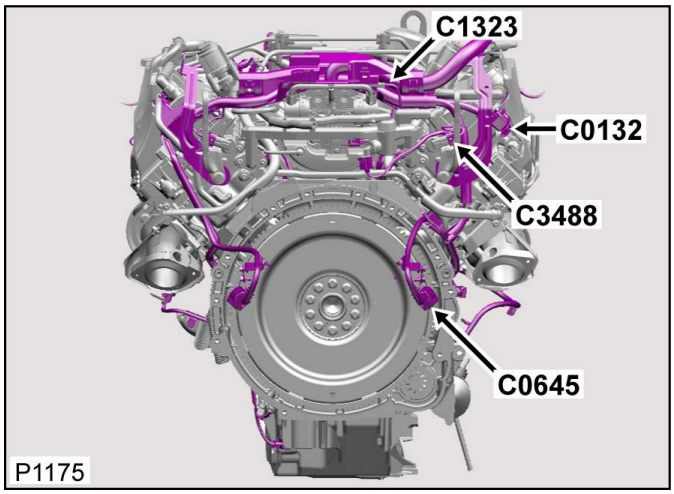

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WN	(LR-T5)	S/JOINT PIS29	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	G	(LR-T5)	C2724	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	GN	(LR-T5)	S/JOINT PIS30	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0144T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to tailgate harness

Location: Rear of headlining

Qualifier:

ASSEMBLY

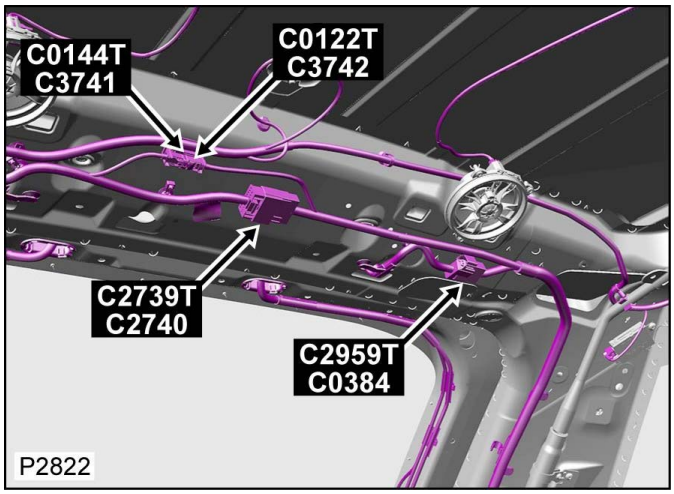

Part No.: XUD812480

Colour: NO COLOUR

Cavities: 1WY

Harness: CABIN HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	510T	C1185
1S	SCR	SCR	510T	C1185

Click here to print

Connector: **C0147**

CONNECTOR HOUSING NOT SERVICEABLE

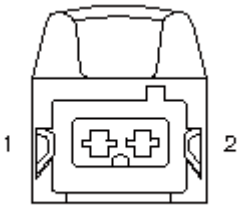

BLACK

Part No.: YPC114920

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Sensor-Engine coolant-level

Location: Front LH side of engine compartment

Qualifier:

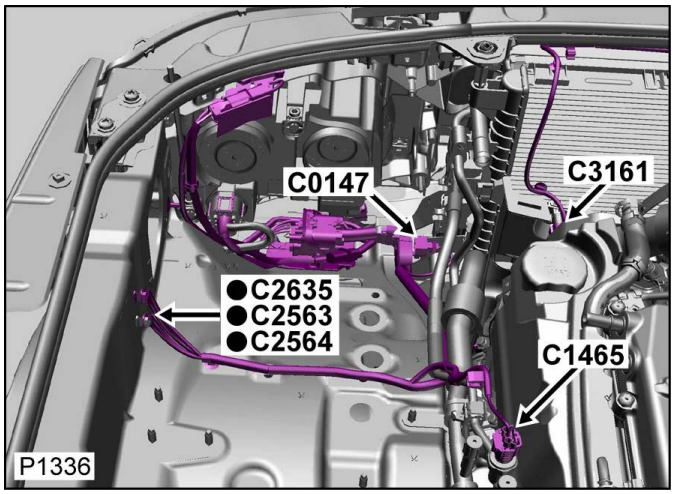


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	WO	139L	C0584L
1	0.35	WO	200R	C0584R
2	0.5	B	499	S/JOINT SJ171

Click here to print

Connector: **C0149**

CONNECTOR HOUSING NOT SERVICEABLE

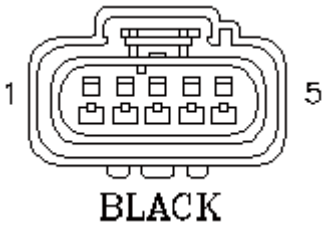

Part No.: YPC801300

Colour: BLACK


Cavities: 5WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Sensor-MAF/IAT-Bank 1

Location: Front RH side of engine compartment

Qualifier:

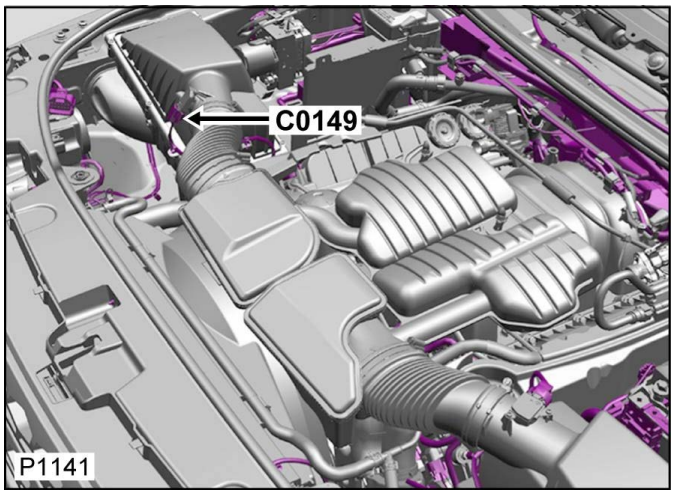


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	BR	ALL	C0634
2	0.5	B	ALL	S/JOINT PIS10
3	0.5	BO	ALL	S/JOINT PIS15
4	0.5	BU	ALL	C0634
5	0.5	BG	ALL	C0634

Click here to print

Connector: C0150

CONNECTOR HOUSING NOT SERVICEABLE

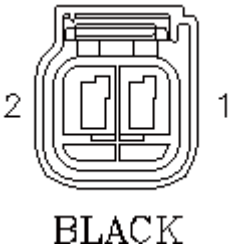

BLACK

Part No.: YPC901710

Colour: BLACK


Cavities: 2WY

Harness: KNOCK SENSORS PETROL HARNESS

Description: Sensor-Knock-Bank 1-Front

Location: Top of engine - RH side

Qualifier:

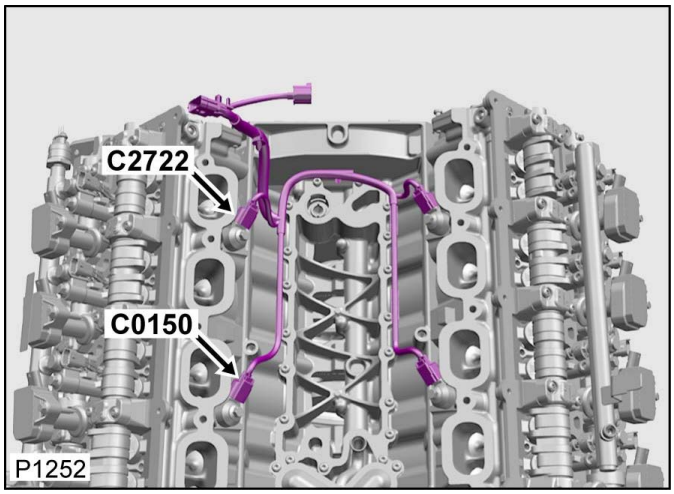


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	PO	ALL	C0904	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	WN	ALL	C0904	418-411-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0152

CONNECTOR HOUSING NOT SERVICEABLE

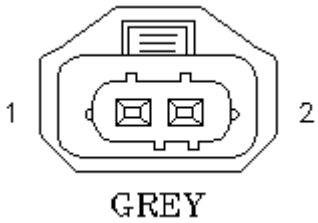

Part No.: YPC913410

Colour: GREY


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Purge control valve - PV8

Location: Top of engine - LH side

Qualifier:

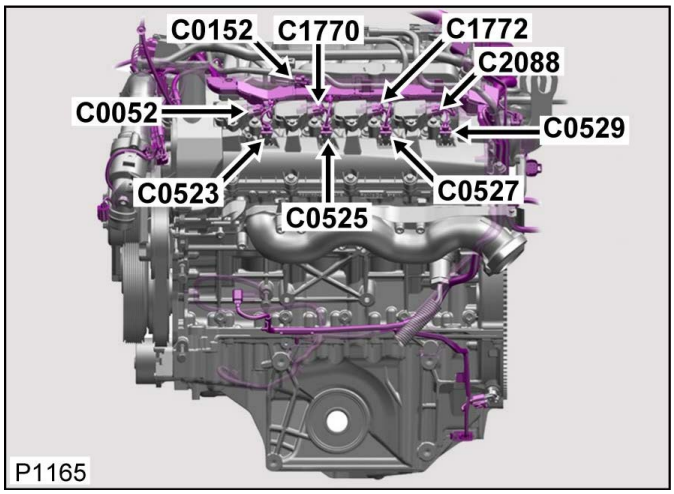


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	WN	ALL	C0634
2	0.5	S	ALL	S/JOINT PIS88

Click here to print

Connector: C0156

CONNECTOR HOUSING NOT SERVICEABLE

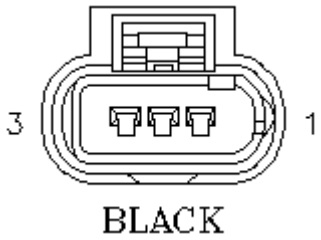

Part No.: YPC913370

Colour: BLACK


Cavities: 3WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Ignition coil-1 - PV8

Location: Top of engine - RH side

Qualifier:

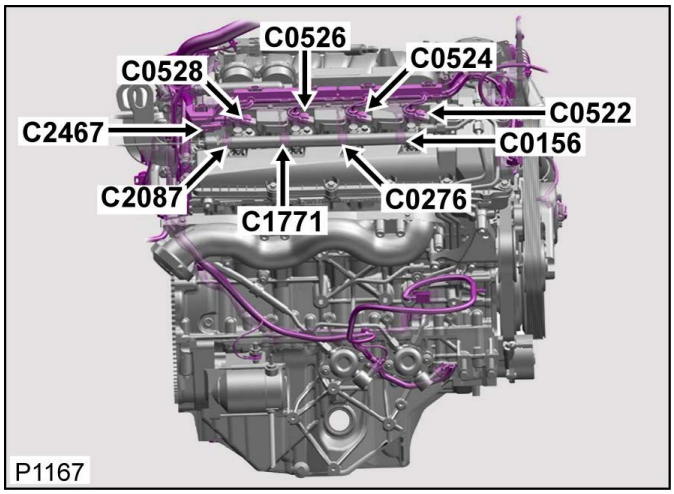


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	WP	ALL	C0634
2	0.5	B	ALL	S/JOINT PIS26
3	0.5	W	ALL	S/JOINT PIS20

Click here to print

Connector: **C0168**

CONNECTOR HOUSING NOT SERVICEABLE

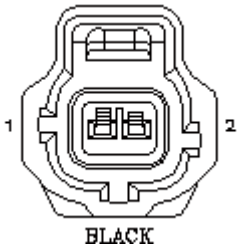

Part No.: YPC501080

Colour: BLACK


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Sensor-Crankshaft-position (CKP) - PV8

Location: LH side of engine

Qualifier:

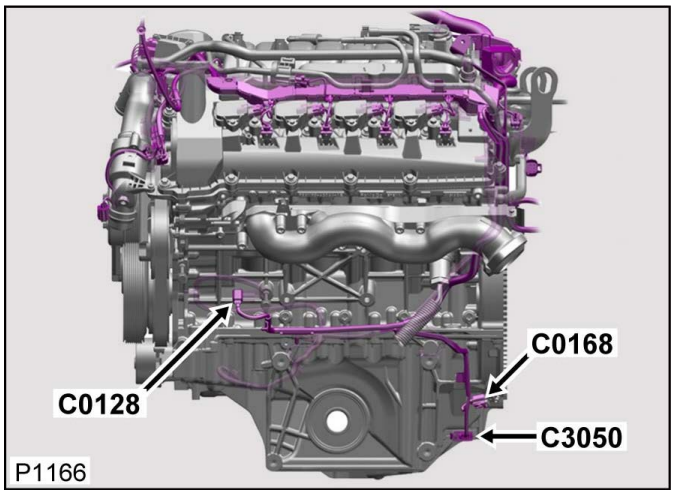


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	NR	ALL	C0634	418-549-66	-	418-116A	418-117	-	418-112	418-107
2	0.5	WR	ALL	S/JOINT PIS42	418-549-50	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0168B

CONNECTOR HOUSING NOT SERVICEABLE

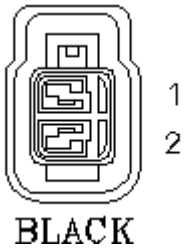

Part No.: YPC500750

Colour: BLACK


Cavities: 2WY

Harness: CRANK LINK HARNESS

Description: Sensor-Crankshaft-position (CKP) - PV8

Location: LH side of engine

Qualifier:

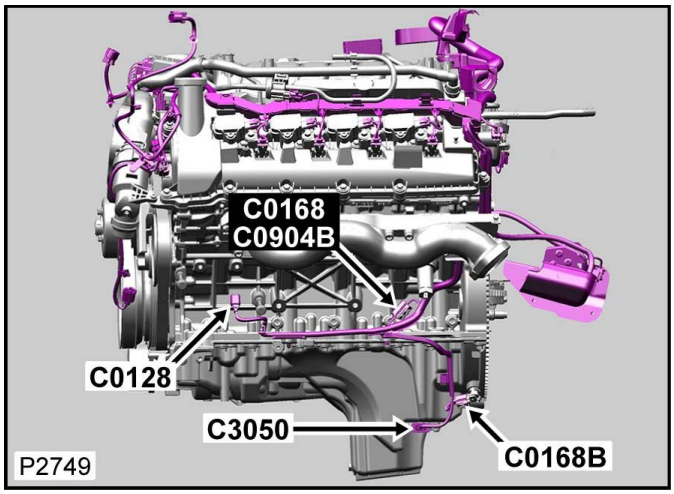


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	ALL	C0904B	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	O	ALL	C0904B	418-411-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0168M

CONNECTOR HOUSING NOT SERVICEABLE

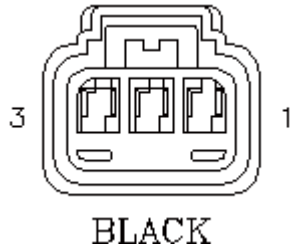

Part No.: YPC900540

Colour: BLACK


Cavities: 3WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Sensor-Crankshaft-position (CKP) - DV6

Location: LH side of engine

Qualifier:

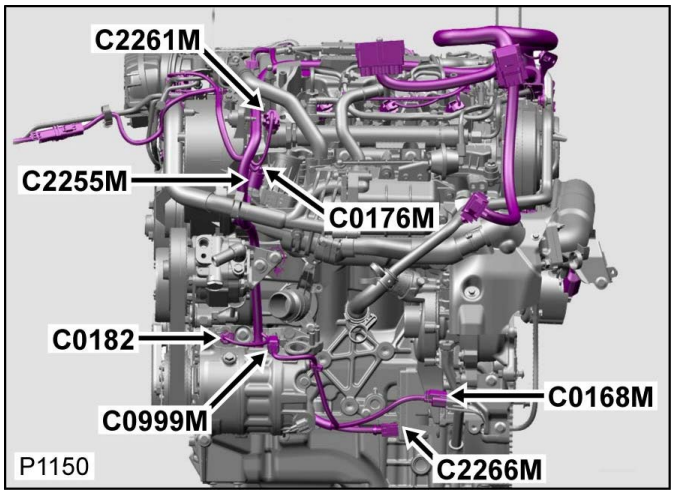

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	SP	798	S/JOINT SJ5	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	YP	798	C0659M	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.75	GN	798	C0659M	-	-	-	-	-	-	-

Click here to print

Connector: **C0169**

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC909170

Colour: GREY


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Sensor-Engine coolant-temperature (ECT) - PV8

Location: Lower front of engine - LH side

Qualifier:

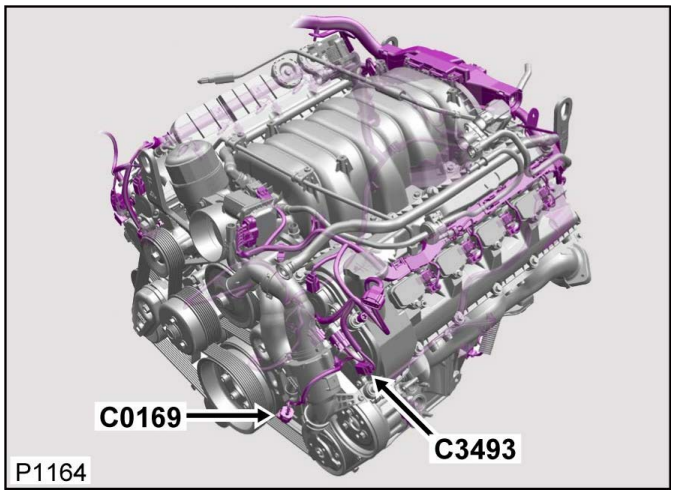

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	Y	ALL	C0634	418-549-66	-	418-116A	418-117	418-104	418-113	418-108
2	0.5	NG	ALL	S/JOINT PIS43	418-549-66	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: **C0169M**

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC909170

Colour: GREY


Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Sensor-Engine coolant temperature (ECT) - DV6

Location: Front of engine - center

Qualifier:

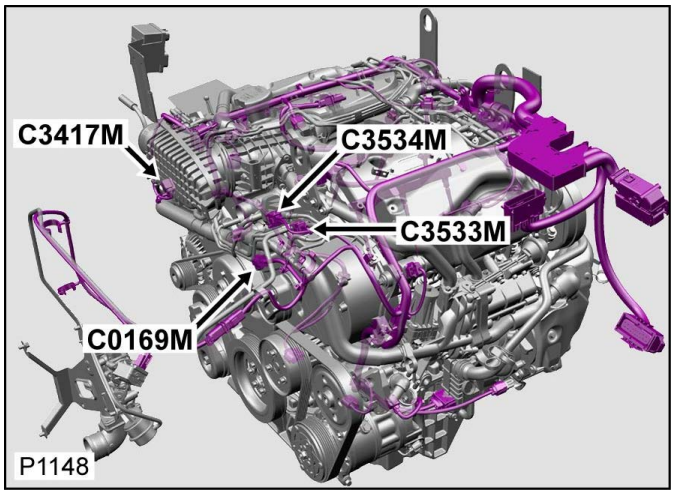

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	Y	798	C0659M	418-549-66	-	418-116A	418-117	418-104	418-113	418-108
2	0.5	NG	798	C0659M	418-549-66	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C0175


CONNECTOR HOUSING NOT SERVICEABLE

Description: Unit-Electric throttle - PV8

Location: Top of engine

Qualifier:

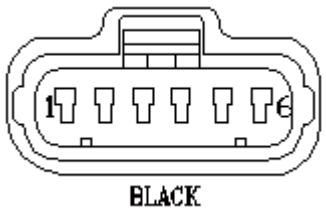

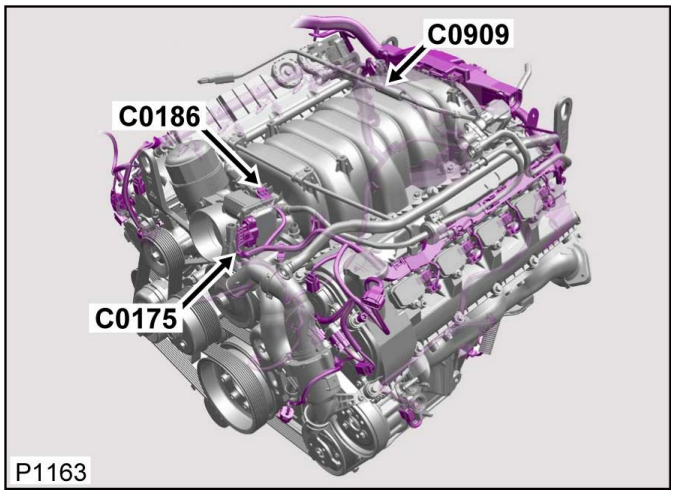

Part No.: YPC909120

Colour: BLACK

Cavities: 6WY

Harness: ENGINE PETROL AJ133 HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	N	ALL	C0634
2	0.5	Y	ALL	C0634
3	0.5	GP	ALL	C0634
4	0.5	UO	ALL	C0634
5	1.0	UG	ALL	C0634
6	1.0	YP	ALL	C0634

Click here to print

Connector: C0176M

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC903430

Colour: GREY


Cavities: 3WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Sensor-Camshaft-position (CMP) - DV6

Location: LH side of engine

Qualifier:

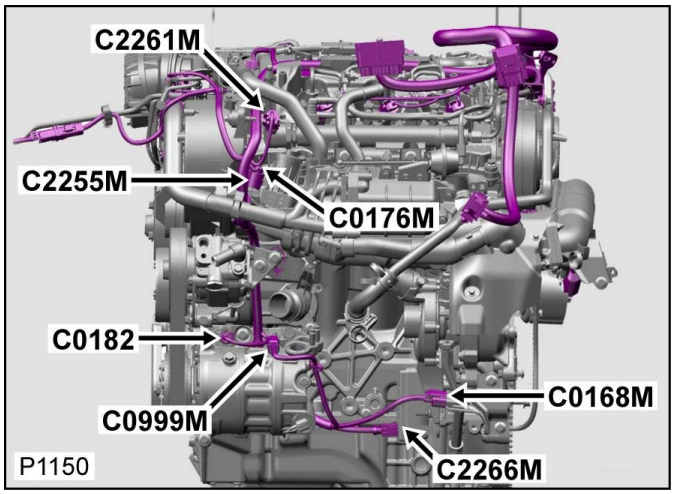


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WG	798	C0659M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	P	798	C0659M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	SP	798	S/JOINT SJ5	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0178N

CONNECTOR HOUSING NOT SERVICEABLE

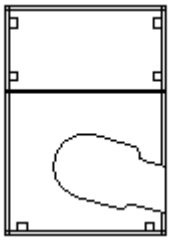

Part No.: YPG800820

Colour: TIN PLATED


Cavities: 1WY

Harness: BATTERY POSITIVE DIESEL V6 3.0L RHD HARNESS

Description: Starter motor - DV6

Location: RH side of engine

Qualifier:

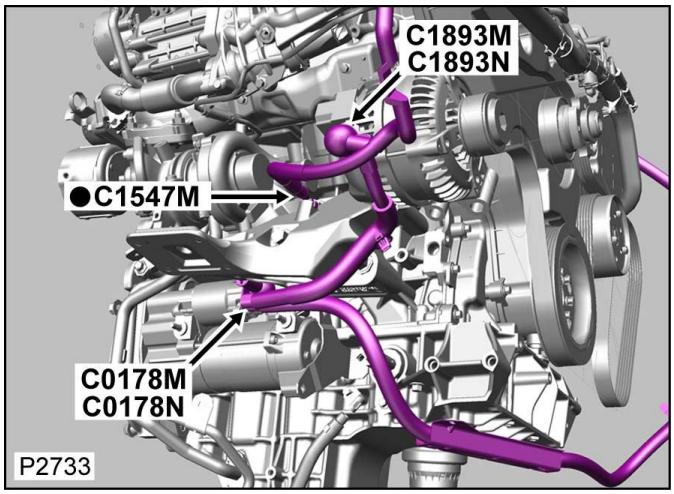


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0T	R	ALL	C0192N
1	35.0T	R	ALL	C1893N

Click here to print

Connector: C0178R

CONNECTOR HOUSING NOT SERVICEABLE

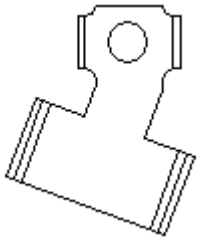

Part No.: YPG800830

Colour: TIN PLATED


Cavities: 1WY

Harness: BATTERY POSITIVE PETROL V8 RHD HARNESS

Description: Starter motor - PV8

Location: RH side of engine

Qualifier:

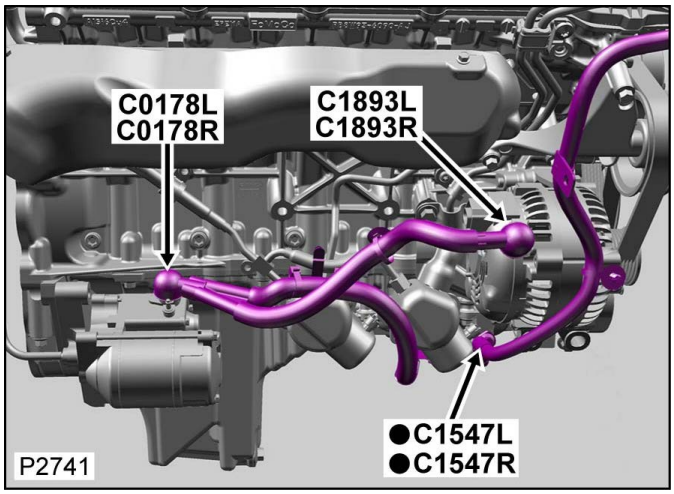

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0T	R	ALL	C0192R
1	35.0T	R	ALL	C1893R

Click here to print


Connector: C0179


CONNECTOR HOUSING NOT SERVICEABLE

Description: Starter motor - PV8

Location: RH side of engine

Qualifier:



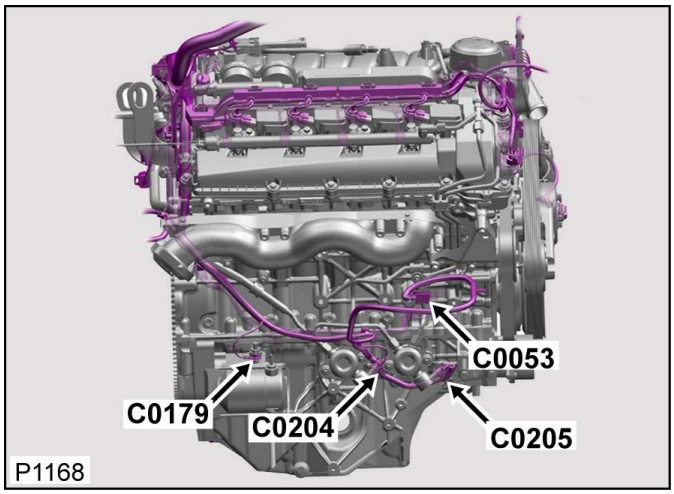

Part No.: YPG901620

Colour: TIN PLATED

Cavities: 1WY

Harness: ENGINE PETROL AJ133 HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	PO	(LRR)	C2724

Click here to print

Connector: C0179M

CONNECTOR HOUSING NOT SERVICEABLE

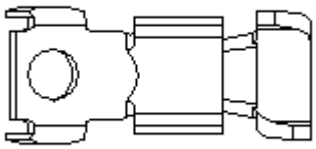

Part No.: YPG900770

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Starter motor - DV6

Location: RH side of engine

Qualifier:

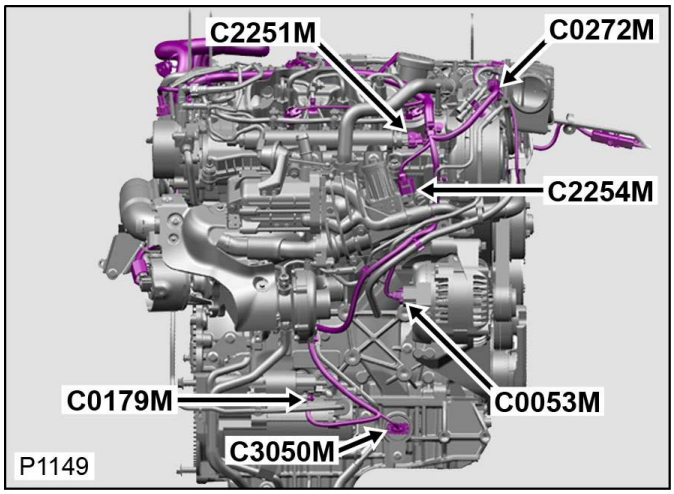


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	SO	798	C3069M

Click here to print

Connector: C0182

CONNECTOR HOUSING NOT SERVICEABLE

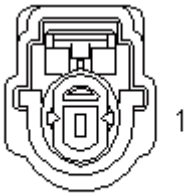

BLACK

Part No.: YPC902930

Colour: BLACK


Cavities: 1WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Solenoid-Clutch-Compressor (A/C)

Location: LH side of engine

Qualifier:

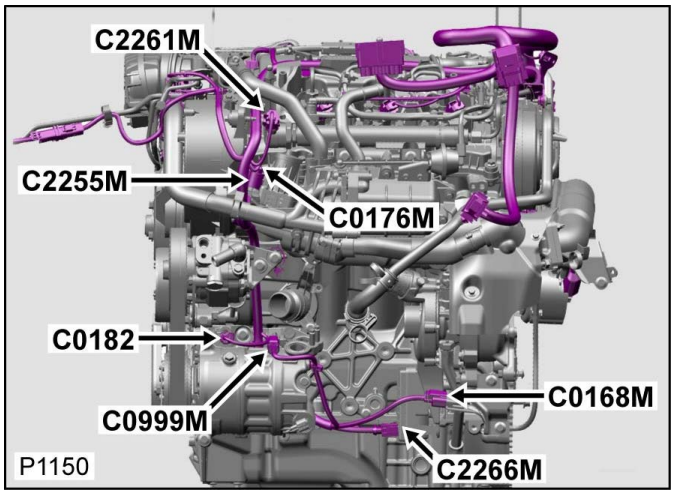

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	PW	798	C3069M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: **C0184M**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Sensor-Temperature-Fuel rail - DV6

Location: Top of engine

Qualifier:

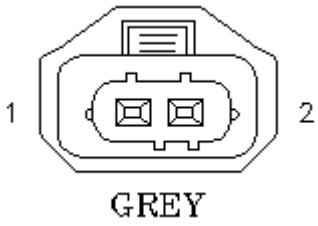

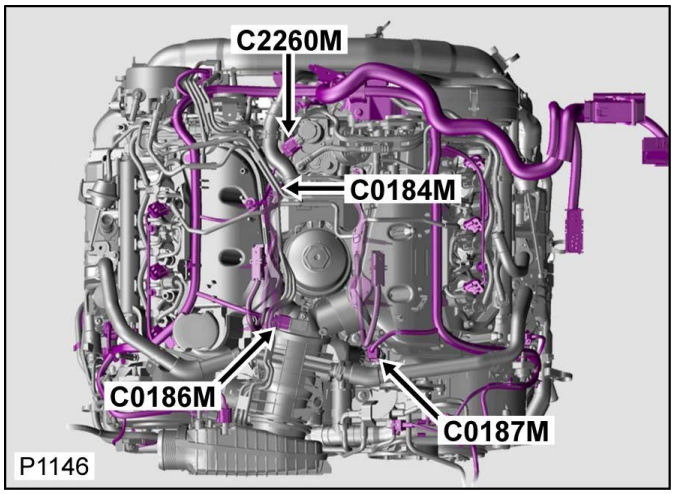

Part No.: YPC913410

Colour: GREY

Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	G	798	C0659M
2	0.5	PW	798	C0659M

Click here to print

Connector: **C0186**

CONNECTOR HOUSING NOT SERVICEABLE

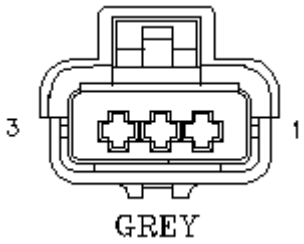

Part No.: YPC908010

Colour: GREY


Cavities: 3WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Sensor-Temperature and Manifold-Absolute Pressure (TMAP)

Location: Top of engine

Qualifier:

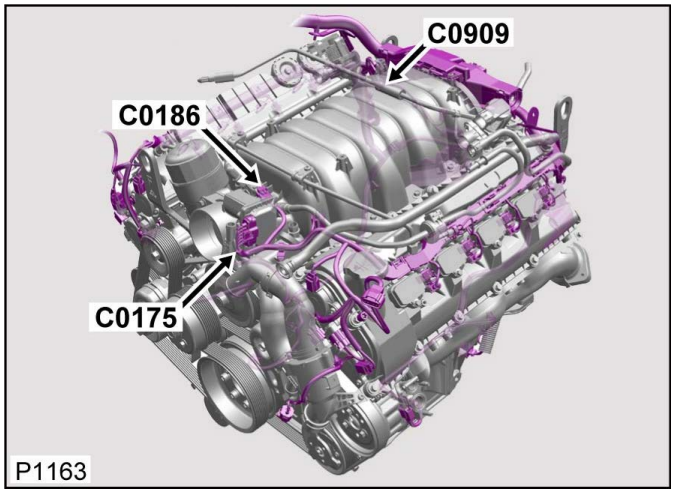


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	GN	ALL	S/JOINT PIS30
2	0.5	WN	ALL	S/JOINT PIS29
3	0.5	S	ALL	C0634

Click here to print

Connector: C0186M

CONNECTOR HOUSING NOT SERVICEABLE

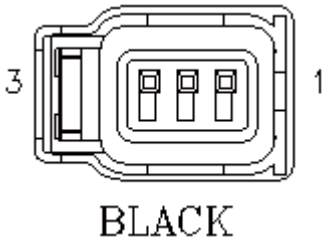

Part No.: YPC909100

Colour: BLACK


Cavities: 3WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Sensor-Manifold Absolute-Pressure (MAP) - DV6

Location: Top of engine

Qualifier:

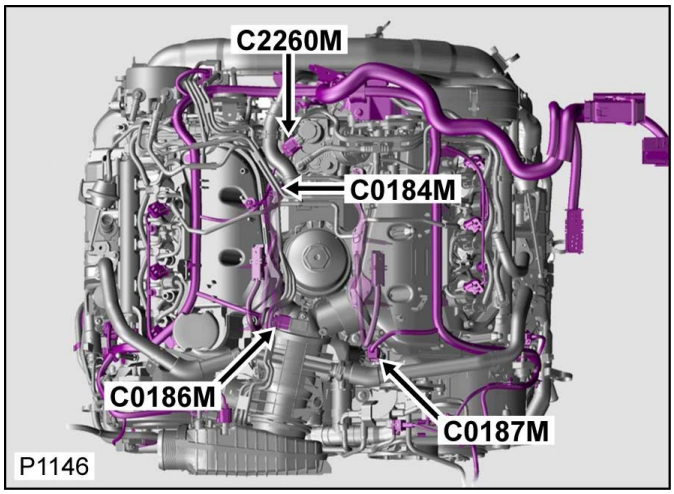

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	NG	798	C0659M
2	0.5	UG	798	C0659M
3	0.5	Y	798	S/JOINT SJ4

Click here to print

Connector: **C0187M**

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC909180

Colour: BLACK


Cavities: 1WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Switch-Oil pressure - DV6

Location: Top of engine

Qualifier:

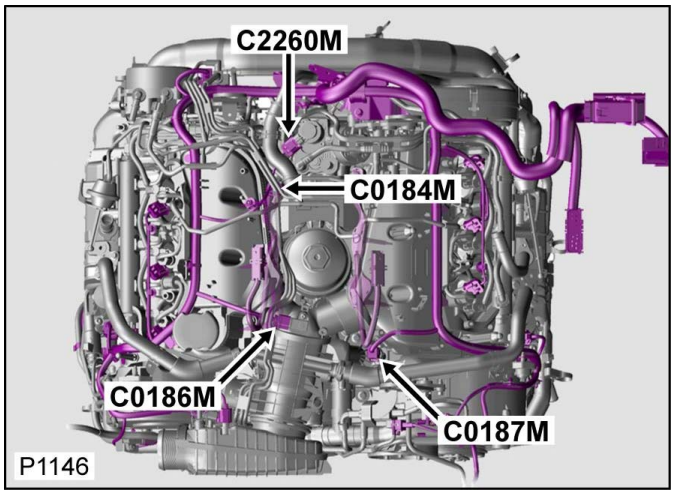


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	S	798	C3069M

Click here to print

Connector: **C0189L**

CONNECTOR HOUSING NOT SERVICEABLE

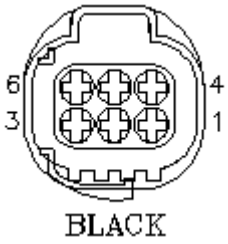

Part No.: YPC803140

Colour: BLACK


Cavities: 6WY

Harness: ENGINE COMPARTMENT HARNESS

Description: ECU-Glow plug

Location: Driver side of engine compartment

Qualifier:

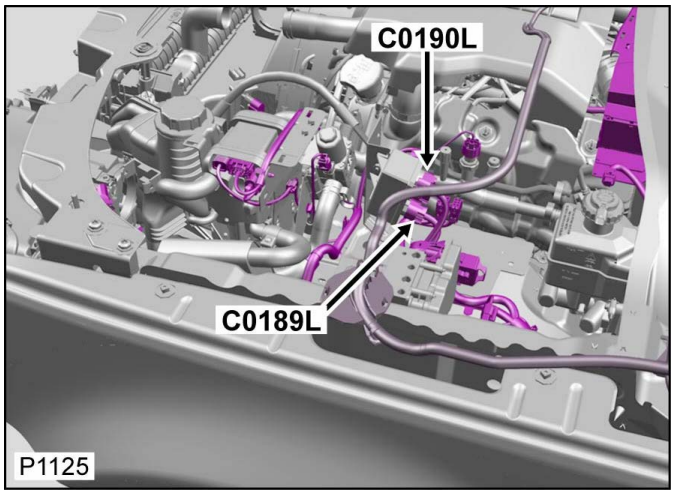


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	NU	798L	C3476	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
2	1.5	GW	798L	C2581	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
3	1.5	SP	798L	C3476	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
4	1.5	PW	798L	C3476	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
5	1.5	WN	798L	C2581	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
6	1.5	YU	798L	C2581	418-411-68	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0189R**

CONNECTOR HOUSING NOT SERVICEABLE

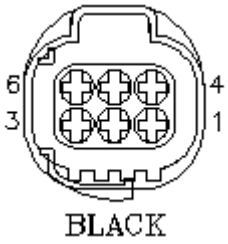

Part No.: YPC803140

Colour: BLACK


Cavities: 6WY

Harness: ENGINE COMPARTMENT HARNESS

Description: ECU-Glow plug

Location: Driver side of engine compartment

Qualifier:

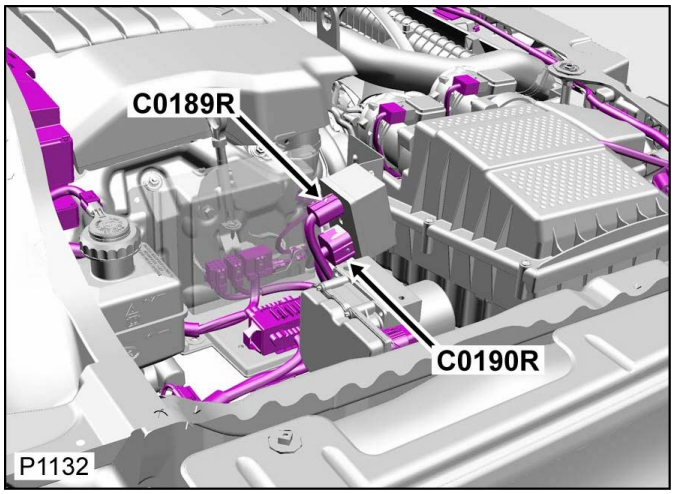


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	NU	798R	C3476	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
2	1.5	GW	798R	C2581	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
3	1.5	SP	798R	C3476	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
4	1.5	PW	798R	C3476	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
5	1.5	WN	798R	C2581	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
6	1.5	YU	798R	C2581	418-411-68	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0190L**

CONNECTOR HOUSING NOT SERVICEABLE

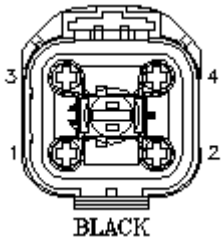

Part No.: YPC803090

Colour: BLACK


Cavities: 5WY

Harness: ENGINE COMPARTMENT HARNESS

Description: ECU-Glow plug

Location: Driver side of engine compartment

Qualifier:

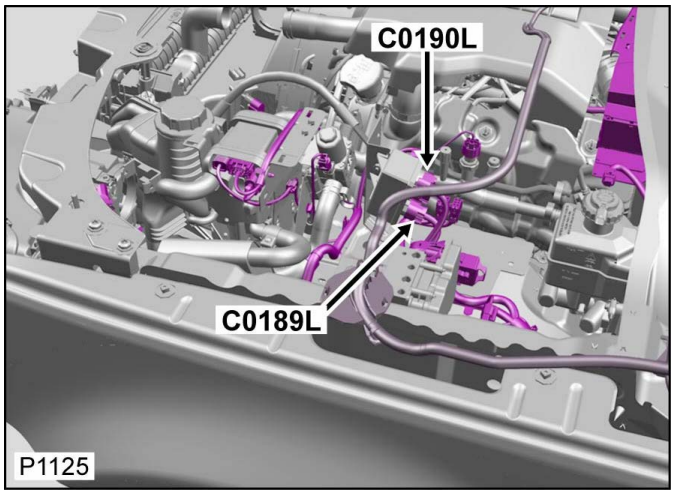

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	WG	798L	C0658L	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	NP	798L	C0658L	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
3	0.75	WO	798L	S/JOINT SJ867	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
4	0.75	UN	798L	S/JOINT SJ868	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
5	6.0	YR	798L	C0570L	-	-	-	-	-	-	-

Click here to print


Connector: **C0190R**


CONNECTOR HOUSING NOT SERVICEABLE

Description: ECU-Glow plug

Location: Driver side of engine compartment

Qualifier:

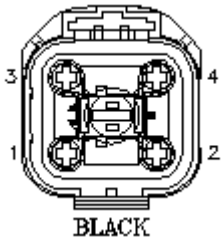

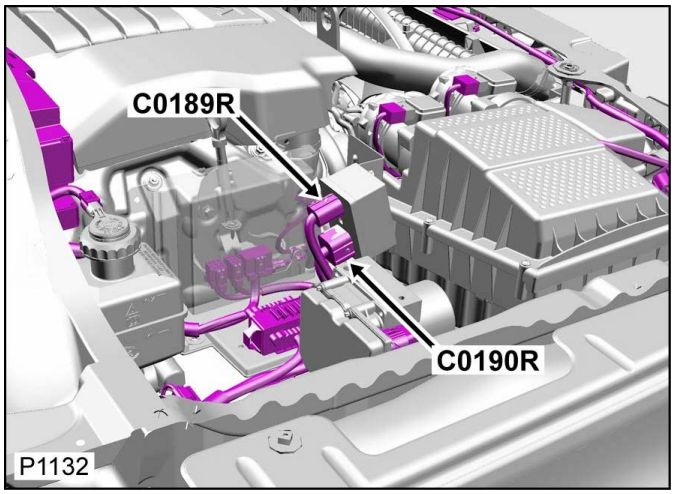

Part No.: YPC803090

Colour: BLACK

Cavities: 5WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	WG	798R	C0658R	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	NP	798R	C0658R	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
3	0.75	WO	798R	S/JOINT SJ1867	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
4	0.75	UN	798R	S/JOINT SJ1868	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
5	6.0	YR	798R	C0570R	-	-	-	-	-	-	-

Click here to print


Connector: C0192N


CONNECTOR HOUSING NOT SERVICEABLE

Description: Battery - DV6

Location: Passenger side of engine compartment

Qualifier:

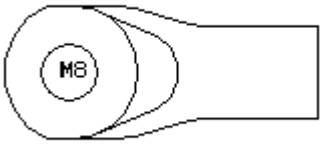

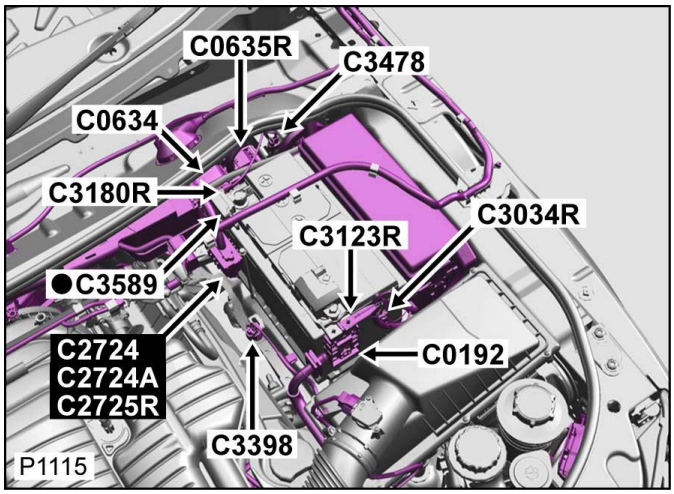

Part No.: YPG800200

Colour: TIN PLATED

Cavities: 1WY

Harness: BATTERY POSITIVE DIESEL V6 3.0L RHD HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0T	R	ALL	C0178N

Click here to print


Connector: C0192R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Battery - PV8

Location: Rear LH side of engine compartment

Qualifier: RHD condition illustrated

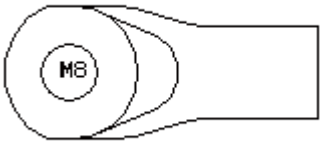

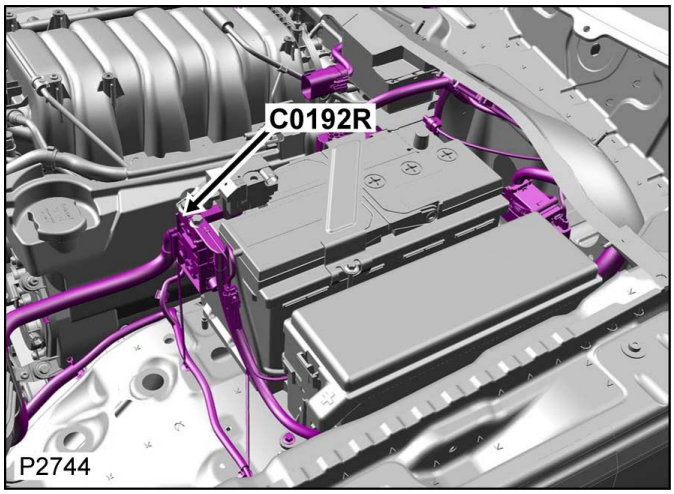

Part No.: YPG800200

Colour: TIN PLATED

Cavities: 1WY

Harness: BATTERY POSITIVE PETROL V8 RHD HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0T	R	ALL	C0178R

Click here to print


Connector: C0193

CONNECTOR HOUSING NOT SERVICEABLE

Description: TCM and Control Valve Body

Location: RH side of gearbox

Qualifier:

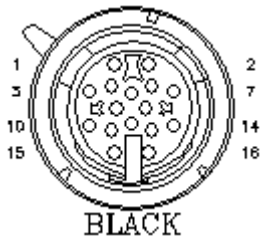


Part No.: YPC501330

Colour: BLACK

Cavities: 16WY

Harness: TRANSMISSION AUTO-PETROL HARNESS

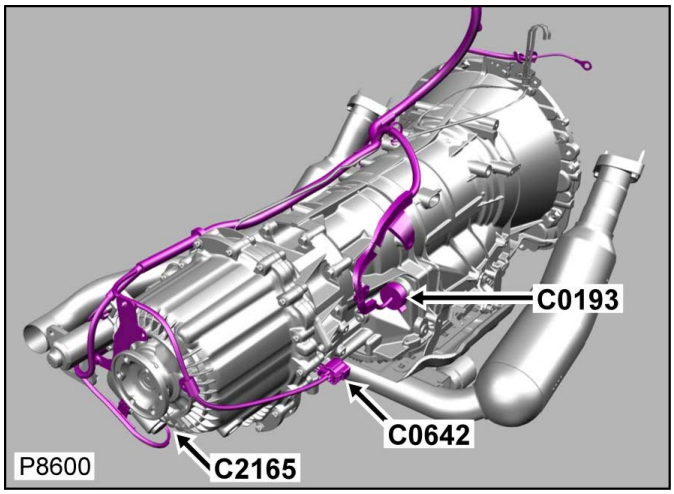

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	BG	282L	C3425L	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	BG	282R	C3425R	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	YB	282	S/JOINT SJ721	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	N	282L	C3425L	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	N	282R	C3425R	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	Y	282L	C3425L	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	Y	282R	C3425R	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	YN	282	S/JOINT SJ720	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	R	282L	C3425L	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	R	282R	C3425R	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
9	0.75	R	282L	C3427L	418-072	-	418-116A	418-117	-	418-112	418-107
9	0.75	R	282R	C3427R	418-072	-	418-116A	418-117	-	418-112	418-107
10	0.5	GO	282L	C3427L	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	GO	282R	C3427R	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	Y	282L	C3425L	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	Y	282R	C3425R	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	G	282L	C3425L	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	G	282R	C3425R	418-549-58	-	418-116A	418-117	418-104	418-112	418-107

13	1.0	B	282	S/JOINT SJ8409	418-072	-	418-116A	418-117	-	418-112	418-107
14	1.0	PY	282L	C3427L	418-072	-	418-116A	418-117	-	418-112	418-107
14	1.0	PY	282R	C3427R	418-072	-	418-116A	418-117	-	418-112	418-107
16	1.0	B	282	S/JOINT SJ8409	418-072	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0204

CONNECTOR HOUSING NOT SERVICEABLE



BLACK

Part No.: YPC800650

Colour: BLACK


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Pump 1-High pressure fuel

Location: RH side of engine

Qualifier:

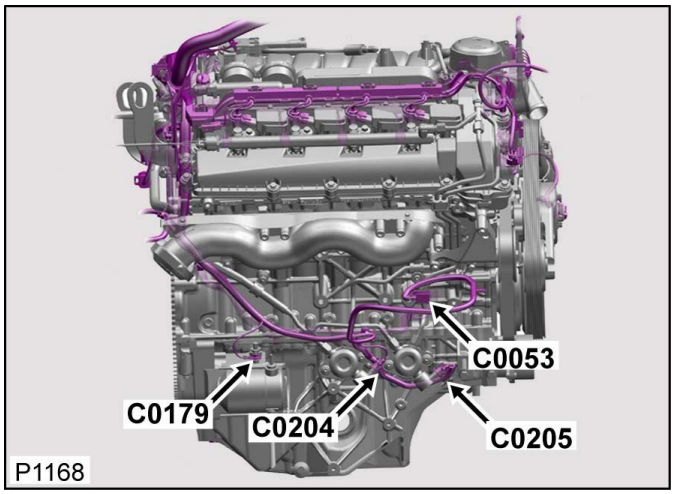

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	YS	ALL	C0634
2	1.0	SO	ALL	C0634

Click here to print

Connector: C0205

CONNECTOR HOUSING NOT SERVICEABLE



BLACK

Part No.: YPC800650

Colour: BLACK


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Pump 2-High pressure fuel

Location: RH side of engine

Qualifier:

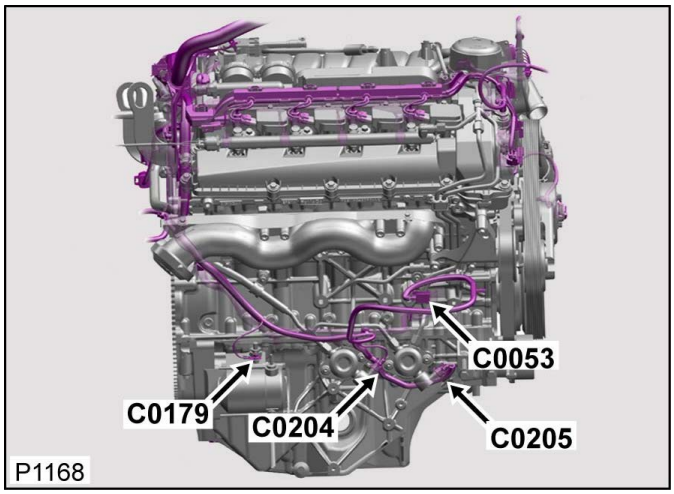

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	GU	ALL	C0634
2	1.0	WN	ALL	C0634

Click here to print


Connector: C0223L

CONNECTOR HOUSING NOT SERVICEABLE

Description: Instrument panel harness to main harness

Location: LH 'A' post

Qualifier:

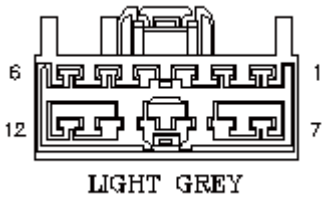


Part No.: YPC910640

Colour: LIGHT GREY

Cavities: 12WY

Harness: FACIA COMPOSITE HARNESS

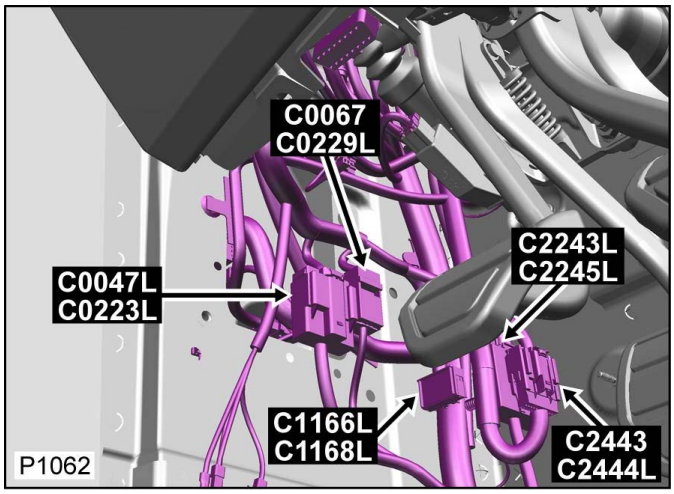

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	RW	216L	C0582	418-587-10	-	418-116A	418-117	-	418-112	418-107
2	0.5	GK	139L	S/JOINT SJ552	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
3	0.75	G	125L	C3481	418-587-10	-	418-116A	418-117	-	418-112	418-107
4	0.75	GW	125L	C3481	418-587-10	-	418-116A	418-117	-	418-112	418-107
9	1.5	GB	139L	S/JOINT SJ199	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
10	1.5	RB	13SL	C0582	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
11	0.75	G	125L	C3481	418-587-10	-	418-116A	418-117	-	418-112	418-107
12	0.75	GW	125L	C3481	418-587-10	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0223R

CONNECTOR HOUSING NOT SERVICEABLE

Description: Instrument panel harness to main harness

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

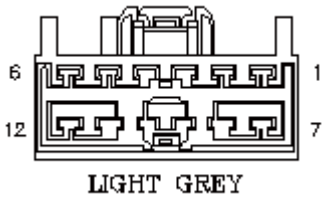


Part No.: YPC910640

Colour: LIGHT GREY

Cavities: 12WY

Harness: FACIA COMPOSITE HARNESS

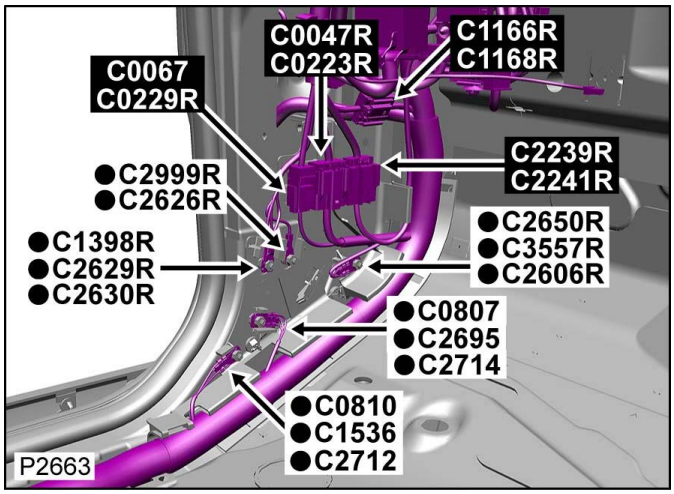


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	LGW	134R	S/JOINT SJ14	418-587-10	-	418-116A	418-117	-	418-112	418-107
2	1.5	GB	200R	S/JOINT SJ199	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
3	0.35	BR	200TR	C2239R	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	RU	216R	C2992	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	RY	216R	C2992	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
6	0.35	G	216SR	C1629SR	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
7	0.75	G	125R	C3481	418-587-10	-	418-116A	418-117	-	418-112	418-107
8	0.75	GW	125R	C3481	418-587-10	-	418-116A	418-117	-	418-112	418-107
9	0.75	G	125R	C3481	418-587-10	-	418-116A	418-117	-	418-112	418-107
10	0.75	GW	125R	C3481	418-587-10	-	418-116A	418-117	-	418-112	418-107
11	0.5	G	200R	C0582	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
12	2.5	NR	200TR	C2239R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C0227

CONNECTOR HOUSING NOT SERVICEABLE

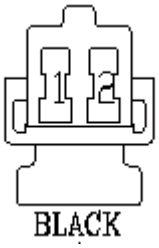

Part No.: YPC10225

Colour: BLACK


Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Description: Lamp-Glove compartment

Location: Behind glove compartment

Qualifier:

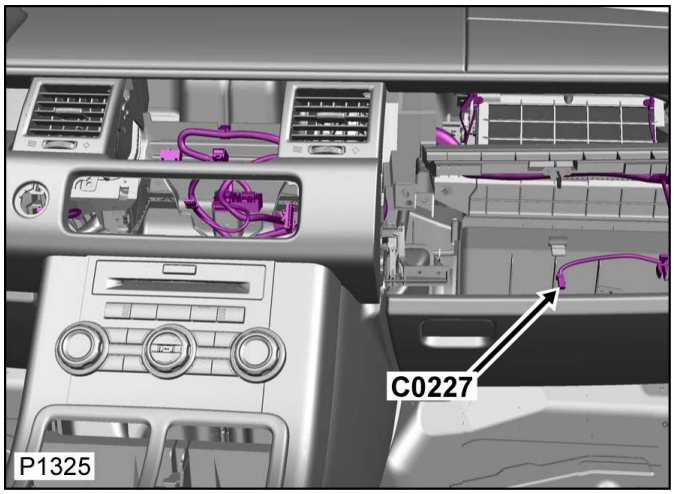


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	134	S/JOINT SJ662	418-549-61	-	418-116A	-	418-104	418-112	418-107
2	0.5	LGW	134	S/JOINT SJ14	418-549-61	-	418-116A	-	418-104	418-112	418-107

Click here to print

Connector: C0229L

CONNECTOR HOUSING NOT SERVICEABLE

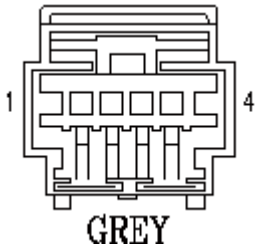

Part No.: YPC900630

Colour: GREY


Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS

Description: Instrument panel harness to main harness

Location: LH 'A' post

Qualifier:

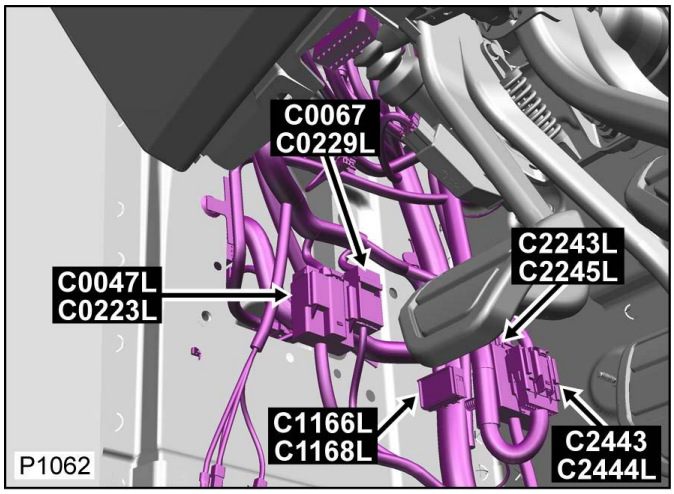


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	RY	216L	C2641L
2	0.5	R	216L	C2641L
3	0.5	RG	216L	C2641L
4	0.5	RB	216L	C2641L

Click here to print

Connector: C0229R

CONNECTOR HOUSING NOT SERVICEABLE

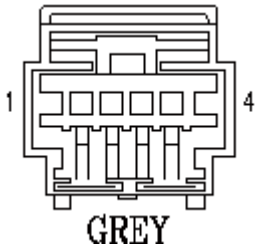

Part No.: YPC900630

Colour: GREY


Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS

Description: Instrument panel harness to main harness

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

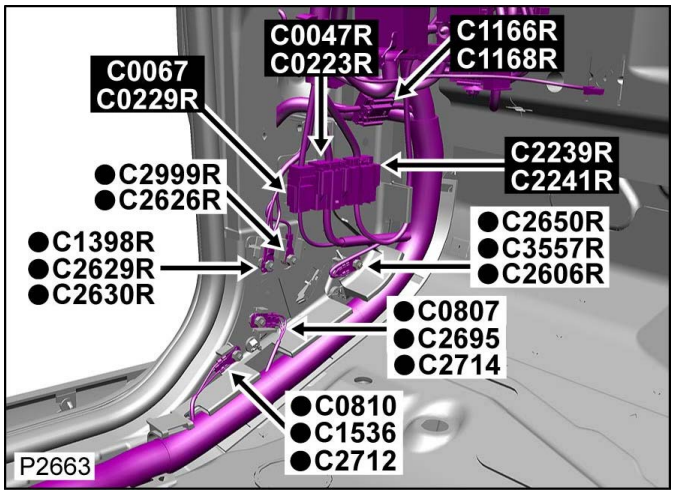

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	BU	216R	C0251R
2	0.5	GU	216R	C0251R
3	0.5	BR	216R	C0261R
4	0.5	GO	216R	C0261R

Click here to print


Connector: C0230


CONNECTOR HOUSING NOT SERVICEABLE

Description: Instrument cluster

Location: Behind instrument cluster

Qualifier:

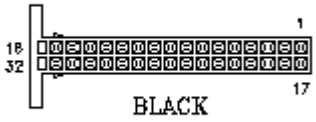

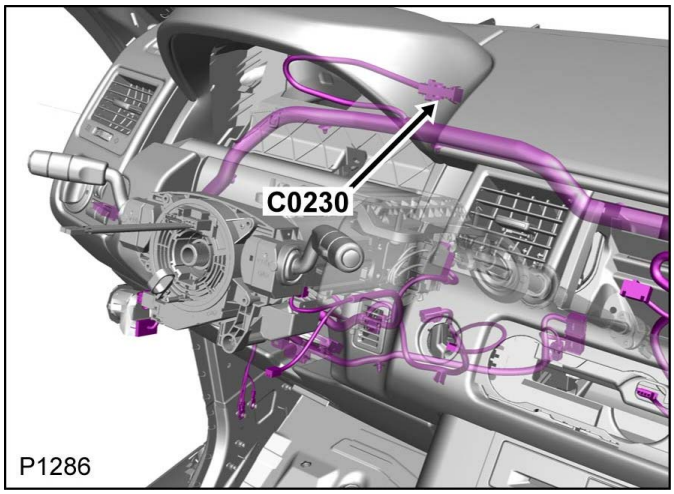

Part No.: YPC901800

Colour: BLACK

Cavities: 32WY

Harness: FACIA COMPOSITE HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	RU	499	S/JOINT SJ134	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
5	0.5	YB	499	S/JOINT SJ862	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
7	0.35	YU	499	S/JOINT SJ731	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
9	0.5	B	499	S/JOINT SJ661	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
12	0.35	WP	499	C0580	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
15	0.5	B	139L	C2626L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
15	0.5	B	200R	C0562R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
21	0.5	YN	499	S/JOINT SJ852	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
23	0.35	YW	499	S/JOINT SJ730	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
28	0.35	WS	139L	C0082L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
28	0.35	WS	200R	C0082R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
31	0.5	B	777L	C2055L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
31	0.5	B	777R	C2055R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0231L

CONNECTOR HOUSING NOT SERVICEABLE

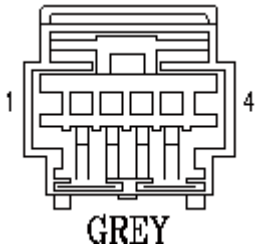

Part No.: YPC900630

Colour: GREY


Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS

Description: Instrument panel harness to main harness

Location: Base of RH 'A' post

Qualifier: LHD condition illustrated

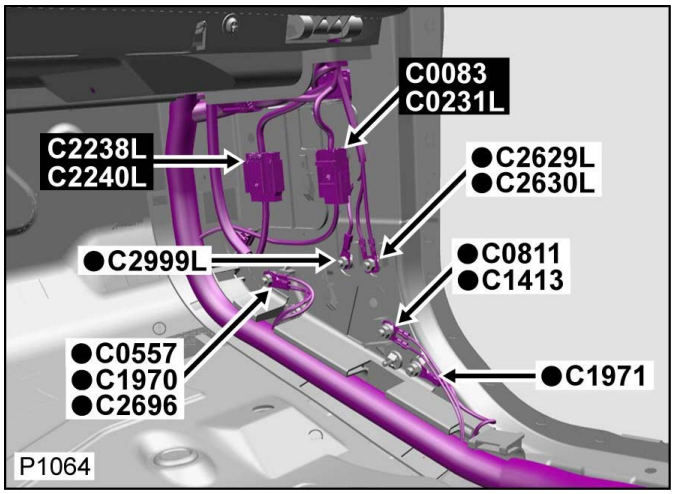


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	BU	216L	C0251L
2	0.5	GU	216L	C0251L
3	0.5	BR	216L	C0261L
4	0.5	GO	216L	C0261L

Click here to print

Connector: C0231R

CONNECTOR HOUSING NOT SERVICEABLE

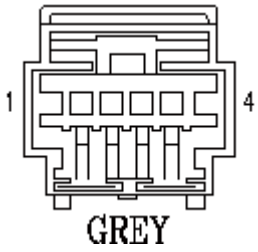

Part No.: YPC900630

Colour: GREY


Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS

Description: Instrument panel harness to main harness

Location: Base of RH 'A' post

Qualifier: RHD condition illustrated

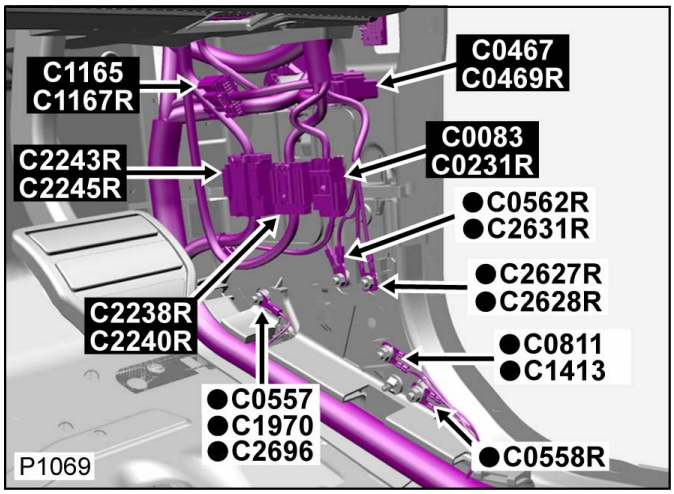

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	RY	216R	C2641R
2	0.5	R	216R	C2641R
3	0.5	RG	216R	C2641R
4	0.5	RB	216R	C2641R

Click here to print


Connector: C0232L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Clock-Analogue

Location: Behind center of Instrument panel

Qualifier: LHD condition illustrated

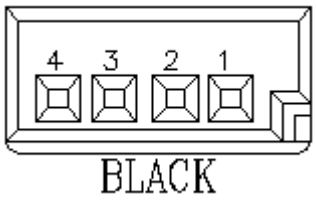

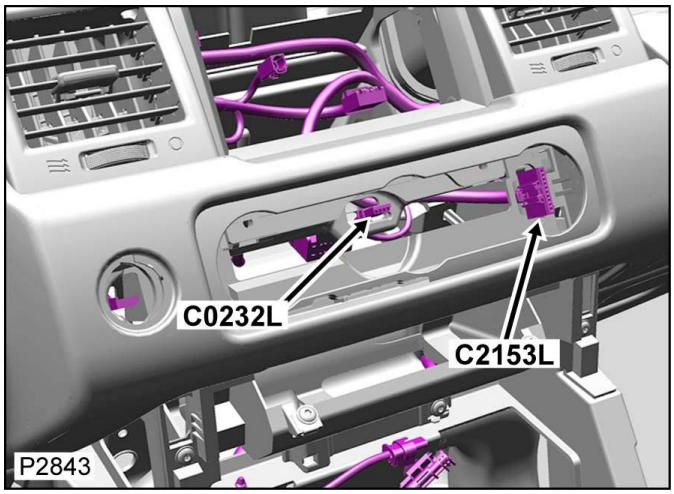

Part No.: YPC906610

Colour: BLACK

Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GK	124L	S/JOINT SJ552	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.5	RN	124L	S/JOINT SJ117	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
3	0.35	WS	124L	S/JOINT SJ132	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.5	B	124L	S/JOINT SJ661	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0232R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Clock-Analogue

Location: Behind center of Instrument panel

Qualifier: RHD condition illustrated

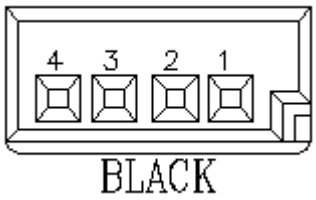

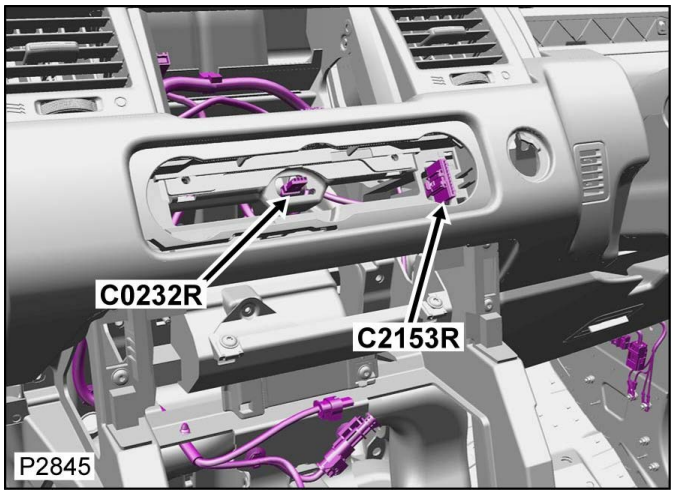

Part No.: YPC906610

Colour: BLACK

Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GK	124R	S/JOINT SJ552	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.5	RN	124R	S/JOINT SJ117	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
3	0.35	WS	124R	S/JOINT SJ132	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.5	B	124R	S/JOINT SJ661	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0237B

CONNECTOR HOUSING NOT SERVICEABLE

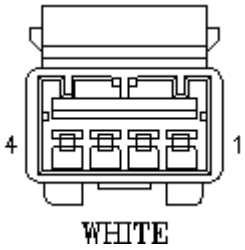

Part No.: YPC10207

Colour: WHITE


Cavities: 4WY

Harness: SEAT REAR HARNESS

Description: Heater-seat cushion

Location: Beneath rear seat

Qualifier:

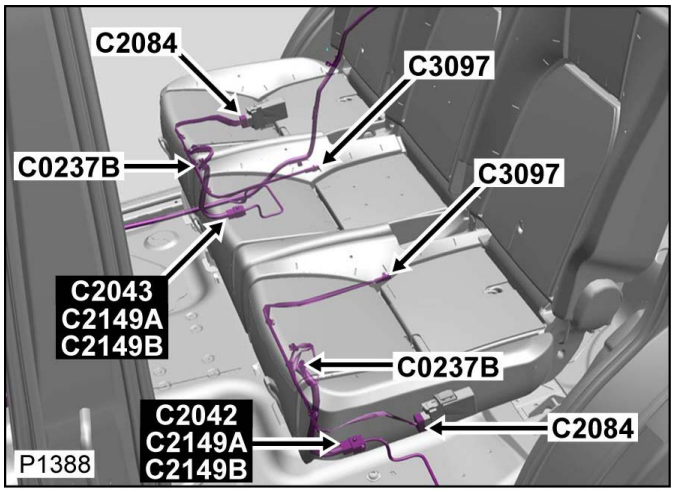


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	KW	572	C3097	-	-	-	-	-	-	-
2	1.5	K	572	C2084	-	-	-	-	-	-	-
3	0.35	LG	572	C2084	418-549-64	-	418-116A	-	418-104	418-112	418-107
4	0.35	BG	572	C2084	418-549-64	-	418-116A	-	418-104	418-112	418-107

Click here to print

Connector: C0246T

CONNECTOR HOUSING NOT SERVICEABLE

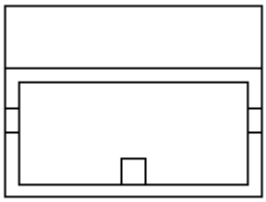

BLACK

Part No.: AAU1010

Colour: BLACK


Cavities: 1WY

Harness: CABIN HARNESS

Description: Windshield RH heater element

Location: RH 'A' post

Qualifier:

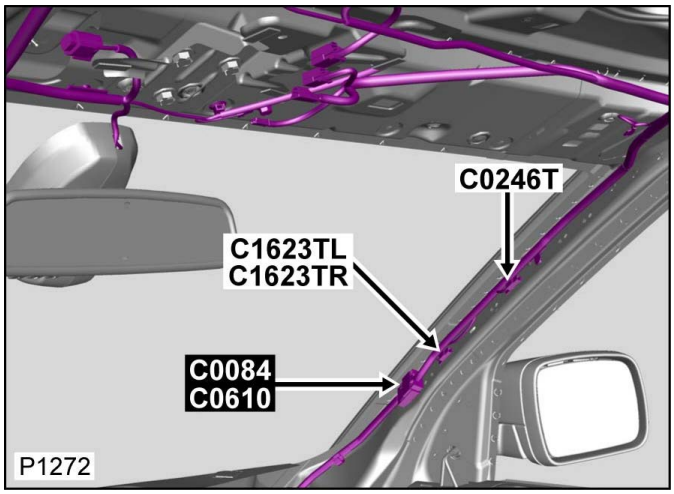

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	109T	S/JOINT SJ276

Click here to print


Connector: C0247T

CONNECTOR HOUSING NOT SERVICEABLE

Description: Windshield LH heater element

Location: LH 'A' post

Qualifier:

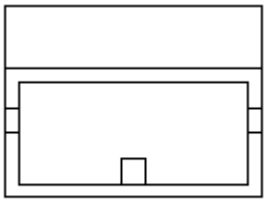


BLACK

Part No.: AAU1010

Colour: BLACK

Cavities: 1WY

Harness: CABIN HARNESS

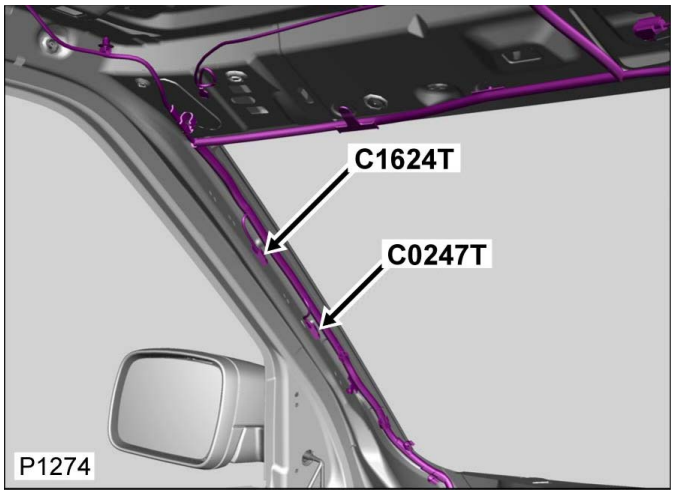

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	109T	C2695

Click here to print


Connector: C0251L

CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Air bag-Passenger

Location: Behind passenger air bag module

Qualifier:

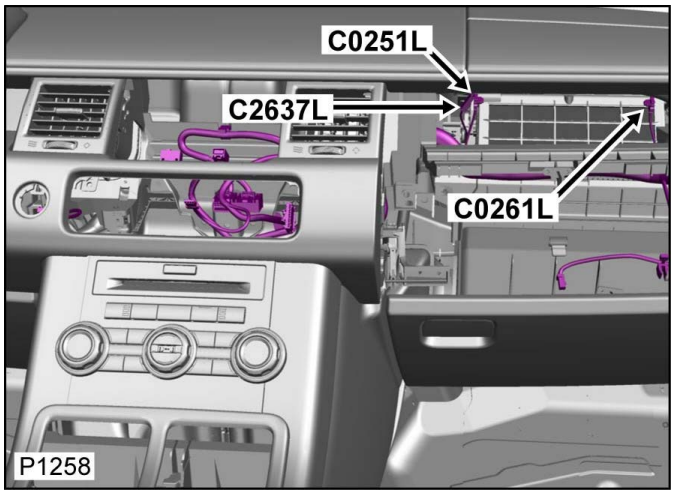

ASSEMBLY

Part No.: XUD801490

Colour: NO COLOUR

Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	BU	216L	C0231L
2	0.5	GU	216L	C0231L

Click here to print


Connector: C0251R

CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Air bag-Passenger

Location: Behind passenger air bag module

Qualifier:

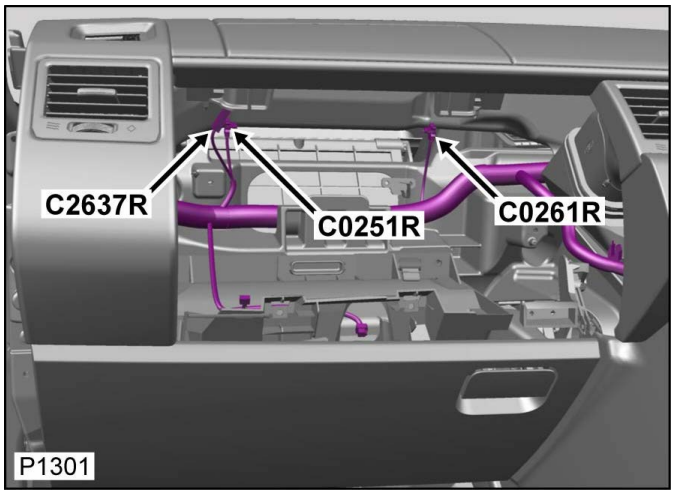

ASSEMBLY

Part No.: XUD801490

Colour: NO COLOUR

Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	BU	216R	C0229R
2	0.5	GU	216R	C0229R

Click here to print


Connector: C0256

CONNECTOR HOUSING NOT SERVICEABLE

Description: Restraints Control Module (RCM)

Location: Behind center console

Qualifier:

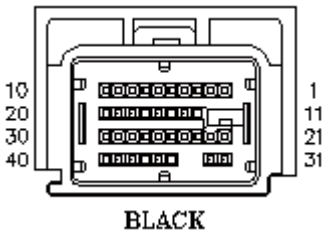


BLACK

Part No.: YPC802870

Colour: BLACK

Cavities: 36WY

Harness: CABIN HARNESS

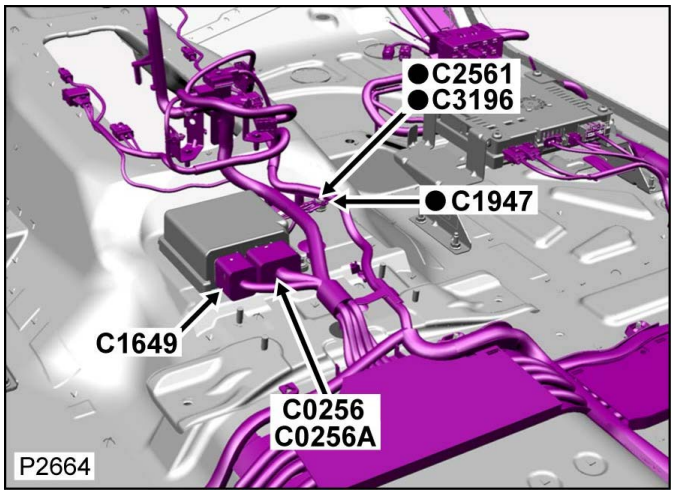

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WU	216	C2378	418-411-70	-	418-116A	418-117	-	418-112	418-107
2	0.5	R	216	C2378	418-411-70	-	418-116A	418-117	-	418-112	418-107
3	0.5	RW	216S	C1479S	418-411-70	-	418-116A	418-117	-	418-112	418-107
3	0.5	RW	216T	C1479T	418-411-70	-	418-116A	418-117	-	418-112	418-107
4	0.5	BW	216S	C1479S	418-411-70	-	418-116A	418-117	-	418-112	418-107
4	0.5	BW	216T	C1479T	418-411-70	-	418-116A	418-117	-	418-112	418-107
5	0.5	BU	216S	C1480S	418-411-70	-	418-116A	418-117	-	418-112	418-107
5	0.5	BU	216T	C1480T	418-411-70	-	418-116A	418-117	-	418-112	418-107
6	0.5	GU	216S	C1480S	418-411-70	-	418-116A	418-117	-	418-112	418-107
6	0.5	GU	216T	C1480T	418-411-70	-	418-116A	418-117	-	418-112	418-107
7	0.5	BW	216S	C2124S	418-411-70	-	418-116A	418-117	-	418-112	418-107
8	0.5	GW	216S	C2124S	418-411-70	-	418-116A	418-117	-	418-112	418-107
9	0.5	BY	216S	C2125S	418-411-70	-	418-116A	418-117	-	418-112	418-107
10	0.5	GY	216S	C2125S	418-411-70	-	418-116A	418-117	-	418-112	418-107
13	0.5	P	216S	C1654S	418-411-70	-	418-116A	418-117	-	418-112	418-107
13	0.5	P	216T	C1654T	418-411-70	-	418-116A	418-117	-	418-112	418-107
14	0.5	GW	216S	C1654S	418-411-70	-	418-116A	418-117	-	418-112	418-107
14	0.5	GW	216T	C1654T	418-411-70	-	418-116A	418-117	-	418-112	418-107


15	0.5	WR	216S	C1655S	418-411-70	-	418-116A	418-117	-	418-112	418-107
15	0.5	WR	216T	C1655T	418-411-70	-	418-116A	418-117	-	418-112	418-107
16	0.5	UW	216S	C1655S	418-411-70	-	418-116A	418-117	-	418-112	418-107
16	0.5	UW	216T	C1655T	418-411-70	-	418-116A	418-117	-	418-112	418-107
17	0.5	LGR	216L	C2378	418-411-70	-	418-116A	418-117	-	418-112	418-107
17	0.5	LGR	216R	C2368	418-411-70	-	418-116A	418-117	-	418-112	418-107
18	0.5	LGB	216L	C2378	418-411-70	-	418-116A	418-117	-	418-112	418-107
18	0.5	LGB	216R	C2368	418-411-70	-	418-116A	418-117	-	418-112	418-107
19	0.5	UR	216L	C3283L	418-411-70	-	418-116A	418-117	-	418-112	418-107
19	0.5	UR	216R	C3283R	418-411-70	-	418-116A	418-117	-	418-112	418-107
20	0.5	UR	216L	C3283L	418-411-70	-	418-116A	418-117	-	418-112	418-107
20	0.5	YB	216R	C3283R	418-411-70	-	418-116A	418-117	-	418-112	418-107
21	0.5	WY	216	C2368	418-411-70	-	418-116A	418-117	-	418-112	418-107
22	0.5	NY	216	C2368	418-411-70	-	418-116A	418-117	-	418-112	418-107
23	0.5	LG	216L	C2378	418-411-70	-	418-116A	418-117	-	418-112	418-107
23	0.5	LG	216R	C2368	418-411-70	-	418-116A	418-117	-	418-112	418-107
24	0.35	RY	216L	C1166L	418-411-48	-	418-116A	418-117	418-104	418-113	418-108
24	0.35	RY	216R	C0047R	418-411-48	-	418-116A	418-117	418-104	418-113	418-108
25	0.35	G	216L	C2378	418-411-48	-	418-116A	418-117	418-104	418-113	418-108
25	0.35	G	216R	C2368	418-411-48	-	418-116A	418-117	418-104	418-113	418-108
26	0.35	G	216L	C2368	418-411-48	-	418-116A	418-117	418-104	418-113	418-108
26	0.35	G	216R	C2378	418-411-48	-	418-116A	418-117	418-104	418-113	418-108
27	0.5	WR	216	C2126	418-411-70	-	418-116A	418-117	-	418-112	418-107
28	0.5	WLG	216	C2126	418-411-70	-	418-116A	418-117	-	418-112	418-107
29	0.5	RW	216	C2127	418-411-70	-	418-116A	418-117	-	418-112	418-107
30	0.5	RLG	216	C2127	418-411-70	-	418-116A	418-117	-	418-112	418-107
31	0.35	YN	216	S/JOINT SJ1005	418-411-48	-	418-116A	418-117	418-104	418-113	418-108
32	0.35	YB	216	S/JOINT SJ1006	418-411-48	-	418-116A	418-117	418-104	418-113	418-108
35	0.5	YR	216L	C2368	418-411-70	-	418-116A	418-117	-	418-112	418-107
35	0.5	YR	216R	C2378	418-411-70	-	418-116A	418-117	-	418-112	418-107
36	0.5	UB	216L	C2368	418-411-70	-	418-116A	418-117	-	418-112	418-107

36	0.5	UB	216R	C2378	418-411-70	-	418-116A	418-117	-	418-112	418-107
37	0.5	WLG	216	C0399	418-411-70	-	418-116A	418-117	-	418-112	418-107
38	0.5	NLG	216	C0399	418-411-70	-	418-116A	418-117	-	418-112	418-107
39	0.5	WLG	216	C0397	418-411-70	-	418-116A	418-117	-	418-112	418-107
40	0.5	NLG	216	C0397	418-411-70	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: **C0256A**

CONNECTOR HOUSING NOT SERVICEABLE

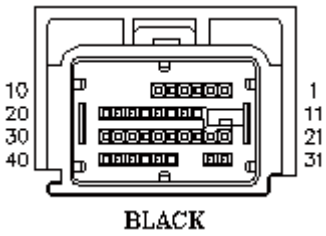

BLACK

Part No.: YPC802890

Colour: BLACK


Cavities: 32WY

Harness: CABIN HARNESS

Description: Restraints Control Module (RCM)

Location: Behind center console

Qualifier:

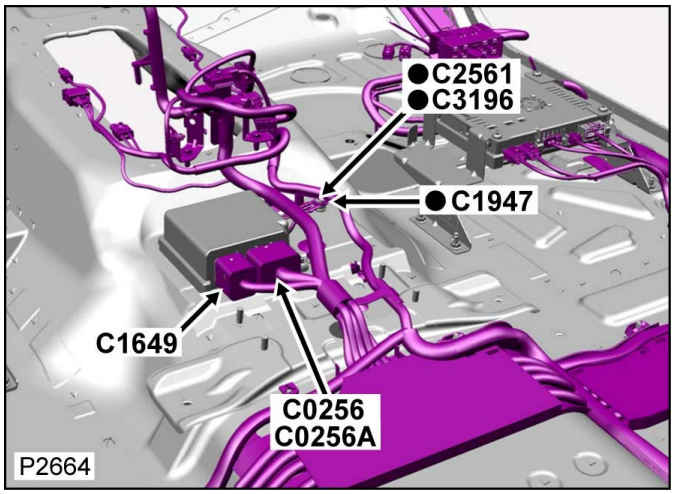

Click here to print


Connector: C0257

CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Air bag-Driver

Location: Behind driver air bag module

Qualifier:

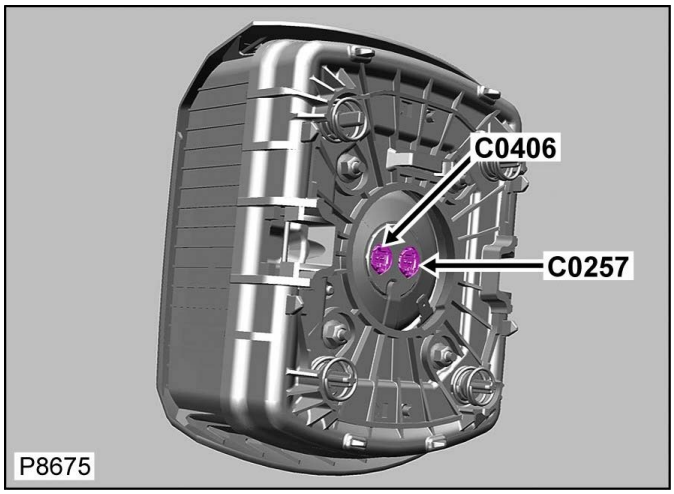

ASSEMBLY

Part No.: CASSY

Colour: NO COLOUR

Cavities: 1WY

Harness: STEERING WHEEL HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	PN	499	C1948
2	0.5	YG	499	C1948

Click here to print


Connector: C0261L

CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Air bag-Passenger

Location: Behind passenger air bag module

Qualifier:

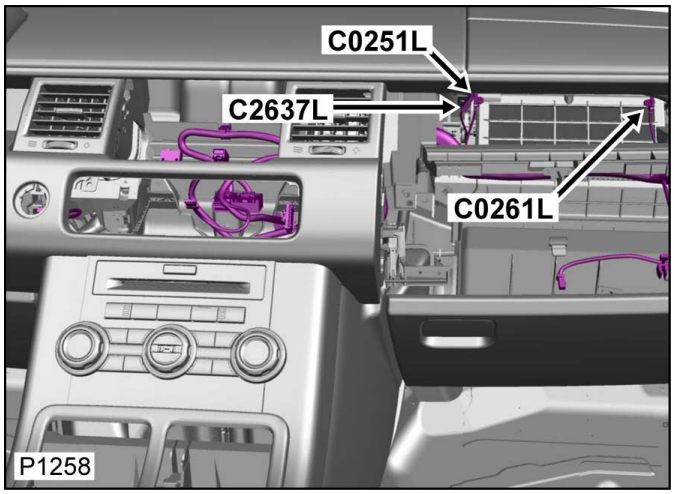

ASSEMBLY

Part No.: XUD801500

Colour: NO COLOUR

Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	BR	216L	C0231L
2	0.5	GO	216L	C0231L

Click here to print

Connector: C0261R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Air bag-Passenger

Location: Behind passenger air bag module

Qualifier:

ASSEMBLY

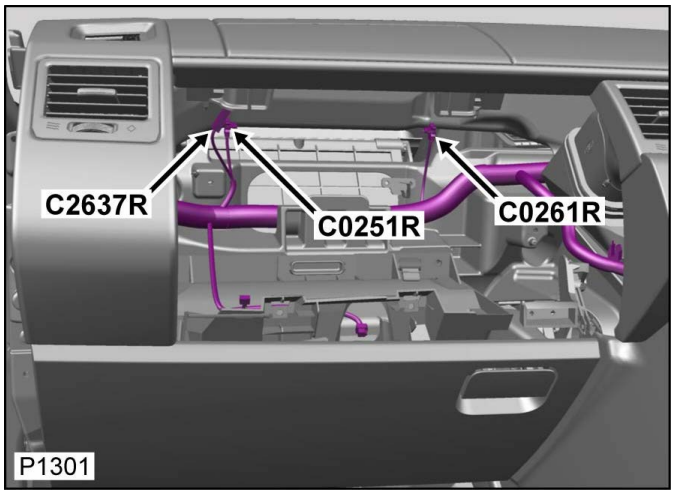

Part No.: XUD801500

Colour: NO COLOUR

Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	BR	216R	C0229R
2	0.5	GO	216R	C0229R

Click here to print

Connector: **C0269**

CONNECTOR HOUSING SERVICEABLE

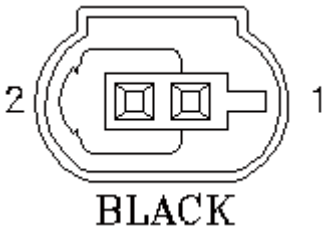

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: CHASSIS HARNESS

Description: Sensor-Temperature-Differential oil

Location: Beneath rear of vehicle - Center

Qualifier:

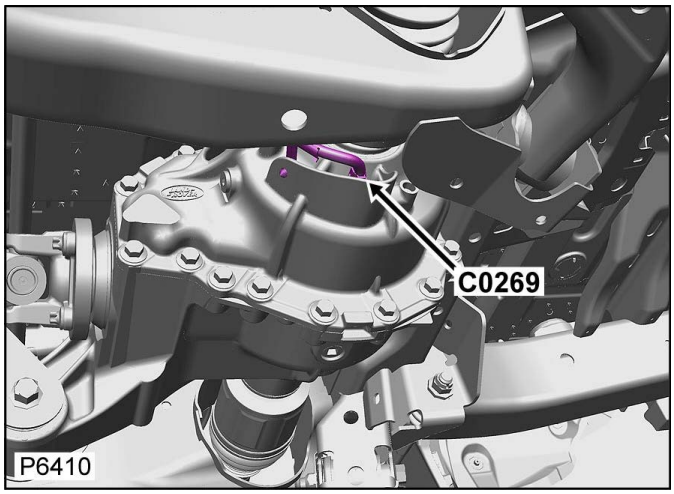

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	R	401	C0390	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	Y	401	C0390	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C0272M

CONNECTOR HOUSING NOT SERVICEABLE


Description: Throttle-EGR-Inlet - DV6

Location: RH side of engine

Qualifier:

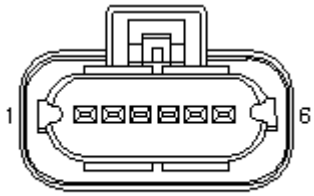

BLACK

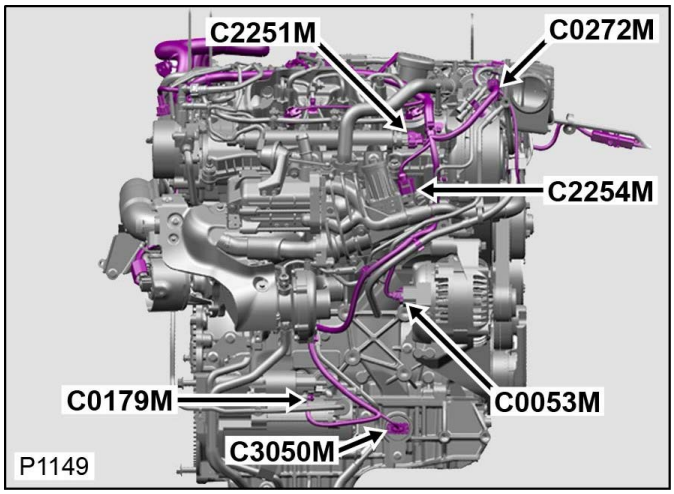

Part No.: YPC913020

Colour: BLACK

Cavities: 6WY

Harness: ENGINE DIESEL 3.0L HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	YP	798	C0659M
2	0.5	S	798	C0659M
3	0.75	GP	798	C0659M
4	0.75	N	798	C0659M
6	0.5	Y	798	S/JOINT SJ4

Click here to print

Connector: C0276

CONNECTOR HOUSING NOT SERVICEABLE

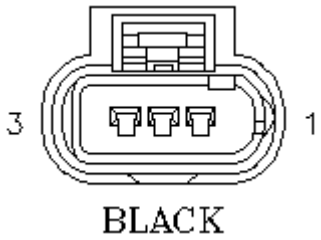

Part No.: YPC913370

Colour: BLACK


Cavities: 3WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Ignition coil-3 - PV8

Location: Top of engine - RH side

Qualifier:

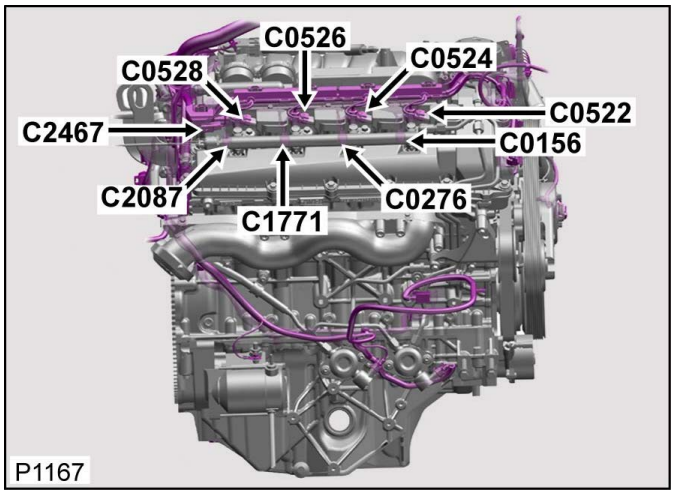


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	YU	ALL	C0634
2	0.5	B	ALL	S/JOINT PIS26
3	0.5	W	ALL	S/JOINT PIS20

Click here to print

Connector: C0278L

CONNECTOR HOUSING NOT SERVICEABLE

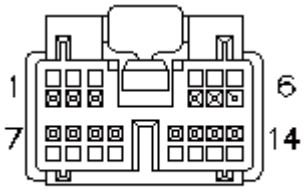

GREEN

Part No.: YPC800760

Colour: GREEN


Cavities: 14WY

Harness: FACIA COMPOSITE HARNESS

Description: Switch-Steering column-Wiper

Location: Behind steering column cowl

Qualifier:

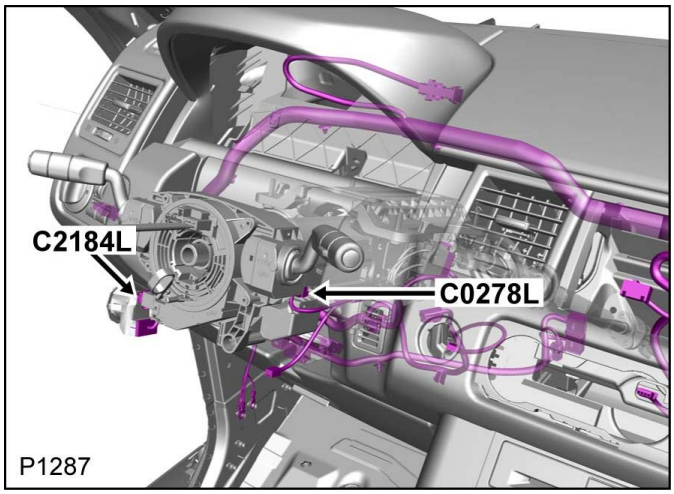


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	0.35	LGP	90L	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.35	WLG	90L	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.35	GS	90L	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.35	LG	139L	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
8	0.35	LGG	139L	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
9	0.35	GS	90L	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
10	0.35	RLG	90L	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
11	0.5	B	139L	C2631L	418-587-02	-	418-116A	418-117	-	418-112	418-107
12	0.35	LGS	193L	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
13	0.35	GY	193L	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0278R

CONNECTOR HOUSING NOT SERVICEABLE

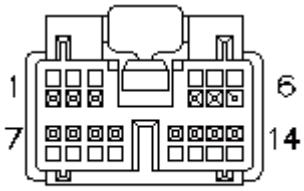

GREEN

Part No.: YPC800760

Colour: GREEN


Cavities: 14WY

Harness: FACIA COMPOSITE HARNESS

Description: Switch-Steering column-Wiper

Location: Behind steering column cowl

Qualifier:

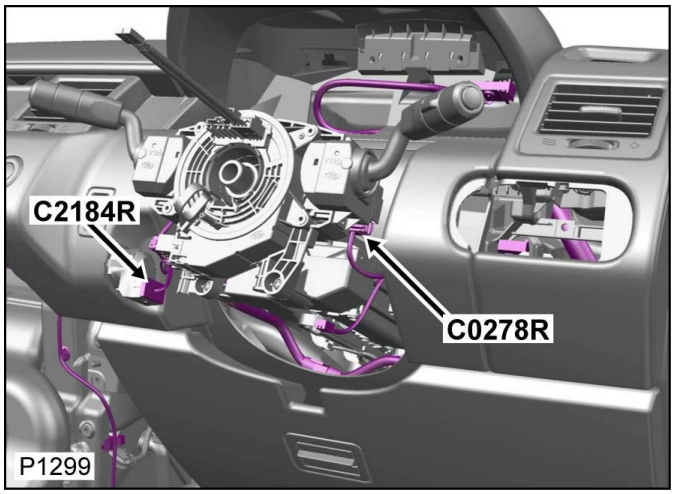

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	0.35	LGP	90R	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.35	WLG	90R	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.35	GS	90R	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.35	LG	200R	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
8	0.35	LGG	200R	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
9	0.35	GS	90R	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
10	0.35	RLG	90R	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
11	0.5	B	200R	C2631R	418-587-02	-	418-116A	418-117	-	418-112	418-107
12	0.35	LGS	193R	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
13	0.35	GY	193R	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0304

CONNECTOR HOUSING NOT SERVICEABLE

Description: Motor-Window-Rear

Location: Behind rear door trim panel

Qualifier: LH side illustrated RH side similar

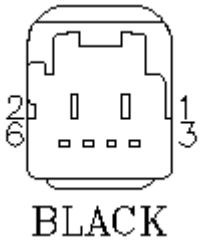


Part No.: YPC802960

Colour: BLACK

Cavities: 6WY

Harness: REAR DOOR HARNESS

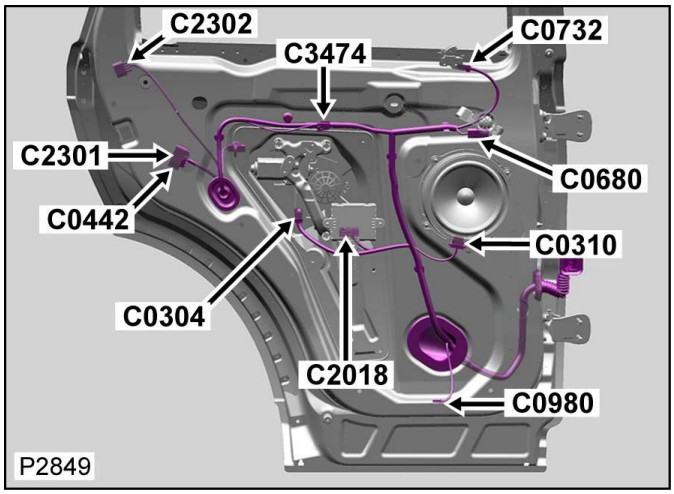


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	PO	499	C2018	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	SN	499	C2018	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
3	0.5	NG	499	C2018	-	-	-	-	-	-	-
4	0.5	NY	278	C2018	-	-	-	-	-	-	-
4	0.5	NY	277	C2018	-	-	-	-	-	-	-
5	0.5	SP	499	C2018	-	-	-	-	-	-	-
6	0.5	US	278	C2018	-	-	-	-	-	-	-
6	0.5	US	277	C2018	-	-	-	-	-	-	-

Click here to print

Connector: C0309

CONNECTOR HOUSING NOT SERVICEABLE

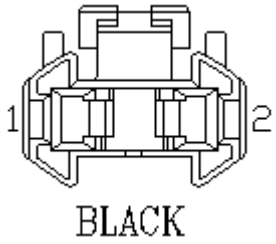

Part No.: YPC912980

Colour: BLACK


Cavities: 2WY

Harness: ROOF HARNESS

Description: RH rear surround sound speaker

Location: Rear of headlining - RH side

Qualifier:

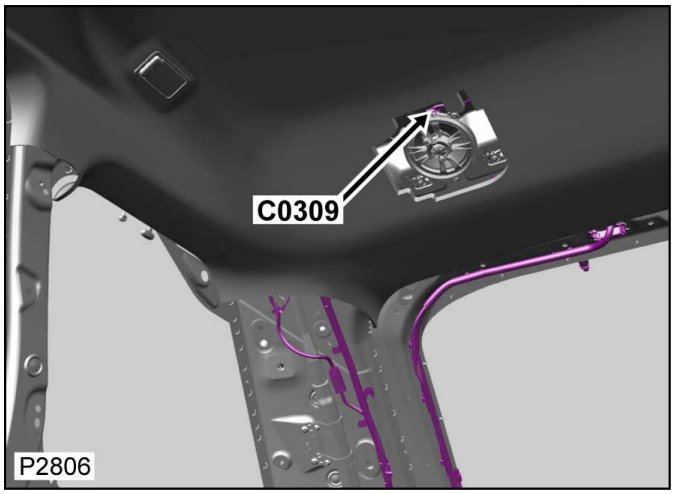


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	NU	420	C0610
2	1.5	NW	420	C0610

Click here to print

Connector: C0310

CONNECTOR HOUSING NOT SERVICEABLE

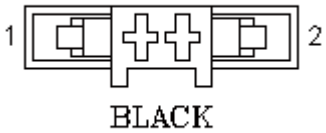

Part No.: YPC113640

Colour: BLACK


Cavities: 2WY

Harness: REAR DOOR HARNESS

Description: Speaker-Low range-Rear door

Location: Behind rear door trim panel

Qualifier: LH side illustrated RH side similar

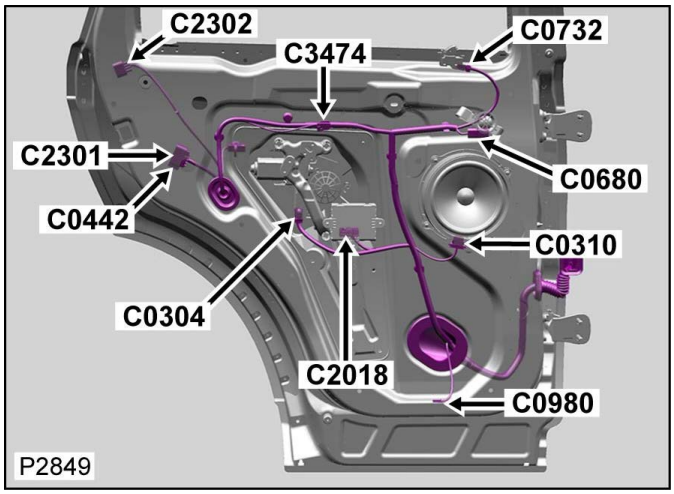


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	NY	478L	C0803
1	1.5	NU	478R	C0804
2	1.5	WG	478L	C0803
2	1.5	NW	478R	C0804

Click here to print

Connector: C0311

CONNECTOR HOUSING NOT SERVICEABLE

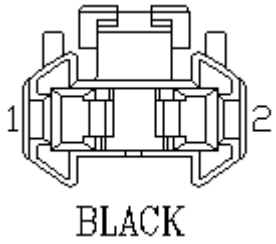

Part No.: YPC912980

Colour: BLACK


Cavities: 2WY

Harness: ROOF HARNESS

Description: LH rear surround sound speaker

Location: Rear of headlining - LH side

Qualifier:

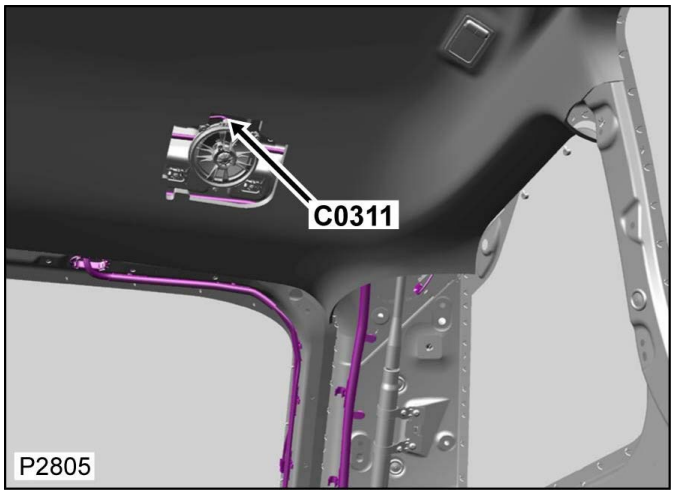

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	NY	420	C0610
2	1.5	WG	420	C0610

Click here to print


Connector: C0319

CONNECTOR HOUSING SERVICEABLE

Description: Mirror-Door

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated

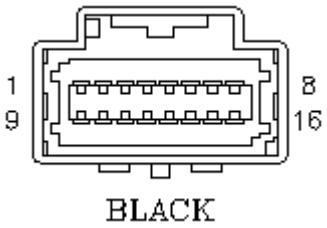


Part No.: YPC500910

Colour: BLACK

Cavities: 16WY

Harness: DOORS FRONT HARNESS

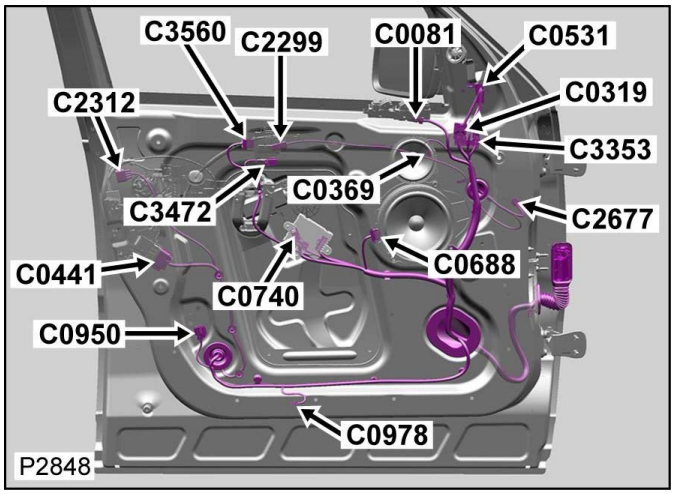

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WN	672	C2058	418-411-47	-	418-116A	418-117	-	418-112	418-107
1	0.5	WN	673	C2057	418-411-47	-	418-116A	418-117	-	418-112	418-107
1	0.5	WN	674	C3507	418-411-47	-	418-116A	418-117	-	418-112	418-107
1	0.5	WN	675	C3508	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.5	GW	672	C2058	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.5	GW	673	C2057	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.5	GW	674	C3507	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.5	GW	675	C3508	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.5	WP	672	C2058	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.5	WP	673	C2057	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.5	WP	674	C3507	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.5	WP	675	C3508	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.5	BN	672	C2058	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.5	BN	673	C2057	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.5	BN	674	C3507	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.5	BN	675	C3508	418-411-47	-	418-116A	418-117	-	418-112	418-107
5	0.35	WO	672	C2058	-	-	-	-	-	-	-
5	0.35	WO	673	C2057	-	-	-	-	-	-	-
5	0.35	WO	674	C3507	-	-	-	-	-	-	-
5	0.35	WO	675	C3508	-	-	-	-	-	-	-

6	0.35	YO	672	C2058	-	-	-	-	-	-	-
6	0.35	YO	673	C2057	-	-	-	-	-	-	-
6	0.35	YO	674	C3507	-	-	-	-	-	-	-
6	0.35	YO	675	C3508	-	-	-	-	-	-	-
7	0.35	SP	672	C2058	-	-	-	-	-	-	-
7	0.35	SP	673	C2057	-	-	-	-	-	-	-
7	0.35	SP	674	C3507	-	-	-	-	-	-	-
7	0.35	SP	675	C3508	-	-	-	-	-	-	-
8	0.35	UO	672	C2058	-	-	-	-	-	-	-
8	0.35	UO	673	C2057	-	-	-	-	-	-	-
8	0.35	UO	674	C3507	-	-	-	-	-	-	-
8	0.35	UO	675	C3508	-	-	-	-	-	-	-
9	0.35	NG	672	C2058	-	-	-	-	-	-	-
9	0.35	NG	673	C2057	-	-	-	-	-	-	-
9	0.35	NG	674	C3507	-	-	-	-	-	-	-
9	0.35	NG	675	C3508	-	-	-	-	-	-	-
10	0.35	Y	672	C2058	-	-	-	-	-	-	-
10	0.35	Y	673	C2057	-	-	-	-	-	-	-
10	0.35	Y	674	C3507	-	-	-	-	-	-	-
10	0.35	Y	675	C3508	-	-	-	-	-	-	-
11	0.5	P	672	C2058	418-411-47	-	418-116A	418-117	-	418-112	418-107
11	0.5	P	673	C2057	418-411-47	-	418-116A	418-117	-	418-112	418-107
11	0.5	P	674	C3507	418-411-47	-	418-116A	418-117	-	418-112	418-107
11	0.5	P	675	C3508	418-411-47	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0355

CONNECTOR HOUSING NOT SERVICEABLE

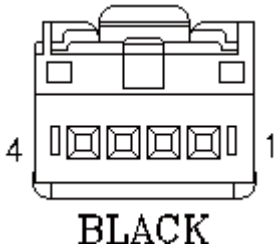

Part No.: YPC801040

Colour: BLACK


Cavities: 4WY

Harness: ROOF HARNESS

Description: Lamp-Interior-Front

Location: Behind Center headlining

Qualifier:

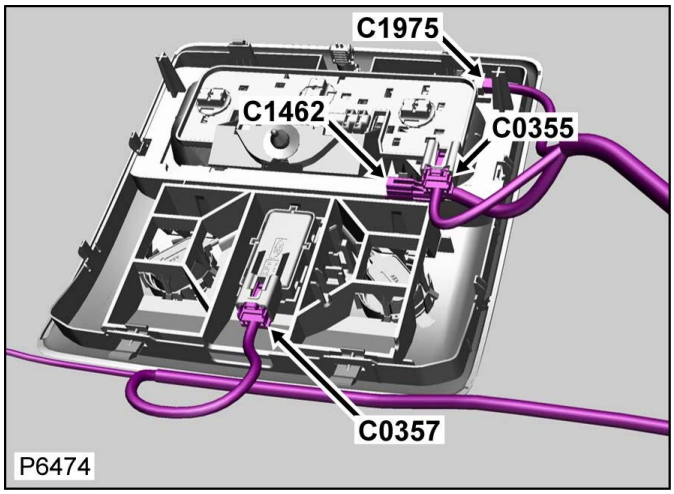


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	PU	134	C0610
2	0.5	LGW	134	S/JOINT SJ234
3	0.75	B	134	S/JOINT SJ275
4	0.75	P	134	C0610

Click here to print

Connector: C0357

CONNECTOR HOUSING NOT SERVICEABLE

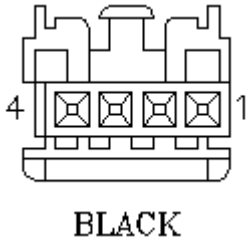

BLACK

Part No.: YPC902310

Colour: BLACK


Cavities: 4WY

Harness: ROOF HARNESS

Description: Lamp-Interior-Front

Location: Behind Center headlining

Qualifier:

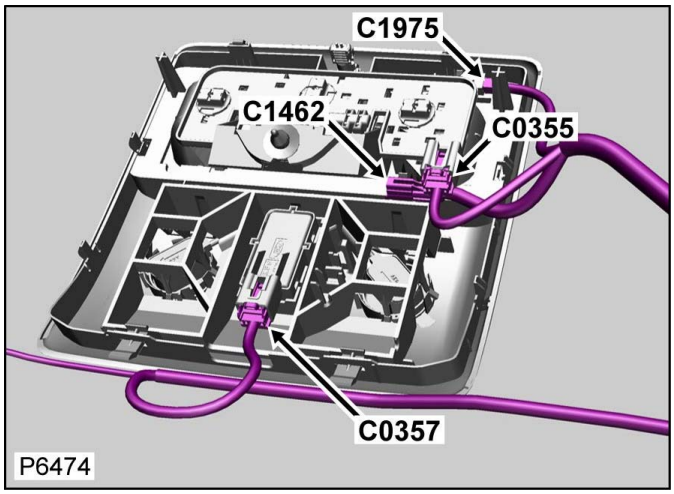

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	GW	227	C0610	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	RN	227	S/JOINT SJ237	-	-	-	-	-	-	-
3	0.35	OY	227	C0610	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.75	B	227	S/JOINT SJ275	-	-	-	-	-	-	-

Click here to print


Connector: **C0358**

CONNECTOR HOUSING NOT SERVICEABLE

Description: Sensor-Volumetric

Location: Behind Center headlining

Qualifier:

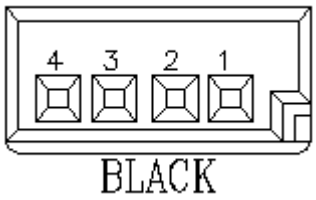



Part No.: YPC906610

Colour: BLACK

Cavities: 4WY

Harness: ROOF HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	R	22	C0610	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.5	G	22	C0610	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
3	0.5	B	22	S/JOINT SJ275	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0369

CONNECTOR HOUSING NOT SERVICEABLE

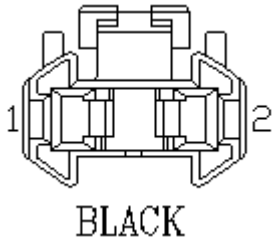

Part No.: YPC912980

Colour: BLACK


Cavities: 2WY

Harness: DOORS FRONT HARNESS

Description: Speaker-Mid range-Front door

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated

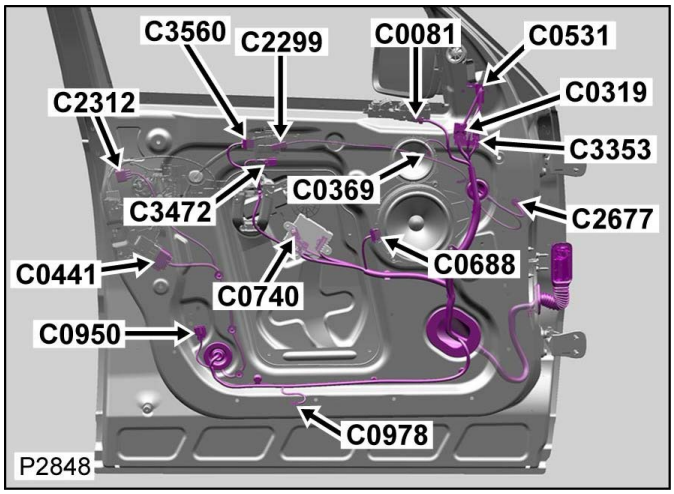


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	SU	478L	C0439
1	1.5	YS	478R	C3646
2	1.5	NU	478L	C0439
2	1.5	PS	478R	C3646

Click here to print

Connector: C0369L

CONNECTOR HOUSING NOT SERVICEABLE

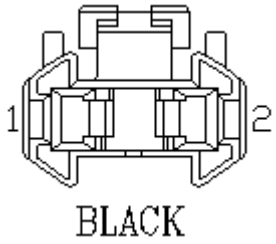

Part No.: YPC912980

Colour: BLACK


Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Description: Center speaker

Location: Instrument panel-center-top

Qualifier:

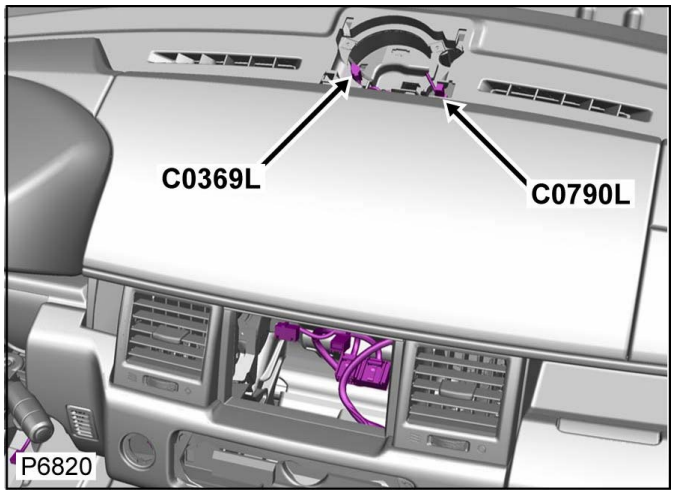


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	GW	124L	C0469L
2	1.5	G	124L	C0469L

Click here to print

Connector: **C0369R**

CONNECTOR HOUSING NOT SERVICEABLE

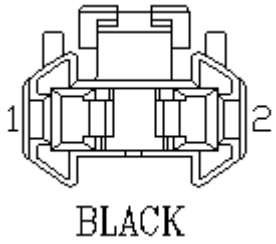

Part No.: YPC912980

Colour: BLACK


Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Description: Center speaker

Location: Instrument panel-center-top

Qualifier:

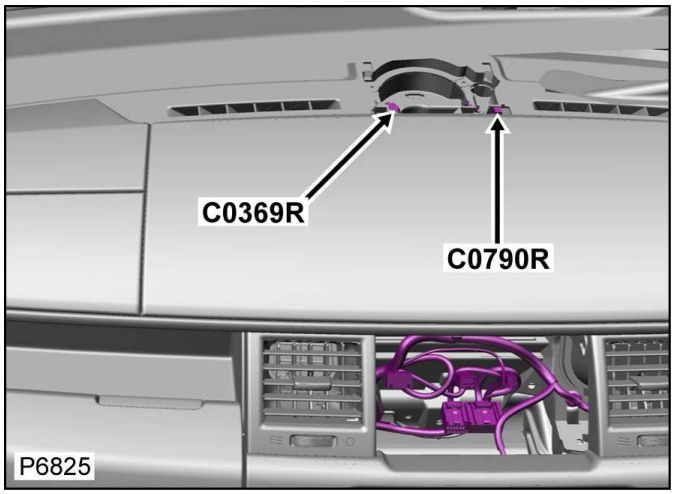


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	GW	124R	C0469R
2	1.5	G	124R	C0469R

Click here to print

Connector: **C0374L**

CONNECTOR HOUSING SERVICEABLE

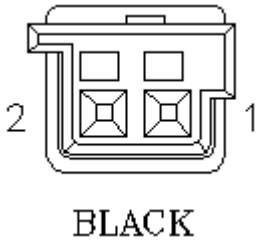

BLACK

Part No.: YPC802690

Colour: BLACK


Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Description: Clock spring

Location: Behind steering column cowl LH side

Qualifier:

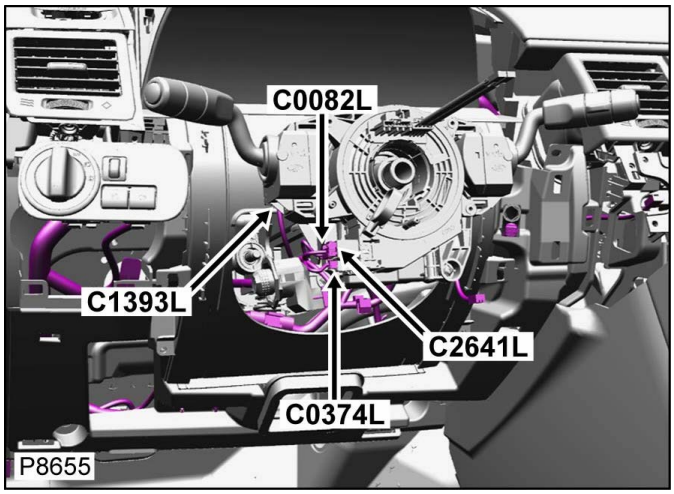


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	801L	S/JOINT SJ663L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.75	R	801L	C0582	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: **C0374R**

CONNECTOR HOUSING SERVICEABLE

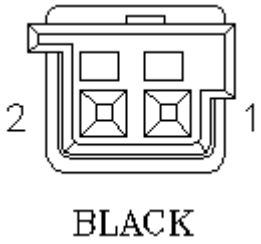

BLACK

Part No.: YPC802690

Colour: BLACK


Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Description: Clock spring

Location: Behind steering column cowl LH side

Qualifier:

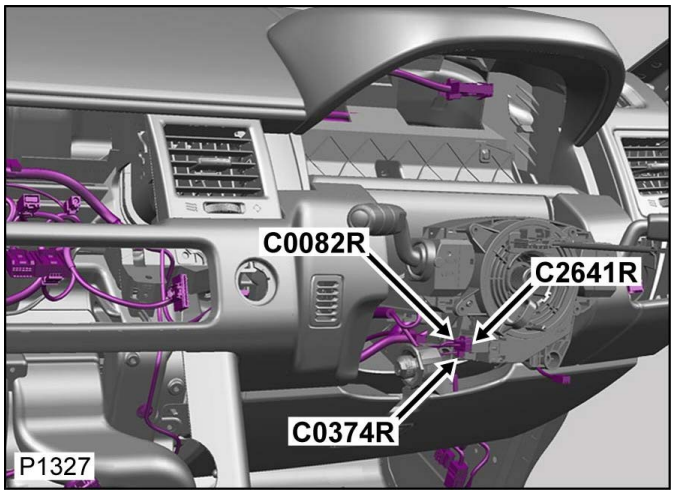

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	801R	S/JOINT SJ663R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.75	R	801R	C0582	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0376


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to chassis harness

Location: Beneath rear of vehicle LH side

Qualifier:

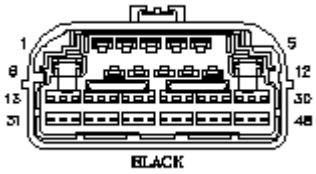

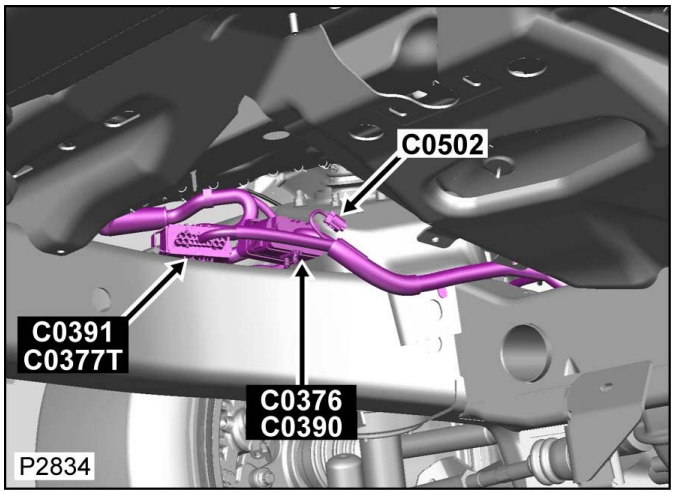

Part No.: YPC803000

Colour: BLACK

Cavities: 48WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	252	S/JOINT SJ140	-	-	-	-	-	-	-
2	0.35	WU	139L	C0586L	-	-	-	-	-	-	-
2	0.35	WU	200R	C0586R	-	-	-	-	-	-	-
3	0.35	WR	139L	C0586L	-	-	-	-	-	-	-
3	0.35	WR	200R	C0586R	-	-	-	-	-	-	-
6	4.0	WP	254L	C2243L	-	-	-	-	-	-	-
6	2.5	WP	252	C2369	-	-	-	-	-	-	-
6	2.5	WP	254R	C2242R	-	-	-	-	-	-	-
9	2.5	R	401S	C2164S	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
9	2.5	R	401T	C2164T	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
10	2.5	U	401S	C2164S	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
10	2.5	U	401T	C2164T	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
12	2.5	B	252	C2369	-	-	-	-	-	-	-
12	4.0	B	254	S/JOINT SJ405	-	-	-	-	-	-	-
13	0.5	YG	395S	C0868S	-	-	-	-	-	-	-
13	0.5	YG	986TL	C0868TL	-	-	-	-	-	-	-
13	0.5	YG	982T	C0868TA	-	-	-	-	-	-	-
13	0.5	YG	986TR	C0868TR	-	-	-	-	-	-	-
14	0.5	YU	395S	C0868S	-	-	-	-	-	-	-
14	0.5	YU	986TL	C0868TL	-	-	-	-	-	-	-
14	0.5	YU	982T	C0868TA	-	-	-	-	-	-	-
14	0.5	YU	986TR	C0868TR	-	-	-	-	-	-	-
15	0.5	R	395S	C2053S	-	-	-	-	-	-	-
15	0.5	R	986TL	C2053TL	-	-	-	-	-	-	-
15	0.5	R	982T	C2053TA	-	-	-	-	-	-	-
15	0.5	R	986TR	C2053TR	-	-	-	-	-	-	-
16	0.5	Y	395S	C2053S	-	-	-	-	-	-	-

16	0.5	Y	986TL	C2053TL	-	-	-	-	-	-	-
16	0.5	Y	982T	C2053TA	-	-	-	-	-	-	-
16	0.5	Y	986TR	C2053TR	-	-	-	-	-	-	-
17	0.5	R	139L	C0585L	-	-	-	-	-	-	-
17	0.5	R	200R	C0585R	-	-	-	-	-	-	-
18	0.5	BK	139L	C0586L	-	-	-	-	-	-	-
18	0.5	BK	200R	C0586R	-	-	-	-	-	-	-
19	0.5	G	139L	C0586L	-	-	-	-	-	-	-
19	0.5	G	200R	C0586R	-	-	-	-	-	-	-
20	0.5	RS	522	C0376	-	-	-	-	-	-	-
20	0.5	U	401S	C2164S	-	-	-	-	-	-	-
20	0.5	U	401T	C2164T	-	-	-	-	-	-	-
21	0.5	RU	522	C0376	-	-	-	-	-	-	-
21	0.5	W	401S	C2164S	-	-	-	-	-	-	-
21	0.5	W	401T	C2164T	-	-	-	-	-	-	-
22	0.5	RY	522	C0376	-	-	-	-	-	-	-
22	0.5	G	401S	C2164S	-	-	-	-	-	-	-
22	0.5	G	401T	C2164T	-	-	-	-	-	-	-
23	0.5	RG	522	C0376	-	-	-	-	-	-	-
23	0.5	N	401S	C2164S	-	-	-	-	-	-	-
23	0.5	N	401T	C2164T	-	-	-	-	-	-	-
24	0.5	RW	522	C0376	-	-	-	-	-	-	-
24	0.5	S	401S	C2164S	-	-	-	-	-	-	-
24	0.5	S	401T	C2164T	-	-	-	-	-	-	-
25	0.5	RW	522	C0376	-	-	-	-	-	-	-
25	0.5	O	401S	C2164S	-	-	-	-	-	-	-
25	0.5	O	401T	C2164T	-	-	-	-	-	-	-
26	0.5	RG	522	C0376	-	-	-	-	-	-	-
26	0.5	R	401S	C2164S	-	-	-	-	-	-	-
26	0.5	R	401T	C2164T	-	-	-	-	-	-	-
27	0.5	RY	522	C0376	-	-	-	-	-	-	-
27	0.5	Y	401S	C2164S	-	-	-	-	-	-	-
27	0.5	Y	401T	C2164T	-	-	-	-	-	-	-
28	1.5	B	499	S/JOINT SJ405	-	-	-	-	-	-	-
29	1.5	B	499	S/JOINT SJ405	-	-	-	-	-	-	-
30	0.5	R	139L	C0586L	-	-	-	-	-	-	-
30	0.5	R	200R	C0586R	-	-	-	-	-	-	-
31	0.5	YN	980	S/JOINT SJ1009	-	-	-	-	-	-	-
31	0.5	YN	979L	S/JOINT SJ1007	-	-	-	-	-	-	-
31	0.5	YN	979SR	C2053S	-	-	-	-	-	-	-
31	0.5	YN	245T	S/JOINT SJ1011T	-	-	-	-	-	-	-
31	0.5	YN	1037TR	C2053TA	-	-	-	-	-	-	-
31	0.5	YN	1036TR	C2053TR	-	-	-	-	-	-	-
32	0.5	YB	980	S/JOINT SJ1010	-	-	-	-	-	-	-
32	0.5	YB	979L	S/JOINT SJ1008	-	-	-	-	-	-	-
32	0.5	YB	979SR	C2053S	-	-	-	-	-	-	-
32	0.5	YB	245T	S/JOINT SJ1012T	-	-	-	-	-	-	-

32	0.5	YB	1037TR	C2053TA	-	-	-	-	-	-	-
32	0.5	YB	1036TR	C2053TR	-	-	-	-	-	-	-
33	0.5	OY	419L	C0867L	-	-	-	-	-	-	-
33	0.5	OY	419R	C0867R	-	-	-	-	-	-	-
34	0.5	OR	419L	C0867L	-	-	-	-	-	-	-
34	0.5	OR	419R	C0867R	-	-	-	-	-	-	-
35	0.5	OB	419L	C0867L	-	-	-	-	-	-	-
35	0.5	OB	419R	C0867R	-	-	-	-	-	-	-
36	0.5	SY	419L	C0867L	-	-	-	-	-	-	-
36	0.5	SY	419R	C0867R	-	-	-	-	-	-	-
37	0.5	SU	419L	C0867L	-	-	-	-	-	-	-
37	0.5	SU	419R	C0867R	-	-	-	-	-	-	-
38	0.5	SR	419L	C0867L	-	-	-	-	-	-	-
38	0.5	SR	419R	C0867R	-	-	-	-	-	-	-
39	0.5	BO	419L	C2030L	-	-	-	-	-	-	-
39	0.5	BO	419R	C2030R	-	-	-	-	-	-	-
40	0.5	BN	419L	C2030L	-	-	-	-	-	-	-
40	0.5	BN	419R	C2030R	-	-	-	-	-	-	-
41	0.5	RU	522	C0376	-	-	-	-	-	-	-
41	1.0	R	401S	C2164S	-	-	-	-	-	-	-
41	1.0	R	401T	C2164T	-	-	-	-	-	-	-
42	0.5	RS	522	C0376	-	-	-	-	-	-	-
42	1.0	G	401S	C2164S	-	-	-	-	-	-	-
42	1.0	G	401T	C2164T	-	-	-	-	-	-	-
43	1.0	BY	419L	C0867L	-	-	-	-	-	-	-
43	1.0	BY	419R	C0867R	-	-	-	-	-	-	-
44	1.0	BG	419L	C0867L	-	-	-	-	-	-	-
44	1.0	BG	419R	C0867R	-	-	-	-	-	-	-
45	1.0	BW	419L	C2030L	-	-	-	-	-	-	-
45	1.0	BW	419R	C2030R	-	-	-	-	-	-	-
46	1.0	BU	419L	C2030L	-	-	-	-	-	-	-
46	1.0	BU	419R	C2030R	-	-	-	-	-	-	-
47	1.0	BP	419L	C0867L	-	-	-	-	-	-	-
47	1.0	BP	419R	C0867R	-	-	-	-	-	-	-
48	1.0	BO	419L	C0867L	-	-	-	-	-	-	-
48	1.0	BO	419R	C0867R	-	-	-	-	-	-	-

Click here to print


Connector: C0377T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to chassis harness

Location: Beneath rear of vehicle LH side

Qualifier:

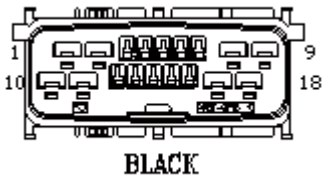

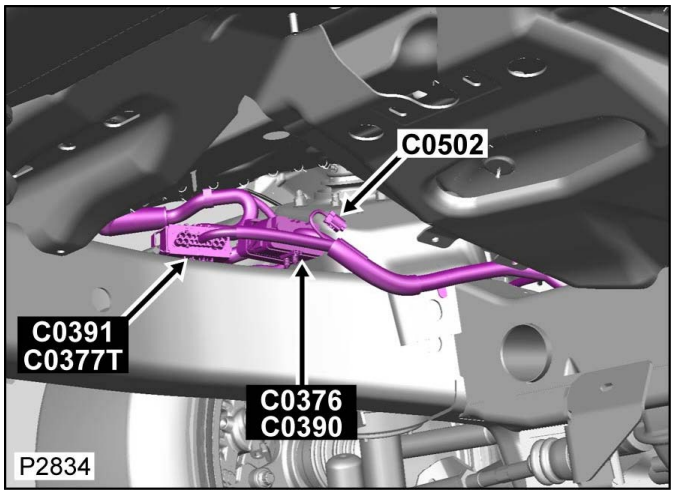

Part No.: YPC909660

Colour: BLACK

Cavities: 18WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	RW	245T	C3087T	-	-	-	-	-	-	-
2	0.75	WR	245T	C3087T	-	-	-	-	-	-	-
3	0.75	RW	245T	C3087T	-	-	-	-	-	-	-
4	0.75	WR	245T	C3087T	-	-	-	-	-	-	-
5	0.75	RW	245T	C3087T	-	-	-	-	-	-	-
6	0.75	WR	245T	C3087T	-	-	-	-	-	-	-
7	0.35	BU	245T	S/JOINT SJ248T	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.35	BR	245T	C3087T	-	-	-	-	-	-	-
10	0.35	BY	245T	S/JOINT SJ249T	-	-	-	-	-	-	-
11	0.35	BU	245T	S/JOINT SJ248T	-	-	-	-	-	-	-
12	0.35	BR	245T	C3087T	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
13	0.35	BY	245T	S/JOINT SJ249T	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
14	0.35	BU	245T	S/JOINT SJ248T	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
15	0.35	BR	245T	C3087T	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
16	0.35	BY	245T	S/JOINT SJ249T	418-411-08	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C0381

CONNECTOR HOUSING NOT SERVICEABLE

Description: Heated rear window (HRW)

Location: LH side of taildoor

Qualifier:

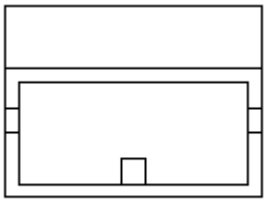


BLACK

Part No.: AAU1010

Colour: BLACK

Cavities: 1WY

Harness: TAILGATE HARNESS

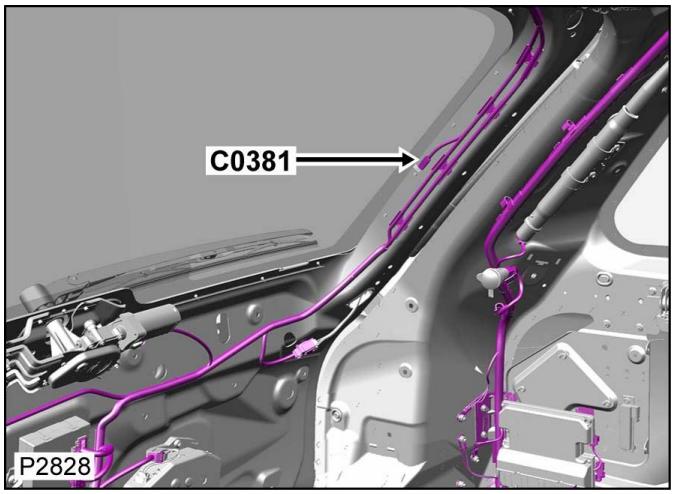

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	NP	499	C0384

Click here to print


Connector: C0382

CONNECTOR HOUSING NOT SERVICEABLE

Description: Heated rear window (HRW)

Location: RH side of tail door

Qualifier:

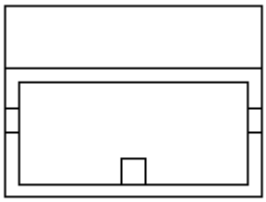


BLACK

Part No.: AAU1010

Colour: BLACK

Cavities: 1WY

Harness: TAILGATE HARNESS

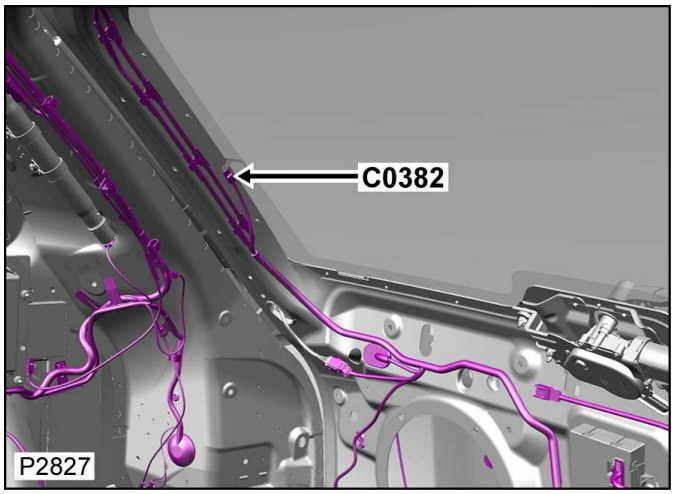


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	499	C0384

Click here to print

Connector: **C0384**

CONNECTOR HOUSING NOT SERVICEABLE

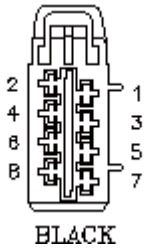

Part No.: YPC901240

Colour: BLACK


Cavities: 8WY

Harness: TAILGATE HARNESS

Description: Tailgate harness to main harness

Location: Rear of headlining

Qualifier:

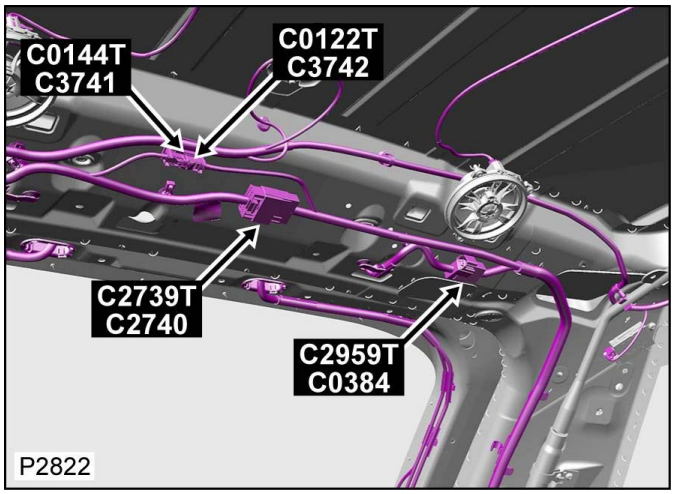

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	4.0	B	499	C0382	418-100	-	418-116A	418-117	-	418-114	418-109
2	4.0	NP	499	C0381	418-100	-	418-116A	418-117	-	418-114	418-109
3	2.5	B	499	C3733	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
4	1.5	GW	499	C1352	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
5	1.5	G	499	C1352	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
7	2.5	B	499	S/JOINT SJ628	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
8	0.5	B	499	C0615	418-411-46	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0388

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC913140

Colour: LIGHT GREY


Cavities: 3WY

Harness: TAILGATE HARNESS

Description: Motor-Wiper-Rear screen

Location: Center of taildoor, behind trim panel

Qualifier:

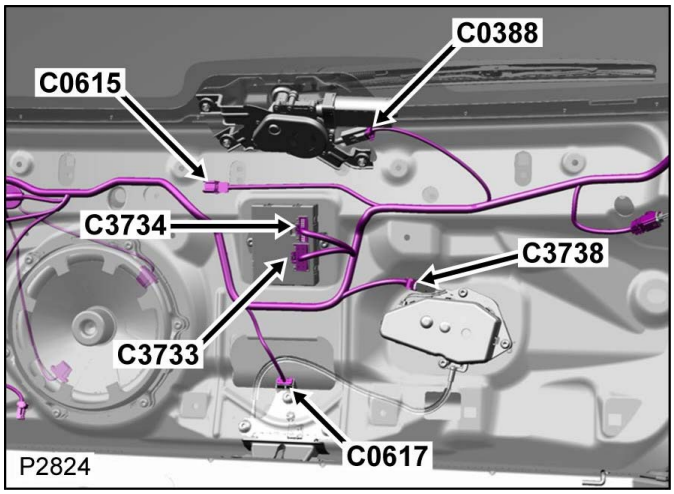

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	NG	499	C2740	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
2	1.5	B	499	C2740	-	-	-	-	-	-	-
3	1.5	GLG	499	C2740	-	-	-	-	-	-	-

Click here to print


Connector: C0390


CONNECTOR HOUSING NOT SERVICEABLE

Description: Chassis harness to main harness

Location: Beneath rear of vehicle LH side

Qualifier:

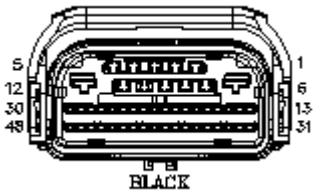

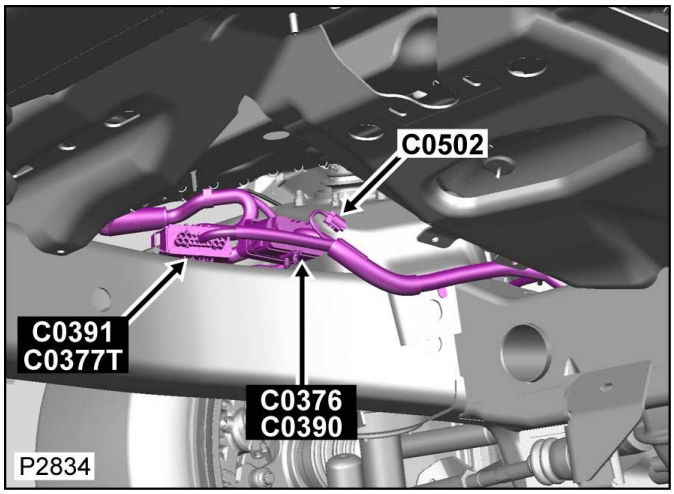

Part No.: YPC803010

Colour: BLACK

Cavities: 48WY

Harness: CHASSIS HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	B	499T	C0114T
1	0.75	B	499S	C0114S
2	0.5	WU	99T	C0114T
2	0.5	WU	99S	C0114S
3	0.5	WR	99T	C0114T
3	0.5	WR	99S	C0114S
6	4.0	WP	499T	S/JOINT SJ1
6	4.0	WP	499S	S/JOINT SJ3
9	2.5	R	401	C2168
10	2.5	U	401	C2168
12	4.0	B	499T	S/JOINT SJ2
12	4.0	B	499S	S/JOINT SJ4
13	0.5	YG	395	C2178
14	0.5	YU	395	C2178
15	0.5	R	395	C2178
16	0.5	Y	395	C2178
17	0.5	R	395	C2178
18	0.5	BK	99T	C0114T
18	0.5	BK	99S	C0114S
19	0.5	G	395	C2178
20	0.5	U	401	C2168
20	0.5	RS	448	C0390
21	0.5	W	401	C2168
21	0.5	RU	448	C0390
22	0.5	G	401	C2168
22	0.5	RY	448	C0390
23	0.5	N	401	C2168
23	0.5	RG	448	C0390
24	0.5	S	401	C2168
24	0.5	RW	448	C0390
25	0.5	O	401	C2168
25	0.5	RW	448	C0390

26	0.5	R	401	C0269
26	0.5	RG	448	C0390
27	0.5	Y	401	C0269
27	0.5	RY	448	C0390
28	1.5	B	395	C2178
29	1.5	B	395	C2178
30	0.5	R	131	C0968
31	0.5	YN	395	C2178
32	0.5	YB	395	C2178
33	0.5	OY	826	C1699
33	0.5	OY	245	C3422
34	0.5	OR	826	C1699
34	0.5	OR	245	C3422
35	0.5	OB	826	C1699
35	0.5	OB	245	C3422
36	0.5	SY	826	C1698
36	0.5	SY	245	C3423
37	0.5	SU	826	C1698
37	0.5	SU	245	C3423
38	0.5	SR	826	C1698
38	0.5	SR	245	C3423
39	0.5	BO	419	C0781
40	0.5	BN	419	C0781
41	1.0	R	401	C2168
41	0.5	RU	448	C0390
42	1.0	G	401	C2168
42	0.5	RS	448	C0390
43	1.0	BY	419	C2101
44	1.0	BG	419	C2101
45	1.0	BW	419	C2101
46	1.0	BU	419	C2101
47	1.0	BP	419	C2101
48	1.0	BO	419	C2101

Click here to print


Connector: C0391

CONNECTOR HOUSING NOT SERVICEABLE

Description: Chassis harness to main harness

Location: Beneath rear of vehicle LH side

Qualifier:

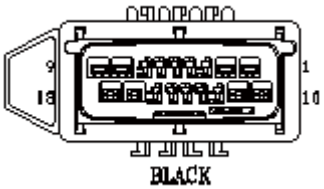


Part No.: YPC909600

Colour: BLACK

Cavities: 18WY

Harness: CHASSIS HARNESS

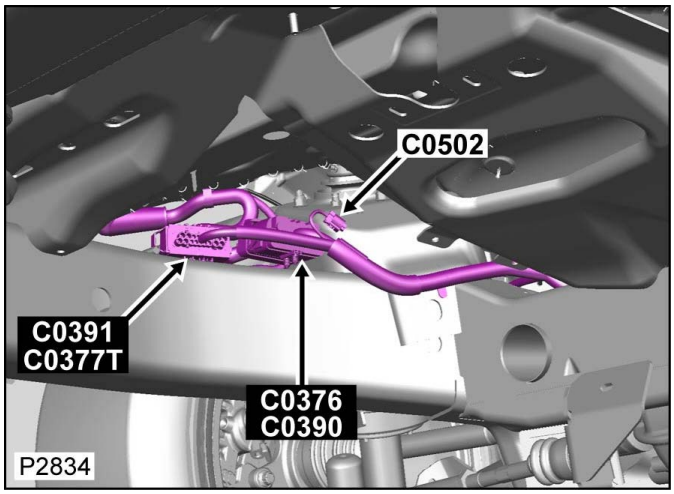

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	RW	245	C3078	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	WR	245	C3078	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	RW	245	C3080	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	WR	245	C3080	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	RW	245	C3081	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.35	WR	245	C3081	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	BU	245	C3422	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	BR	245	C3422	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	BY	245	C3422	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	BU	245	C3423	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	BR	245	C3423	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
13	0.5	BY	245	C3423	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	BU	245	C3095	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
15	0.5	BR	245	C3095	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
16	0.5	BY	245	C3095	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0396


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to door harness

Location: LH 'A' post

Qualifier:



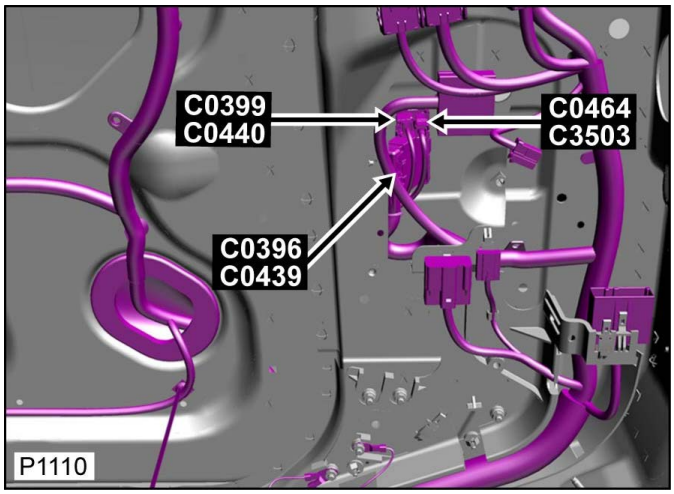

Part No.: YPC803280

Colour: GREY

Cavities: 24WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	R	139L	C0585L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
1	2.5	YR	200R	C0585R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	0.5	B	139L	C0556L	-	-	-	-	-	-	-
2	0.35	W	200R	C0586R	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.35	BN	139L	C0586L	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.35	PN	499	C0435	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	RN	827	S/JOINT SJ52	-	-	-	-	-	-	-
6	0.35	GW	410S	C2428S	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.35	GW	410T	C2428T	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.5	KR	41	S/JOINT SJ871	-	-	-	-	-	-	-
8	1.5	G	125SL	C0047L	-	-	-	-	-	-	-
8	1.5	NU	478S	C0492S	-	-	-	-	-	-	-
8	1.5	G	125SR	C0047R	-	-	-	-	-	-	-
8	1.5	NU	478T	C0492T	-	-	-	-	-	-	-
9	1.5	GW	125SL	C0047L	-	-	-	-	-	-	-
9	1.5	SU	478S	C0492S	-	-	-	-	-	-	-
9	1.5	GW	125SR	C0047R	-	-	-	-	-	-	-
9	1.5	SU	478T	C0492T	-	-	-	-	-	-	-
10	1.5	N	410S	C2429S	-	-	-	-	-	-	-
10	1.5	N	410T	C2429T	-	-	-	-	-	-	-
11	1.5	GO	478S	C0491S	-	-	-	-	-	-	-
11	1.5	GO	478T	C0491T	-	-	-	-	-	-	-
12	1.5	SO	478S	C0491S	-	-	-	-	-	-	-
12	1.5	SO	478T	C0491T	-	-	-	-	-	-	-
											418-

13	4.0	B	499	C1536	418-100	-	418-116A	418-117	-	418-114	109
14	0.35	RU	410S	C2428S	418-411-45	-	418-116A	418-117	-	418-112	418-107
14	0.35	RU	410T	C2428T	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.35	RG	410S	C2428S	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.35	RG	410T	C2428T	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.35	GB	410S	C2160S	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.35	GB	410T	C2160T	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.35	GR	410S	C2160S	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.35	GR	410T	C2160T	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.35	SP	207L	C2378	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.35	YW	499	S/JOINT SJ2010	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.35	YU	499	S/JOINT SJ2011	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	1.5	W	478S	C0491S	-	-	-	-	-	-	-
21	1.5	W	478T	C0491T	-	-	-	-	-	-	-
22	1.5	WN	478S	C0491S	-	-	-	-	-	-	-
22	1.5	WN	478T	C0491T	-	-	-	-	-	-	-
23	1.5	NP	410S	C2429S	-	-	-	-	-	-	-
23	1.5	NP	410T	C2429T	-	-	-	-	-	-	-
24	0.35	R	410	S/JOINT SJ21	418-411-46	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0397

CONNECTOR HOUSING NOT SERVICEABLE

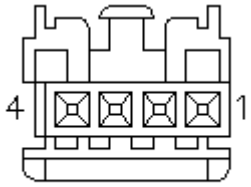

BLACK

Part No.: YPC902310

Colour: BLACK


Cavities: 4WY

Harness: CABIN HARNESS

Description: Main harness to door harness

Location: RH 'A' post

Qualifier:

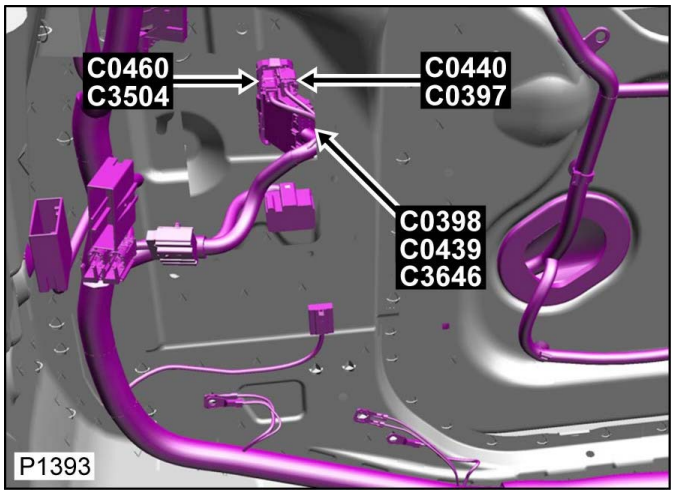

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WLG	216	C0256	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	NLG	216	C0256	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	YK	41	S/JOINT SJ870	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	GK	139L	S/JOINT SJ14	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	GK	200R	S/JOINT SJ14	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0398


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to door harness

Location: RH 'A' post

Qualifier:



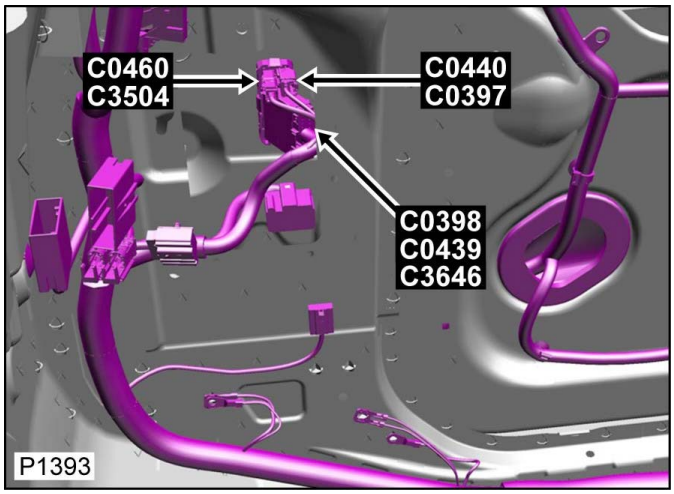

Part No.: YPC803280

Colour: GREY

Cavities: 24WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	YR	139L	C0585L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
1	2.5	R	200R	C0585R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	0.35	W	139L	C0586L	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	B	200R	C0558R	-	-	-	-	-	-	-
3	0.35	BN	200R	C0586R	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.35	PN	499	C0436	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	RN	827	S/JOINT SJ52	-	-	-	-	-	-	-
6	0.35	SN	410S	C2428S	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.35	SN	410T	C2428T	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.5	KR	41	S/JOINT SJ871	-	-	-	-	-	-	-
8	1.5	G	125S	C0467	-	-	-	-	-	-	-
8	1.5	PS	478S	C0492S	-	-	-	-	-	-	-
8	1.5	PS	478T	C0492T	-	-	-	-	-	-	-
9	1.5	GW	125S	C0467	-	-	-	-	-	-	-
9	1.5	YS	478S	C0492S	-	-	-	-	-	-	-
9	1.5	YS	478T	C0492T	-	-	-	-	-	-	-
10	1.5	SN	410S	C2429S	-	-	-	-	-	-	-
10	1.5	SN	410T	C2429T	-	-	-	-	-	-	-
11	1.5	PO	478S	C0491S	-	-	-	-	-	-	-
11	1.5	PO	478T	C0491T	-	-	-	-	-	-	-
12	1.5	YO	478S	C0491S	-	-	-	-	-	-	-
12	1.5	YO	478T	C0491T	-	-	-	-	-	-	-
13	4.0	B	499	C1413	418-100	-	418-116A	418-117	-	418-114	418-109
14	0.35	RU	410S	C2428S	418-411-45	-	418-116A	418-117	-	418-112	418-

											107
14	0.35	RU	410T	C2428T	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.35	OY	410S	C2428S	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.35	OY	410T	C2428T	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.35	PN	410S	C2160S	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.35	PN	410T	C2160T	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.35	PO	410S	C2160S	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.35	PO	410T	C2160T	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.35	SP	207R	C2368	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.35	YW	499	S/JOINT SJ2000	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.35	YU	499	S/JOINT SJ2001	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	1.5	WP	478S	C0491S	-	-	-	-	-	-	-
21	1.5	WP	478T	C0491T	-	-	-	-	-	-	-
22	1.5	WO	478S	C0491S	-	-	-	-	-	-	-
22	1.5	WO	478T	C0491T	-	-	-	-	-	-	-
23	1.5	WP	410S	C2429S	-	-	-	-	-	-	-
23	1.5	WP	410T	C2429T	-	-	-	-	-	-	-
24	0.35	R	410	S/JOINT SJ21	418-411-46	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0399

CONNECTOR HOUSING NOT SERVICEABLE

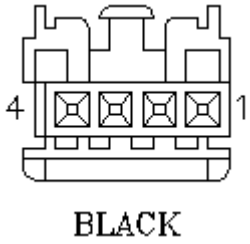

BLACK

Part No.: YPC902310

Colour: BLACK


Cavities: 4WY

Harness: CABIN HARNESS

Description: Main harness to door harness

Location: LH 'A' post

Qualifier:

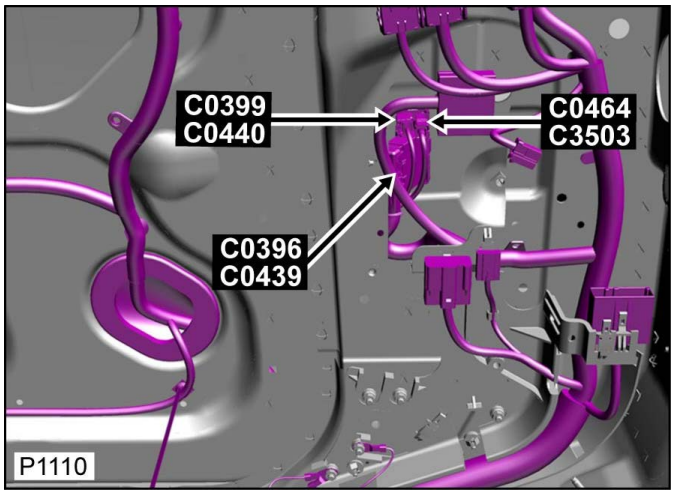

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WLG	216	C0256	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	NLG	216	C0256	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	YK	41	S/JOINT SJ870	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	GK	139L	S/JOINT SJ14	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	GK	200R	S/JOINT SJ14	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0400


CONNECTOR HOUSING NOT SERVICEABLE

Description: Sensor-Parking aid-Inner-Front-LH

Location: Behind LH side of front bumper

Qualifier:

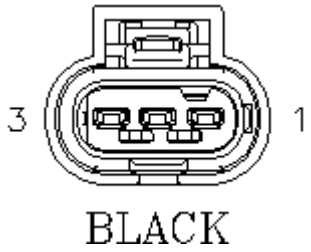

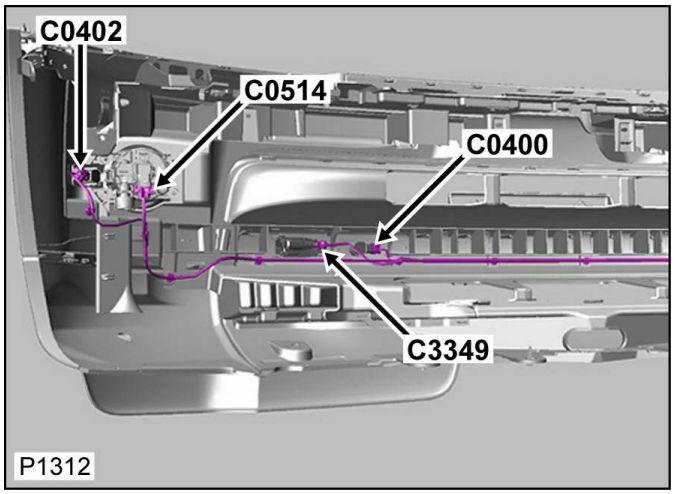

Part No.: YPC908700

Colour: BLACK

Cavities: 3WY

Harness: FRONT BUMPER HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	N	309	S/JOINT SJ402
2	0.35	YS	309	C2278
3	0.35	B	309	S/JOINT SJ403

Click here to print

Connector: C0401

CONNECTOR HOUSING NOT SERVICEABLE

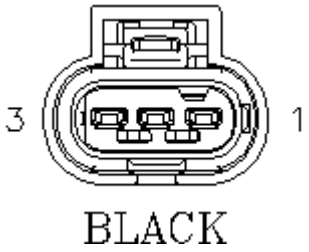

Part No.: YPC908700

Colour: BLACK


Cavities: 3WY

Harness: FRONT BUMPER HARNESS

Description: Sensor-Parking aid-Inner-Front-RH

Location: Behind RH side of front bumper

Qualifier:

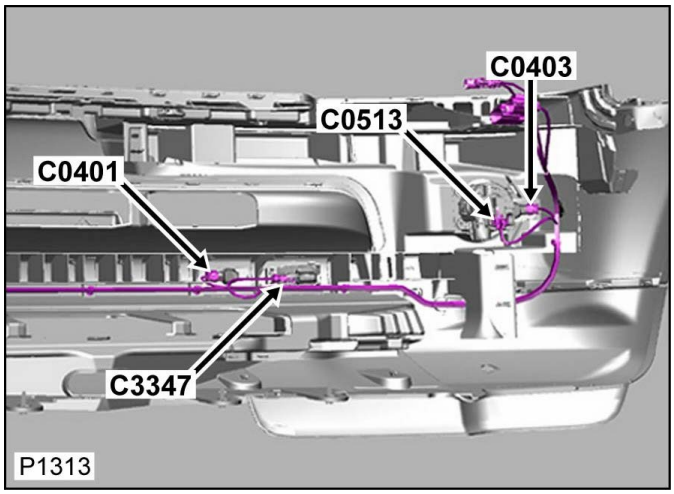


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	N	309	S/JOINT SJ402
2	0.35	YB	309	C2278
3	0.35	B	309	S/JOINT SJ403

Click here to print

Connector: **C0402**

CONNECTOR HOUSING NOT SERVICEABLE

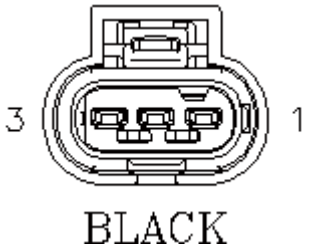

Part No.: YPC908700

Colour: BLACK


Cavities: 3WY

Harness: FRONT BUMPER HARNESS

Description: Sensor-Parking aid-Outer-Front-LH

Location: Behind LH side of front bumper

Qualifier:

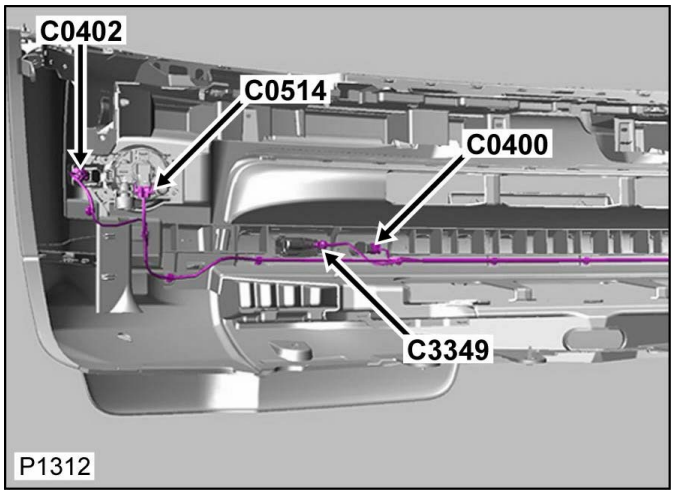


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	N	309	S/JOINT SJ402
2	0.35	YO	309	C2278
3	0.35	B	309	S/JOINT SJ403

Click here to print

Connector: C0403

CONNECTOR HOUSING NOT SERVICEABLE

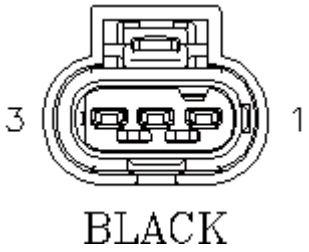

Part No.: YPC908700

Colour: BLACK


Cavities: 3WY

Harness: FRONT BUMPER HARNESS

Description: Sensor-Parking aid-Outer-Front-RH

Location: Behind RH side of front bumper

Qualifier:

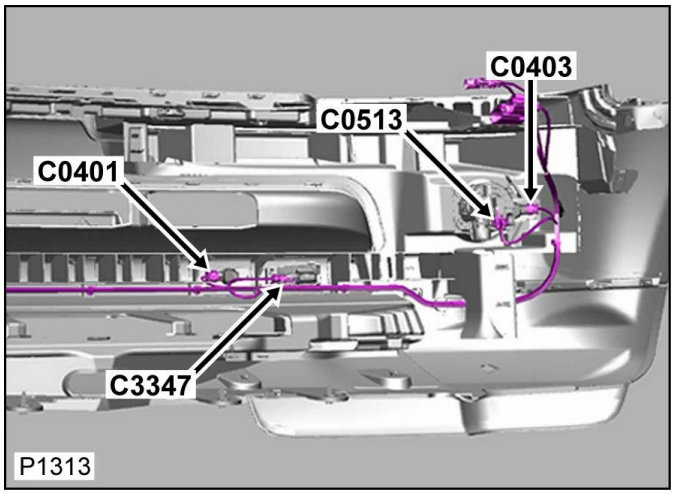

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	N	309	S/JOINT SJ402
2	0.35	YG	309	C2278
3	0.35	B	309	S/JOINT SJ403

Click here to print

Connector: C0406


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Air bag-Driver

Location: Behind driver air bag module

Qualifier:

ASSEMBLY

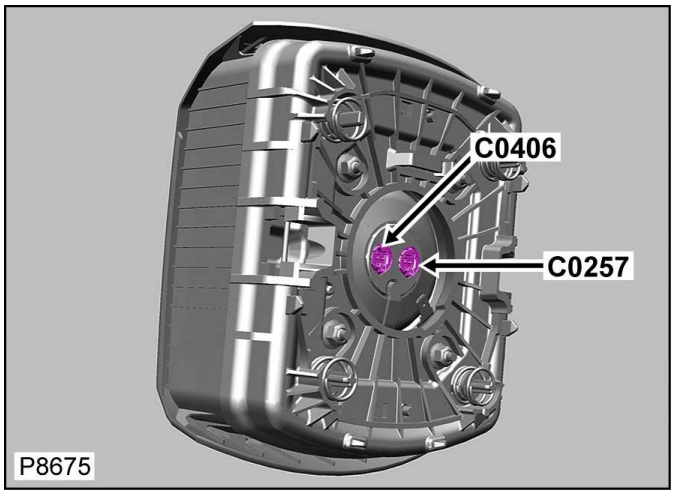

Part No.: CASSY

Colour: NO COLOUR

Cavities: 1WY

Harness: STEERING WHEEL HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	W	499	C1948
2	0.5	U	499	C1948

Click here to print

Connector: C0412

CONNECTOR HOUSING NOT SERVICEABLE

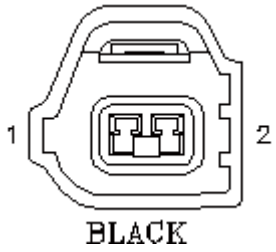

Part No.: YPC108190

Colour: BLACK


Cavities: 2WY

Harness: ATC TEMP SENSOR LINK HARNESS

Description: Sensor-Ambient air-temperature

Location: Behind center of bumper

Qualifier:

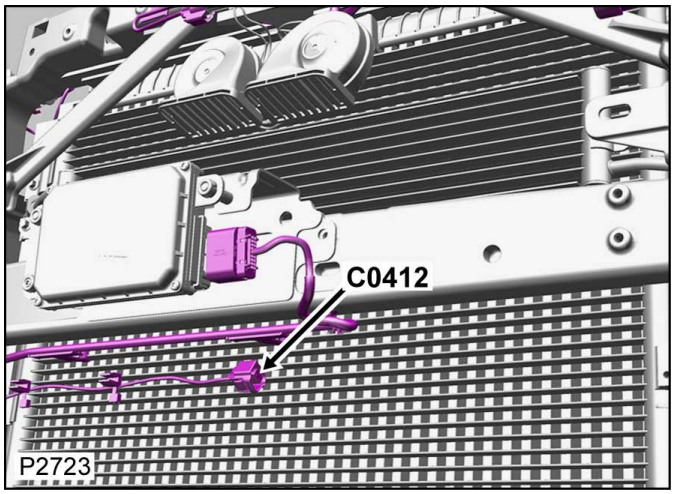


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	YG	713	C3127
2	0.5	BN	713	C3127

Click here to print

Connector: **C0417**

CONNECTOR HOUSING NOT SERVICEABLE

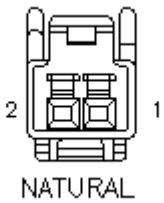

Part No.: YPC909960

Colour: NATURAL


Cavities: 2WY

Harness: ATC RHD HARNESS

Description: Sensor-Temperature-Evaporator

Location: Climate control assembly-Driver side

Qualifier:

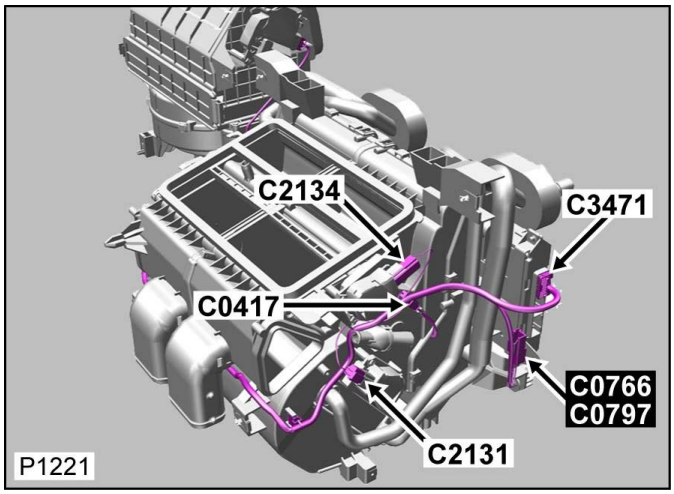

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	NB	499	C3471
2	0.5	P	499	S/JOINT SJ3

Click here to print


Connector: C0419


CONNECTOR HOUSING NOT SERVICEABLE

Description: Intake air door motor

Location: Climate control assembly-Passenger side

Qualifier:

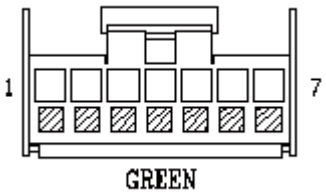

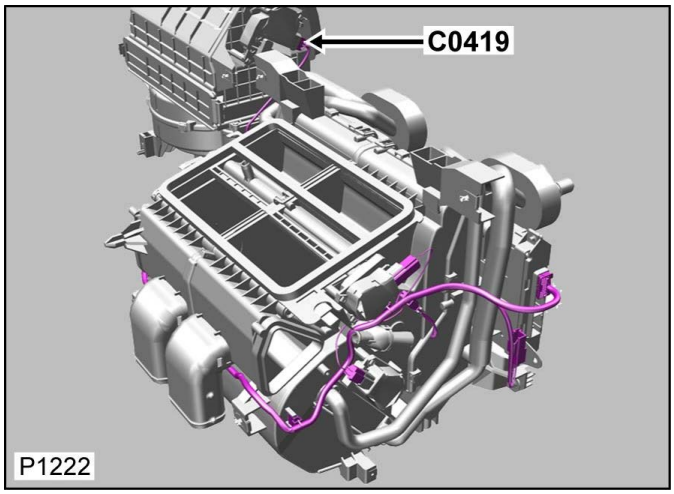

Part No.: YPC106450

Colour: GREEN

Cavities: 7WY

Harness: ATC RHD HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	N	499	C3471	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	P	499	S/JOINT SJ3	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	YB	499	C3471	418-587-02	-	418-116A	418-117	-	418-112	418-107
6	0.5	GB	499	C3471	418-587-02	-	418-116A	418-117	-	418-112	418-107
7	0.5	RW	499	C3471	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0435


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to rear door harness

Location: In LH 'B' post

Qualifier:

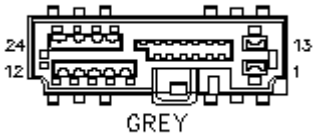

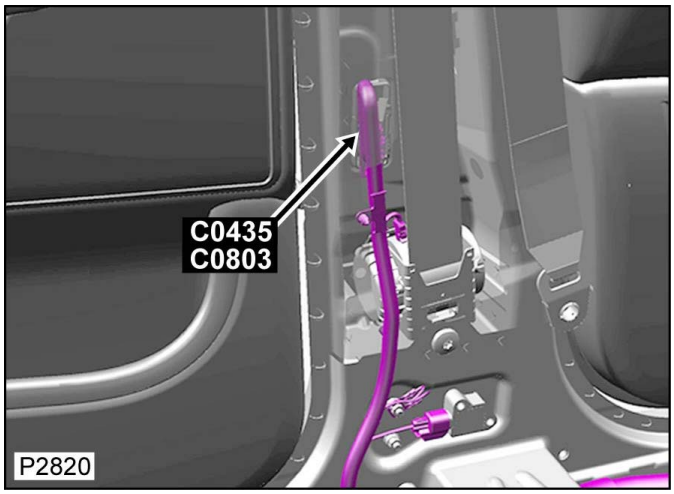

Part No.: YPC803280

Colour: GREY

Cavities: 24WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	UR	139L	C0585L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
1	2.5	UR	200R	C0585R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
4	0.35	PN	499	C0396	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	1.5	WG	478S	C0491S	-	-	-	-	-	-	-
8	1.5	G	125SL	C0047L	-	-	-	-	-	-	-
8	1.5	G	125SR	C0047R	-	-	-	-	-	-	-
8	1.5	WG	478T	C0491T	-	-	-	-	-	-	-
9	1.5	GW	125SL	C0047L	-	-	-	-	-	-	-
9	1.5	NY	478S	C0491S	-	-	-	-	-	-	-
9	1.5	GW	125SR	C0047R	-	-	-	-	-	-	-
9	1.5	NY	478T	C0491T	-	-	-	-	-	-	-
10	1.5	GN	478S	C0491S	-	-	-	-	-	-	-
10	1.5	GN	478T	C0491T	-	-	-	-	-	-	-
11	1.5	SN	478S	C0491S	-	-	-	-	-	-	-
11	1.5	SN	478T	C0491T	-	-	-	-	-	-	-
12	0.35	PLG	139L	C0586L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
12	0.35	PLG	200R	C0586R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
13	2.5	B	499	C2565	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
14	0.35	RW	410S	C2428S	418-411-45	-	418-116A	418-117	-	418-112	418-107
14	0.35	RW	410T	C2428T	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.35	RW	410S	C2428S	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.35	RW	410T	C2428T	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.35	NP	410S	C2160S	418-411-45	-	418-116A	418-117	-	418-112	418-107

16	0.35	NP	410T	C2160T	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.35	NU	410S	C2160S	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.35	NU	410T	C2160T	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.75	P	134	S/JOINT SJ38	-	-	-	-	-	-	-
19	0.5	RN	827	S/JOINT SJ52	-	-	-	-	-	-	-
20	0.35	PO	410S	C2428S	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.35	PO	410T	C2428T	418-411-45	-	418-116A	418-117	-	418-112	418-107
22	1.5	YU	410S	C2429S	-	-	-	-	-	-	-
22	1.5	YU	410T	C2429T	-	-	-	-	-	-	-
23	1.5	WN	410S	C2429S	-	-	-	-	-	-	-
23	1.5	WN	410T	C2429T	-	-	-	-	-	-	-
24	0.35	R	410	S/JOINT SJ21	418-411-46	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0436


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to rear door harness

Location: In RH 'B' post

Qualifier:



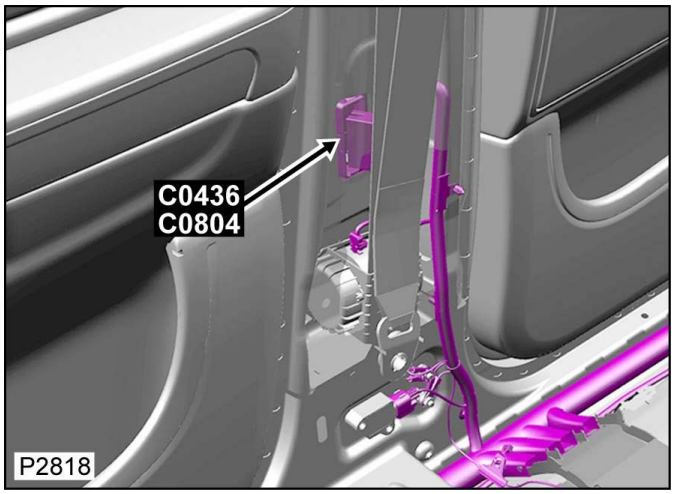

Part No.: YPC803280

Colour: GREY

Cavities: 24WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	GR	139L	C0585L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
1	2.5	GR	200R	C0585R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
4	0.35	PN	499	C0398	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	1.5	G	125S	C0467	-	-	-	-	-	-	-
8	1.5	NW	478S	C0491S	-	-	-	-	-	-	-
8	1.5	NW	478T	C0491T	-	-	-	-	-	-	-
9	1.5	GW	125S	C0467	-	-	-	-	-	-	-
9	1.5	NU	478S	C0491S	-	-	-	-	-	-	-
9	1.5	NU	478T	C0491T	-	-	-	-	-	-	-
10	1.5	UW	478S	C0491S	-	-	-	-	-	-	-
10	1.5	UW	478T	C0491T	-	-	-	-	-	-	-
11	1.5	PU	478S	C0491S	-	-	-	-	-	-	-
11	1.5	PU	478T	C0491T	-	-	-	-	-	-	-
12	0.35	PLG	139L	C0586L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
12	0.35	PLG	200R	C0586R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
13	2.5	B	499	C0809	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
14	0.35	RW	410S	C2428S	418-411-45	-	418-116A	418-117	-	418-112	418-107
14	0.35	RW	410T	C2428T	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.35	UW	410S	C2428S	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.35	UW	410T	C2428T	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.35	YS	410S	C2160S	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.35	YS	410T	C2160T	418-411-45	-	418-116A	418-117	-	418-112	418-107
											418-

17	0.35	YO	410S	C2160S	418-411-45	-	418-116A	418-117	-	418-112	107
17	0.35	YO	410T	C2160T	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.75	P	134	S/JOINT SJ38	-	-	-	-	-	-	-
19	0.5	RN	827	S/JOINT SJ52	-	-	-	-	-	-	-
20	0.35	NU	410S	C2428S	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.35	NU	410T	C2428T	418-411-45	-	418-116A	418-117	-	418-112	418-107
22	1.5	G	410S	C2429S	-	-	-	-	-	-	-
22	1.5	G	410T	C2429T	-	-	-	-	-	-	-
23	1.5	WN	410S	C2429S	-	-	-	-	-	-	-
23	1.5	WN	410T	C2429T	-	-	-	-	-	-	-
24	0.35	R	410	S/JOINT SJ21	418-411-46	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0439


CONNECTOR HOUSING NOT SERVICEABLE

Description: Door harness to main harness

Location: LH 'A' post

Qualifier:



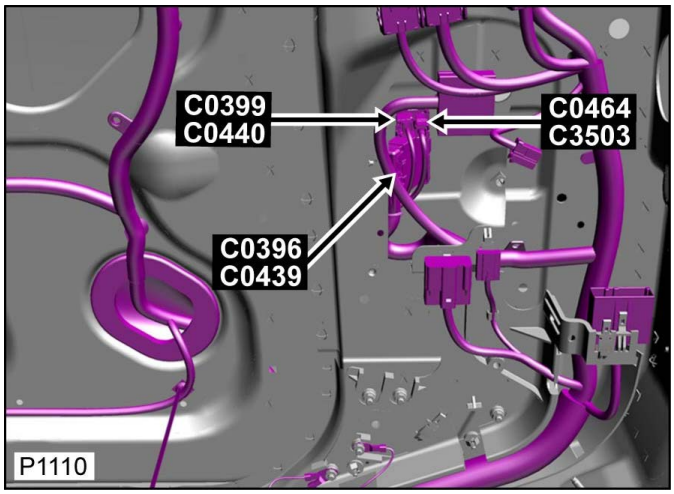

Part No.: YPC803300

Colour: GREY

Cavities: 24WY

Harness: DOORS FRONT HARNESS

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	B	672	C2017	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
1	2.5	B	675	C2272	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
2	0.5	B	672	C3560	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.5	B	675	C0441	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	672	C0441	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.5	B	787	S/JOINT SJ19	418-411-47	-	418-116A	418-117	-	418-112	418-107
5	0.5	B	827L	C3472	418-411-47	-	418-116A	418-117	-	418-112	418-107
6	0.5	B	811	C2312	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.5	B	787	C3560	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	1.5	NU	478L	C0369	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
9	1.5	SU	478L	C0369	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
10	1.5	B	811	C2312	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
11	1.5	PO	478L	C0531	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
12	1.5	YO	478L	C0531	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
13	4.0	B	787	S/JOINT SJ840	418-587-05	-	418-116A	418-117	-	418-114	418-109
14	0.35	RU	811	C2299	-	-	-	-	-	-	-
15	0.35	RG	811	C2299	-	-	-	-	-	-	-
16	0.35	G	811	C2299	-	-	-	-	-	-	-
17	0.35	W	811	C2299	-	-	-	-	-	-	-
18	0.5	B	207L	C3560	418-411-47	-	418-116A	418-117	-	418-112	418-107

19	0.35	B	672	C2058	-	-	-	-	-	-	-
19	0.5	B	675	C3508	418-411-47	-	418-116A	418-117	-	418-112	418-107
20	0.35	B	672	C2058	-	-	-	-	-	-	-
20	0.5	B	675	C3508	418-411-47	-	418-116A	418-117	-	418-112	418-107
21	1.5	W	478L	C0688	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
22	1.5	WN	478L	C0688	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
23	1.5	B	811	C2312	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
24	0.35	R	811	C2299	418-411-15	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0440

CONNECTOR HOUSING SERVICEABLE

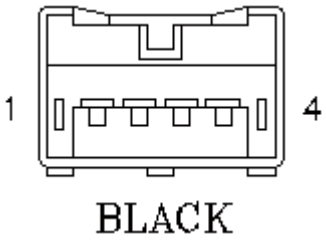

Part No.: YPC906730

Colour: BLACK


Cavities: 4WY

Harness: DOORS FRONT HARNESS

Description: Door harness to main harness

Location: LH 'A' post

Qualifier:

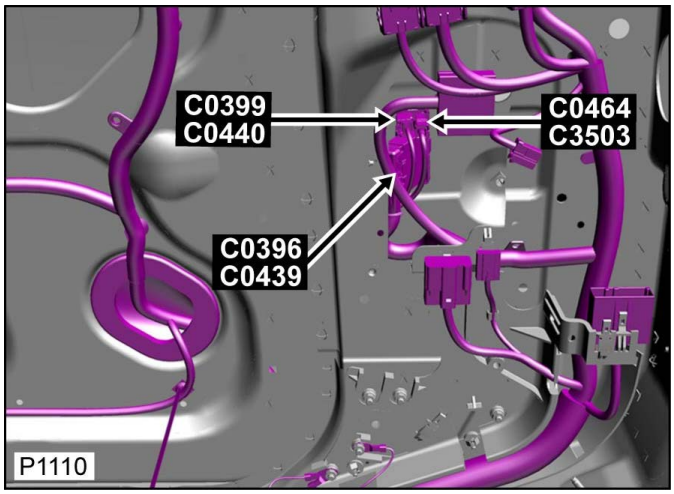

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WLG	787	C0950	418-411-47	-	418-116A	418-117	-	418-112	418-107
1	0.5	WLG	788	C0950	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.5	NLG	787	C0950	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.5	NLG	788	C0950	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	787	C3560	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	788	C3560	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.5	B	672	S/JOINT SJ2024	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.5	B	673	C3560	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.5	B	674	S/JOINT SJ2024	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.5	B	675	C3560	418-411-47	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0441


CONNECTOR HOUSING NOT SERVICEABLE

Description: Motor-Door lock-Front

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated

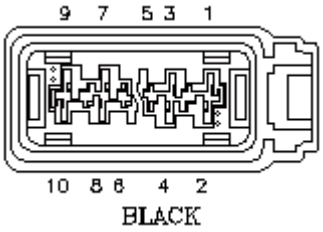

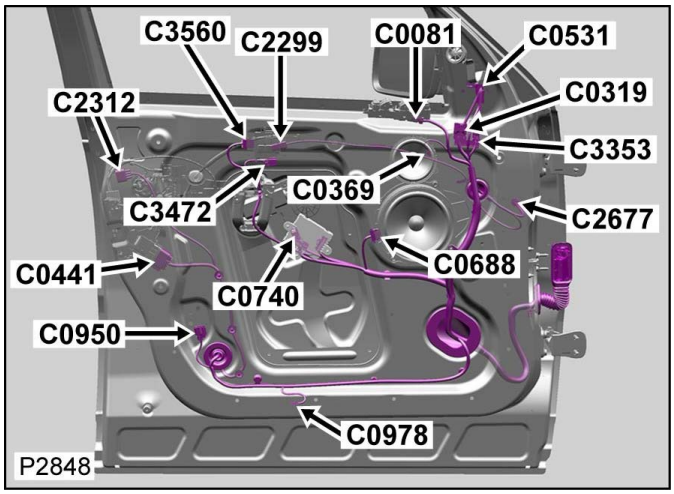

Part No.: YPC901160

Colour: BLACK

Cavities: 10WY

Harness: DOORS FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	B	672	C2017	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	B	675	C2272	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	B	673	C3646	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	B	672	C0439	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	B	675	C0439	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	B	674	C3646	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.75	B	672	C2017	-	-	-	-	-	-	-
5	0.75	B	675	C2272	-	-	-	-	-	-	-
5	0.75	B	674	C2271	-	-	-	-	-	-	-
5	0.75	B	673	C2016	-	-	-	-	-	-	-
6	0.75	B	672	C2017	-	-	-	-	-	-	-
6	0.75	B	673	C2016	-	-	-	-	-	-	-
6	0.75	B	674	C2271	-	-	-	-	-	-	-
6	0.75	B	675	C2272	-	-	-	-	-	-	-
7	0.75	B	672	C2017	-	-	-	-	-	-	-
7	0.75	B	675	C2272	-	-	-	-	-	-	-
7	0.75	B	673	C2016	-	-	-	-	-	-	-
7	0.75	B	674	C2271	-	-	-	-	-	-	-
8	0.35	B	673	C2016	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	B	674	C2271	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	B	672	C2058	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	B	673	C2057	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	B	674	C3507	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

9	0.5	B	675	C3508	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	B	672	C2017	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	B	673	C2016	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	B	674	C2271	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	B	675	C2272	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C0442


CONNECTOR HOUSING NOT SERVICEABLE

Description: Motor-Door-lock-Rear

Location: Behind rear door trim panel

Qualifier: LH side illustrated RH side similar

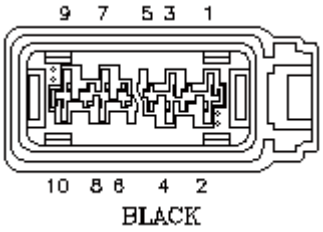

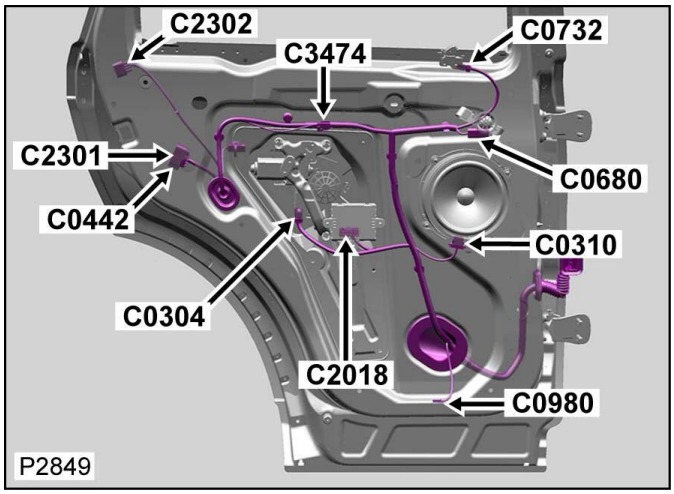

Part No.: YPC901160

Colour: BLACK

Cavities: 10WY

Harness: REAR DOOR HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	B	277	C2018	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	B	277	C0803	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	B	278	C0804	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.75	B	278	C2018	-	-	-	-	-	-	-
5	0.75	B	277	C2018	-	-	-	-	-	-	-
6	0.75	B	499	C2018	-	-	-	-	-	-	-
7	0.75	B	277	C2018	-	-	-	-	-	-	-
7	0.75	B	278	C2018	-	-	-	-	-	-	-
8	0.35	B	278	C2018	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C0460


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to door harness

Location: RH 'A' post

Qualifier:

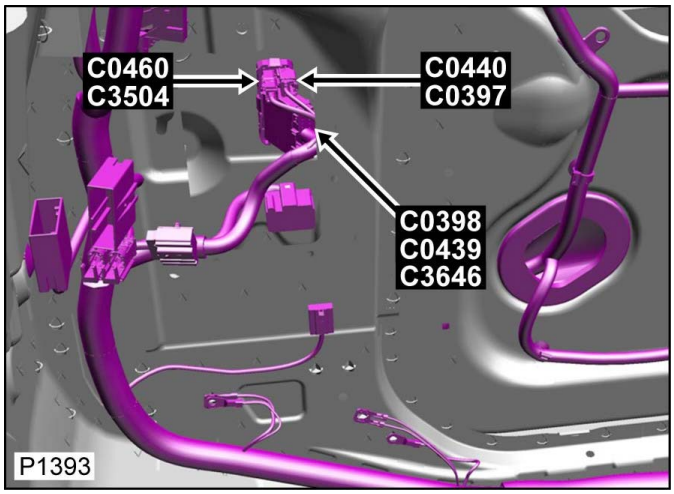

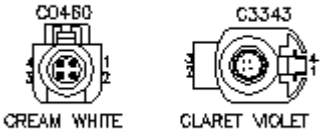

Part No.: XUD815690

Colour: NO COLOUR

Cavities: 4WY

Harness: CABIN HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784	C3343
2	0.5	O	784	C3343
3	0.5	G	784	C3343
4	0.5	N	784	C3343

Click here to print

Connector: C0464


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to door harness

Location: LH 'A' post

Qualifier:

No connector face
Geen connector-vooraanzicht
Pas de face de connecteur
Kein diagramm
Senza faccia connettore
Sem imagen dos pinos da ficha
No hay cara de conector

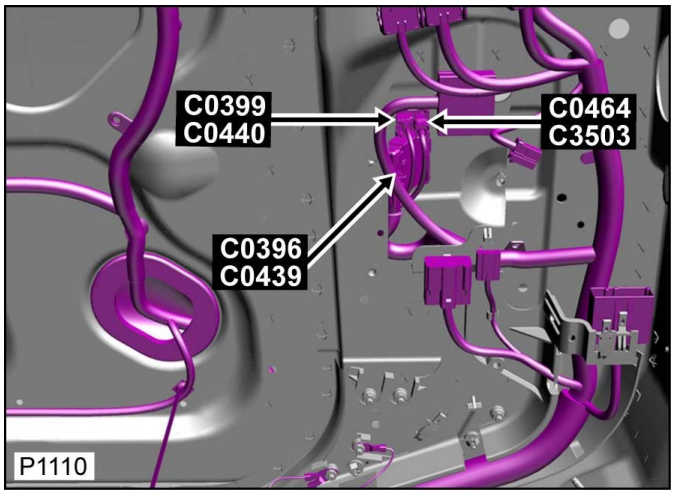

Part No.: XUD815700

Colour: NO COLOUR

Cavities: 4WY

Harness: CABIN HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784	C3344
2	0.5	O	784	C3344
3	0.5	G	784	C3344
4	0.5	N	784	C3344

Click here to print

Connector: C0467


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to instrument panel harness

Location: RH 'A' post

Qualifier:



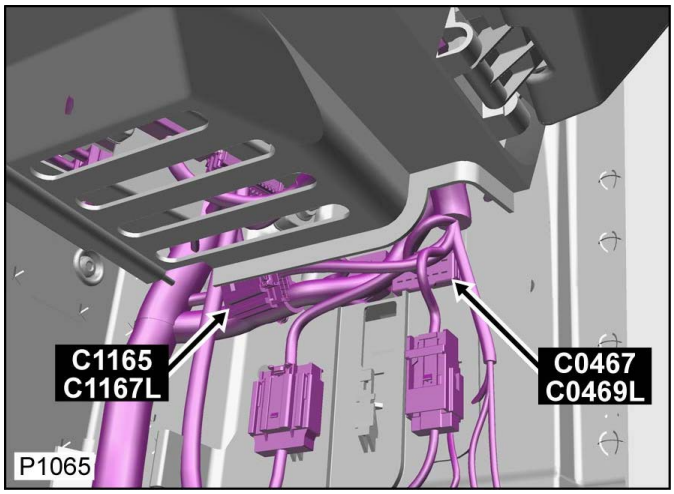

Part No.: YPC911790

Colour: LIGHT GREY

Cavities: 12WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	KR	41L	S/JOINT SJ871	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	YK	41L	S/JOINT SJ870	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
2	1.5	RB	13SR	C0868S	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
3	2.5	R	410S	C2429S	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
3	2.5	R	410T	C2429T	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
4	0.5	RN	139L	S/JOINT SJ52	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
5	0.75	OG	21S	S/JOINT SJ397S	-	-	-	-	-	-	-
5	1.5	LGW	982T	C0868TA	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
5	1.5	LGW	986TL	C0868TL	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
5	1.5	LGW	986TR	C0868TR	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
6	1.5	BP	41S	C3007	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
7	0.75	LGW	134L	C0084	-	-	-	-	-	-	-
8	0.5	R	982T	C2053TA	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	R	986TL	C2053TL	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	R	986TR	C2053TR	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
9	1.5	G	125S	C0398	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
10	1.5	GW	125S	C0398	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
10	0.75	YR	478S	C2415S	-	-	-	-	-	-	-
10	0.75	YR	478T	C2415T	-	-	-	-	-	-	-
											418-

11	1.5	G	125S	C0436	418-411-16	-	418-116A	418-117	418-104	418-113	108
11	1.5	G	420S	C0492S	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
11	1.5	G	420T	C0492T	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
12	1.5	GW	125S	C0436	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
12	1.5	SP	420S	C0492S	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
12	1.5	SP	420T	C0492T	418-411-16	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C0469L

CONNECTOR HOUSING NOT SERVICEABLE

Description: Instrument panel harness to main harness

Location: RH 'A' post

Qualifier:

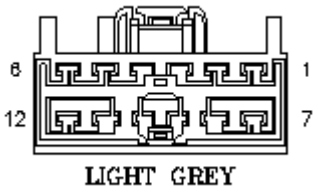


Part No.: YPC500580

Colour: LIGHT GREY

Cavities: 12WY

Harness: FACIA COMPOSITE HARNESS

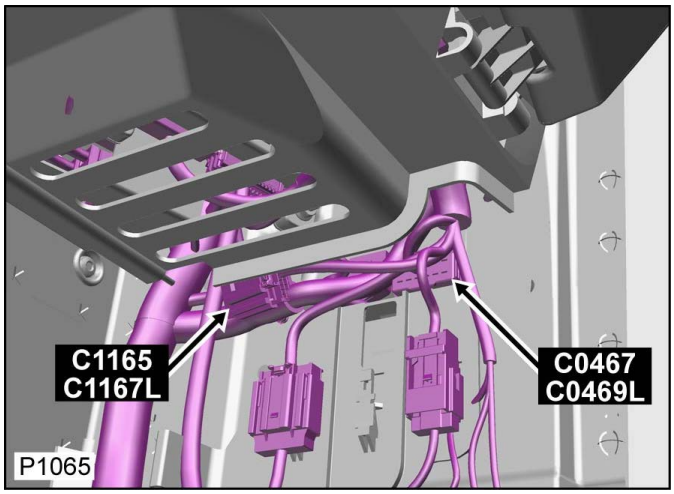

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	KR	41L	C0581	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	YK	41L	C0581	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
3	2.5	R	139L	C0582	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
4	0.5	RN	139L	S/JOINT SJ117	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
5	1.5	LGW	43TL	C0582	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
5	0.75	OG	21L	C3470	418-587-10	-	418-116A	418-117	-	418-112	418-107
6	1.5	BP	41L	C0582	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
7	0.75	LGW	134L	S/JOINT SJ14	418-587-10	-	418-116A	418-117	-	418-112	418-107
8	0.5	R	139TL	C0580	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
9	0.75	G	125L	C3481	418-587-10	-	418-116A	418-117	-	418-112	418-107
10	0.75	GW	125L	C3481	418-587-10	-	418-116A	418-117	-	418-112	418-107
10	0.75	YR	124L	C0582	418-587-10	-	418-116A	418-117	-	418-112	418-107
11	1.5	G	124L	C0369L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
11	0.75	G	125L	C3481	418-587-10	-	418-116A	418-117	-	418-112	418-107
12	1.5	GW	124L	C0369L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
12	0.75	GW	125L	C3481	418-587-10	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0469R

CONNECTOR HOUSING NOT SERVICEABLE

Description: Instrument panel harness to main harness

Location: Base of RH 'A' post

Qualifier: RHD condition illustrated

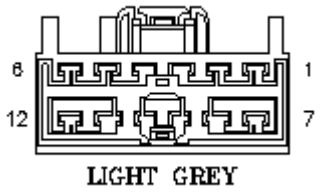


Part No.: YPC500580

Colour: LIGHT GREY

Cavities: 12WY

Harness: FACIA COMPOSITE HARNESS

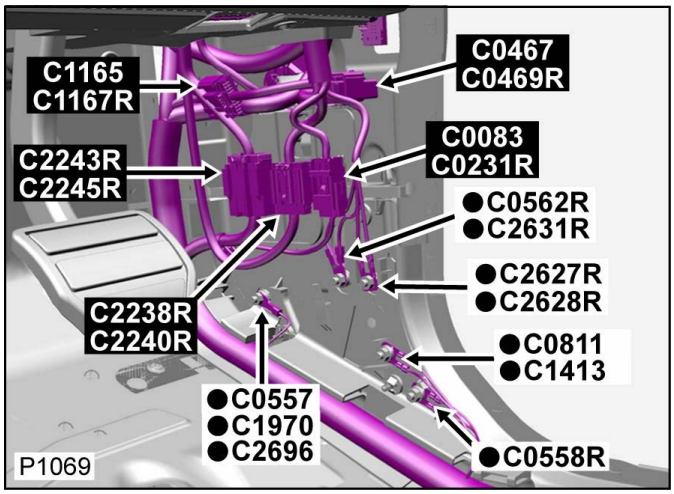


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	1.5	RB	13SR	C0582	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
3	2.5	R	200R	C0582	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
5	1.5	LGW	43TR	C0582	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
5	0.75	OG	21R	C3470	418-587-10	-	418-116A	418-117	-	418-112	418-107
6	1.5	BP	41R	C0582	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
8	0.5	R	200TR	C0580	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
9	0.75	G	125R	C3481	418-587-10	-	418-116A	418-117	-	418-112	418-107
10	0.75	GW	125R	C3481	418-587-10	-	418-116A	418-117	-	418-112	418-107
10	0.75	YR	124R	C0582	418-587-10	-	418-116A	418-117	-	418-112	418-107
11	1.5	G	124R	C0369R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
11	0.75	G	125R	C3481	418-587-10	-	418-116A	418-117	-	418-112	418-107
12	1.5	GW	124R	C0369R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
12	0.75	GW	125R	C3481	418-587-10	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0476

CONNECTOR HOUSING NOT SERVICEABLE

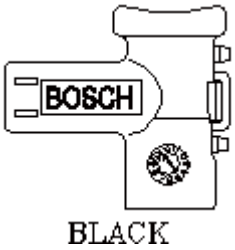

BLACK

Part No.: YPC910510

Colour: BLACK


Cavities: 1WY

Harness: GLOWPLUG LINK V6 RHS HARNESS

Description: Glow plug

Location: Top of engine - RH side

Qualifier:

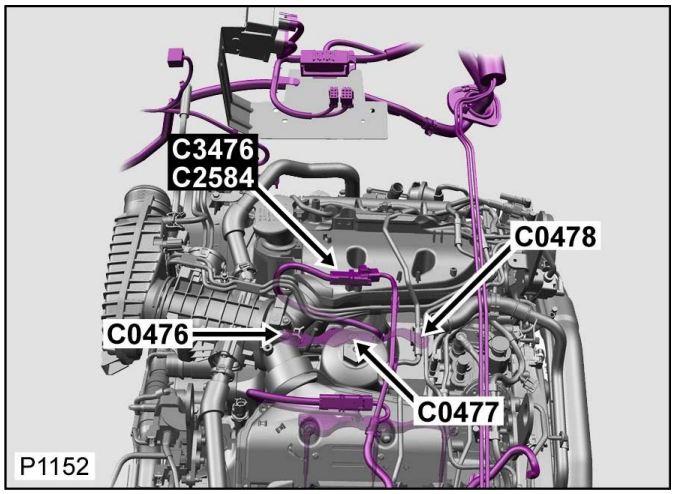


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	GO	695	C2584

Click here to print

Connector: C0477

CONNECTOR HOUSING NOT SERVICEABLE

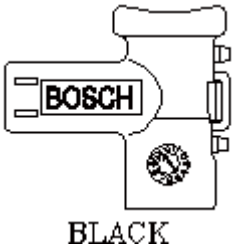

BLACK

Part No.: YPC910510

Colour: BLACK


Cavities: 1WY

Harness: GLOWPLUG LINK V6 RHS HARNESS

Description: Glow plug

Location: Top of engine - RH side

Qualifier:

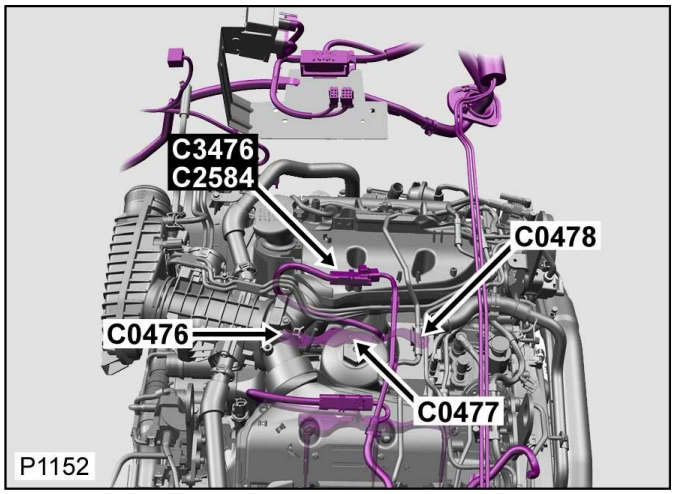


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	GR	695	C2584

Click here to print

Connector: C0478

CONNECTOR HOUSING NOT SERVICEABLE

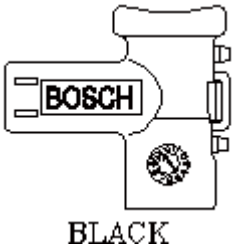

Part No.: YPC910510

Colour: BLACK


Cavities: 1WY

Harness: GLOWPLUG LINK V6 RHS HARNESS

Description: Glow plug

Location: Top of engine - RH side

Qualifier:

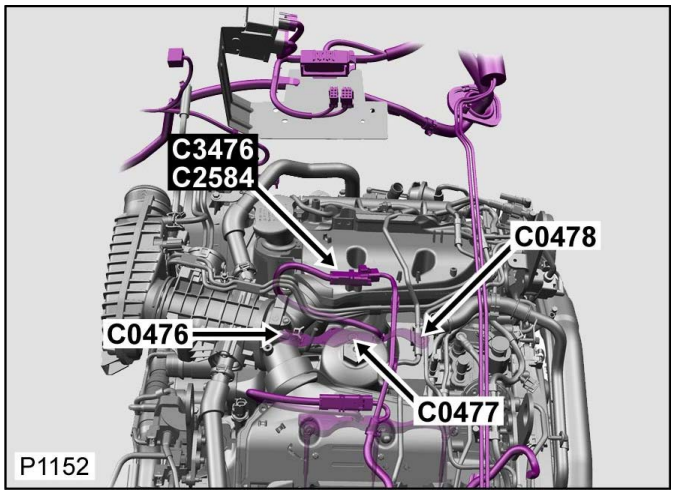


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	GU	695	C2584

Click here to print

Connector: C0479

CONNECTOR HOUSING NOT SERVICEABLE

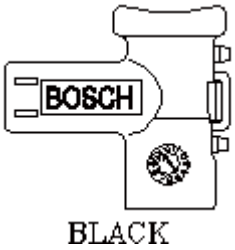

BLACK

Part No.: YPC910510

Colour: BLACK


Cavities: 1WY

Harness: GLOWPLUG LINK V6 LHS HARNESS

Description: Glow plug

Location: Top of engine - LH side

Qualifier:

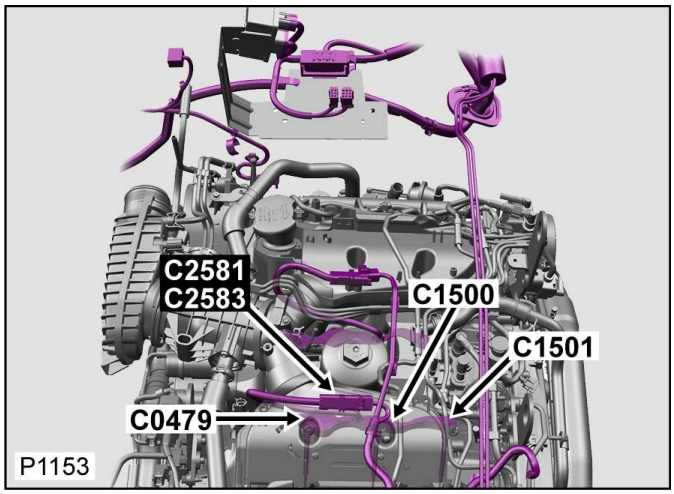


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	GO	695	C2583

Click here to print

Connector: C0491T

CONNECTOR HOUSING NOT SERVICEABLE

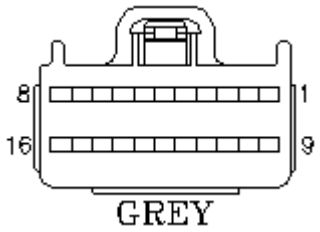

Part No.: YPC914020

Colour: GREY


Cavities: 16WY

Harness: CABIN HARNESS

Description: Amplifier-power

Location: Behind luggage compartment carpet RH side

Qualifier:

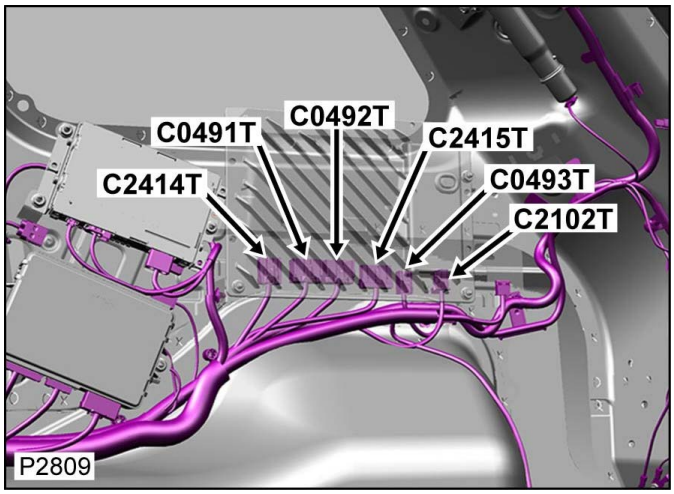


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	GO	478T	C0396
2	1.5	W	478T	C0396
3	1.5	PO	478T	C0398
4	1.5	WP	478T	C0398
5	1.5	GN	478T	C0435
6	1.5	WG	478T	C0435
7	1.5	UW	478T	C0436
8	1.5	NW	478T	C0436
9	1.5	SO	478T	C0396
10	1.5	WN	478T	C0396
11	1.5	YO	478T	C0398
12	1.5	WO	478T	C0398
13	1.5	SN	478T	C0435
14	1.5	NY	478T	C0435
15	1.5	PU	478T	C0436
16	1.5	NU	478T	C0436

Click here to print

Connector: C0492T

CONNECTOR HOUSING NOT SERVICEABLE

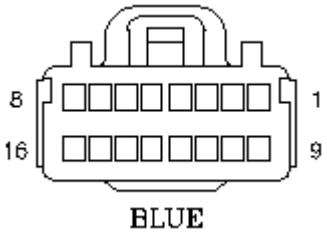

Part No.: YPC910180

Colour: BLUE


Cavities: 16WY

Harness: CABIN HARNESS

Description: Amplifier-power

Location: Behind luggage compartment carpet RH side

Qualifier:

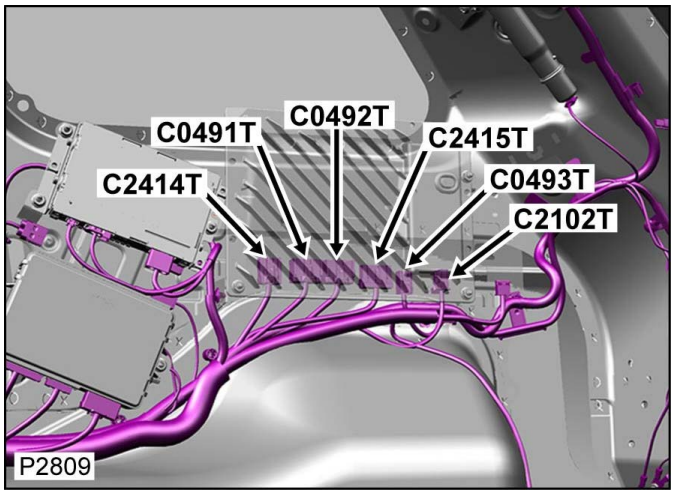

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	NU	478T	C0396
2	1.5	PS	478T	C0398
3	1.5	NP	499T	C2739T
4	1.5	P	499T	C2959T
5	1.5	WG	420T	C0084
6	1.5	NW	420T	C0084
7	1.5	G	420T	C0467
9	1.5	SU	478T	C0396
10	1.5	YS	478T	C0398
11	1.5	S	499T	C2739T
12	1.5	Y	499T	C2959T
13	1.5	NY	420T	C0084
14	1.5	NU	420T	C0084
15	1.5	SP	420T	C0467

Click here to print

Connector: C0493T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Amplifier-power

Location: Behind luggage compartment carpet RH side

Qualifier:

ASSEMBLY

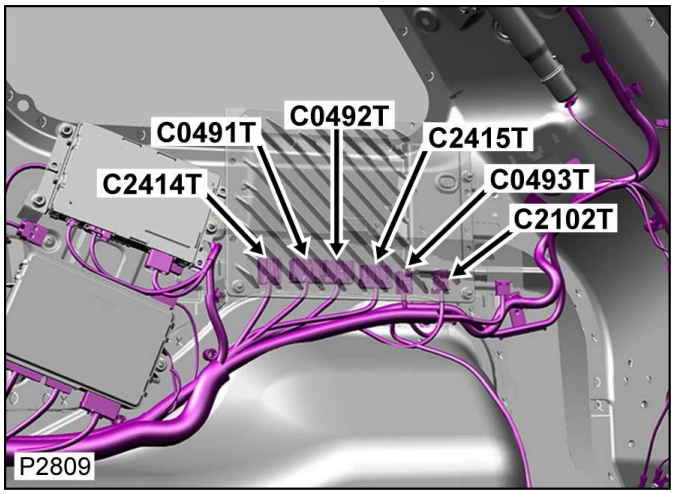

Part No.: XUD815360

Colour: NO COLOUR

Cavities: 4WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	514T	C3825T
2	0.13	N	514T	C3825T
3	0.13	P	514T	C3825T
4	0.5	B	514T	C3825T
5	SCR	SCR	514T	C3825T

Click here to print

Connector: **C0502**

CONNECTOR HOUSING SERVICEABLE

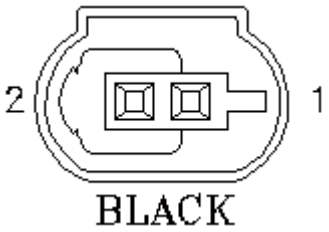

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: CHASSIS HARNESS

Description: Wheel speed Sensor-Rear-LH

Location: Beneath rear of vehicle LH side

Qualifier:

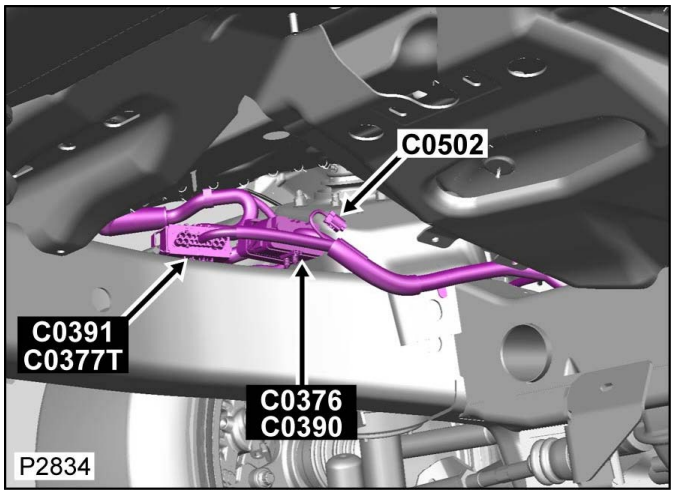


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WY	413T	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	WY	413S	C2294SB	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	W	413T	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	W	413S	C2294SB	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0503**

CONNECTOR HOUSING SERVICEABLE

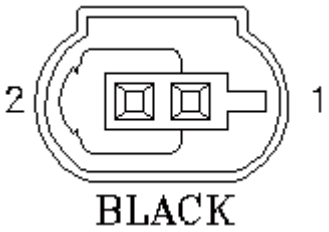

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: CHASSIS HARNESS

Description: Wheel speed Sensor-Rear-RH

Location: Below RH rear wheelarch

Qualifier:

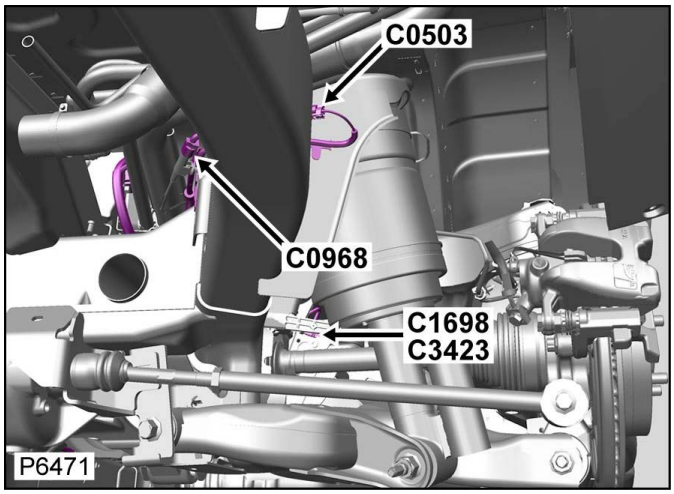

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WG	413T	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	WG	413S	C2294SB	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	W	413T	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	W	413S	C2294SB	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C0506L


CONNECTOR HOUSING NOT SERVICEABLE

Description: ABS module

Location: Rear LH side of engine compartment

Qualifier:

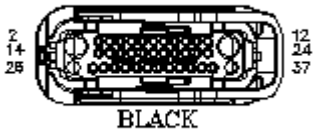

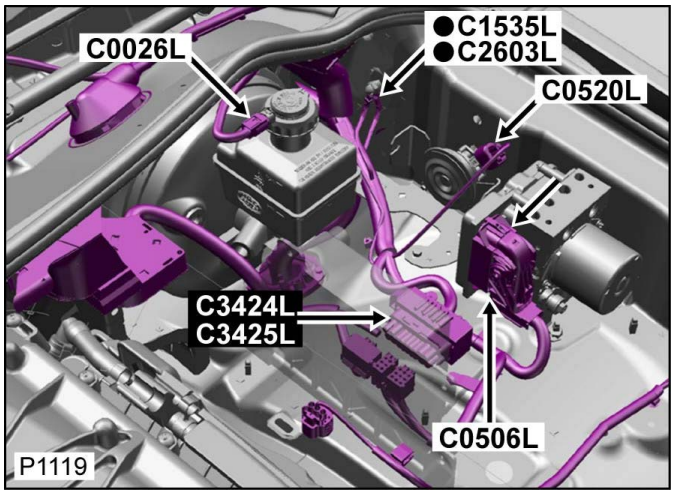

Part No.: YPC803170

Colour: BLACK

Cavities: 38WY

Harness: ENGINE COMPARTMENT HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	R	413L	C0570L
4	0.5	R	920L	C2444L
4	0.5	R	921L	C2245L
6	0.5	Y	413L	C0517
7	0.75	R	413L	C0570L
8	0.5	BG	413L	C2245L
13	4.0	B	413L	C2603L
14	0.5	G	413L	C1656L
17	0.5	WP	413L	C2444L
18	0.5	UY	413L	C0517
19	0.5	UG	413L	C2293
20	0.5	W	413L	C2293
21	0.5	UR	413L	C0516
24	0.5	YB	413L	S/JOINT SJ776
25	2.5	NG	413L	C0570L
26	0.5	GW	413L	C1656L
31	0.5	G	413L	C2293
33	0.5	UW	413L	C2293
34	0.5	R	413L	C0516
35	0.75	LG	413L	S/JOINT SJ109
37	0.5	YN	413L	S/JOINT SJ786
38	2.5	B	413L	C2603L

Click here to print

Connector: C0506R

CONNECTOR HOUSING NOT SERVICEABLE

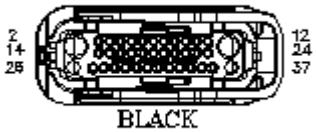

Part No.: YPC803170

Colour: BLACK


Cavities: 38WY

Harness: ENGINE COMPARTMENT HARNESS

Description: ABS module

Location: Rear RH side of engine compartment

Qualifier:

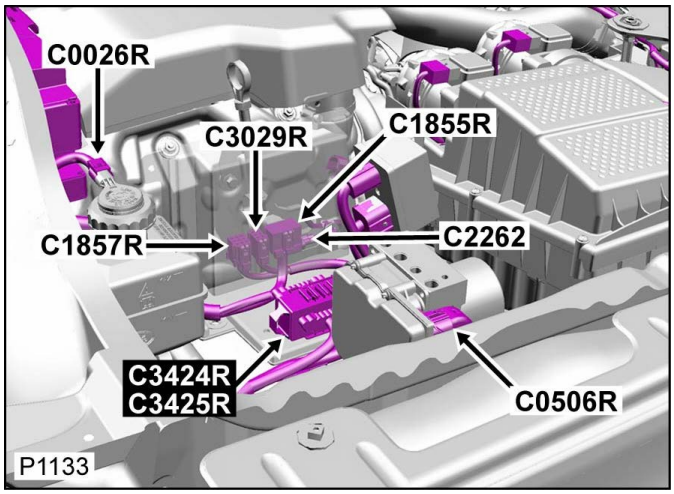

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	R	413R	C0570R
4	0.5	R	920R	C2240R
4	0.5	R	921R	C2244R
6	0.5	Y	413R	C0517
7	0.75	R	413R	C0570R
8	0.5	BG	413R	C2245R
13	4.0	B	413R	C2603R
14	0.5	G	413R	C1656R
17	0.5	WP	413R	C2240R
18	0.5	UY	413R	C0517
19	0.5	UG	413R	C2293
20	0.5	W	413R	C2293
21	0.5	UR	413R	C0516
24	0.5	YB	413R	S/JOINT SJ1776
25	2.5	NG	413R	C0570R
26	0.5	GW	413R	C1656R
31	0.5	G	413R	C2293
33	0.5	UW	413R	C2293
34	0.5	R	413R	C0516
35	0.75	LG	413R	S/JOINT SJ1109
37	0.5	YN	413R	S/JOINT SJ1786
38	2.5	B	413R	C2603R

Click here to print

Connector: C0513

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC909750

Colour: BLACK


Cavities: 2WY

Harness: FRONT BUMPER HARNESS

Description: Lamp-Fog-Front-RH

Location: Behind RH side of front bumper

Qualifier:

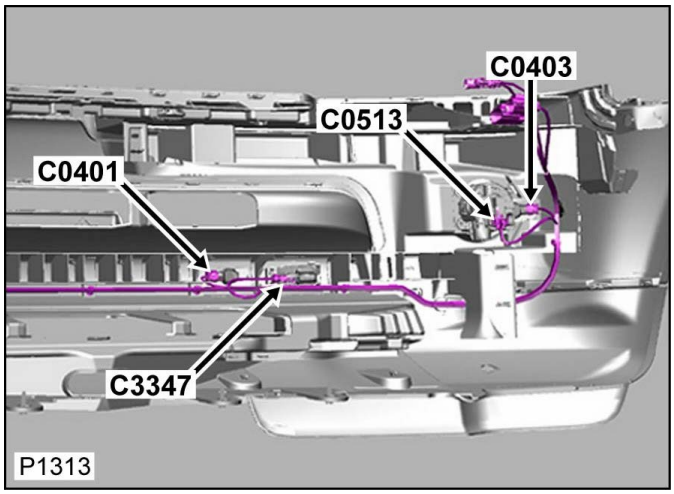

Wire Chart

CAV	CSA	COL	CCT	DESTN
B	1.0	B	93	S/JOINT SJ404
A	1.0	UP	93	S/JOINT SJ191

Click here to print

Connector: **C0514**

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC909750

Colour: BLACK


Cavities: 2WY

Harness: FRONT BUMPER HARNESS

Description: Lamp-Fog-Front-LH

Location: Behind LH side of front bumper

Qualifier:

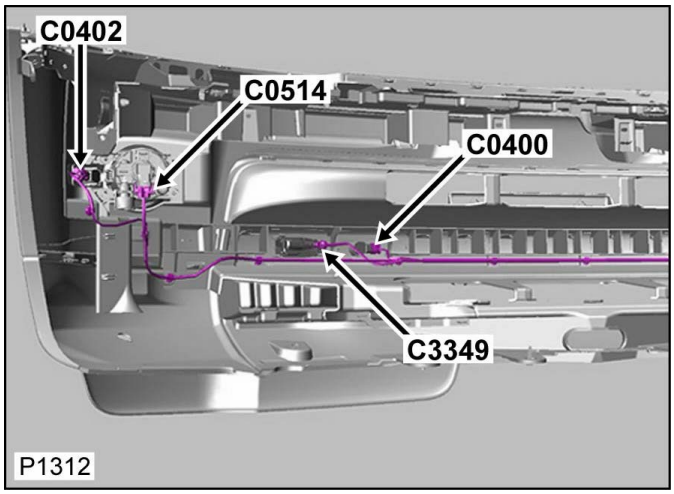


Wire Chart

CAV	CSA	COL	CCT	DESTN
B	1.0	B	93	S/JOINT SJ404
A	1.0	UP	93	S/JOINT SJ191

Click here to print

Connector: **C0516**

CONNECTOR HOUSING SERVICEABLE

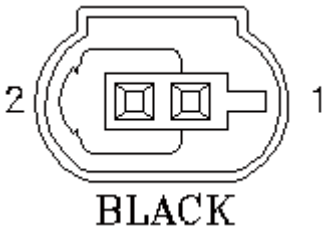

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Wheel speed Sensor-Front-LH

Location: Behind LH front fender splash shield

Qualifier:

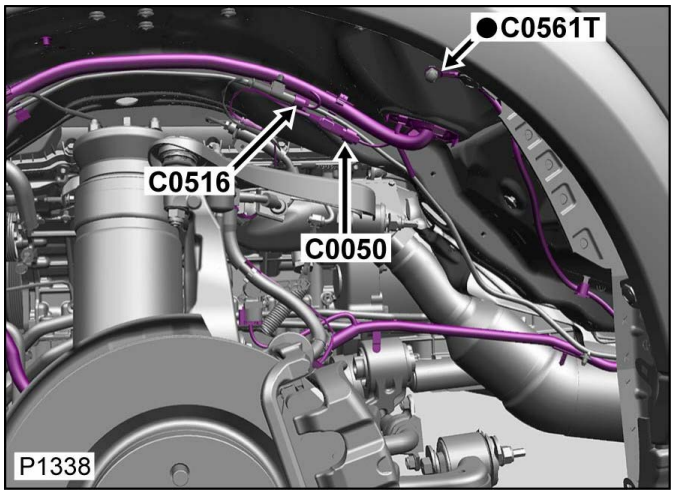


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	R	413L	C0506L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	R	413R	C0506R	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	UR	413L	C0506L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	UR	413R	C0506R	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0517**

CONNECTOR HOUSING SERVICEABLE

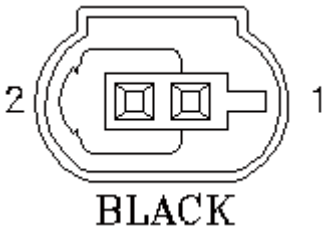

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Wheel speed Sensor-Front-RH

Location: Behind RH front fender splash shield

Qualifier:

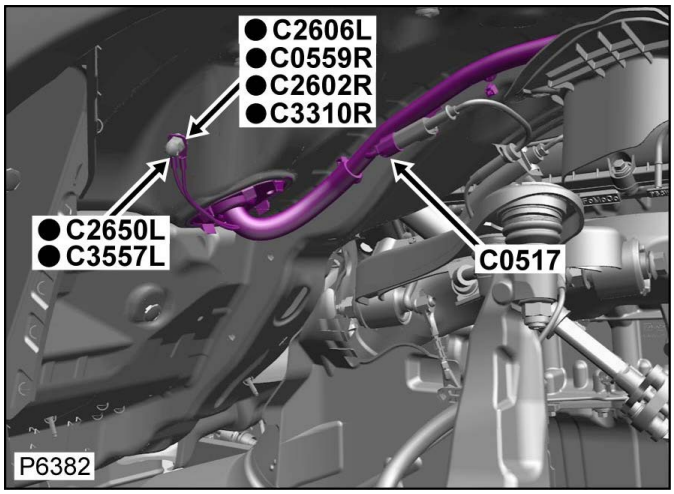


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	Y	413L	C0506L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	Y	413R	C0506R	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	UY	413L	C0506L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	UY	413R	C0506R	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0518**

CONNECTOR HOUSING NOT SERVICEABLE

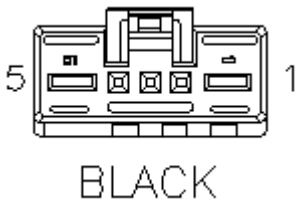

Part No.: YPC901850

Colour: BLACK


Cavities: 5WY

Harness: SEAT LINK HARNESS

Description: Motor-Seat-recline-LH

Location: Under front seat squab cover

Qualifier:

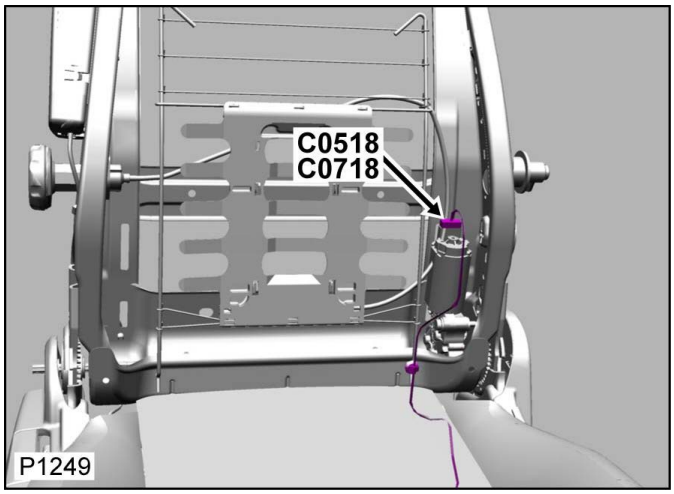


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	K	494	C0775	418-549-17	-	418-116A	418-117	-	418-113	418-108
5	2.5	N	494	C0775	418-549-17	-	418-116A	418-117	-	418-113	418-108

Click here to print

Connector: **C0518**

CONNECTOR HOUSING NOT SERVICEABLE

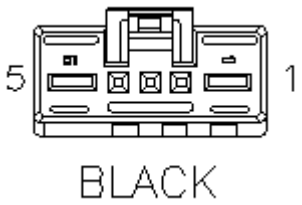

Part No.: YPC901850

Colour: BLACK


Cavities: 5WY

Harness: SEAT LINK HARNESS

Description: Motor-Seat-recline-LH

Location: Under front seat squab cover

Qualifier:

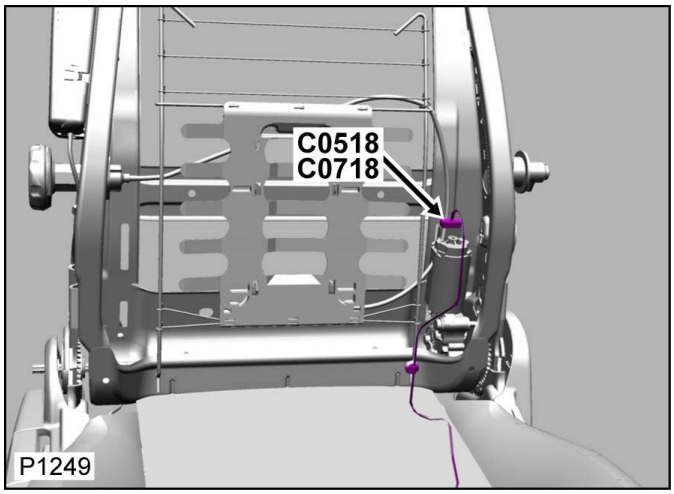


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	K	494	C0775	418-549-17	-	418-116A	418-117	-	418-113	418-108
5	2.5	N	494	C0775	418-549-17	-	418-116A	418-117	-	418-113	418-108

Click here to print

Connector: C0520L

CONNECTOR HOUSING NOT SERVICEABLE

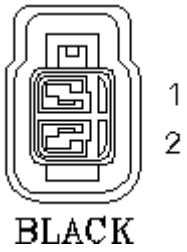

Part No.: YPC500750

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Passive-sounder

Location: Rear LH side of engine compartment

Qualifier:

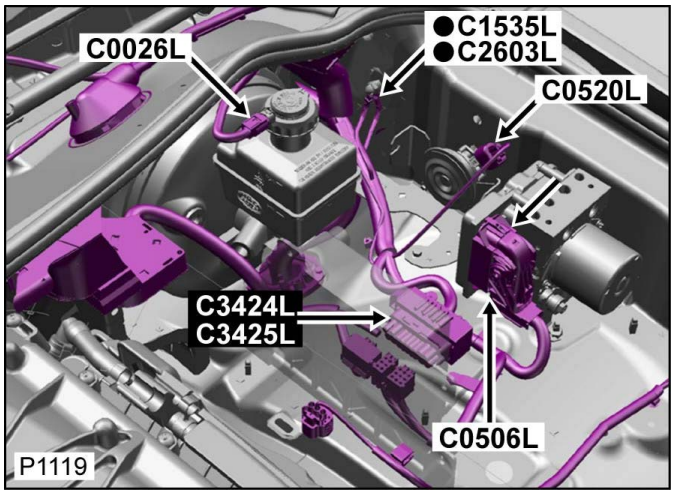


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	OB	139L	C0583L	-	-	-	-	-	-	-
2	0.5	B	139L	S/JOINT SJ171	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0520R

CONNECTOR HOUSING NOT SERVICEABLE

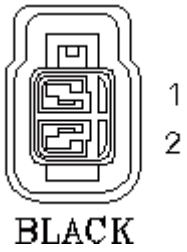

Part No.: YPC500750

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Passive-sounder

Location: Rear RH side of engine compartment

Qualifier:

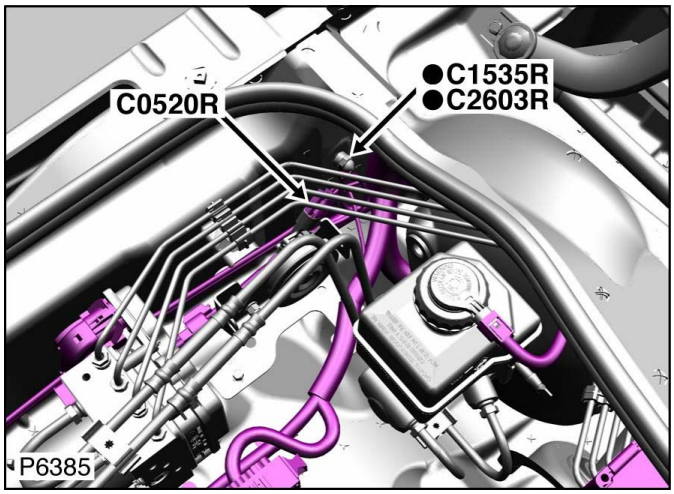


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	OB	200R	C0583R	-	-	-	-	-	-	-
2	0.5	B	200R	S/JOINT SJ173	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0522

CONNECTOR HOUSING NOT SERVICEABLE

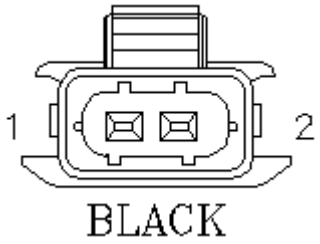

Part No.: YPC912700

Colour: BLACK


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Fuel injector-No.1 - PV8

Location: Top of engine - RH side

Qualifier:

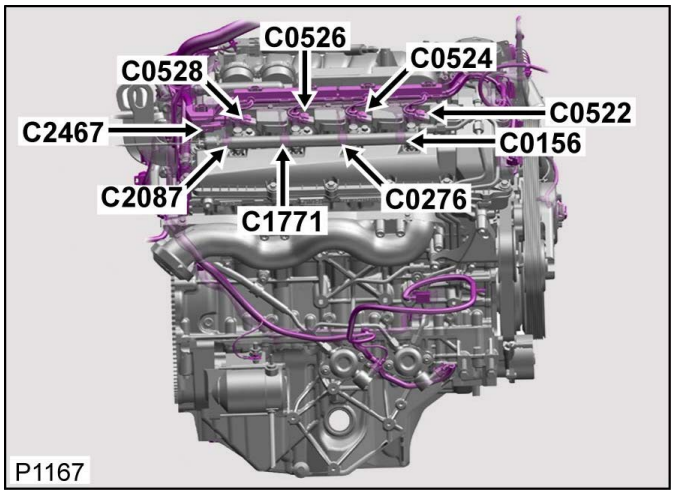


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	YU	ALL	C0634
2	1.0	GU	ALL	C0634

Click here to print

Connector: C0522M

CONNECTOR HOUSING NOT SERVICEABLE

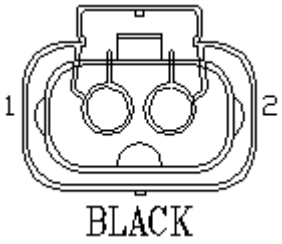

Part No.: YPC913430

Colour: BLACK


Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Fuel injector-No.1 - DV6

Location: Top of engine - RH side

Qualifier:

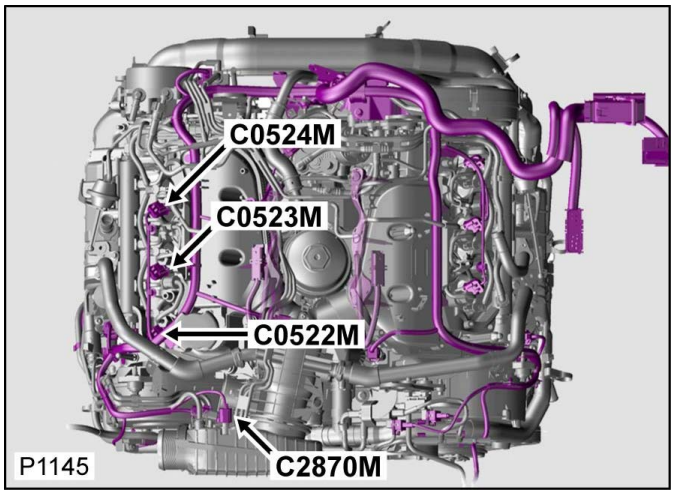


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	YU	798	C0659M
2	1.0	GU	798	C0659M

Click here to print

Connector: C0523

CONNECTOR HOUSING NOT SERVICEABLE

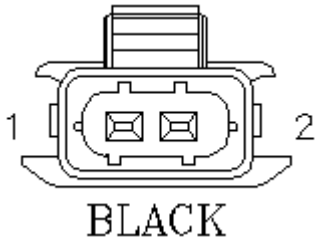

Part No.: YPC912700

Colour: BLACK


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Fuel injector-No.2 - PV8

Location: Top of engine - LH side

Qualifier:

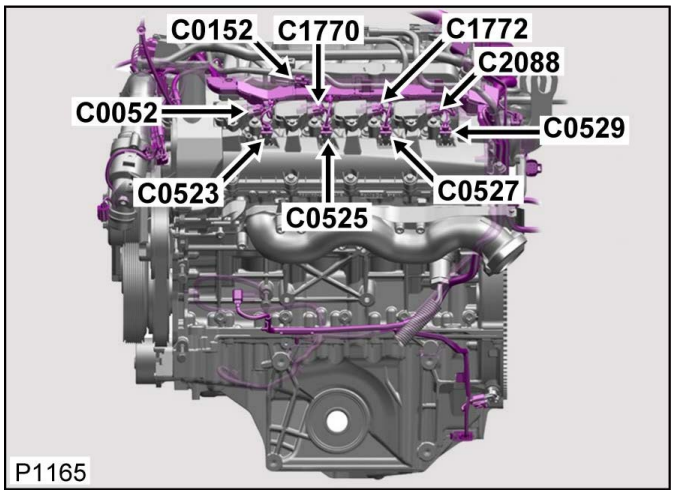


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	WG	ALL	C0634
2	1.0	N	ALL	C0634

Click here to print

Connector: C0523M

CONNECTOR HOUSING NOT SERVICEABLE

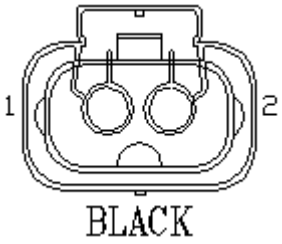

Part No.: YPC913430

Colour: BLACK


Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Fuel injector-No.2 - DV6

Location: Top of engine - RH side

Qualifier:

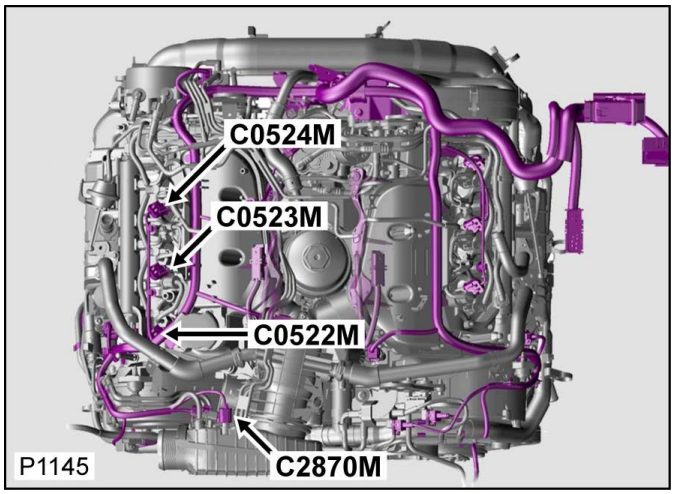


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	UO	798	C0659M
2	1.0	SY	798	C0659M

Click here to print

Connector: C0524

CONNECTOR HOUSING NOT SERVICEABLE

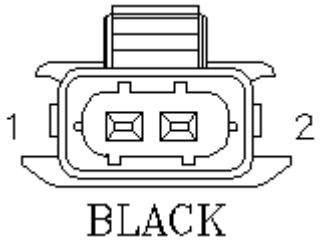

Part No.: YPC912700

Colour: BLACK


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Fuel injector-No.3 - PV8

Location: Top of engine - RH side

Qualifier:

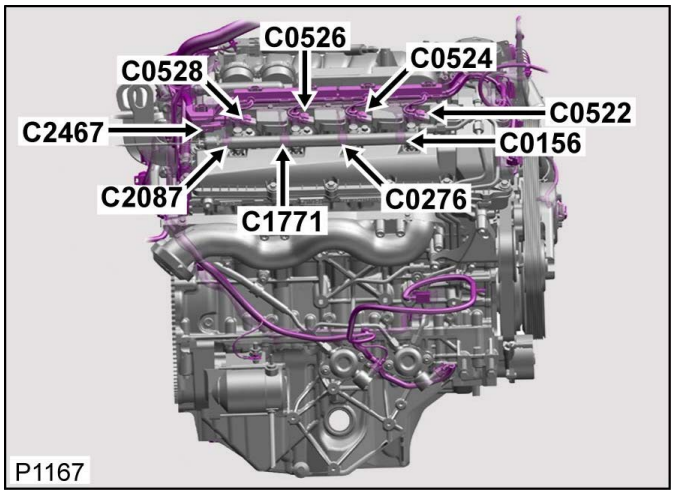


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	UO	ALL	C0634
2	1.0	SY	ALL	C0634

Click here to print

Connector: C0524M

CONNECTOR HOUSING NOT SERVICEABLE

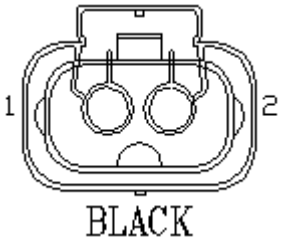

Part No.: YPC913430

Colour: BLACK


Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Fuel injector-No.3 - DV6

Location: Top of engine - RH side

Qualifier:

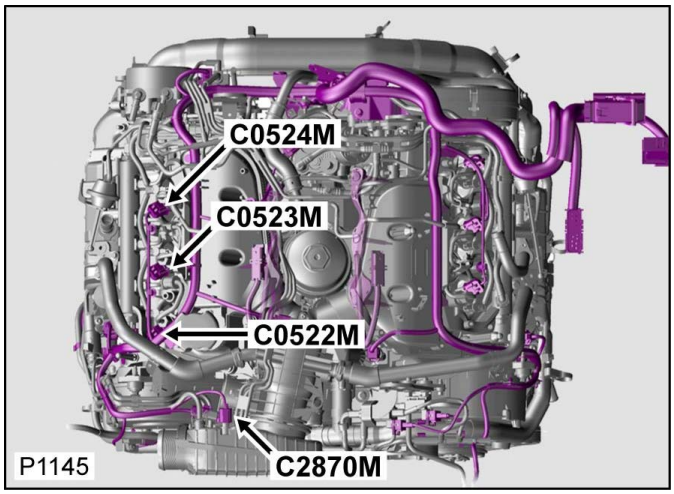


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	GP	798	C0659M
2	1.0	PS	798	C0659M

Click here to print

Connector: C0525

CONNECTOR HOUSING NOT SERVICEABLE

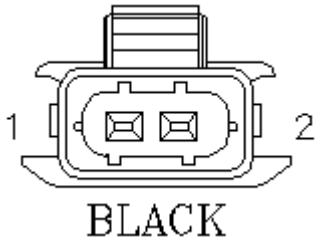

Part No.: YPC912700

Colour: BLACK


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Fuel injector-No.4 - PV8

Location: Top of engine - LH side

Qualifier:

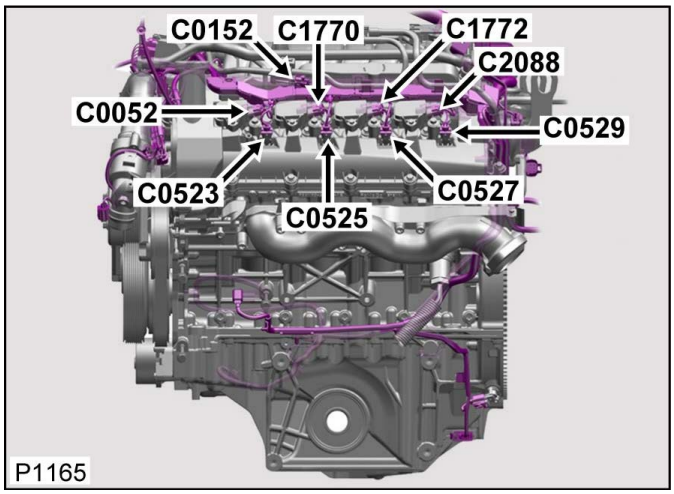

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	NP	ALL	C0634
2	1.0	GW	ALL	C0634

Click here to print


Connector: C0525M

CONNECTOR HOUSING NOT SERVICEABLE

Description: Fuel injector-No.4 - DV6

Location: Top of engine - LH side

Qualifier:

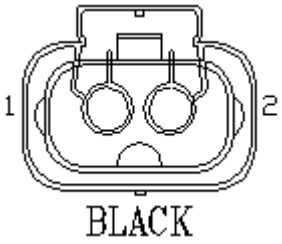


Part No.: YPC913430

Colour: BLACK

Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS

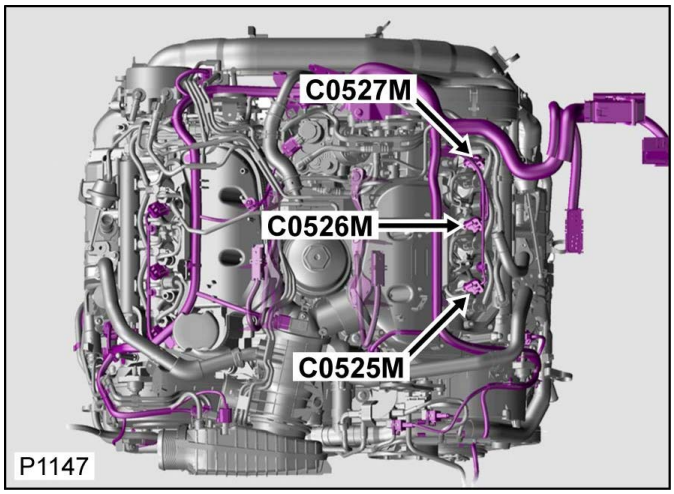


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	WG	798	C0659M
2	1.0	N	798	C0659M

Click here to print

Connector: C0526

CONNECTOR HOUSING NOT SERVICEABLE

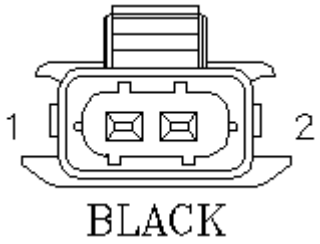

Part No.: YPC912700

Colour: BLACK


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Fuel injector-No.5 - PV8

Location: Top of engine - RH side

Qualifier:

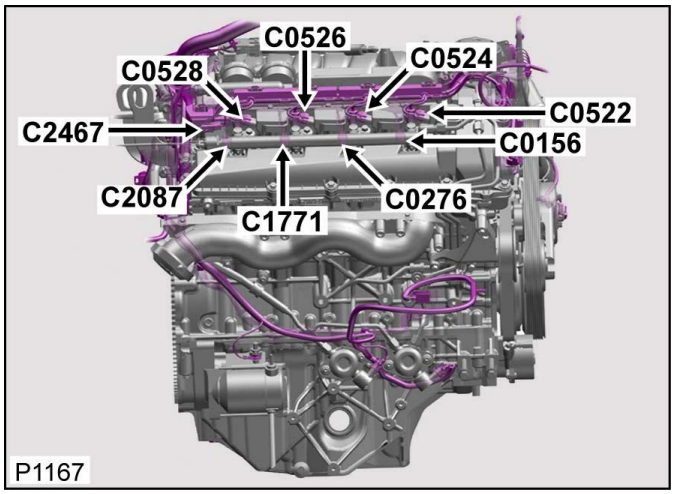


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	GP	ALL	C0634
2	1.0	P	ALL	C0634

Click here to print

Connector: C0526M

CONNECTOR HOUSING NOT SERVICEABLE

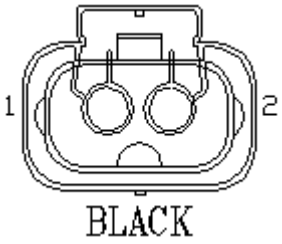

Part No.: YPC913430

Colour: BLACK


Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Fuel injector-No.5 - DV6

Location: Top of engine - LH side

Qualifier:

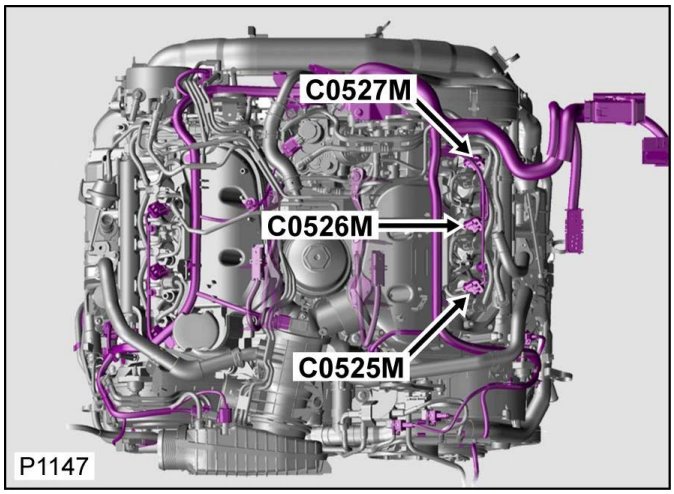


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	NP	798	C0659M
2	1.0	GW	798	C0659M

Click here to print

Connector: C0527

CONNECTOR HOUSING NOT SERVICEABLE

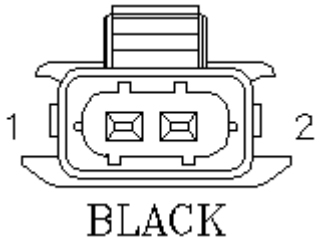

Part No.: YPC912700

Colour: BLACK


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Fuel injector-No.6 - PV8

Location: Top of engine - LH side

Qualifier:

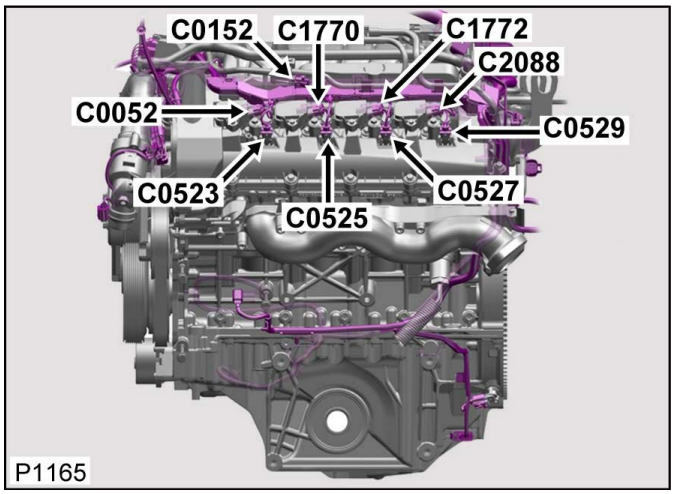


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	UW	ALL	C0634
2	1.0	SN	ALL	C0634

Click here to print

Connector: C0527M

CONNECTOR HOUSING NOT SERVICEABLE

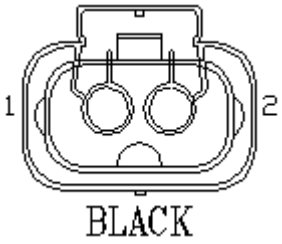

Part No.: YPC913430

Colour: BLACK


Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Fuel injector-No.6 - DV6

Location: Top of engine - LH side

Qualifier:

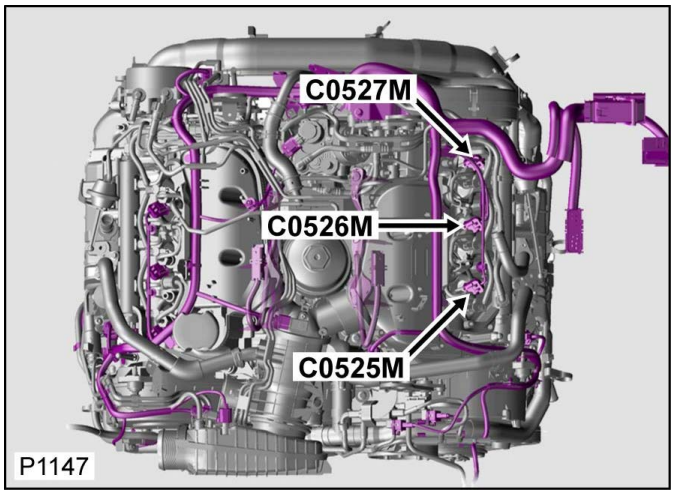


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	UW	798	C0659M
2	1.0	SN	798	C0659M

Click here to print

Connector: C0528

CONNECTOR HOUSING NOT SERVICEABLE

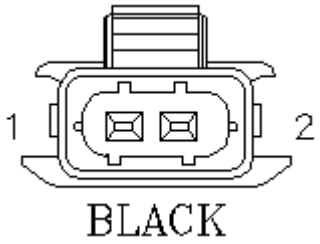

Part No.: YPC912700

Colour: BLACK


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Fuel injector-No.7 - PV8

Location: Top of engine - RH side

Qualifier:

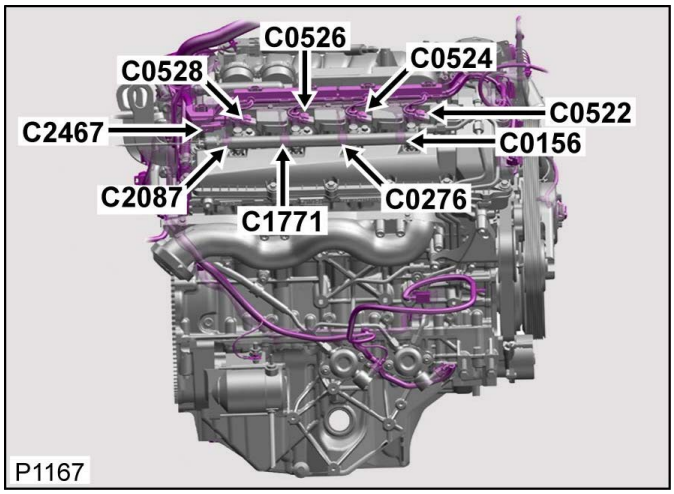


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	U	ALL	C0634
2	1.0	YO	ALL	C0634

Click here to print

Connector: C0529

CONNECTOR HOUSING NOT SERVICEABLE

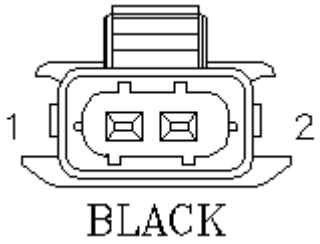

Part No.: YPC912700

Colour: BLACK


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Fuel injector-No.8 - PV8

Location: Top of engine - LH side

Qualifier:

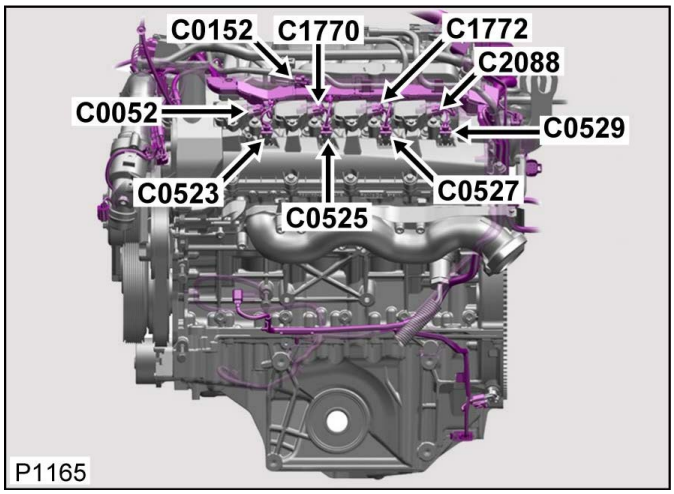


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	WO	ALL	C0634
2	1.0	PO	ALL	C0634

Click here to print

Connector: C0531

CONNECTOR HOUSING NOT SERVICEABLE

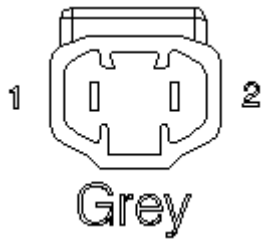

Part No.: YPC914420

Colour: LIGHT GREY


Cavities: 2WY

Harness: DOORS FRONT HARNESS

Description: Speaker-High range-Front door

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated

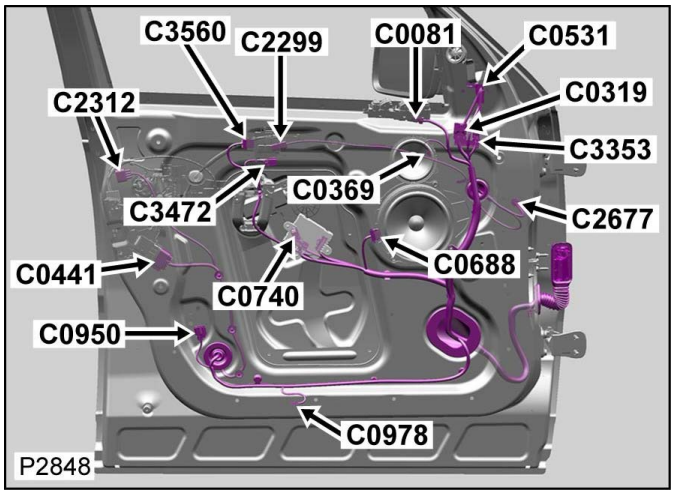


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	PO	478L	C0439
1	1.5	PO	478R	C3646
2	1.5	YO	478L	C0439
2	1.5	YO	478R	C3646

Click here to print

Connector: C0556L

CONNECTOR HOUSING NOT SERVICEABLE

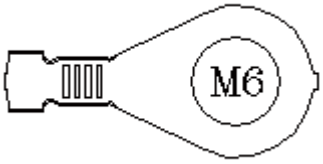

Part No.: YPG101120

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: LHD condition illustrated

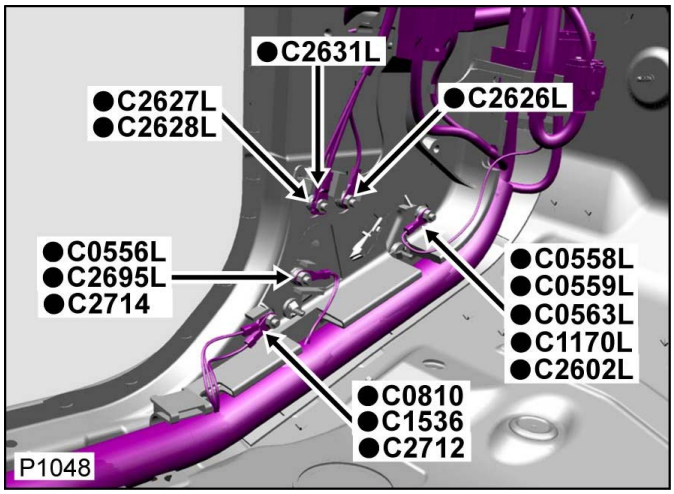


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	139L	C0396

Click here to print

Connector: C0557

CONNECTOR HOUSING NOT SERVICEABLE

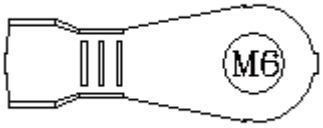

Part No.: YPG801380

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of RH 'A' post

Qualifier: LHD condition illustrated

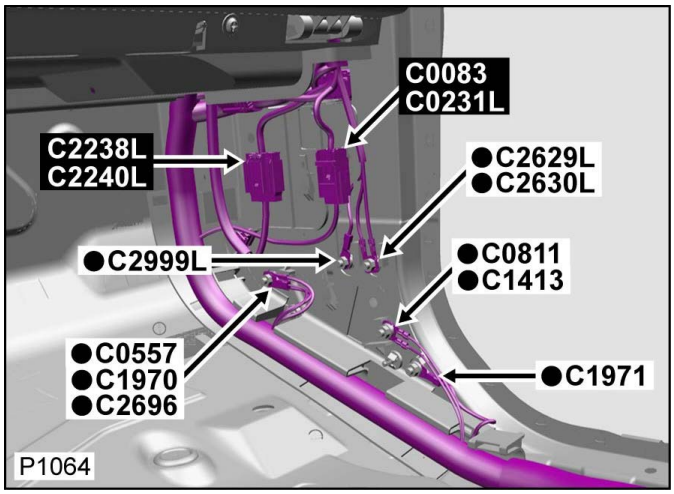


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	478S	C2414S
1	4.0	B	478T	C2414T

Click here to print

Connector: C0558L

CONNECTOR HOUSING NOT SERVICEABLE

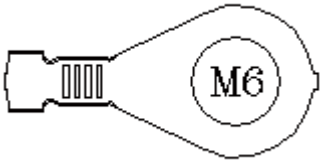

Part No.: YPG101120

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: LHD condition illustrated

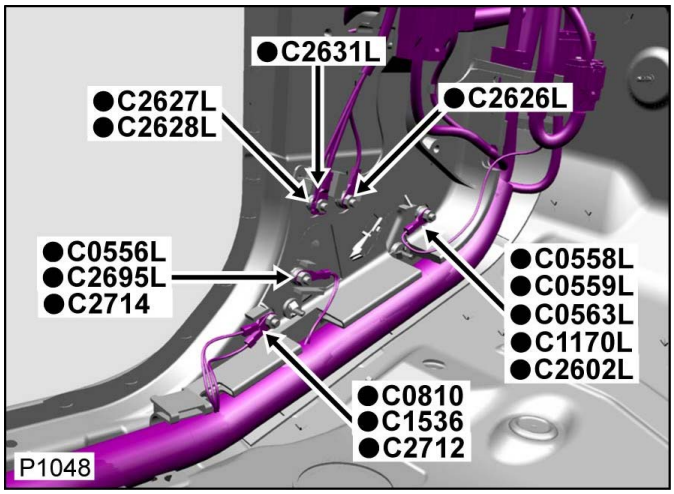


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	B	423L	C1656L

Click here to print

Connector: C0558R

CONNECTOR HOUSING NOT SERVICEABLE

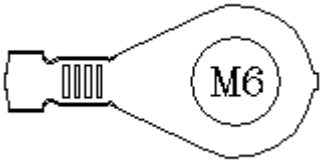

Part No.: YPG101120

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of RH 'A' post

Qualifier: RHD condition illustrated

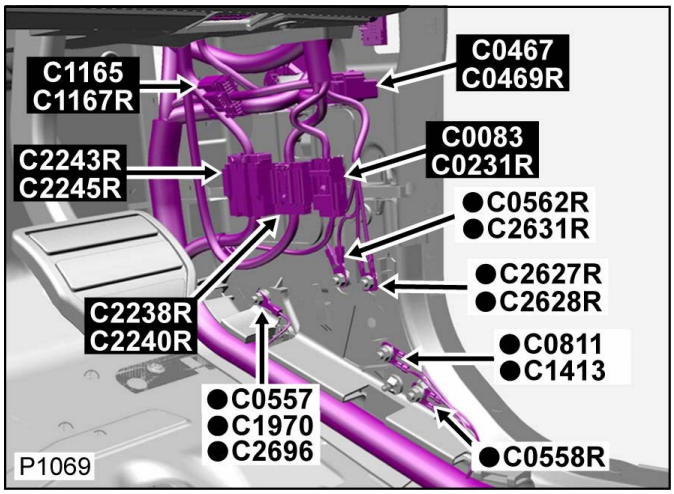


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	200R	C0398

Click here to print

Connector: C0559L

CONNECTOR HOUSING NOT SERVICEABLE

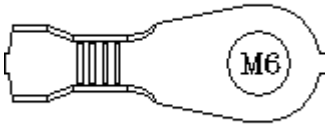

Part No.: YPG800650

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: LHD condition illustrated

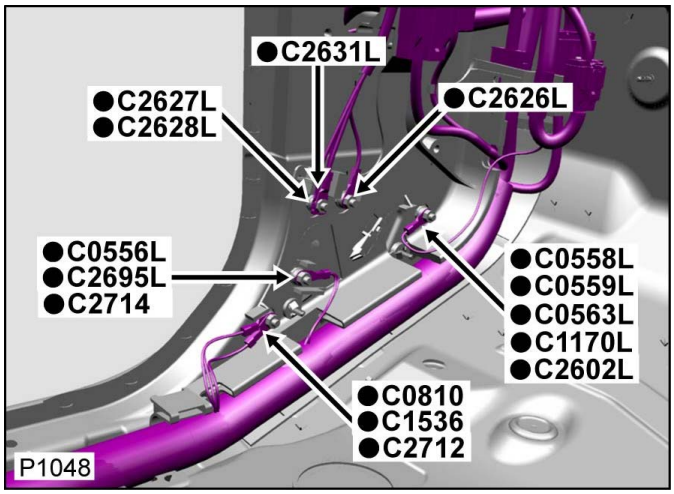


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	808L	C2321L
1	0.75	B	808L	C1656L

Click here to print

Connector: C0559R

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG101610

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Behind RH front fender splash shield

Qualifier:

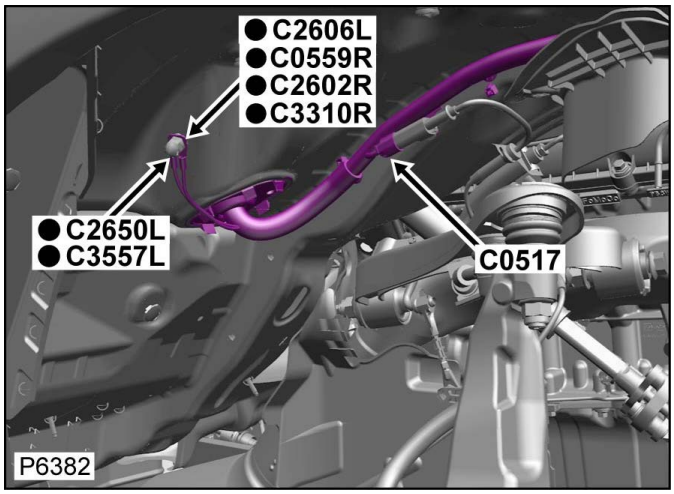


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	B	953R	C2188R
1	2.5	B	953R	C2321R

Click here to print

Connector: C0560L

CONNECTOR HOUSING NOT SERVICEABLE

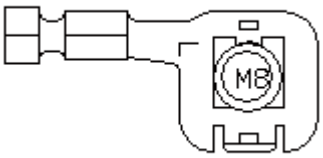

Part No.: YPG900110

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Front RH side of engine compartment

Qualifier:

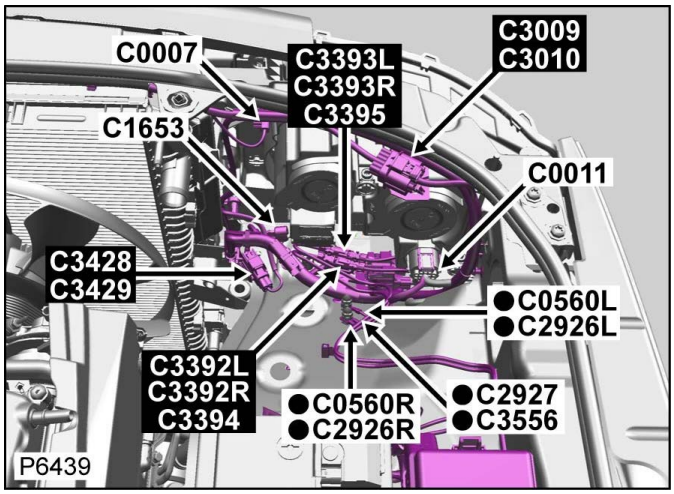


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	139L	S/JOINT SJ173

Click here to print

Connector: C0560R

CONNECTOR HOUSING NOT SERVICEABLE

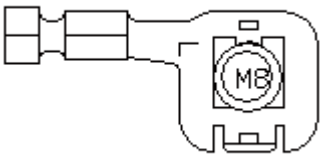

Part No.: YPG900110

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Front RH side of engine compartment

Qualifier:

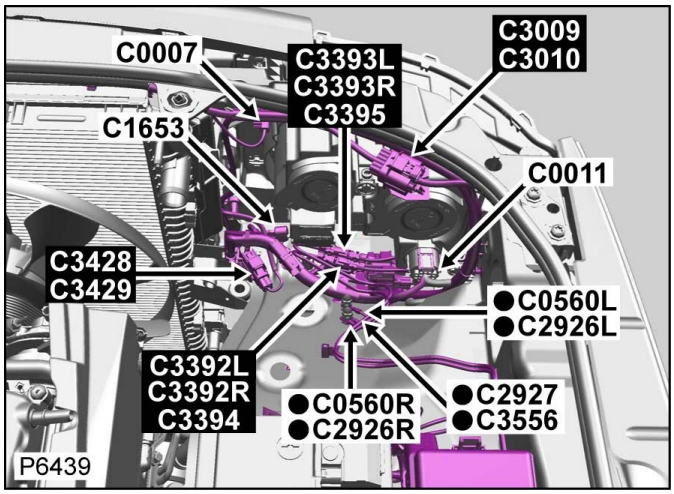


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	200R	S/JOINT SJ173

Click here to print

Connector: **C0561T**

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG101610

Colour: TIN PLATED


Cavities: 1WY

Harness: CHASSIS HARNESS

Description: Ground point

Location: Behind LH front fender splash shield

Qualifier:

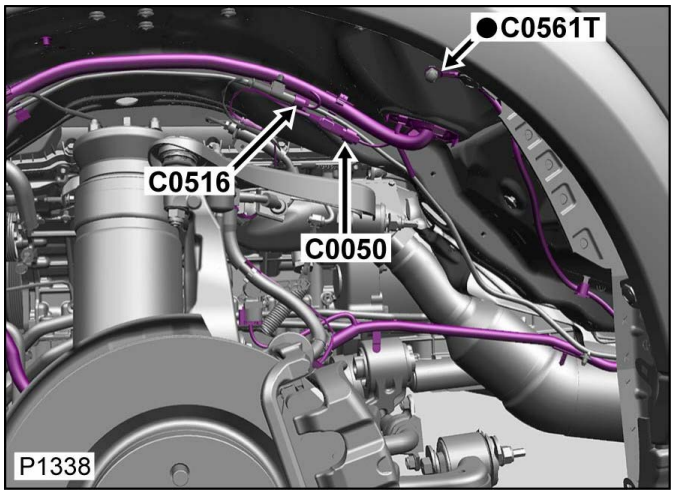


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	6.0	B	419T	C0780

Click here to print

Connector: C0562R

CONNECTOR HOUSING NOT SERVICEABLE

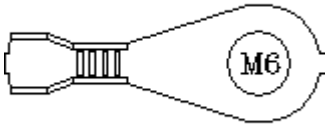

Part No.: YPG800660

Colour: TIN PLATED


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Ground point

Location: Base of RH 'A' post

Qualifier: RHD condition illustrated

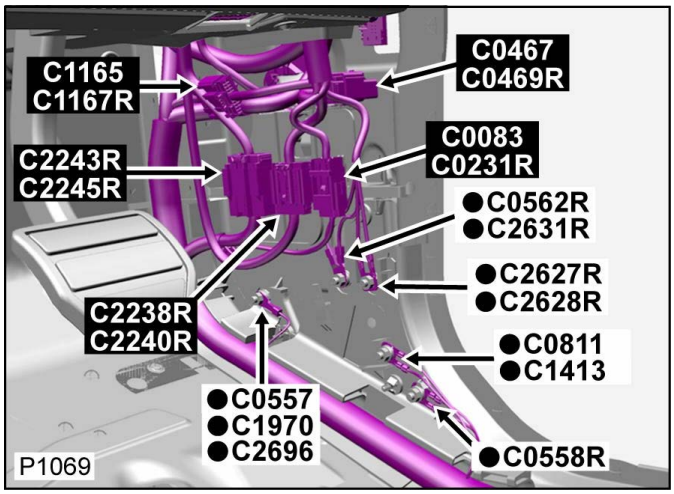


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	200R	C0230

Click here to print

Connector: C0563L

CONNECTOR HOUSING NOT SERVICEABLE

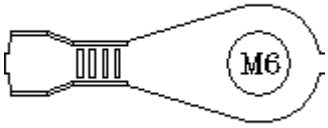

Part No.: YPG800670

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: LHD condition illustrated

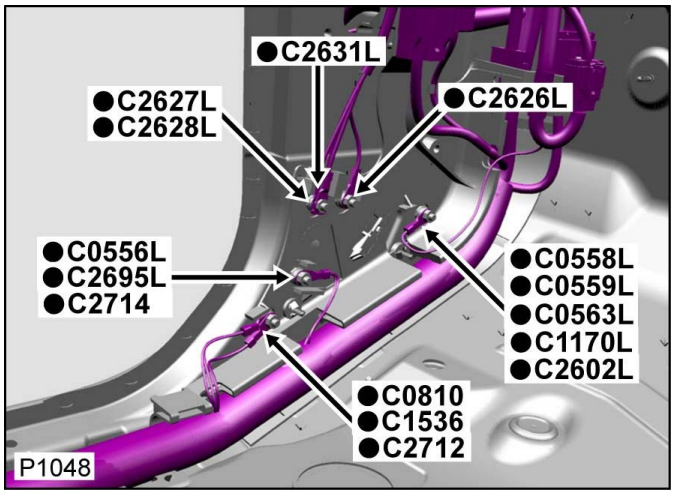


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	B	319L	C2590

Click here to print

Connector: C0564

CONNECTOR HOUSING NOT SERVICEABLE

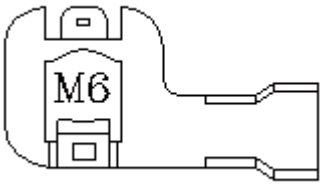

Part No.: YPG900260

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Rear LH side of engine compartment

Qualifier:

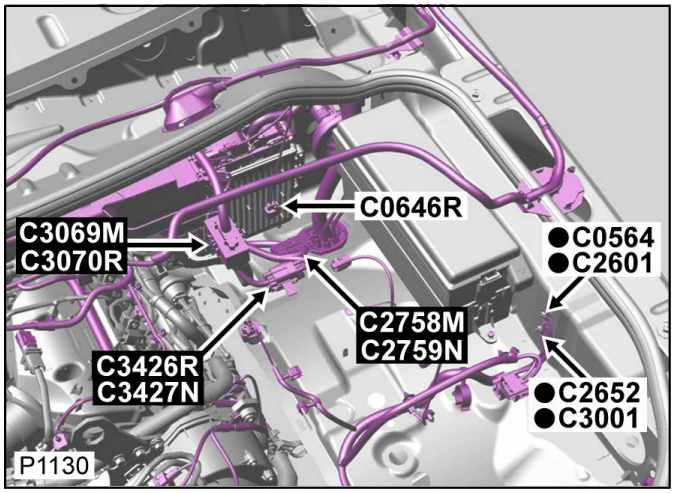


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	254	S/JOINT SJ879

Click here to print

Connector: C0565T

CONNECTOR HOUSING NOT SERVICEABLE

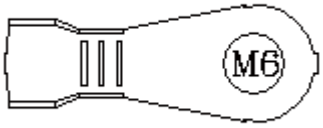

Part No.: YPG801380

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of 'D' post LH side

Qualifier:

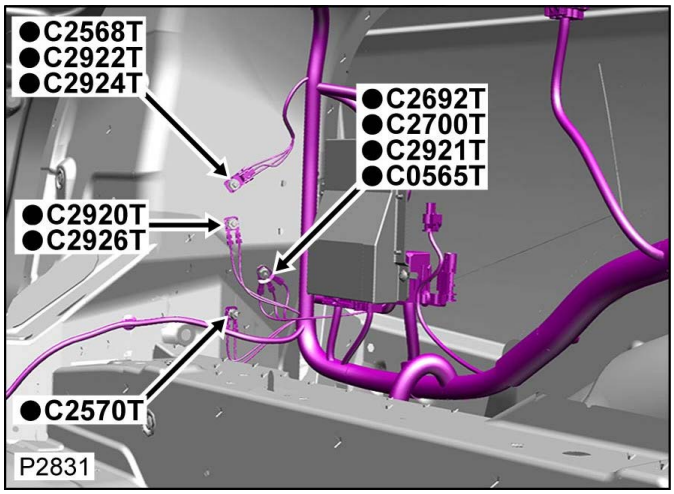

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	6.0	W	319TL	C1390T

Click here to print


Connector: C0570L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Junction-box engine

Location: Passenger side of engine compartment

Qualifier:

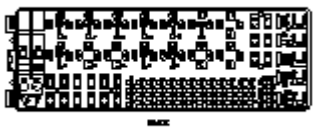

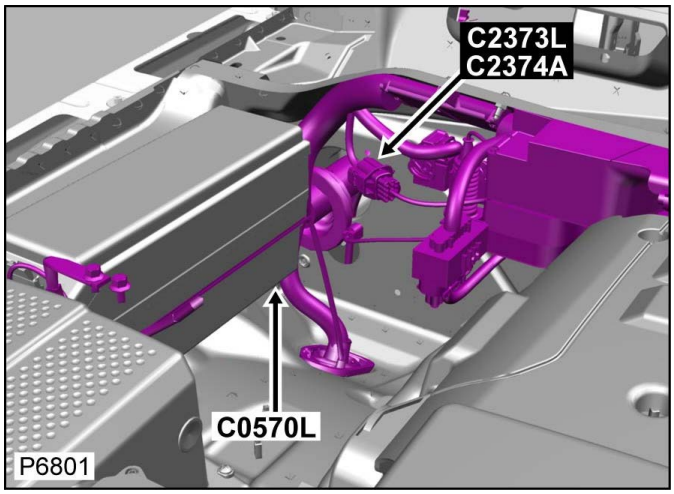

Part No.: YQE800080

Colour: BLACK

Cavities: 194WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	2.5	R	885L	S/JOINT SJ14	418-587-15	-	418-116A	418-117	-	418-113	418-108
3	0.5	B	885L	S/JOINT SJ173	-	-	-	-	-	-	-
4	4.0	YB	797L	S/JOINT SJ901	418-587-06	-	418-116A	418-117	-	418-114	418-109
5	4.0	YB	797L	S/JOINT SJ902	418-587-06	-	418-116A	418-117	-	418-114	418-109
8	4.0	NU	21L	C2244L	-	-	-	-	-	-	-
10	2.5	WR	374L	C3006	-	-	-	-	-	-	-
10	1.5	WR	798L	C3070L	-	-	-	-	-	-	-
11	4.0	NR	139L	C2996L	-	-	-	-	-	-	-
12	2.5	R	282L	C2725L	-	-	-	-	-	-	-
12	2.5	R	798L	C3070L	-	-	-	-	-	-	-
12	2.5	RB	797L	C2274L	-	-	-	-	-	-	-
14	0.5	LG	885L	S/JOINT SJ947	-	-	-	-	-	-	-
18	0.5	B	798L	C0658L	418-587-16	-	418-116A	418-117	-	418-112	418-107
18	0.75	NG	797L	C0872L	418-587-16	-	418-116A	418-117	-	418-112	418-107
18	0.5	B	282L	C0635L	418-587-16	-	418-116A	418-117	-	418-112	418-107
19	0.5	UP	139L	C0584L	418-587-16	-	418-116A	418-117	-	418-112	418-107
21	1.5	NO	797L	S/JOINT SJ999	-	-	-	-	-	-	-
21	0.5	U	798L	S/JOINT SJ933	418-587-16	-	418-116A	418-117	-	418-112	418-107
21	0.75	N	252L	S/JOINT SJ13	418-587-16	-	418-116A	418-117	-	418-112	418-107
24	0.5	UR	21L	C2412L	418-587-16	-	418-116A	418-117	-	418-112	418-107
25	0.5	G	183L	C0584L	418-587-16	-	418-116A	418-117	-	418-112	418-107

26	4.0	B	183L	S/JOINT SJ15	-	-	-	-	-	-	-
28	0.75	N	374L	S/JOINT SJ13	418-587-16	-	418-116A	418-117	-	418-112	418-107
28	0.5	B	798L	S/JOINT SJ173	418-587-16	-	418-116A	418-117	-	418-112	418-107
30	0.5	B	374L	C0635L	418-587-16	-	418-116A	418-117	-	418-112	418-107
30	0.5	N	798L	C2240L	418-587-16	-	418-116A	418-117	-	418-112	418-107
33	0.5	LGW	139L	C2240L	418-587-16	-	418-116A	418-117	-	418-112	418-107
34	0.5	B	282L	C0635L	418-587-16	-	418-116A	418-117	-	418-112	418-107
34	0.5	B	798L	C0658L	418-587-16	-	418-116A	418-117	-	418-112	418-107
34	0.5	WR	797L	S/JOINT SJ479	418-587-16	-	418-116A	418-117	-	418-112	418-107
36	0.5	B	282L	C0635L	418-587-16	-	418-116A	418-117	-	418-112	418-107
36	0.5	B	798L	C0658L	418-587-16	-	418-116A	418-117	-	418-112	418-107
36	0.5	R	797L	C0872L	418-587-16	-	418-116A	418-117	-	418-112	418-107
38	2.5	RLG	139L	C0030L	418-587-15	-	418-116A	418-117	-	418-113	418-108
40	4.0	PS	109L	S/JOINT SJ100	418-587-06	-	418-116A	418-117	-	418-114	418-109
45	2.5	LGR	183L	C0828	-	-	-	-	-	-	-
49	2.5	ULG	139L	C0030L	418-587-15	-	418-116A	418-117	-	418-113	418-108
50	0.5	PU	139L	C0584L	-	-	-	-	-	-	-
51	4.0	PS	109L	C2244L	418-587-06	-	418-116A	418-117	-	418-114	418-109
52	4.0	YB	797L	S/JOINT SJ80	418-587-06	-	418-116A	418-117	-	418-114	418-109
53	6.0	NR	419L	S/JOINT SJ572	-	-	-	-	-	-	-
54	6.0	PS	109L	S/JOINT SJ100	-	-	-	-	-	-	-
55	0.5	PW	139L	C2244L	418-587-16	-	418-116A	418-117	-	418-112	418-107
61	2.5	LGW	572L	C2412L	418-587-15	-	418-116A	418-117	-	418-113	418-108
62	0.5	LG	139L	S/JOINT SJ947	-	-	-	-	-	-	-
63	4.0	PU	139L	S/JOINT SJ245	418-587-06	-	418-116A	418-117	-	418-114	418-109
64	4.0	PK	109L	C2245L	418-587-06	-	418-116A	418-117	-	418-114	418-109
65	0.5	BY	419L	C2321L	418-587-16	-	418-116A	418-117	-	418-112	418-107
66	0.5	R	419L	C2321L	418-587-16	-	418-116A	418-117	-	418-112	418-107
67	0.5	N	109L	C0584L	418-587-16	-	418-116A	418-117	-	418-112	418-107
68	0.5	LG	109L	S/JOINT SJ947	418-587-16	-	418-116A	418-117	-	418-112	418-107
69	0.5	B	139L	S/JOINT SJ173	418-587-16	-	418-116A	418-117	-	418-112	418-107
71	0.5	RO	139L	S/JOINT	418-587-16	-	418-116A	418-117	-	418-112	418-

				SJ443							107
72	0.5	R	139L	C0584L	418-587-16	-	418-116A	418-117	-	418-112	418-107
73	1.0	B	139L	C2926L	418-587-16	-	418-116A	418-117	-	418-112	418-107
75	1.5	RU	797L	S/JOINT SJ560	-	-	-	-	-	-	-
76	0.5	RB	797L	S/JOINT SJ995	418-587-16	-	418-116A	418-117	-	418-112	418-107
77	1.5	RU	797L	S/JOINT SJ560	-	-	-	-	-	-	-
78	0.5	RB	797L	S/JOINT SJ995	418-587-16	-	418-116A	418-117	-	418-112	418-107
80	4.0	B	183L	S/JOINT SJ15	-	-	-	-	-	-	-
81	0.5	GR	183L	C0584L	418-587-16	-	418-116A	418-117	-	418-112	418-107
83	1.0	B	139L	S/JOINT SJ173	-	-	-	-	-	-	-
85	4.0	PS	109L	S/JOINT SJ100	418-587-06	-	418-116A	418-117	-	418-114	418-109
87	6.0	PW	109L	C0570L	-	-	-	-	-	-	-
88	0.5	PO	139L	C0583L	418-587-16	-	418-116A	418-117	-	418-112	418-107
92	2.5	RLG	183L	C0828	-	-	-	-	-	-	-
94	1.5	NY	113L	C0570L	418-587-15	-	418-116A	418-117	-	418-113	418-108
95	0.5	LG	139L	S/JOINT SJ947	-	-	-	-	-	-	-
98	2.5	NR	419L	S/JOINT SJ572	418-096	-	418-116A	418-117	-	418-113	418-108
104	2.5	R	139TL	C0570L	418-096	-	418-116A	418-117	-	418-113	418-108
106	0.75	O	377L	C3058L	-	-	-	-	-	-	-
107	0.75	R	413L	C0506L	-	-	-	-	-	-	-
108	2.5	NG	413L	C0506L	418-096	-	418-116A	418-117	-	418-113	418-108
110	0.75	PY	282L	C0635L	-	-	-	-	-	-	-
110	0.75	N	797L	C0872L	-	-	-	-	-	-	-
112	4.0	KW	319L	C2590	418-587-06	-	418-116A	418-117	-	418-114	418-109
113	4.0	R	413L	C0506L	418-587-06	-	418-116A	418-117	-	418-114	418-109
114	4.0	NP	139L	C2412L	418-587-06	-	418-116A	418-117	-	418-114	418-109
115	4.0	PU	139L	C2244L	418-587-06	-	418-116A	418-117	-	418-114	418-109
116	4.0	NU	139L	C0583L	418-587-06	-	418-116A	418-117	-	418-114	418-109
117	6.0	NR	139L	C0583L	-	-	-	-	-	-	-
118	0.5	NO	139L	C0584L	-	-	-	-	-	-	-
119	2.5	WP	254L	S/JOINT SJ489	418-096	-	418-116A	418-117	-	418-113	418-108
119	4.0	WP	282L	C2245L	-	-	-	-	-	-	-
120	1.0	NR	419L	C2320L	-	-	-	-	-	-	-
121	0.75	NK	282L	S/JOINT SJ450	-	-	-	-	-	-	-
121	0.75	UN	798L	S/JOINT SJ868	-	-	-	-	-	-	-

121	1.5	RU	797L	S/JOINT SJ559	418-096	-	418-116A	418-117	-	418-113	418-108
122	0.75	PO	809L	C2025	-	-	-	-	-	-	-
122	1.5	PO	245L	S/JOINT SJ8	418-096	-	418-116A	418-117	-	418-113	418-108
123	1.5	PO	407L	C2188L	418-096	-	418-116A	418-117	-	418-113	418-108
124	2.5	WG	282L	S/JOINT SJ931	418-096	-	418-116A	418-117	-	418-113	418-108
125	1.0	WG	252L	S/JOINT SJ812	-	-	-	-	-	-	-
125	1.5	RU	797L	C2274L	418-096	-	418-116A	418-117	-	418-113	418-108
125	1.0	U	798L	S/JOINT SJ933	-	-	-	-	-	-	-
126	2.5	R	139TL	C2412L	418-096	-	418-116A	418-117	-	418-113	418-108
127	1.5	RU	798L	S/JOINT SJ511	418-096	-	418-116A	418-117	-	418-113	418-108
137	2.5	R	139TL	C0570L	418-587-15	-	418-116A	418-117	-	418-113	418-108
141	1.5	B	139L	C0004	418-587-15	-	418-116A	418-117	-	418-113	418-108
148	1.5	NY	113L	C0570L	418-096	-	418-116A	418-117	-	418-113	418-108
165	0.5	NG	139L	S/JOINT SJ945	-	-	-	-	-	-	-
166	0.75	NK	282L	S/JOINT SJ941	-	-	-	-	-	-	-
166	0.5	PN	97L	C2412L	-	-	-	-	-	-	-
167	2.5	G	798L	S/JOINT SJ946	418-096	-	418-116A	418-117	-	418-113	418-108
167	2.5	NO	797L	S/JOINT SJ999	418-096	-	418-116A	418-117	-	418-113	418-108
167	2.5	N	282L	S/JOINT SJ13	418-096	-	418-116A	418-117	-	418-113	418-108
168	1.5	RU	797L	S/JOINT SJ560	418-096	-	418-116A	418-117	-	418-113	418-108
168	1.5	BN	798L	S/JOINT SJ630	418-096	-	418-116A	418-117	-	418-113	418-108
168	1.5	B	282L	C2725L	418-096	-	418-116A	418-117	-	418-113	418-108
170	0.75	N	282L	C0635L	-	-	-	-	-	-	-
170	0.75	P	798L	S/JOINT SJ866	-	-	-	-	-	-	-
170	1.5	BN	797L	S/JOINT SJ630	418-096	-	418-116A	418-117	-	418-113	418-108
171	1.5	NY	113L	S/JOINT SJ170	418-096	-	418-116A	418-117	-	418-113	418-108
172	2.5	WR	252L	S/JOINT SJ932	418-096	-	418-116A	418-117	-	418-113	418-108
173	1.0	SK	139L	C2244L	-	-	-	-	-	-	-
175	0.5	R	797L	C2274L	-	-	-	-	-	-	-
178	2.5	PU	419L	C2321L	418-096	-	418-116A	418-117	-	418-113	418-108
179	2.5	PN	97L	C0926	418-096	-	418-116A	418-117	-	418-113	418-108
180	1.5	PY	797L	C3424L	418-096	-	418-116A	418-117	-	418-113	418-108
180	1.5	PY	807L	S/JOINT SJ1061	418-096	-	418-116A	418-117	-	418-113	418-108

181	6.0	GY	139L	C2293	-	-	-	-	-	-	-
185	4.0	NG	139L	C0583L	418-587-06	-	418-116A	418-117	-	418-114	418-109
186	6.0	NS	139L	C0583L	-	-	-	-	-	-	-
189	6.0	PW	109L	C0570L	-	-	-	-	-	-	-
191	6.0	YR	798L	C0190L	-	-	-	-	-	-	-

Click here to print


Connector: C0570R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Junction-box engine

Location: Rear LH side of engine compartment

Qualifier:

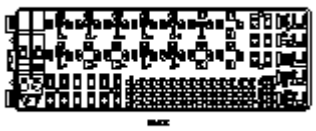

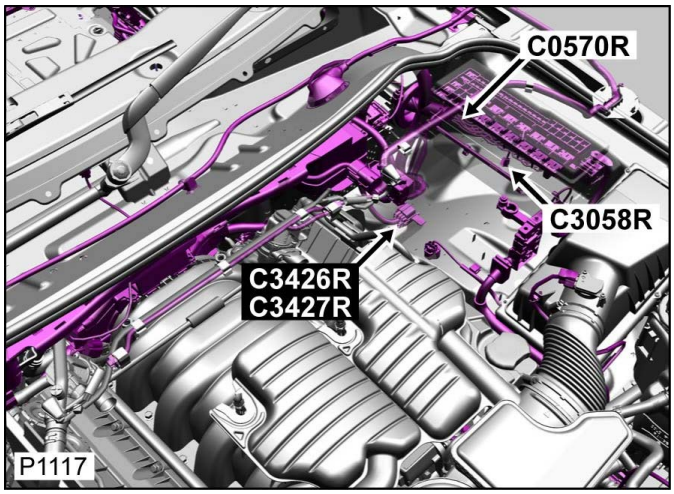

Part No.: YQE800080

Colour: BLACK

Cavities: 194WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	2.5	R	885R	S/JOINT SJ1014	418-587-15	-	418-116A	418-117	-	418-113	418-108
3	0.5	B	885R	S/JOINT SJ173	-	-	-	-	-	-	-
4	4.0	YB	797R	S/JOINT SJ901	418-587-06	-	418-116A	418-117	-	418-114	418-109
5	4.0	YB	797R	S/JOINT SJ902	418-587-06	-	418-116A	418-117	-	418-114	418-109
8	4.0	NU	21R	C2410R	-	-	-	-	-	-	-
10	2.5	WR	374R	C3006	-	-	-	-	-	-	-
10	1.5	WR	798R	C3070R	-	-	-	-	-	-	-
11	4.0	NR	200R	C2996R	-	-	-	-	-	-	-
12	2.5	R	282R	C2725R	-	-	-	-	-	-	-
12	2.5	R	798R	C3070R	-	-	-	-	-	-	-
12	2.5	RB	797R	C2274R	-	-	-	-	-	-	-
14	0.5	LG	885R	S/JOINT SJ1947	-	-	-	-	-	-	-
18	0.5	B	798R	C0658R	418-587-16	-	418-116A	418-117	-	418-112	418-107
18	0.75	NG	797R	C0872R	418-587-16	-	418-116A	418-117	-	418-112	418-107
18	0.5	B	282R	C0635R	418-587-16	-	418-116A	418-117	-	418-112	418-107
19	0.5	UP	200R	C0584R	418-587-16	-	418-116A	418-117	-	418-112	418-107
21	1.5	NO	797R	S/JOINT SJ1999	-	-	-	-	-	-	-
21	0.5	U	798R	S/JOINT SJ1933	418-587-16	-	418-116A	418-117	-	418-112	418-107
21	0.75	N	252R	S/JOINT SJ1013	418-587-16	-	418-116A	418-117	-	418-112	418-107
24	0.5	UR	21R	C2244R	418-587-16	-	418-116A	418-117	-	418-112	418-107
25	0.5	G	183R	C0584R	418-587-16	-	418-116A	418-117	-	418-112	418-107

26	2.5	B	183R	S/JOINT SJ879	-	-	-	-	-	-	-
28	0.75	N	374R	S/JOINT SJ1013	418-587-16	-	418-116A	418-117	-	418-112	418-107
28	0.5	B	798R	S/JOINT SJ171	418-587-16	-	418-116A	418-117	-	418-112	418-107
30	0.5	B	374R	C0635R	418-587-16	-	418-116A	418-117	-	418-112	418-107
30	0.5	N	798R	C2241R	418-587-16	-	418-116A	418-117	-	418-112	418-107
33	0.5	LGW	200R	C2241R	418-587-16	-	418-116A	418-117	-	418-112	418-107
34	0.5	B	282R	C0635R	418-587-16	-	418-116A	418-117	-	418-112	418-107
34	0.5	B	798R	C0658R	418-587-16	-	418-116A	418-117	-	418-112	418-107
34	0.5	WR	797R	S/JOINT SJ1479	418-587-16	-	418-116A	418-117	-	418-112	418-107
36	0.5	B	282R	C0635R	418-587-16	-	418-116A	418-117	-	418-112	418-107
36	0.5	B	798R	C0658R	418-587-16	-	418-116A	418-117	-	418-112	418-107
36	0.5	R	797R	C0872R	418-587-16	-	418-116A	418-117	-	418-112	418-107
38	2.5	RLG	200R	C0030R	418-587-15	-	418-116A	418-117	-	418-113	418-108
40	4.0	PS	109R	S/JOINT SJ1000	418-587-06	-	418-116A	418-117	-	418-114	418-109
45	2.5	LGR	183R	C0828	-	-	-	-	-	-	-
49	2.5	ULG	200R	C0030R	418-587-15	-	418-116A	418-117	-	418-113	418-108
50	0.5	PU	200R	C0584R	-	-	-	-	-	-	-
51	4.0	PS	109R	C2245R	418-587-06	-	418-116A	418-117	-	418-114	418-109
52	4.0	YB	797R	S/JOINT SJ80	418-587-06	-	418-116A	418-117	-	418-114	418-109
53	6.0	NR	419R	S/JOINT SJ1572	-	-	-	-	-	-	-
54	6.0	PS	109R	S/JOINT SJ1000	-	-	-	-	-	-	-
55	0.5	PW	200R	C2410R	418-587-16	-	418-116A	418-117	-	418-112	418-107
61	2.5	LGW	572R	C2410R	418-587-15	-	418-116A	418-117	-	418-113	418-108
62	0.5	LG	200R	S/JOINT SJ1947	-	-	-	-	-	-	-
63	4.0	PU	200R	S/JOINT SJ1245	418-587-06	-	418-116A	418-117	-	418-114	418-109
64	4.0	PK	109R	C2244R	418-587-06	-	418-116A	418-117	-	418-114	418-109
65	0.5	BY	419R	C2321R	418-587-16	-	418-116A	418-117	-	418-112	418-107
66	0.5	R	419R	C2321R	418-587-16	-	418-116A	418-117	-	418-112	418-107
67	0.5	N	109R	C0584R	418-587-16	-	418-116A	418-117	-	418-112	418-107
68	0.5	LG	109R	S/JOINT SJ1947	418-587-16	-	418-116A	418-117	-	418-112	418-107
69	0.5	B	200R	S/JOINT SJ171	418-587-16	-	418-116A	418-117	-	418-112	418-107
71	0.5	RO	200R	S/JOINT	418-587-16	-	418-116A	418-117	-	418-112	418-

				SJ443							107
72	0.5	R	200R	C0584R	418-587-16	-	418-116A	418-117	-	418-112	418-107
73	1.0	B	200R	C2926R	418-587-16	-	418-116A	418-117	-	418-112	418-107
75	1.5	RU	797R	S/JOINT SJ1560	-	-	-	-	-	-	-
76	0.5	RB	797R	S/JOINT SJ1995	418-587-16	-	418-116A	418-117	-	418-112	418-107
77	1.5	RU	797R	S/JOINT SJ1560	-	-	-	-	-	-	-
78	0.5	RB	797R	S/JOINT SJ1995	418-587-16	-	418-116A	418-117	-	418-112	418-107
80	2.5	B	183R	S/JOINT SJ879	-	-	-	-	-	-	-
81	0.5	GR	183R	C0584R	418-587-16	-	418-116A	418-117	-	418-112	418-107
83	1.0	B	200R	S/JOINT SJ173	-	-	-	-	-	-	-
85	4.0	PS	109R	S/JOINT SJ1000	418-587-06	-	418-116A	418-117	-	418-114	418-109
87	6.0	PW	109R	C0570R	-	-	-	-	-	-	-
88	0.5	PO	200R	C0583R	418-587-16	-	418-116A	418-117	-	418-112	418-107
92	2.5	RLG	183R	C0828	-	-	-	-	-	-	-
94	1.5	NY	113R	C0570R	418-587-15	-	418-116A	418-117	-	418-113	418-108
95	0.5	LG	572R	S/JOINT SJ1947	-	-	-	-	-	-	-
98	2.5	NR	419R	S/JOINT SJ1572	418-096	-	418-116A	418-117	-	418-113	418-108
104	2.5	R	200TR	C0570R	418-096	-	418-116A	418-117	-	418-113	418-108
106	0.75	O	377R	C3058R	-	-	-	-	-	-	-
107	0.75	R	413R	C0506R	-	-	-	-	-	-	-
108	2.5	NG	413R	C0506R	418-096	-	418-116A	418-117	-	418-113	418-108
110	0.75	PY	282R	C0635R	-	-	-	-	-	-	-
110	0.75	N	797R	C0872R	-	-	-	-	-	-	-
113	4.0	R	413R	C0506R	418-587-06	-	418-116A	418-117	-	418-114	418-109
114	4.0	NP	200R	C2245R	418-587-06	-	418-116A	418-117	-	418-114	418-109
115	4.0	PU	200R	C2410R	418-587-06	-	418-116A	418-117	-	418-114	418-109
116	4.0	NU	200R	C0583R	418-587-06	-	418-116A	418-117	-	418-114	418-109
117	6.0	NR	200R	C0583R	-	-	-	-	-	-	-
118	0.5	NO	200R	C0584R	-	-	-	-	-	-	-
119	2.5	WP	254R	S/JOINT SJ1489	418-096	-	418-116A	418-117	-	418-113	418-108
119	4.0	WP	282R	C2244R	-	-	-	-	-	-	-
120	1.0	NR	419R	C2320R	-	-	-	-	-	-	-
121	0.75	NK	282R	S/JOINT SJ1450	-	-	-	-	-	-	-
121	0.75	UN	798R	S/JOINT SJ1868	-	-	-	-	-	-	-
121	1.5	RU	797R	S/JOINT SJ1559	418-096	-	418-116A	418-117	-	418-113	418-108

122	0.75	PO	809R	C2025	-	-	-	-	-	-	-
122	1.5	PO	245R	S/JOINT SJ1008	418-096	-	418-116A	418-117	-	418-113	418-108
123	1.5	PO	407R	C2188R	418-096	-	418-116A	418-117	-	418-113	418-108
124	2.5	WG	282R	S/JOINT SJ1931	418-096	-	418-116A	418-117	-	418-113	418-108
125	1.0	WG	252R	S/JOINT SJ1812	-	-	-	-	-	-	-
125	1.5	RU	797R	C2274R	418-096	-	418-116A	418-117	-	418-113	418-108
125	1.0	U	798R	S/JOINT SJ1933	-	-	-	-	-	-	-
126	2.5	R	200TR	C2241R	418-096	-	418-116A	418-117	-	418-113	418-108
127	1.5	RU	798R	S/JOINT SJ511	418-096	-	418-116A	418-117	-	418-113	418-108
137	2.5	R	200TR	C0570R	418-587-15	-	418-116A	418-117	-	418-113	418-108
141	1.5	B	200R	C0004	418-587-15	-	418-116A	418-117	-	418-113	418-108
148	1.5	NY	113R	C0570R	418-096	-	418-116A	418-117	-	418-113	418-108
165	0.5	NG	200R	S/JOINT SJ1945	-	-	-	-	-	-	-
166	0.75	NK	282R	C2725R	-	-	-	-	-	-	-
166	0.5	PN	97R	C2410R	-	-	-	-	-	-	-
167	2.5	G	798R	S/JOINT SJ1946	418-096	-	418-116A	418-117	-	418-113	418-108
167	2.5	NO	797R	S/JOINT SJ1999	418-096	-	418-116A	418-117	-	418-113	418-108
167	2.5	N	282R	S/JOINT SJ1013	418-096	-	418-116A	418-117	-	418-113	418-108
168	1.5	RU	797R	S/JOINT SJ1560	418-096	-	418-116A	418-117	-	418-113	418-108
168	1.5	BN	798R	S/JOINT SJ630	418-096	-	418-116A	418-117	-	418-113	418-108
168	1.5	B	282R	C2725R	418-096	-	418-116A	418-117	-	418-113	418-108
170	0.75	N	282R	C0635R	-	-	-	-	-	-	-
170	0.75	P	798R	S/JOINT SJ1866	-	-	-	-	-	-	-
170	1.5	BN	797R	S/JOINT SJ630	418-096	-	418-116A	418-117	-	418-113	418-108
171	1.5	NY	113R	S/JOINT SJ170	418-096	-	418-116A	418-117	-	418-113	418-108
172	2.5	WR	252R	S/JOINT SJ1932	418-096	-	418-116A	418-117	-	418-113	418-108
173	1.0	SK	200R	C2244R	-	-	-	-	-	-	-
175	0.5	R	797R	C2274R	-	-	-	-	-	-	-
178	2.5	PU	419R	C2321R	418-096	-	418-116A	418-117	-	418-113	418-108
179	2.5	PN	97R	C0926	418-096	-	418-116A	418-117	-	418-113	418-108
180	1.5	PY	797R	C3424R	418-096	-	418-116A	418-117	-	418-113	418-108
180	1.5	PY	807R	S/JOINT SJ1062	418-096	-	418-116A	418-117	-	418-113	418-108
181	6.0	GY	200R	C2293	-	-	-	-	-	-	-
185	4.0	NG	200R	C0583R	418-587-06	-	418-116A	418-117	-	418-114	418-

											109
186	6.0	NS	200R	C0583R	-	-	-	-	-	-	-
189	6.0	PW	109R	C0570R	-	-	-	-	-	-	-
191	6.0	YR	798R	C0190R	-	-	-	-	-	-	-

Click here to print

Connector: C0580


CONNECTOR HOUSING NOT SERVICEABLE

Description: Junction box-Central

Location: Behind passenger side of Instrument panel

Qualifier:



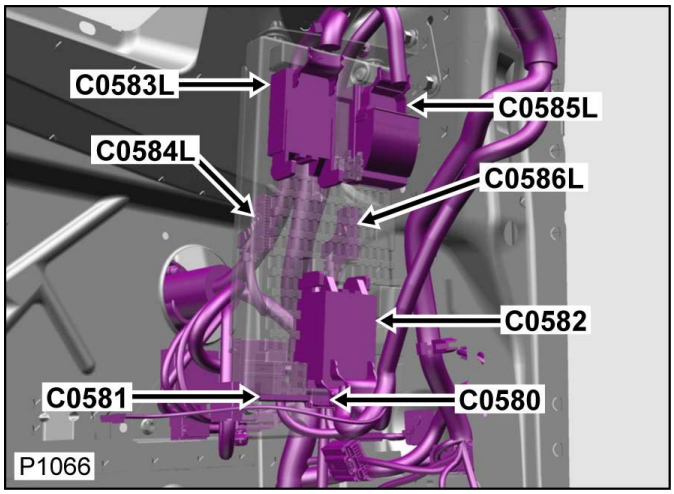

Part No.: YPC803100

Colour: GREY

Cavities: 32WY

Harness: FACIA COMPOSITE HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
2	0.35	G	406L	C1396L
2	0.35	G	406R	C1396R
4	0.35	NW	406L	C2184L
4	0.35	NW	406R	C2184R
7	0.35	WP	499	C0230
11	0.35	RW	499	C0041
12	0.35	Y	499	C0041
15	0.5	BS	139SL	C1167L
15	0.5	BS	139TL	C1168L
15	0.5	BS	200SR	C1167R
15	0.5	BS	200TR	C1167R
16	0.5	BS	139SL	C1168L
16	0.5	R	139TL	C1168L
16	0.5	BS	200SR	C1167R
16	0.5	R	200TR	C1167R
17	0.35	R	139L	C1168L
17	0.35	R	200R	C1167R
18	0.35	R	406L	C1396L
18	0.35	R	406R	C1396R
19	0.5	R	139TL	C0469L
19	0.5	R	200TR	C0469R
21	0.5	YG	216L	C1167L
21	0.5	YG	216R	C1167R
22	0.35	B	139SL	C2453SL
22	0.35	B	139TL	C2453TL
22	0.35	B	200R	C2453R
23	0.35	RO	499	C0041
24	0.35	RO	499	C0041
25	0.5	SN	591L	C1168L
25	0.5	SN	591R	C1168R
26	0.5	PU	134L	C1167L
26	0.5	PU	134R	C1167R

28	0.35	NR	406L	S/JOINT SJ870L
28	0.35	NR	406R	S/JOINT SJ870R
29	0.5	R	499	C0041
32	0.5	R	139L	C1167L
32	0.5	R	200R	C1167R

Click here to print

Connector: C0581


CONNECTOR HOUSING NOT SERVICEABLE

Description: Junction box-Central

Location: Behind passenger side of Instrument panel

Qualifier:



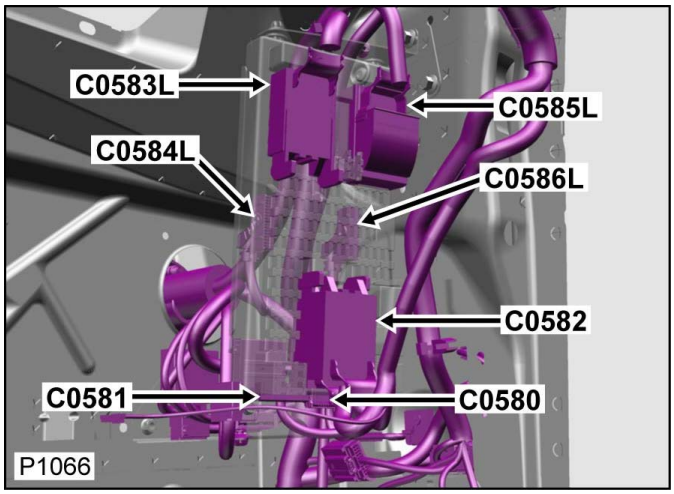

Part No.: YPC803110

Colour: GREY

Cavities: 28WY

Harness: FACIA COMPOSITE HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	GS	90L	C0278L
1	0.35	GS	90R	C0278R
2	0.35	RLG	90L	C0278L
2	0.35	RLG	90R	C0278R
3	0.35	WLG	90L	C0278L
3	0.35	WLG	90R	C0278R
4	0.5	YU	499	S/JOINT SJ976
5	0.5	YW	499	S/JOINT SJ966
6	0.35	GR	139L	C1393L
6	0.35	GR	200R	C1393R
7	0.35	GW	139L	C1393L
7	0.35	GW	200R	C1393R
8	0.35	YK	41L	C0469L
8	0.35	YK	41R	C1168R
9	0.35	KR	41L	C0469L
9	0.35	KR	41R	C1168R
10	0.35	UR	139L	C2209L
10	0.35	UR	200R	C2209R
11	0.35	WS	124	S/JOINT SJ132
11	0.35	WS	125L	C0082L
11	0.35	WS	125R	C0082R
12	0.5	G	139L	S/JOINT SJ223L
12	0.5	G	200R	S/JOINT SJ223R
13	0.5	U	406L	C1396L
13	0.5	U	406R	C1396R
14	0.5	B	406L	C1396L
14	0.5	B	406R	C1396R
15	0.35	LGP	90L	C0278L
15	0.35	LGP	90R	C0278R
17	0.35	UW	139TL	C2453TL
17	0.35	UW	139SL	C2453SL
17	0.35	UW	200R	C2453R

18	0.35	WU	139TL	C2453TL
18	0.35	WU	139SL	C2453SL
18	0.35	WU	200R	C2453R
19	0.35	LGR	139SL	C1629SL
19	0.35	LGR	139TL	C1168L
19	0.35	LGR	200SR	C1629SR
19	0.35	LGR	200TR	C1168R
20	0.35	LGG	139L	C0278L
20	0.35	LGG	200R	C0278R
21	0.35	GY	193L	C0278L
21	0.35	GY	193R	C0278R
22	0.35	UR	139L	C1393L
22	0.35	UR	200R	C1393R
23	0.35	GS	90L	C0278L
23	0.35	GS	90R	C0278R
24	0.35	UR	139L	C1393L
24	0.35	UR	200R	C1393R
25	0.35	R	139L	C1393L
25	0.35	R	200R	C1393R
26	0.35	LG	139L	C0278L
26	0.35	LG	200R	C0278R
27	0.35	LGS	193L	C0278L
27	0.35	LGS	193R	C0278R
28	0.35	R	406L	C1396L
28	0.35	R	406R	C1396R

Click here to print


Connector: C0582


CONNECTOR HOUSING NOT SERVICEABLE

Description: Junction box-Central

Location: Behind passenger side of Instrument panel

Qualifier:

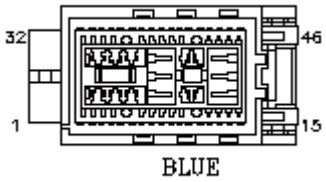

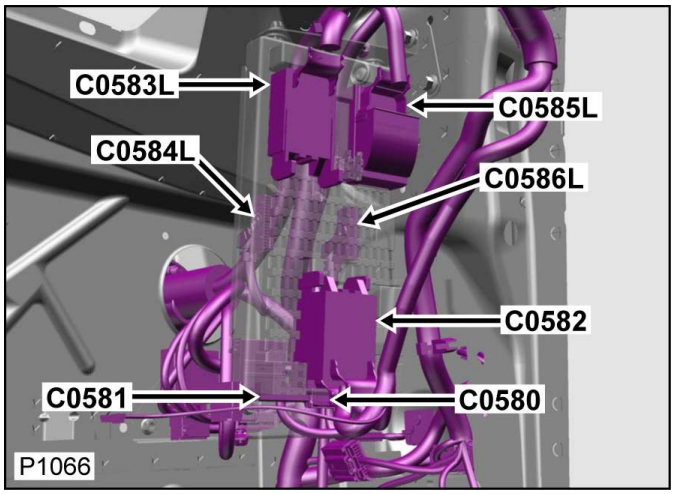

Part No.: YPC801100

Colour: BLUE

Cavities: 46WY

Harness: FACIA COMPOSITE HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	BP	41L	C0469L	-	-	-	-	-	-	-
1	1.5	BP	41R	C0469R	-	-	-	-	-	-	-
2	0.75	P	134	S/JOINT SJ740	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	R	777L	C2055L	-	-	-	-	-	-	-
4	0.5	R	777R	C2055R	-	-	-	-	-	-	-
5	1.5	PU	124	C2115	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
6	1.0	GK	499	S/JOINT SJ552	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
8	0.75	U	124L	C2640L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
8	0.75	U	124R	C2640R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	RY	57	C0040	-	-	-	-	-	-	-
11	1.5	PU	124	S/JOINT SJ131	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
11	1.5	R	125	S/JOINT SJ8	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
12	0.5	G	139L	C1168L	-	-	-	-	-	-	-
12	0.5	G	200R	C1168R	-	-	-	-	-	-	-
13	1.0	GP	499	S/JOINT SJ553	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
15	0.75	LGW	134	S/JOINT SJ14	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
25	0.75	PW	124L	C2640L	418-587-10	-	418-116A	418-117	-	418-112	418-107
25	0.75	PW	124R	C2640R	418-587-10	-	418-116A	418-117	-	418-112	418-107
29	2.5	R	139L	C0469L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
29	2.5	R	200R	C0469R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
30	1.5	LGW	43TL	C0469L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

30	1.5	LGW	43TR	C0469R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
33	1.5	BU	406L	C1396L	-	-	-	-	-	-	-
33	1.5	BU	406R	C1396R	-	-	-	-	-	-	-
34	1.5	UB	406L	C1396L	-	-	-	-	-	-	-
34	1.5	UB	406R	C1396R	-	-	-	-	-	-	-
36	1.5	RB	13SL	C0223L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
36	1.5	RB	13SR	C0469R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
39	0.75	YR	124L	C0469L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
39	0.75	YR	124R	C0469R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
40	0.75	R	139L	C1167L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
40	0.75	R	200R	C1168R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
41	0.75	R	801L	C0374L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
41	0.75	R	801R	C0374R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
43	0.5	G	139L	C1168L	-	-	-	-	-	-	-
43	0.5	G	200R	C0223R	-	-	-	-	-	-	-
44	0.35	GB	139L	C0082L	-	-	-	-	-	-	-
44	0.35	GB	200R	C0082R	-	-	-	-	-	-	-
45	1.0	RW	216L	C0223L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
45	0.75	RW	216R	C1168R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
46	0.5	RU	499	S/JOINT SJ134	-	-	-	-	-	-	-

Click here to print


Connector: C0583L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Junction box-Central

Location: Behind passenger side of Instrument panel

Qualifier:

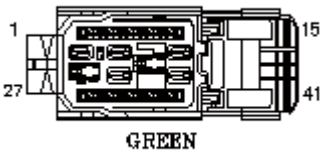

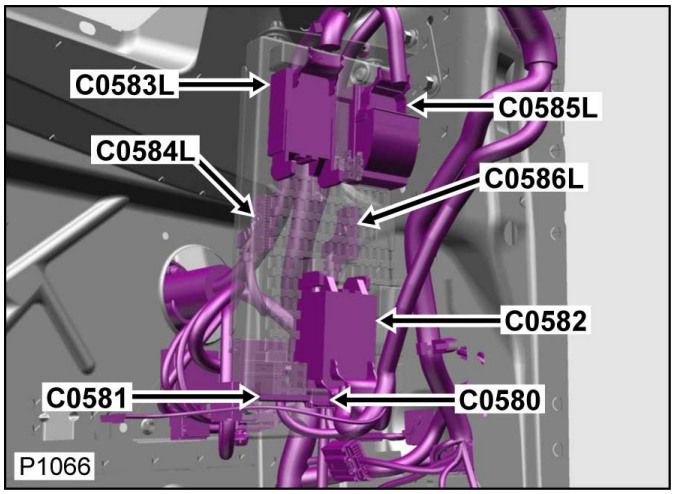

Part No.: YPC801110

Colour: GREEN

Cavities: 41WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	1.5	OB	139L	C0008	-	-	-	-	-	-	-
3	1.5	BO	139L	C0008	-	-	-	-	-	-	-
4	1.5	R	400L	C0009	-	-	-	-	-	-	-
8	0.5	WR	405L	C2025	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.75	LG	413L	S/JOINT SJ109	-	-	-	-	-	-	-
11	1.0	RO	139L	S/JOINT SJ942	-	-	-	-	-	-	-
12	1.0	RB	139L	S/JOINT SJ943	-	-	-	-	-	-	-
13	0.75	LGW	139L	C2412L	-	-	-	-	-	-	-
14	0.5	PO	139L	C0570L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
16	4.0	NG	139L	C0570L	-	-	-	-	-	-	-
20	4.0	NU	139L	C0570L	-	-	-	-	-	-	-
21	6.0	NS	139L	C0570L	-	-	-	-	-	-	-
22	6.0	NR	139L	C0570L	-	-	-	-	-	-	-
24	0.5	B	139L	C0666L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
27	1.5	UP	93L	C2277	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
28	1.5	US	139L	C0009	-	-	-	-	-	-	-
29	1.5	UO	139L	C0011	-	-	-	-	-	-	-
30	1.5	R	400L	C0011	-	-	-	-	-	-	-
31	1.0	OB	139L	C0520L	-	-	-	-	-	-	-
32	1.5	GR	139L	C0009	-	-	-	-	-	-	-
33	0.5	GO	139L	C0011	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
34	1.5	UB	139L	C0011	-	-	-	-	-	-	-
35	0.5	GO	139L	C0009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
37	1.5	GW	139L	C0011	-	-	-	-	-	-	-
38	1.5	UK	139L	C0009	-	-	-	-	-	-	-

39	0.5	RO	404L	C0011	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
40	0.5	RB	404L	C0009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C0583R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Junction box-Central

Location: Behind passenger side of Instrument panel

Qualifier:

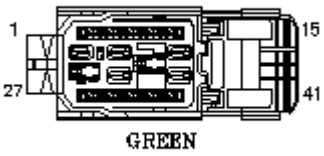

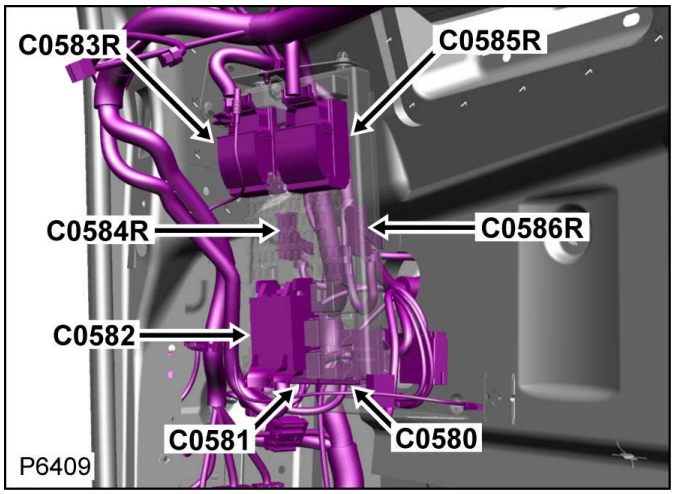

Part No.: YPC801110

Colour: GREEN

Cavities: 41WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	1.5	OB	200R	C0008	-	-	-	-	-	-	-
3	1.5	BO	200R	C0008	-	-	-	-	-	-	-
4	1.5	R	400R	C0009	-	-	-	-	-	-	-
8	0.5	WR	405R	C2025	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.75	LG	413R	S/JOINT SJ1109	-	-	-	-	-	-	-
11	1.0	RO	200R	S/JOINT SJ942	-	-	-	-	-	-	-
12	1.0	RB	200R	S/JOINT SJ943	-	-	-	-	-	-	-
13	0.75	LGW	200R	C2244R	-	-	-	-	-	-	-
14	0.5	PO	200R	C0570R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
16	4.0	NG	200R	C0570R	-	-	-	-	-	-	-
20	4.0	NU	200R	C0570R	-	-	-	-	-	-	-
21	6.0	NS	200R	C0570R	-	-	-	-	-	-	-
22	6.0	NR	200R	C0570R	-	-	-	-	-	-	-
24	0.5	B	200R	C0666R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
27	1.5	UP	93R	C2277	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
28	1.5	US	200R	C0009	-	-	-	-	-	-	-
29	1.5	UO	200R	C0011	-	-	-	-	-	-	-
30	1.5	R	400R	C0011	-	-	-	-	-	-	-
31	1.0	OB	200R	C0520R	-	-	-	-	-	-	-
32	1.5	GR	200R	C0009	-	-	-	-	-	-	-
33	0.5	GO	200R	C0011	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
34	1.5	UB	200R	C0011	-	-	-	-	-	-	-
35	0.5	GO	200R	C0009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
37	1.5	GW	200R	C0011	-	-	-	-	-	-	-
38	1.5	UK	200R	C0009	-	-	-	-	-	-	-

39	0.5	RO	404R	C0011	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
40	0.5	RB	404R	C0009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C0584L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Junction box-Central

Location: Behind passenger side of Instrument panel

Qualifier:



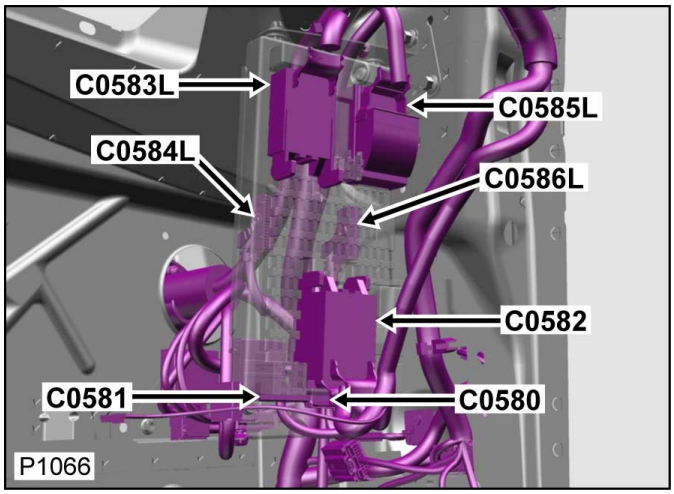

Part No.: YPC801120

Colour: GREEN

Cavities: 32WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	UN	591L	C2199	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.75	NW	591L	C2199	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	UN	807L	C3180L	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	LGR	139L	S/JOINT SJ3	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.35	B	139L	C0007	-	-	-	-	-	-	-
7	0.35	WO	139L	C0147	-	-	-	-	-	-	-
8	0.5	BP	798L	C0658L	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.5	BP	797L	C0872L	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.5	YB	139L	S/JOINT SJ775	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.5	YN	139L	S/JOINT SJ785	418-411-45	-	418-116A	418-117	-	418-112	418-107
12	0.5	NR	139L	C2444L	418-411-45	-	418-116A	418-117	-	418-112	418-107
13	0.5	UP	139L	C0570L	418-411-45	-	418-116A	418-117	-	418-112	418-107
14	0.75	PN	591L	C2198	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.75	Y	591L	C2198	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.75	BR	825L	C2293	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.5	NO	139L	C0570L	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.5	WG	798L	C0658L	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.5	WG	282L	C0635L	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.5	WR	797L	S/JOINT SJ479	418-411-45	-	418-116A	418-117	-	418-112	418-107

19	0.5	WR	282L	C0635L	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	0.35	SP	139L	C0026L	-	-	-	-	-	-	-
22	0.35	P	139L	C0620	-	-	-	-	-	-	-
23	0.75	S	798L	C3070L	418-411-45	-	418-116A	418-117	-	418-112	418-107
23	0.75	BG	797L	C2274L	418-411-45	-	418-116A	418-117	-	418-112	418-107
24	0.5	WG	139L	C0030L	418-411-45	-	418-116A	418-117	-	418-112	418-107
25	0.5	R	139L	C0570L	418-411-45	-	418-116A	418-117	-	418-112	418-107
26	0.5	GR	183L	C0570L	418-411-45	-	418-116A	418-117	-	418-112	418-107
27	0.5	PU	139L	C0570L	418-411-45	-	418-116A	418-117	-	418-112	418-107
28	0.35	NG	139L	S/JOINT SJ945	-	-	-	-	-	-	-
29	0.5	N	109L	C0570L	418-411-45	-	418-116A	418-117	-	418-112	418-107
30	0.5	G	183L	C0570L	418-411-45	-	418-116A	418-117	-	418-112	418-107
31	0.5	YG	377L	S/JOINT SJ12	418-411-45	-	418-116A	418-117	-	418-112	418-107
32	0.75	R	825L	C2293	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0584R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Junction box-Central

Location: Behind passenger side of Instrument panel

Qualifier:



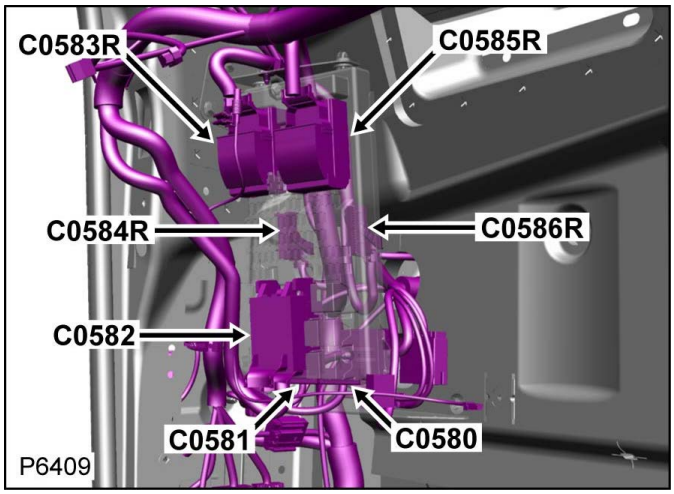

Part No.: YPC801120

Colour: GREEN

Cavities: 32WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	UN	591R	C2199	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.75	NW	591R	C2199	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	UN	807R	C3180R	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	LGR	200R	S/JOINT SJ1003	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.35	B	200R	C0007	-	-	-	-	-	-	-
7	0.35	WO	200R	C0147	-	-	-	-	-	-	-
8	0.5	BP	798R	C0658R	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.5	BP	797R	C0872R	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.5	YB	200R	S/JOINT SJ1775	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.5	YN	200R	S/JOINT SJ1785	418-411-45	-	418-116A	418-117	-	418-112	418-107
12	0.5	NR	200R	C2240R	418-411-45	-	418-116A	418-117	-	418-112	418-107
13	0.5	UP	200R	C0570R	418-411-45	-	418-116A	418-117	-	418-112	418-107
14	0.75	PN	591R	C2198	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.75	Y	591R	C2198	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.75	BR	825R	C3009	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.5	NO	200R	C0570R	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.5	WG	798R	C0658R	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.5	WG	282R	C0635R	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.5	WG	797R	S/JOINT SJ1479	418-411-45	-	418-116A	418-117	-	418-112	418-107

19	0.5	WR	282R	C0635R	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	0.35	SP	200R	C0026R	-	-	-	-	-	-	-
22	0.35	P	200R	C0620	-	-	-	-	-	-	-
23	0.75	S	798R	C3070R	418-411-45	-	418-116A	418-117	-	418-112	418-107
23	0.75	BG	797R	C2274R	418-411-45	-	418-116A	418-117	-	418-112	418-107
24	0.5	WG	200R	C0030R	418-411-45	-	418-116A	418-117	-	418-112	418-107
25	0.5	R	200R	C0570R	418-411-45	-	418-116A	418-117	-	418-112	418-107
26	0.5	GR	183R	C0570R	418-411-45	-	418-116A	418-117	-	418-112	418-107
27	0.5	PU	200R	C0570R	418-411-45	-	418-116A	418-117	-	418-112	418-107
28	0.35	NG	200R	S/JOINT SJ1945	-	-	-	-	-	-	-
29	0.5	N	109R	C0570R	418-411-45	-	418-116A	418-117	-	418-112	418-107
30	0.5	G	183R	C0570R	418-411-45	-	418-116A	418-117	-	418-112	418-107
31	0.5	YG	377R	S/JOINT SJ1012	418-411-45	-	418-116A	418-117	-	418-112	418-107
32	0.75	R	825R	C3009	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0585L

CONNECTOR HOUSING NOT SERVICEABLE

Description: Junction box-Central

Location: Behind passenger side of Instrument panel

Qualifier:

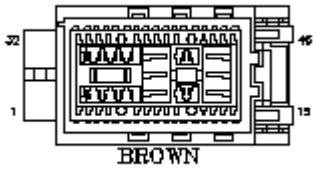


Part No.: YPC801240

Colour: BROWN

Cavities: 46WY

Harness: CABIN HARNESS

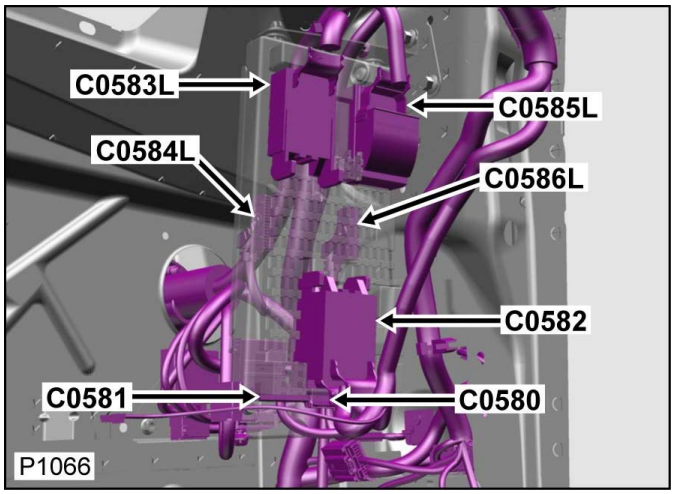

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	U	162SL	C1642S	-	-	-	-	-	-	-
1	1.5	U	162TL	C1389T	-	-	-	-	-	-	-
2	1.5	RY	139SL	C0121S	-	-	-	-	-	-	-
2	1.5	RY	139TL	C0121T	-	-	-	-	-	-	-
3	1.5	G	139SL	C1642S	-	-	-	-	-	-	-
3	1.5	G	162TL	C1390T	-	-	-	-	-	-	-
3	1.5	G	319TL	C1389T	-	-	-	-	-	-	-
5	2.5	B	139L	C1971	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
6	1.0	WO	41L	C3007	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
7	1.5	Y	139SL	C1642S	-	-	-	-	-	-	-
7	1.5	Y	162TL	C1390T	-	-	-	-	-	-	-
7	1.5	Y	319TL	C1389T	-	-	-	-	-	-	-
8	0.75	GP	139SL	C0121S	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
8	0.75	GP	139TL	C0121T	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	1.5	GR	139SL	C0121S	-	-	-	-	-	-	-
9	1.5	GR	139TL	C0121T	-	-	-	-	-	-	-
10	1.5	GW	139SL	C0125S	-	-	-	-	-	-	-
10	1.5	GW	139TL	C0125T	-	-	-	-	-	-	-
11	1.5	LGW	43SL	C0868S	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
12	1.5	R	139SL	C1642S	-	-	-	-	-	-	-
12	1.5	R	162TL	C1389T	-	-	-	-	-	-	-
13	1.5	R	139L	S/JOINT SJ260	-	-	-	-	-	-	-
14	0.75	LGW	419L	C0867L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
15	0.5	R	139L	C0376	-	-	-	-	-	-	-
16	2.5	GR	139L	C0436	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

19	2.5	UK	139SL	C0473S	418-587-15	-	418-116A	418-117	-	418-113	418-108
19	2.5	UK	139TL	C1388T	418-587-15	-	418-116A	418-117	-	418-113	418-108
20	1.5	NR	227SL	C0784S	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
20	1.5	NR	227TL	C0784T	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
21	2.5	PG	139L	S/JOINT SJ222	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
23	4.0	NP	111SL	C0117S	-	-	-	-	-	-	-
23	4.0	NP	139TL	C2959T	-	-	-	-	-	-	-
24	2.5	NP	139L	C2368	418-587-15	-	418-116A	418-117	-	418-113	418-108
25	2.5	B	139L	C1971	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
26	2.5	YR	139L	C0398	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
30	2.5	R	139L	C0396	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
31	4.0	NP	139L	S/JOINT SJ3002	-	-	-	-	-	-	-
32	1.0	B	98SL	C0690S	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
32	1.0	B	98TL	C0690T	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
33	0.75	GP	139SL	C0125S	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
33	0.75	GP	139TL	C0125T	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
34	1.0	B	98SL	C0690S	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
34	1.0	B	98TL	C0690T	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
35	1.5	YN	139SL	C1642S	-	-	-	-	-	-	-
35	1.5	YN	162TL	C1388T	-	-	-	-	-	-	-
35	1.5	YN	319TL	C1389T	-	-	-	-	-	-	-
36	2.5	UR	139L	C0435	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
37	0.5	RU	139L	S/JOINT SJ206	-	-	-	-	-	-	-
38	1.5	RY	139SL	C0125S	-	-	-	-	-	-	-
38	1.5	RY	139TL	C0125T	-	-	-	-	-	-	-
40	1.5	GN	139L	S/JOINT SJ7	-	-	-	-	-	-	-
41	0.5	PY	139L	C2411L	-	-	-	-	-	-	-
43	0.5	NR	810SL	C2428S	-	-	-	-	-	-	-
43	0.5	NR	810TL	C2428T	-	-	-	-	-	-	-
44	1.5	N	319L	S/JOINT SJ318	-	-	-	-	-	-	-
44	1.5	N	162SL	C1642S	-	-	-	-	-	-	-
44	1.5	N	162TL	S/JOINT SJ571T	-	-	-	-	-	-	-
45	0.5	WY	139L	C2411L	-	-	-	-	-	-	-
46	1.5	OG	139SL	S/JOINT SJ396S	-	-	-	-	-	-	-
46	1.5	OG	139TL	S/JOINT SJ396T	-	-	-	-	-	-	-

Click here to print


Connector: C0585R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Junction box-Central

Location: Behind passenger side of Instrument panel

Qualifier:

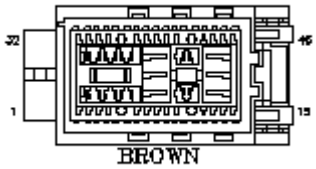

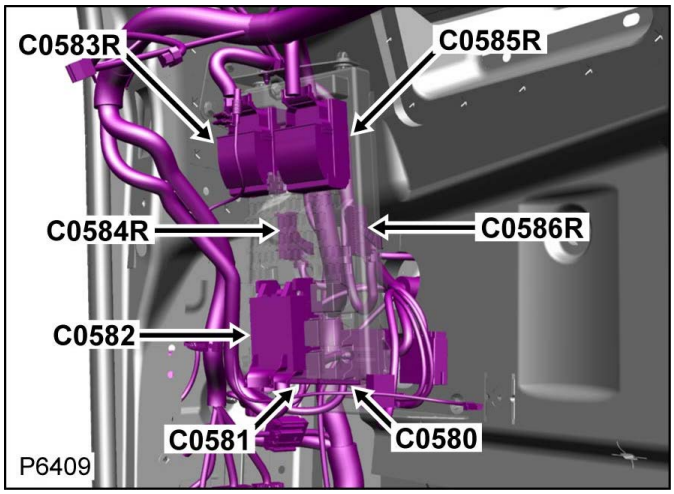

Part No.: YPC801240

Colour: BROWN

Cavities: 46WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	U	200SR	C1642S	-	-	-	-	-	-	-
1	1.5	U	200TR	C1389T	-	-	-	-	-	-	-
2	1.5	RY	200SR	C0121S	-	-	-	-	-	-	-
2	1.5	RY	200TR	C0121T	-	-	-	-	-	-	-
3	1.5	G	200SR	C1642S	-	-	-	-	-	-	-
3	1.5	G	200TR	C1390T	-	-	-	-	-	-	-
5	2.5	B	200R	C0807	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
6	1.0	WO	41R	C3007	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
7	1.5	Y	200SR	C1642S	-	-	-	-	-	-	-
7	1.5	Y	200TR	C1390T	-	-	-	-	-	-	-
8	0.75	GP	200SR	C0121S	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
8	0.75	GP	200TR	C0121T	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	1.5	GR	200SR	C0121S	-	-	-	-	-	-	-
9	1.5	GR	200TR	C0121T	-	-	-	-	-	-	-
10	1.5	GW	200SR	C0125S	-	-	-	-	-	-	-
10	1.5	GW	200TR	C0125T	-	-	-	-	-	-	-
11	1.5	LGW	43SR	C0868S	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
12	1.5	R	200SR	C1642S	-	-	-	-	-	-	-
12	1.5	R	200TR	C1389T	-	-	-	-	-	-	-
13	1.5	R	200R	S/JOINT SJ1260	-	-	-	-	-	-	-
14	0.75	LGW	419R	C0867R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
15	0.5	R	200R	C0376	-	-	-	-	-	-	-
16	2.5	GR	200R	C0436	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
19	2.5	UK	200SR	C0473S	418-587-15	-	418-116A	418-117	-	418-113	418-108
											418-

19	2.5	UK	200TR	C1388T	418-587-15	-	418-116A	418-117	-	418-113	108
20	1.5	NR	227SR	C0784S	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
20	1.5	NR	227TR	C0784T	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
21	2.5	PG	200R	S/JOINT SJ222	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
23	4.0	NP	111SR	C0117S	-	-	-	-	-	-	-
23	4.0	NP	200TR	C2959T	-	-	-	-	-	-	-
24	2.5	NP	200R	C2378	418-587-15	-	418-116A	418-117	-	418-113	418-108
25	2.5	B	200R	C0807	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
26	2.5	YR	200R	C0396	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
30	2.5	R	200R	C0398	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
31	4.0	NP	200R	S/JOINT SJ3004	-	-	-	-	-	-	-
32	1.0	B	41SR	C0690S	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
32	1.0	B	41TR	C0690T	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
33	0.75	GP	200SR	C0125S	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
33	0.75	GP	200TR	C0125T	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
34	1.0	B	41SR	C0690S	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
34	1.0	B	41TR	C0690T	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
35	1.5	YN	200SR	C1642S	-	-	-	-	-	-	-
35	1.5	YN	200TR	C1388T	-	-	-	-	-	-	-
36	2.5	UR	200R	C0435	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
37	0.5	RU	200R	S/JOINT SJ206	-	-	-	-	-	-	-
38	1.5	RY	200SR	C0125S	-	-	-	-	-	-	-
38	1.5	RY	200TR	C0125T	-	-	-	-	-	-	-
40	1.5	GN	200R	S/JOINT SJ7	-	-	-	-	-	-	-
41	0.5	PY	200R	C2409R	-	-	-	-	-	-	-
43	0.5	NR	810SR	C2428S	-	-	-	-	-	-	-
43	0.5	NR	810TR	C2428T	-	-	-	-	-	-	-
44	1.5	N	200SR	C1642S	-	-	-	-	-	-	-
44	1.5	N	200TR	S/JOINT SJ571T	-	-	-	-	-	-	-
45	0.5	WY	200R	C2242R	-	-	-	-	-	-	-
46	1.5	OG	200SR	S/JOINT SJ396S	-	-	-	-	-	-	-
46	1.5	OG	200TR	S/JOINT SJ396T	-	-	-	-	-	-	-

Click here to print


Connector: C0586L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Junction box-Central

Location: Behind passenger side of Instrument panel

Qualifier:

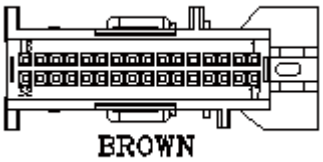

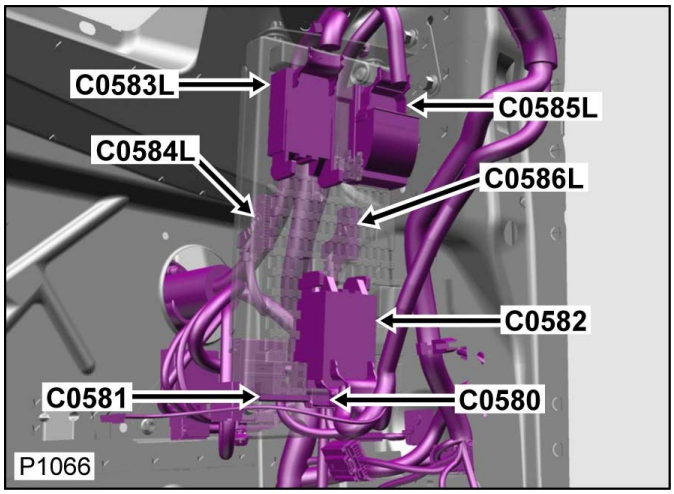

Part No.: YPC908350

Colour: BROWN

Cavities: 32WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	NG	193SL	C0117S	418-411-45	-	418-116A	418-117	-	418-112	418-107
1	0.5	NG	139TL	C2739T	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.35	WK	419L	C0867L	-	-	-	-	-	-	-
4	0.5	G	139L	C0376	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.5	GP	139L	C2411L	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.5	BK	139L	C0376	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.35	O	162L	C2368	-	-	-	-	-	-	-
11	0.35	BN	139L	C0396	-	-	-	-	-	-	-
12	0.35	W	139L	C0398	-	-	-	-	-	-	-
13	0.5	GO	28L	C2411L	418-411-45	-	418-116A	418-117	-	418-112	418-107
14	0.5	R	139L	C0376	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.5	LG	139L	C2242L	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.5	P	139L	S/JOINT SJ227	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.75	GP	139SL	C0117S	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.75	GP	139TL	C2739T	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.75	UO	591L	C2200	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.75	NY	591L	C2200	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.35	WU	139L	C0376	-	-	-	-	-	-	-
21	0.35	WR	139L	C0376	-	-	-	-	-	-	-
23	0.75	B	139SL	C0616S	418-411-45	-	418-116A	418-117	-	418-112	418-107
23	0.75	KR	139TL	C2739T	418-411-45	-	418-116A	418-117	-	418-112	418-107

25	0.35	PLG	139L	C0435	-	-	-	-	-	-	-
26	0.35	PLG	139L	C0436	-	-	-	-	-	-	-
27	0.5	SP	193SL	C2937S	418-411-45	-	418-116A	418-117	-	418-112	418-107
27	0.5	SP	193TL	C2937T	418-411-45	-	418-116A	418-117	-	418-112	418-107
28	0.5	W	139SL	C2937S	418-411-45	-	418-116A	418-117	-	418-112	418-107
28	0.5	B	139TL	C2937T	418-411-45	-	418-116A	418-117	-	418-112	418-107
30	0.75	SP	591SL	C2201S	418-411-45	-	418-116A	418-117	-	418-112	418-107
30	0.75	SP	591TL	C2201T	418-411-45	-	418-116A	418-117	-	418-112	418-107
31	0.75	NG	591SL	C2201S	418-411-45	-	418-116A	418-117	-	418-112	418-107
31	0.75	NG	591TL	C2201T	418-411-45	-	418-116A	418-117	-	418-112	418-107
32	0.5	RN	139L	S/JOINT SJ52	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0586R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Junction box-Central

Location: Behind passenger side of Instrument panel

Qualifier:

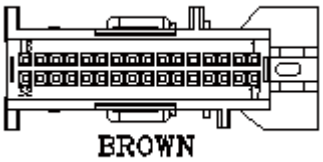

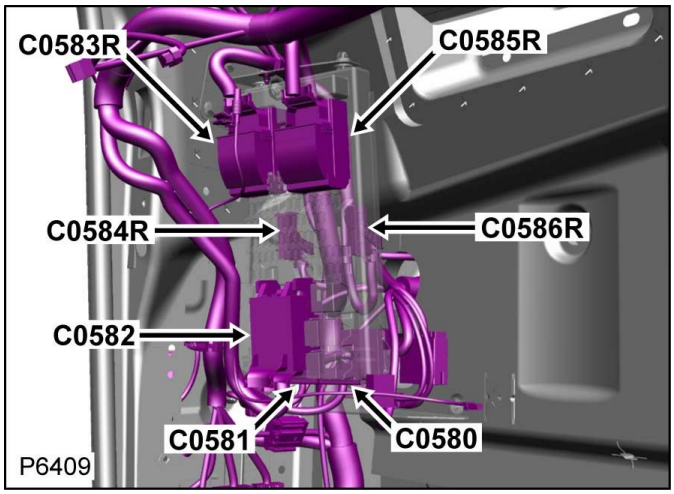

Part No.: YPC908350

Colour: BROWN

Cavities: 32WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	NG	193SR	C0117S	418-411-45	-	418-116A	418-117	-	418-112	418-107
1	0.5	NG	200TR	C2739T	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.35	WK	419R	C0867R	-	-	-	-	-	-	-
4	0.5	G	200R	C0376	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.5	GP	200R	C2243R	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.5	BK	200R	C0376	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.35	O	200R	C2378	-	-	-	-	-	-	-
11	0.35	BN	200R	C0398	-	-	-	-	-	-	-
12	0.35	W	200R	C0396	-	-	-	-	-	-	-
13	0.5	GO	28R	C2242R	418-411-45	-	418-116A	418-117	-	418-112	418-107
14	0.5	R	200R	C0376	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.5	LG	200R	C2242R	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.5	P	200R	S/JOINT SJ227	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.75	GP	200SR	C0117S	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.75	GP	200TR	C2739T	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.75	UO	591R	C2200	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.75	NY	591R	C2200	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.35	WU	200R	C0376	-	-	-	-	-	-	-
21	0.35	WR	200R	C0376	-	-	-	-	-	-	-
23	0.75	B	200SR	C0616S	418-411-45	-	418-116A	418-117	-	418-112	418-107
23	0.75	KR	200TR	C2739T	418-411-45	-	418-116A	418-117	-	418-112	418-107

25	0.35	PLG	200R	C0435	-	-	-	-	-	-	-
26	0.35	PLG	200R	C0436	-	-	-	-	-	-	-
27	0.5	SP	193SR	C2937S	418-411-45	-	418-116A	418-117	-	418-112	418-107
27	0.5	SP	193TR	C2937T	418-411-45	-	418-116A	418-117	-	418-112	418-107
28	0.5	W	200SR	C2937S	418-411-45	-	418-116A	418-117	-	418-112	418-107
28	0.5	B	200TR	C2937T	418-411-45	-	418-116A	418-117	-	418-112	418-107
30	0.75	SP	591SR	C2201S	418-411-45	-	418-116A	418-117	-	418-112	418-107
30	0.75	SP	591TR	C2201T	418-411-45	-	418-116A	418-117	-	418-112	418-107
31	0.75	NG	591SR	C2201S	418-411-45	-	418-116A	418-117	-	418-112	418-107
31	0.75	NG	591TR	C2201T	418-411-45	-	418-116A	418-117	-	418-112	418-107
32	0.5	RN	200R	S/JOINT SJ52	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0610

CONNECTOR HOUSING NOT SERVICEABLE

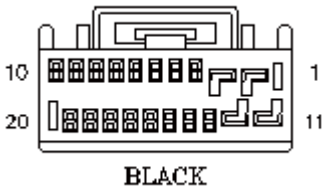

Part No.: YPC900780

Colour: BLACK


Cavities: 20WY

Harness: ROOF HARNESS

Description: Roof harness to main harness

Location: RH 'A' post

Qualifier:

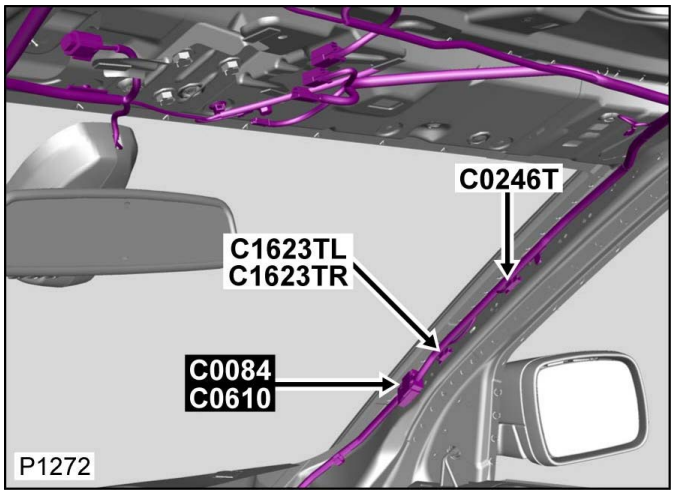


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	NY	420	C0311	-	-	-	-	-	-	-
2	1.5	WG	420	C0311	-	-	-	-	-	-	-
3	0.35	OY	227	C0357	-	-	-	-	-	-	-
5	0.5	RN	134	S/JOINT SJ237	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
6	1.0	LGW	134	S/JOINT SJ234	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
7	0.75	P	134	C0355	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
8	1.0	B	499	S/JOINT SJ275	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
11	1.5	NU	420	C0309	-	-	-	-	-	-	-
12	1.5	NW	420	C0309	-	-	-	-	-	-	-
14	0.5	R	22	C0358	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
15	0.5	G	22	C0358	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
16	0.5	PU	134	C0355	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
17	0.5	B	124	C1462	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
18	0.5	R	124	C1462	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
20	0.35	GW	227	C0357	-	-	-	-	-	-	-

Click here to print

Connector: **C0615**

CONNECTOR HOUSING SERVICEABLE

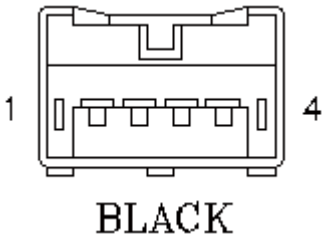

Part No.: YPC906730

Colour: BLACK


Cavities: 4WY

Harness: TAILGATE HARNESS

Description: Switch-Tail door-open

Location: Center of taildoor, behind trim panel

Qualifier:

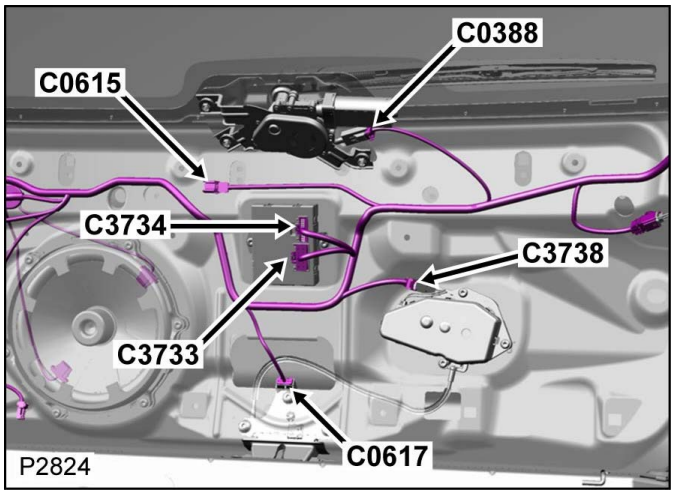

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	499	C2740	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.75	B	499	S/JOINT SJ628	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	499	C0384	418-411-47	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0617


CONNECTOR HOUSING NOT SERVICEABLE

Description: Motor-CDL-Tailgate-Upper

Location: Center of taildoor, behind trim panel

Qualifier:

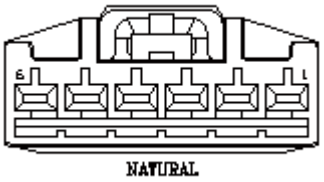

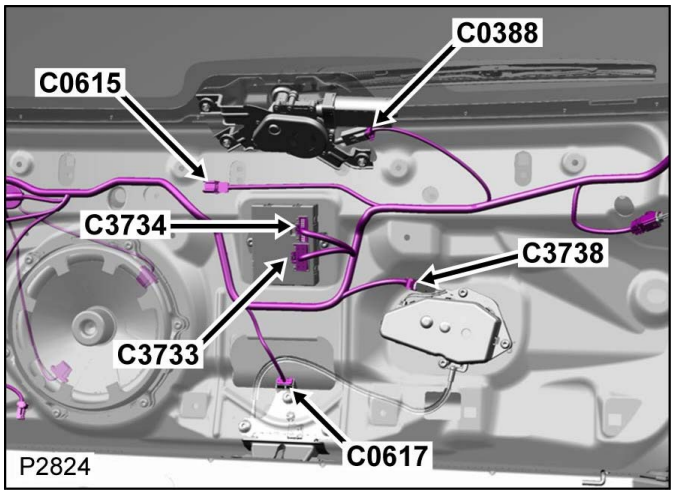

Part No.: YPC801210

Colour: NATURAL

Cavities: 6WY

Harness: TAILGATE HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	499	C2740	-	-	-	-	-	-	-
3	0.5	B	499	C3734	-	-	-	-	-	-	-
5	0.5	B	499	S/JOINT SJ628	-	-	-	-	-	-	-
6	0.75	B	499	C2740	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0620**

CONNECTOR HOUSING SERVICEABLE

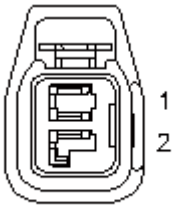

BLACK

Part No.: YPC906370

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Sensor-Washer fluid level

Location: Behind LH front fender splash shield

Qualifier:

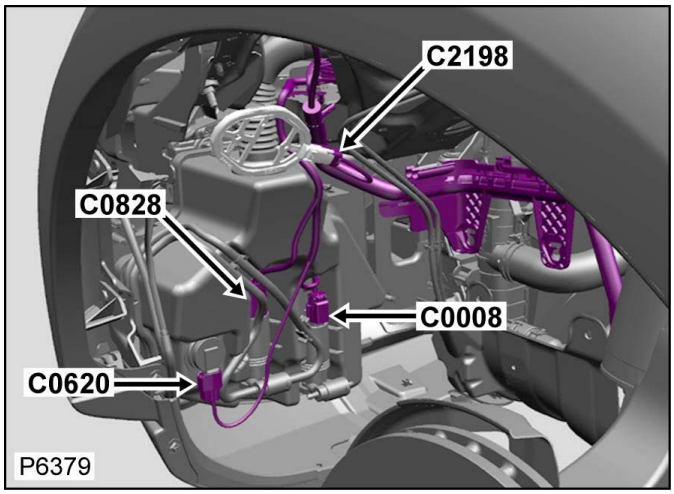

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	P	139L	C0584L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.35	P	200R	C0584R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	499	S/JOINT SJ171	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0632


CONNECTOR HOUSING NOT SERVICEABLE

Description: Junction-box engine

Location: Rear LH side of engine compartment

Qualifier:



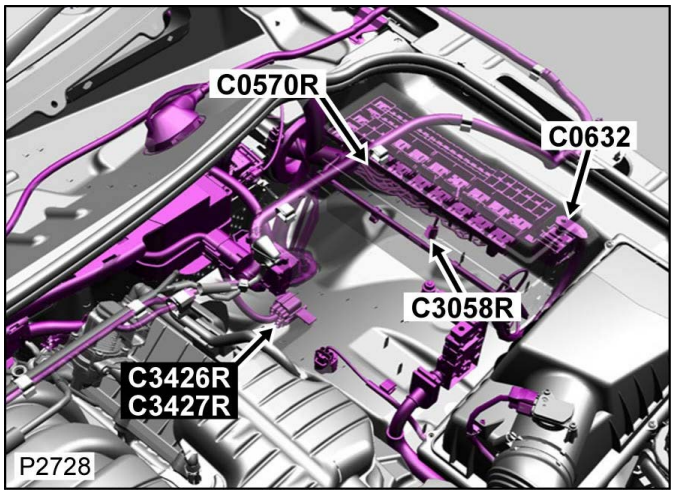

Part No.: YPG800330

Colour: TIN PLATED

Cavities: 1WY

Harness: BATTERY TO FUSEBOX RHD HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	35.0	R	499	C1641

Click here to print


Connector: C0634


CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine control-module (ECM) - PV8

Location: Rear LH side of engine compartment

Qualifier:

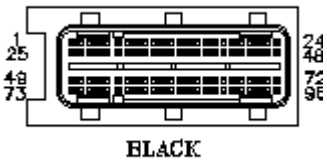

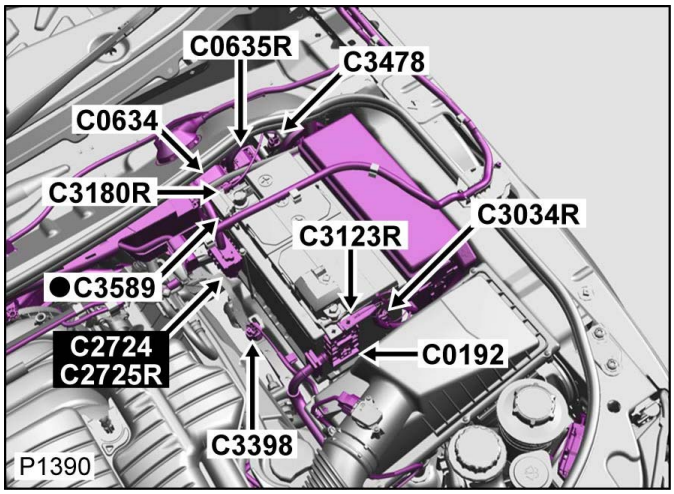

Part No.: YPC913120

Colour: BLACK

Cavities: 96WY

Harness: ENGINE PETROL AJ133 HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	GW	ALL	C0525
2	1.0	YO	ALL	C0528
3	1.0	P	ALL	C0526
4	1.0	SY	ALL	C0524
5	1.0	PO	ALL	C0529
6	0.5	WR	ALL	S/JOINT PIS42
7	0.5	NU	ALL	S/JOINT PIS31
8	0.5	GN	ALL	S/JOINT PIS06
9	0.5	YP	ALL	S/JOINT PIS07
10	0.5	GP	ALL	S/JOINT PIS08
11	0.5	PG	ALL	C0645
12	0.5	WU	ALL	C0644
13	0.5	NG	ALL	S/JOINT PIS43
14	0.5	B	ALL	S/JOINT PIS10
15	0.5	BU	ALL	C0149
16	0.5	BU	ALL	C2454
17	0.5	UN	ALL	C2467
18	0.5	WN	ALL	C0909
19	0.5	NG	ALL	C0909
20	0.5	W	ALL	C0909
21	0.5	G	ALL	C0909
22	0.5	SY	ALL	C3050
23	0.5	WN	ALL	S/JOINT PIS29
24	1.0	SP	ALL	C0644
25	1.0	NP	ALL	C0525
26	1.0	U	ALL	C0528
27	1.0	GP	ALL	C0526
28	1.0	UO	ALL	C0524
29	1.0	WO	ALL	C0529
30	0.5	NR	ALL	C0168
31	0.5	WG	ALL	C3484
32	0.5	YU	ALL	C3486


33	0.5	N	ALL	C3483
34	0.5	P	ALL	C3485
35	0.5	YG	ALL	C0645
36	0.5	SN	ALL	C0644
37	0.5	US	(EN_RY)	C2258
38	0.5	U	ALL	C2467
39	0.5	BR	ALL	C2454
40	0.5	Y	ALL	C3552
42	0.5	PO	ALL	C0909
43	0.5	NU	ALL	C0909
44	0.5	P	ALL	C0909
45	0.5	U	ALL	C0909
46	0.5	Y	ALL	C0175
47	0.5	GN	ALL	S/JOINT PIS30
48	1.0	GN	ALL	C0645
49	1.0	YU	ALL	C0522
50	1.0	UW	ALL	C0527
51	1.0	WG	ALL	C0523
52	1.0	SO	ALL	C0204
53	1.0	WN	ALL	C0205
54	0.5	UN	ALL	C2088
55	0.5	GP	ALL	C2087
56	0.5	YS	ALL	C1772
57	0.5	UO	ALL	C1771
58	0.5	PN	ALL	C1770
59	0.5	YU	ALL	C0276
60	0.5	WN	ALL	C0052
61	0.5	WP	ALL	C0156
63	0.5	UO	ALL	C3050
65	0.5	N	ALL	C0175
66	0.5	UO	ALL	C0175
67	0.5	GP	ALL	C0175
68	0.5	Y	ALL	C0169
69	0.5	S	ALL	C0186
70	0.5	BG	ALL	C0149
71	0.5	BG	ALL	C2454
72	1.0	UG	ALL	C0175
73	1.0	GU	ALL	C0522
74	1.0	SN	ALL	C0527
75	1.0	N	ALL	C0523
76	1.0	YS	ALL	C0204
77	1.0	GU	ALL	C0205
80	0.5	WU	(LRR)	C2724
81	0.5	SY	(LRR)	C2724
82	0.5	BR	ALL	C0149
83	0.5	SO	(EN_RY)	C2258
84	0.5	P	(LR-T5)	C2724
85	0.5	G	ALL	C0909
86	0.5	PN	ALL	C3490
87	0.5	WG	ALL	C3492
88	0.5	PS	ALL	C3491
89	0.5	WO	ALL	C3493

90	0.5	Y	(EN_RX)	C3488
92	0.5	O	(EN_RX)	C3489
94	0.5	WN	ALL	C0152
95	0.5	UN	ALL	C0053
96	1.0	YP	ALL	C0175

Click here to print

Connector: C0635L

CONNECTOR HOUSING SERVICEABLE

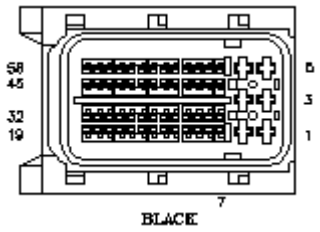

Part No.: YPC803530

Colour: BLACK


Cavities: 58WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine control-module (ECM) - PV8

Location: Rear RH side of engine compartment

Qualifier:

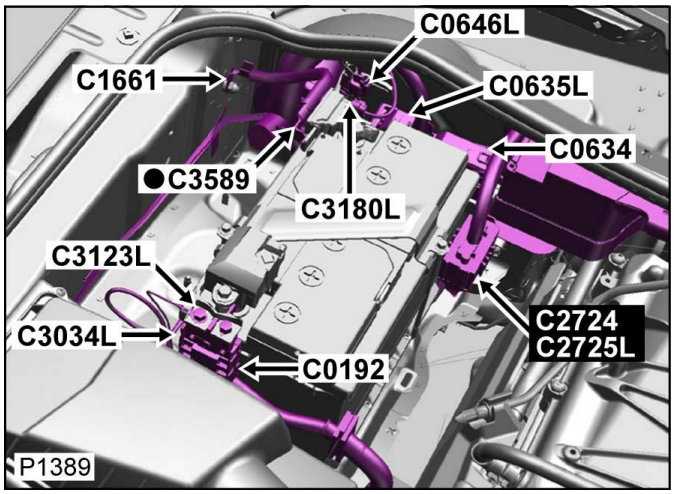

Wire Chart


CAV	CSA	COL	CCT	DESTN
1	2.5	B	252L	C3557L
2	2.5	B	252L	C3557L
3	2.5	B	252L	C2650L
4	0.5	BN	282L	S/JOINT SJ939
5	2.5	N	282L	S/JOINT SJ7
6	2.5	N	282L	S/JOINT SJ7
7	0.5	RB	282L	C3426L
8	0.5	RB	282L	C3426L
9	0.5	B	282L	C0570L
11	0.5	B	282L	C0570L
12	0.5	YR	282L	C0787L
13	0.5	BG	282L	C0787L
14	0.5	WG	282L	C0584L
15	0.5	B	282L	C0570L
17	0.5	WY	282L	C2412L
18	0.5	G	282L	C2725L
19	0.5	WR	282L	C0584L
20	0.5	U	282L	C3426L
21	0.5	WU	282L	C3426L
24	0.5	WU	282L	C2244L
25	0.5	RB	282L	C0787L
26	0.5	U	282L	C0787L
28	0.5	UR	282L	C2412L
29	0.5	YG	252L	C3126
30	0.5	YG	282L	C2244L
31	0.5	OY	282L	C0787L
32	0.5	R	252L	C0787L
33	0.75	WG	282L	S/JOINT SJ812
34	0.5	R	319L	C2293
35	0.5	B	374L	C0570L
36	0.5	GO	282L	S/JOINT SJ905
37	0.5	PG	282L	S/JOINT SJ814

40	0.75	UR	252L	S/JOINT SJ174
41	0.5	N	282L	C2240L
43	0.75	PY	282L	C0570L
45	0.5	YB	822L	S/JOINT SJ177
45	0.5	YB	999L	S/JOINT SJ1005
45	0.5	YB	1009L	S/JOINT SJ775
46	0.75	N	282L	C0570L
47	0.75	WO	282L	C3426L
48	0.75	WP	282L	C3426L
52	0.5	G	319L	C2293
53	0.5	Y	319L	C2293
54	0.5	G	282L	C2240L
58	0.5	YN	822L	S/JOINT SJ176
58	0.5	YN	999L	S/JOINT SJ1024
58	0.5	YN	1009L	S/JOINT SJ785

Click here to print

Connector: **C0635R**

CONNECTOR HOUSING SERVICEABLE

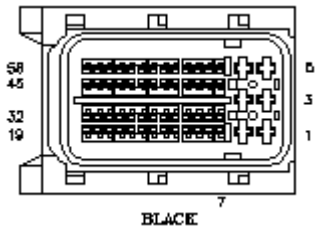

Part No.: YPC803530

Colour: BLACK


Cavities: 58WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine control-module (ECM) - PV8

Location: Rear LH side of engine compartment

Qualifier:

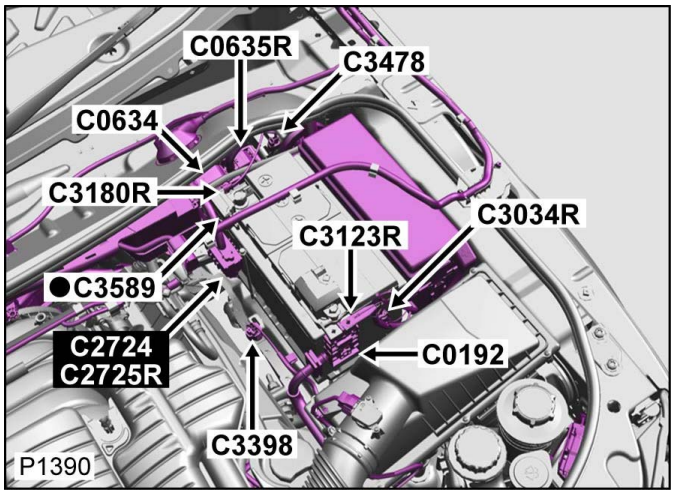

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	252R	C3557R
2	2.5	B	252R	C3557R
3	2.5	B	252R	C2650R
4	0.5	BN	282R	S/JOINT SJ1939
5	2.5	N	282R	S/JOINT SJ1863
6	2.5	N	282R	S/JOINT SJ1863
7	0.5	RB	282R	C3426R
8	0.5	RB	282R	C3426R
9	0.5	B	282R	C0570R
11	0.5	B	282R	C0570R
12	0.5	YR	282R	C0787R
13	0.5	BG	282R	C0787R
14	0.5	WG	282R	C0584R
15	0.5	B	282R	C0570R
17	0.5	WY	282R	C2244R
18	0.5	G	282R	C2725R
19	0.5	WR	282R	C0584R
20	0.5	U	282R	C3426R
21	0.5	WU	282R	C3426R
24	0.5	WU	282R	C2410R
25	0.5	RB	282R	C0787R
26	0.5	U	282R	C0787R
28	0.5	UR	282R	C2410R
29	0.5	YG	252R	C3126
30	0.5	YG	282R	C2410R
31	0.5	OY	282R	C0787R
32	0.5	R	252R	C0787R
33	0.75	WG	282R	S/JOINT SJ1812
35	0.5	B	374R	C0570R
36	0.5	GO	282R	S/JOINT SJ1905
37	0.5	PG	282R	S/JOINT SJ1814
40	0.75	UR	252R	S/JOINT SJ1174

41	0.5	N	282R	C2241R
43	0.75	PY	282R	C0570R
45	0.5	YB	1000R	S/JOINT SJ2005
45	0.5	YB	1001R	S/JOINT SJ1775
46	0.75	N	282R	C0570R
47	0.75	WO	282R	C3426R
48	0.75	G	282R	C3426R
54	0.5	G	282R	C2241R
58	0.5	YN	1000R	S/JOINT SJ2024
58	0.5	YN	1001R	S/JOINT SJ1785

Click here to print

Connector: C0642

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC500600

Colour: DARK GREY


Cavities: 4WY

Harness: TRANSMISSION AUTO-PETROL HARNESS

Description: Sensor-Heated oxygen-Post catalyst-Right bank 1

Location: RH side of gearbox

Qualifier:

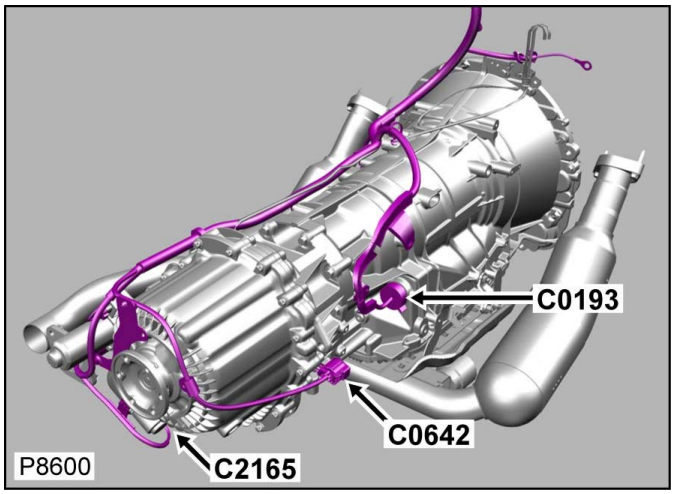

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	WG	282L	C3427L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
1	1.5	WG	282R	C3427R	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
2	1.0	WO	282L	C3427L	-	-	-	-	-	-	-
2	1.0	WO	282R	C3427R	-	-	-	-	-	-	-
3	0.5	RB	282L	C3427L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	RB	282R	C3427R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	U	282L	C3427L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	U	282R	C3427R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0644

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC904200

Colour: BLACK


Cavities: 4WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Sensor-Heated oxygen-Pre catalyst-Left bank 2

Location: Rear LH side of engine

Qualifier:

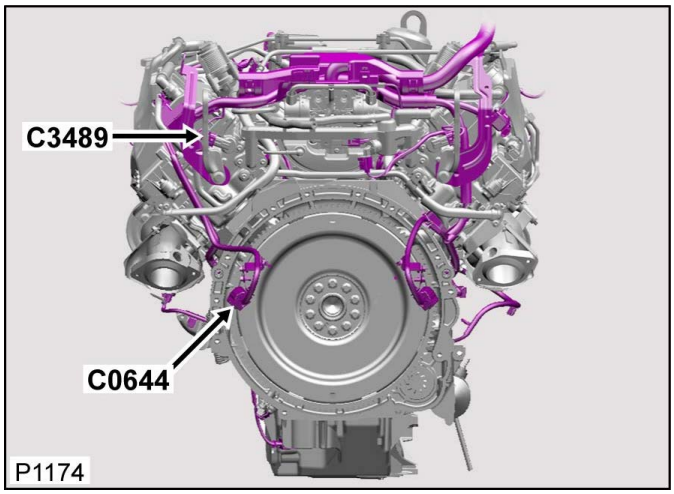

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	P	(LRR)	C2724	-	-	-	-	-	-	-
2	1.0	SP	ALL	C0634	-	-	-	-	-	-	-
3	0.5	WU	ALL	C0634	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	SN	ALL	C0634	418-411-73	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0645

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC904200

Colour: BLACK


Cavities: 4WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Sensor-Heated oxygen-Pre catalyst-Right bank 1

Location: Rear RH side of engine

Qualifier:

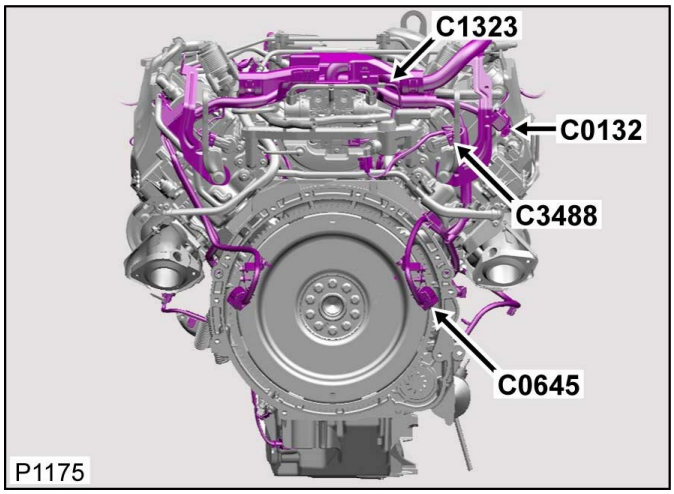


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	S	(LRR)	C2724	-	-	-	-	-	-	-
2	1.0	GN	ALL	C0634	-	-	-	-	-	-	-
3	0.5	PG	ALL	C0634	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	YG	ALL	C0634	418-411-73	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0646L

CONNECTOR HOUSING NOT SERVICEABLE

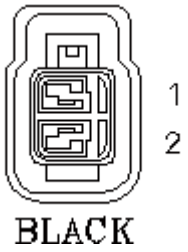

Part No.: YPC500750

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Fan-E-box

Location: Rear RH side of engine compartment

Qualifier:

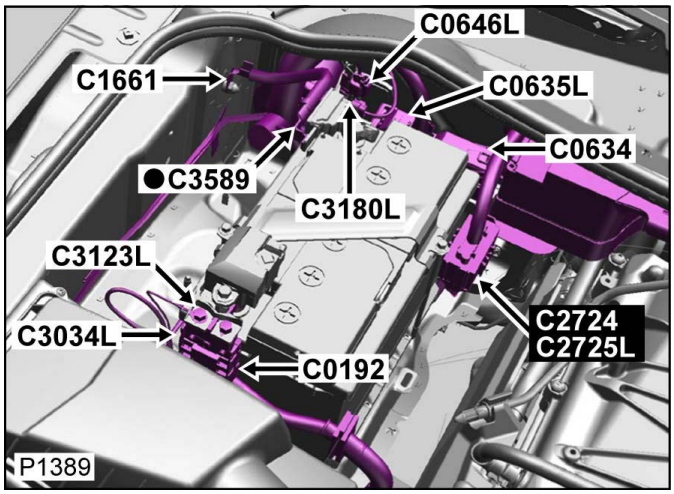


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	UB	282L	C2725L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.75	YU	798L	C0658L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	NK	282L	S/JOINT SJ450	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	BN	798L	S/JOINT SJ630	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0646R

CONNECTOR HOUSING NOT SERVICEABLE

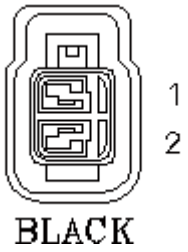

Part No.: YPC500750

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Fan-E-box

Location: Rear LH side of engine compartment

Qualifier:

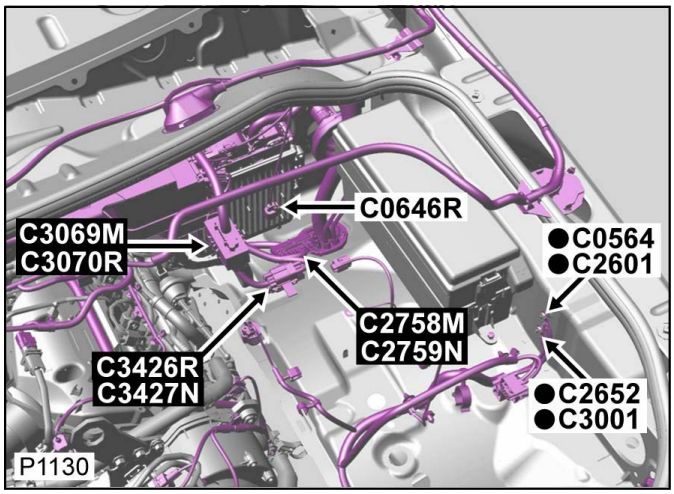

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	YU	798R	C0658R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	BN	798R	S/JOINT SJ630	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C0647L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Dynamic response module

Location: Driver 'A' post

Qualifier:

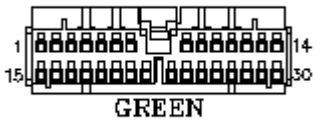

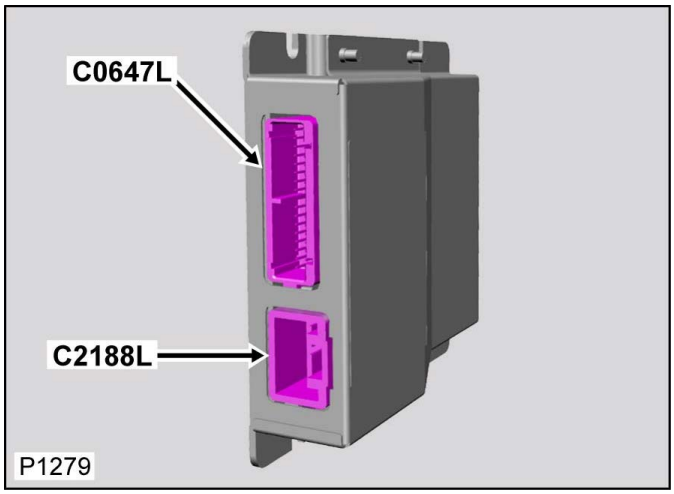

Part No.: YPC106500

Colour: GREEN

Cavities: 30WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	BG	407L	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.75	P	407L	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
6	0.75	GR	407L	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
7	0.75	OG	407L	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
8	0.75	YB	407L	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
9	0.75	GR	407L	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
13	0.35	Y	407L	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
14	0.35	YS	407L	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
15	0.35	YB	407L	S/JOINT SJ276	418-587-02	-	418-116A	418-117	-	418-112	418-107
16	0.35	YN	407L	S/JOINT SJ274	418-587-02	-	418-116A	418-117	-	418-112	418-107
19	0.35	YG	407L	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
20	0.35	YK	407L	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
22	0.35	OS	407L	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
23	0.35	YK	407L	C2245L	418-587-02	-	418-116A	418-117	-	418-112	418-107
25	0.35	YB	407L	C2245L	418-587-02	-	418-116A	418-117	-	418-112	418-107
26	0.35	YB	407L	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
28	0.35	OS	407L	C2245L	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0647R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Dynamic response module

Location: Driver 'A' post

Qualifier:

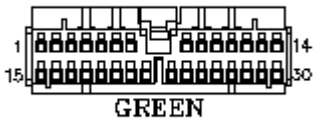

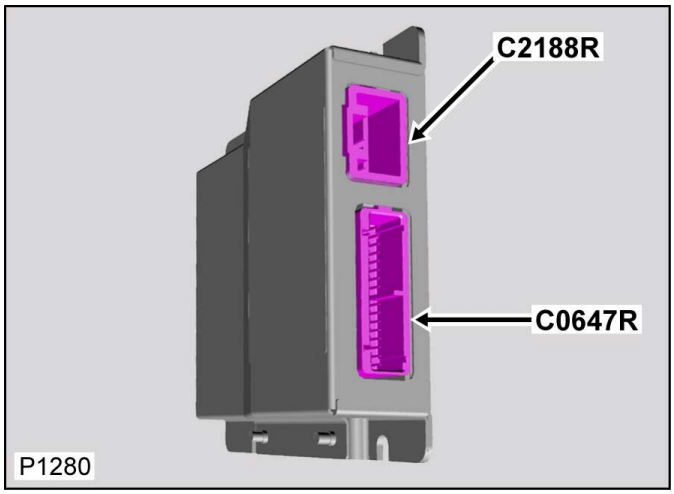

Part No.: YPC106500

Colour: GREEN

Cavities: 30WY

Harness: ENGINE COMPARTMENT HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	BG	407R	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.75	P	407R	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
6	0.75	GR	407R	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
7	0.75	OG	407R	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
8	0.75	YB	407R	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
9	0.75	GR	407R	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
13	0.35	Y	407R	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
14	0.35	YS	407R	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
15	0.35	YB	407R	S/JOINT SJ1276	418-587-02	-	418-116A	418-117	-	418-112	418-107
16	0.35	YN	407R	S/JOINT SJ1274	418-587-02	-	418-116A	418-117	-	418-112	418-107
19	0.35	YG	407R	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
20	0.35	YK	407R	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
22	0.35	OS	407R	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
23	0.35	YK	407R	C2410R	418-587-02	-	418-116A	418-117	-	418-112	418-107
25	0.35	YB	407R	C2410R	418-587-02	-	418-116A	418-117	-	418-112	418-107
26	0.35	YB	407R	C2396	418-587-02	-	418-116A	418-117	-	418-112	418-107
28	0.35	OS	407R	C2410R	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0656

CONNECTOR HOUSING NOT SERVICEABLE

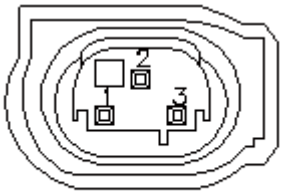

GREY

Part No.: YPC906030

Colour: GREY


Cavities: 3WY

Harness: ARC LINK HARNESS

Description: Accelerometer-Lower

Location: Beneath vehicle - RH side

Qualifier:

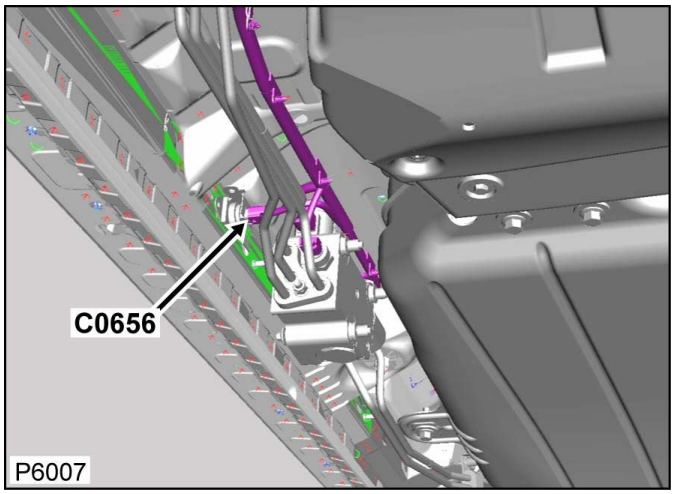


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	OS	407	C2394	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	YK	407	C2394	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	YB	407	C2394	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0657T

CONNECTOR HOUSING NOT SERVICEABLE

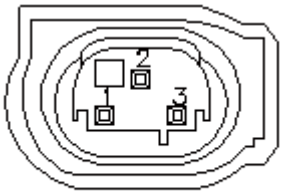

GREY

Part No.: YPC906030

Colour: GREY


Cavities: 3WY

Harness: CABIN HARNESS

Description: Accelerometer-Upper

Location: Front of headlining in the center

Qualifier:

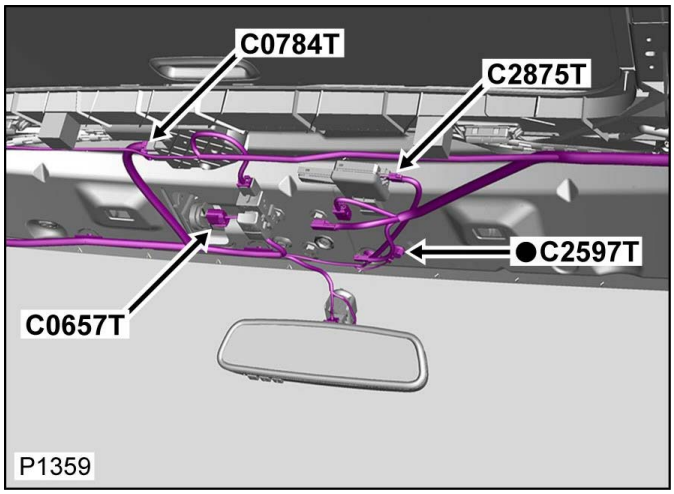


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	OS	407TL	C2243L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
1	0.35	OS	407TR	C2409R	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	YK	407TL	C2243L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	YK	407TR	C2409R	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	YB	407TL	C2243L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	YB	407TR	C2409R	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0658L**

CONNECTOR HOUSING SERVICEABLE

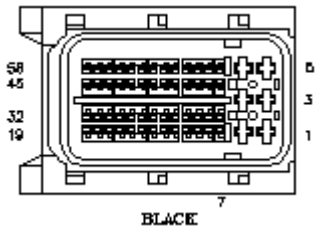

Part No.: YPC803530

Colour: BLACK


Cavities: 58WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine control-module (ECM) - DV6

Location: Rear RH side of engine compartment

Qualifier: LHD condition illustrated

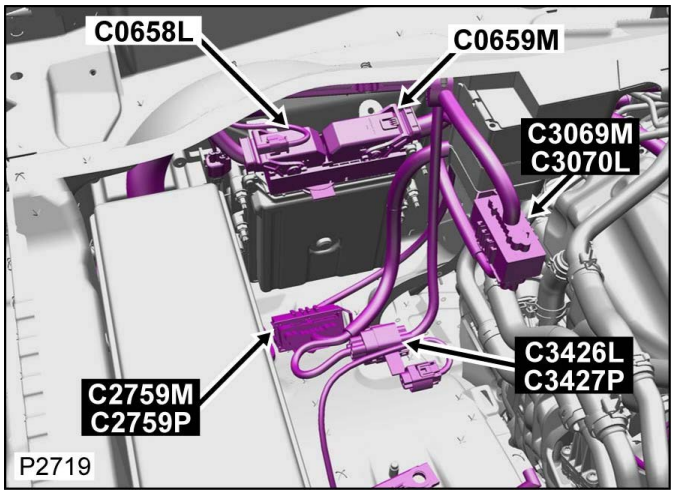

Wire Chart


CAV	CSA	COL	CCT	DESTN
1	2.5	B	798L	C3557L
2	2.5	B	798L	C3557L
3	2.5	G	798L	S/JOINT SJ946
4	2.5	B	798L	C2650L
5	2.5	G	798L	S/JOINT SJ946
6	2.5	B	798L	C2650L
7	0.75	RN	798L	C2762
8	0.5	YR	798L	C3426L
10	0.5	WO	798L	S/JOINT SJ867
11	0.5	UN	798L	C3426L
12	0.5	WU	798L	S/JOINT SJ489
14	0.75	WG	798L	C0190L
15	0.5	WY	798L	C2412L
17	0.75	NB	798L	C2761
18	0.75	UO	798L	C2262
19	0.5	B	798L	C0570L
20	0.5	BN	798L	C3126
21	0.5	YG	798L	C3126
22	0.5	OY	798L	S/JOINT SJ864
23	0.5	R	798L	C0787L
24	0.5	NR	798L	C3426L
25	0.5	NY	798L	C2244L
26	0.5	GP	798L	S/JOINT SJ814
27	0.75	SR	798L	C2762
28	0.5	WG	798L	C0584L
29	0.75	NR	798L	S/JOINT SJ510
30	0.5	UN	798L	C3070L
31	0.5	GO	798L	S/JOINT SJ905
32	0.75	NB	798L	C2270
35	0.5	RB	798L	C0787L
36	0.5	YLG	798L	C0787L
37	0.5	WU	798L	C3426L

40	0.35	YN	995L	S/JOINT SJ176
40	0.35	YN	996L	S/JOINT SJ1024
40	0.35	YN	1010L	S/JOINT SJ785
41	0.5	BP	798L	C0584L
42	0.5	B	798L	C0570L
44	0.75	O	798L	C2270
45	0.5	UR	798L	S/JOINT SJ174
48	0.5	U	798L	C0787L
49	0.5	BG	798L	S/JOINT SJ865
50	0.5	YG	798L	C3070L
53	0.35	YB	995L	S/JOINT SJ177
53	0.35	YB	996L	S/JOINT SJ1005
53	0.35	YB	1010L	S/JOINT SJ775
54	0.75	NP	798L	C0190L
55	0.5	B	798L	C0570L
58	0.75	YU	798L	C0646L

Click here to print

Connector: **C0658R**

CONNECTOR HOUSING SERVICEABLE

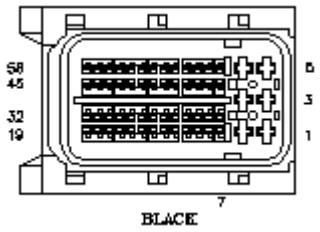

Part No.: YPC803530

Colour: BLACK


Cavities: 58WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine control-module (ECM) - DV6

Location: Passenger side of engine compartment

Qualifier:

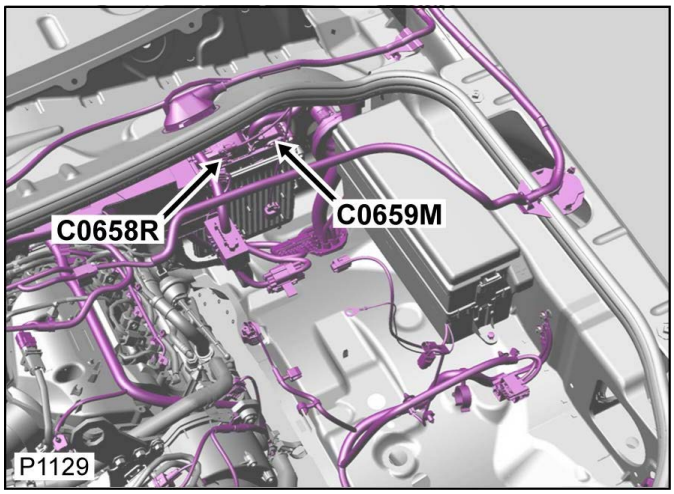

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	798R	C3557R
2	2.5	B	798R	C3557R
3	2.5	G	798R	S/JOINT SJ1946
4	2.5	B	798R	C2650R
5	2.5	G	798R	S/JOINT SJ1946
6	2.5	B	798R	C2650R
7	0.75	RN	798R	C2762
8	0.5	YR	798R	C3426R
10	0.5	WO	798R	S/JOINT SJ1867
11	0.5	UN	798R	C3426R
12	0.5	WU	798R	S/JOINT SJ1489
14	0.75	WG	798R	C0190R
15	0.5	WY	798R	C2244R
17	0.75	NB	798R	C2761
18	0.75	UO	798R	C2262
19	0.5	B	798R	C0570R
20	0.5	BN	798R	C3126
21	0.5	YG	798R	C3126
22	0.5	OY	798R	S/JOINT SJ1864
23	0.5	R	798R	C0787R
24	0.5	NR	798R	C3426R
25	0.5	NY	798R	C2410R
26	0.5	GP	798R	S/JOINT SJ1814
27	0.75	SR	798R	C2762
28	0.5	WG	798R	C0584R
29	0.75	NR	798R	S/JOINT SJ510
30	0.5	UN	798R	C3070R
31	0.5	GO	798R	S/JOINT SJ1905
32	0.75	NB	798R	C2270
35	0.5	RB	798R	C0787R
36	0.5	YLG	798R	C0787R
37	0.5	WU	798R	C3426R

40	0.35	YN	997R	S/JOINT SJ2024
40	0.35	YN	998R	S/JOINT SJ1785
41	0.5	BP	798R	C0584R
42	0.5	B	798R	C0570R
44	0.75	O	798R	C2270
45	0.5	UR	798R	S/JOINT SJ1174
48	0.5	U	798R	C0787R
49	0.5	BG	798R	S/JOINT SJ1865
50	0.5	YG	798R	C3070R
53	0.35	YB	997R	S/JOINT SJ2005
53	0.35	YB	998R	S/JOINT SJ1775
54	0.75	NP	798R	C0190R
55	0.5	B	798R	C0570R
58	0.75	YU	798R	C0646R

Click here to print


Connector: C0659M


CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine control-module (ECM) - DV6

Location: Passenger side of engine compartment

Qualifier:

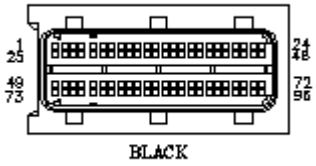

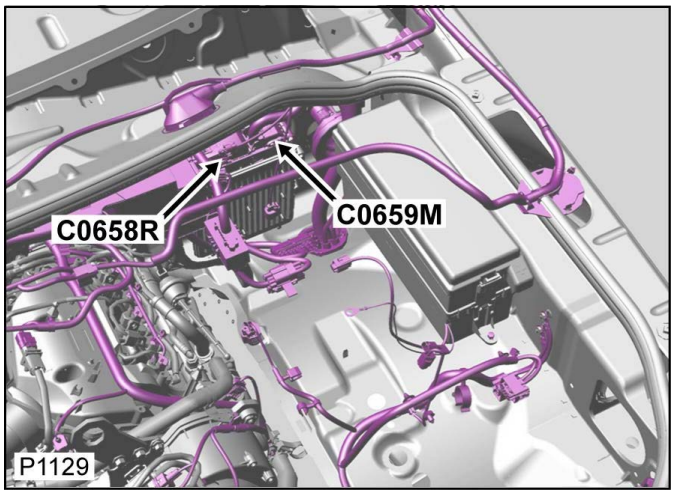

Part No.: YPC913480

Colour: BLACK

Cavities: 96WY

Harness: ENGINE DIESEL 3.0L HARNESS

Wire Chart


CAV	CSA	COL	CCT	DESTN
1	1.0	WG	798	C0525M
2	1.0	NP	798	C0526M
3	1.0	UW	798	C0527M
5	0.75	UO	798	S/JOINT SJ2
7	0.75	YP	798	C2255M
12	0.5	PN	798	C3419M
14	0.5	NG	798	C0186M
15	0.75	WO	798	C2266M
17	0.5	YP	798	C0272M
19	0.75	SY	798	C3050M
21	0.75	OB	798	C3069M
22	0.75	WO	798	C2758M
24	1.0	W	798	C2266M
25	1.0	N	798	C0525M
26	1.0	GW	798	C0526M
27	1.0	SN	798	C0527M
29	0.5	OG	798	C2758M
30	0.5	YS	798	C2758M
31	0.5	G	798	C0184M
36	0.5	Y	798	C0169M
37	0.5	YO	798	C2758M
38	0.5	OS	798	C2758M
39	0.5	PW	798	C0184M
40	0.5	P	798	C0176M
41	0.5	WG	798	C0176M
42	0.75	S	798	C2266M
44	0.5	YP	798	C0168M
45	0.75	UO	798	C3050M
46	0.75	NY	798	C2260M
47	0.75	YU	798	C3534M
48	1.0	U	798	C2266M
49	1.0	YU	798	C0522M

50	1.0	UO	798	C0523M
51	1.0	GP	798	C0524M
53	0.75	GN	798	C0168M
54	0.5	NG	798	C0169M
55	0.5	UN	798	C2251M
56	0.5	S	798	C0272M
57	0.5	YP	798	C2870M
60	0.5	UN	798	C2758M
61	0.5	G	798	C2758M
64	0.5	NW	798	S/JOINT SJ3
65	0.75	Y	798	S/JOINT SJ4
66	0.75	SP	798	S/JOINT SJ5
67	0.75	UW	798	C2266M
68	0.5	S	798	C3419M
69	0.75	GU	798	C3533M
70	0.75	YS	798	C3233M
71	0.75	GP	798	C1526M
72	0.75	GP	798	C0272M
73	1.0	GU	798	C0522M
74	1.0	SY	798	C0523M
75	1.0	PS	798	C0524M
77	0.5	WN	798	C2758M
78	0.5	OU	798	S/JOINT SJ14
79	0.5	PO	798	C2758M
80	0.5	UG	798	C0186M
81	0.5	N	798	C2758M
82	0.5	YP	798	C2254M
83	0.5	SO	798	C2758M
84	0.5	SP	798	C2758M
86	0.5	SP	798	C2758M
87	0.5	S	798	C2251M
89	0.5	Y	798	C3419M
90	0.5	UN	798	C2251M
91	0.75	US	798	C2261M
92	0.75	UG	798	C2254M
93	0.75	GU	798	C2254M
94	0.75	UG	798	C2255M
95	0.75	GU	798	C2255M
96	0.75	N	798	C0272M

Click here to print

Connector: C0666L

CONNECTOR HOUSING NOT SERVICEABLE

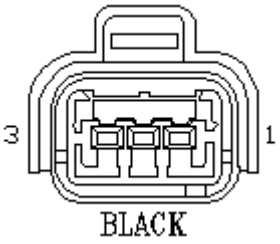

Part No.: YPC906360

Colour: BLACK


Cavities: 3WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Sounder-Battery backed

Location: Rear LH side of engine compartment

Qualifier:

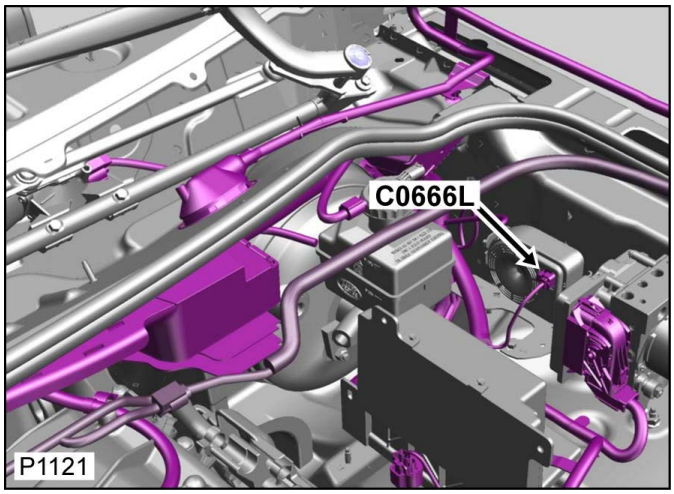


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	139L	S/JOINT SJ171	418-411-58	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	139L	C2444L	418-411-58	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	B	139L	C0583L	418-411-58	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0666R**

CONNECTOR HOUSING NOT SERVICEABLE

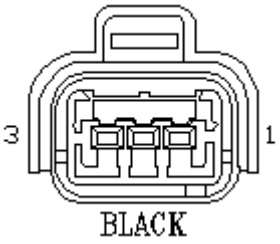

Part No.: YPC906360

Colour: BLACK


Cavities: 3WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Sounder-Battery backed

Location: Driver side of engine compartment

Qualifier:

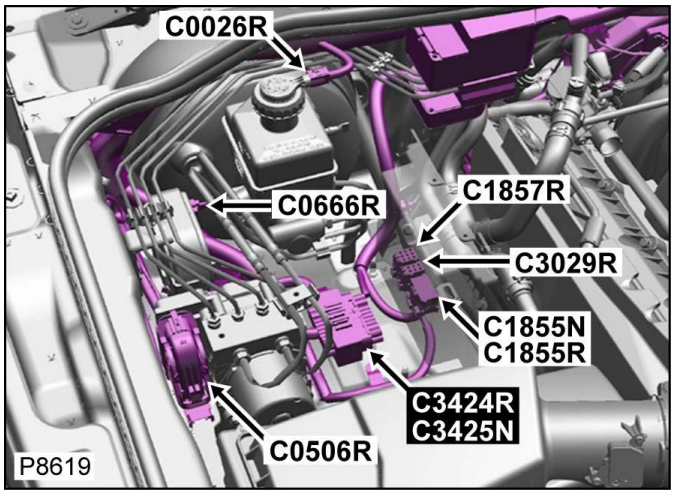

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	200R	S/JOINT SJ173	418-411-58	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	200R	C2240R	418-411-58	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	B	200R	C0583R	418-411-58	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: **C0674T**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Receiver-Radio-frequency (RF)

Location: Rear of headlining - LH side

Qualifier:

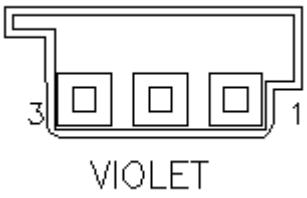

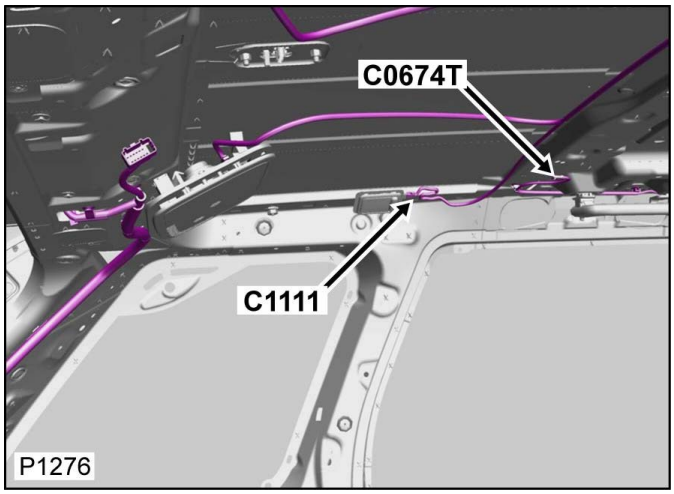

Part No.: YPC911600

Colour: VIOLET

Cavities: 3WY

Harness: CABIN HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	499T	C2597T	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.35	SN	810T	C2428T	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
3	0.5	RU	499T	S/JOINT SJ206	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0680

CONNECTOR HOUSING NOT SERVICEABLE

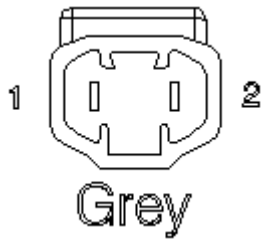

Part No.: YPC914420

Colour: LIGHT GREY


Cavities: 2WY

Harness: REAR DOOR HARNESS

Description: Speaker-High range-Rear door

Location: Behind rear door trim panel

Qualifier: LH side illustrated RH side similar

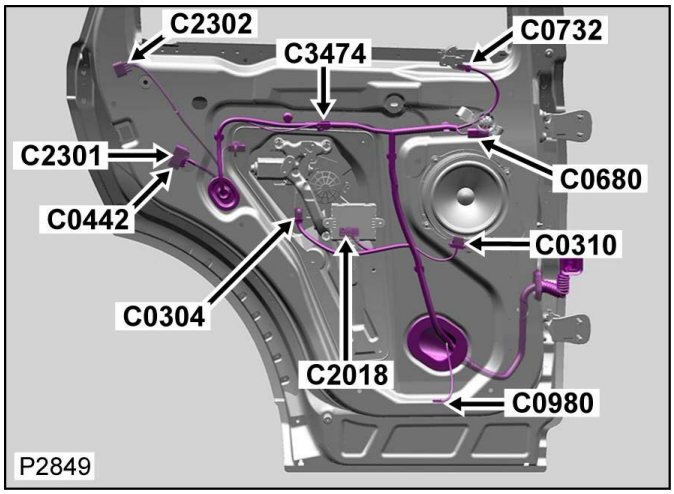


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	GN	478L	C0803
1	1.5	UW	478R	C0804
2	1.5	SN	478L	C0803
2	1.5	PU	478R	C0804

Click here to print

Connector: C0688

CONNECTOR HOUSING NOT SERVICEABLE

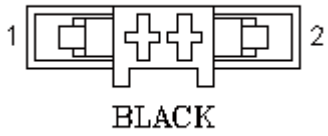

Part No.: YPC113640

Colour: BLACK


Cavities: 2WY

Harness: DOORS FRONT HARNESS

Description: Speaker-Low range-Front door

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated

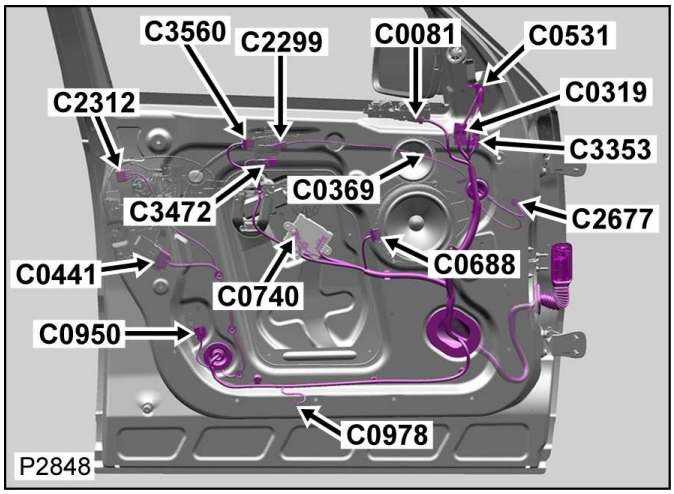


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	WN	478L	C0439
1	1.5	GW	478R	C3646
2	1.5	W	478L	C0439
2	1.5	G	478R	C3646

Click here to print

Connector: **C0690T**

CONNECTOR HOUSING NOT SERVICEABLE

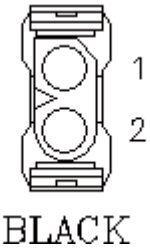

BLACK

Part No.: YPC112260

Colour: BLACK


Cavities: 2WY

Harness: CABIN HARNESS

Description: Motor-Security-Fuel flap

Location: Behind luggage compartment carpet RH side

Qualifier:

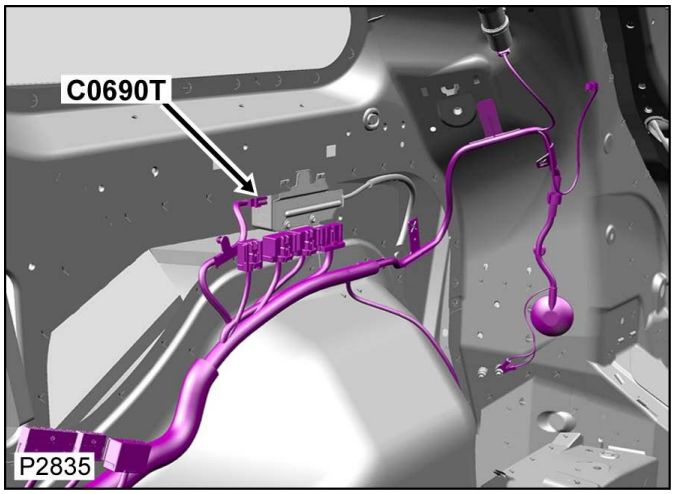


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	B	98TL	C0585L	418-549-03	-	418-116A	418-117	-	418-112	418-107
1	1.0	B	41TR	C0585R	418-549-03	-	418-116A	418-117	-	418-112	418-107
2	1.0	B	98TL	C0585L	418-549-03	-	418-116A	418-117	-	418-112	418-107
2	1.0	B	41TR	C0585R	418-549-03	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: **C0698T**

CONNECTOR HOUSING SERVICEABLE

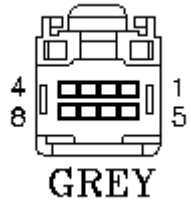

Part No.: YPC905670

Colour: GREY


Cavities: 8WY

Harness: CABIN HARNESS

Description: Mirror-Electrochromic

Location: Rear view mirror

Qualifier:

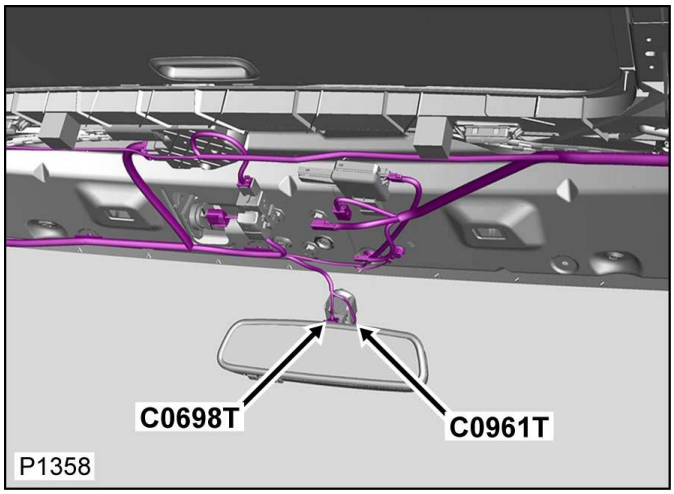

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	PW	139TL	C2242L	418-411-45	-	418-116A	418-117	-	418-112	418-107
1	0.5	PW	200TR	C2409R	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.75	GN	341T	S/JOINT SJ7	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	499T	C2714	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.35	YU	823T	S/JOINT SJ2011	-	-	-	-	-	-	-
8	0.35	YW	823T	S/JOINT SJ2010	-	-	-	-	-	-	-

Click here to print


Connector: C0700A

CONNECTOR HOUSING NOT SERVICEABLE

Description: Switch pack-Center-console

Location: Beneath center console LH side

Qualifier: LHD condition illustrated

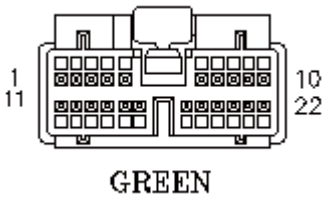


Part No.: YPC106490

Colour: GREEN

Cavities: 22WY

Harness: CONSOLE FRONT HARNESS

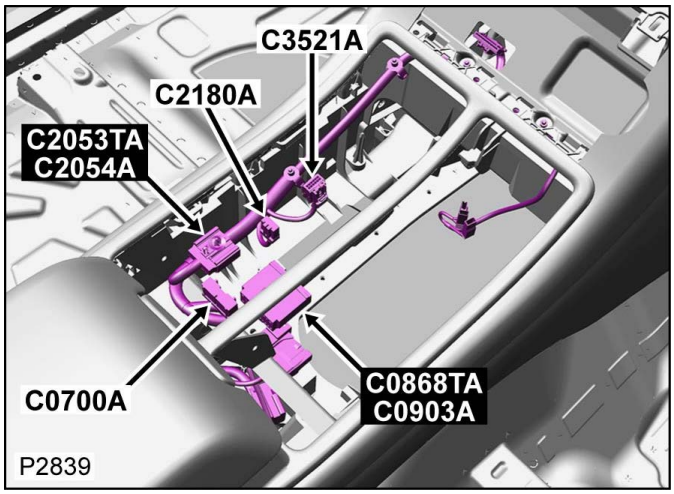

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	YB	982L	S/JOINT SJ1033	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.35	YN	982L	S/JOINT SJ1032	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	R	982L	C2054A	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.35	BK	982L	C2054A	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.35	BW	982L	C2054A	418-587-02	-	418-116A	418-117	-	418-112	418-107
6	0.5	BG	982L	C0903A	418-587-02	-	418-116A	418-117	-	418-112	418-107
7	0.5	GB	982L	S/JOINT SJ303	418-587-02	-	418-116A	418-117	-	418-112	418-107
8	0.5	RN	982L	S/JOINT SJ322	418-587-02	-	418-116A	418-117	-	418-112	418-107
9	0.35	O	982L	C0903A	418-587-02	-	418-116A	418-117	-	418-112	418-107
10	0.35	OR	982L	C0903A	418-587-02	-	418-116A	418-117	-	418-112	418-107
11	0.35	BY	982L	C2054A	418-587-02	-	418-116A	418-117	-	418-112	418-107
12	0.35	BG	982L	C2054A	418-587-02	-	418-116A	418-117	-	418-112	418-107
13	0.35	BO	982L	C2054A	418-587-02	-	418-116A	418-117	-	418-112	418-107
14	0.35	BR	982L	C2054A	418-587-02	-	418-116A	418-117	-	418-112	418-107
15	0.35	BN	982L	C2054A	418-587-02	-	418-116A	418-117	-	418-112	418-107
16	0.35	BS	982L	C2054A	418-587-02	-	418-116A	418-117	-	418-112	418-107
17	0.35	BP	982L	C2054A	418-587-02	-	418-116A	418-117	-	418-112	418-107
18	0.5	B	982L	S/JOINT SJ323	418-587-02	-	418-116A	418-117	-	418-112	418-107

20	0.75	OG	982L	C0903A	418-587-02	-	418-116A	418-117	-	418-112	418-107
21	0.35	G	982L	C0903A	418-587-02	-	418-116A	418-117	-	418-112	418-107
22	0.35	GR	982L	C0903A	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0700B

CONNECTOR HOUSING NOT SERVICEABLE

Description: Switch pack-Center-console

Location: Beneath center console RH side

Qualifier: RHD condition illustrated

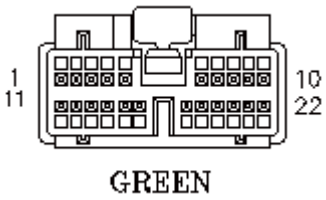


Part No.: YPC106490

Colour: GREEN

Cavities: 22WY

Harness: CONSOLE FRONT HARNESS

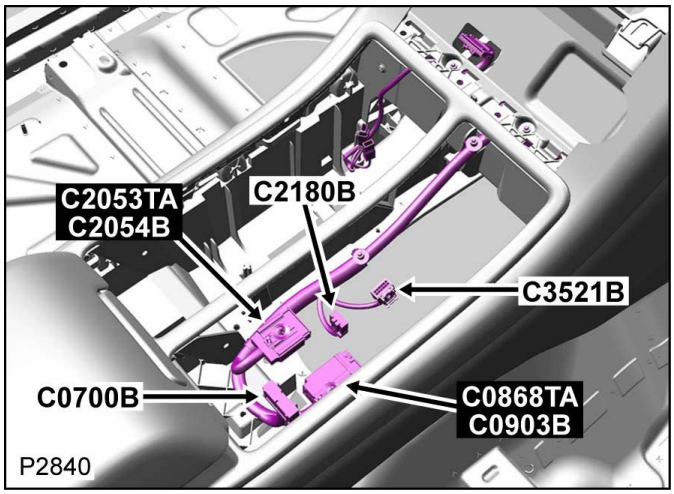

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	YB	982R	S/JOINT SJ1037	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.35	YN	982R	S/JOINT SJ1036	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	R	982R	C2054B	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	BK	982R	C2054B	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	BW	982R	C2054B	418-587-02	-	418-116A	418-117	-	418-112	418-107
6	0.5	BG	982R	C0903B	418-587-02	-	418-116A	418-117	-	418-112	418-107
7	0.5	GB	982R	S/JOINT SJ303	418-587-02	-	418-116A	418-117	-	418-112	418-107
8	0.5	RN	982R	S/JOINT SJ322	418-587-02	-	418-116A	418-117	-	418-112	418-107
9	0.35	O	982R	C0903B	418-587-02	-	418-116A	418-117	-	418-112	418-107
10	0.35	OR	982R	C0903B	418-587-02	-	418-116A	418-117	-	418-112	418-107
11	0.5	BY	982R	C2054B	418-587-02	-	418-116A	418-117	-	418-112	418-107
12	0.5	BG	982R	C2054B	418-587-02	-	418-116A	418-117	-	418-112	418-107
13	0.5	BO	982R	C2054B	418-587-02	-	418-116A	418-117	-	418-112	418-107
14	0.5	BR	982R	C2054B	418-587-02	-	418-116A	418-117	-	418-112	418-107
15	0.5	BN	982R	C2054B	418-587-02	-	418-116A	418-117	-	418-112	418-107
16	0.5	BS	982R	C2054B	418-587-02	-	418-116A	418-117	-	418-112	418-107
17	0.35	BP	982R	C2054B	418-587-02	-	418-116A	418-117	-	418-112	418-107
18	0.5	B	982R	S/JOINT SJ323	418-587-02	-	418-116A	418-117	-	418-112	418-107

20	0.75	OG	982R	C0903B	418-587-02	-	418-116A	418-117	-	418-112	418-107
21	0.35	G	982R	C0903B	418-587-02	-	418-116A	418-117	-	418-112	418-107
22	0.35	GR	982R	C0903B	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0700L

CONNECTOR HOUSING NOT SERVICEABLE

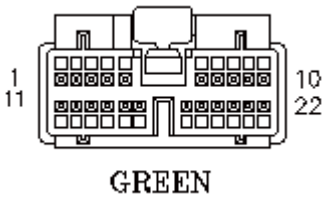

GREEN

Part No.: YPC106490

Colour: GREEN


Cavities: 22WY

Harness: CONSOLE FRONT HARNESS

Description: Switch pack-Center-console

Location: Beneath center console LH side

Qualifier:

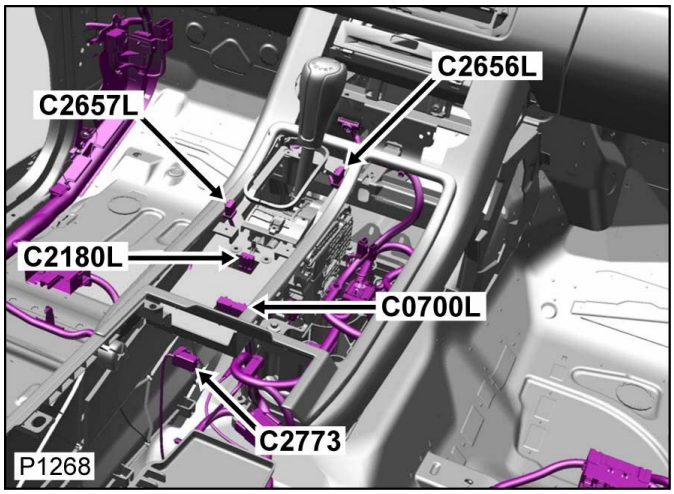

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	YB	986L	S/JOINT SJ1045	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.35	YN	986L	S/JOINT SJ1044	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	R	986L	C2054L	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.35	BK	986L	C2054L	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.35	BW	986L	C2054L	418-587-02	-	418-116A	418-117	-	418-112	418-107
6	0.5	BG	986L	C0903L	418-587-02	-	418-116A	418-117	-	418-112	418-107
7	0.5	GB	986L	S/JOINT SJ303	418-587-02	-	418-116A	418-117	-	418-112	418-107
8	0.5	RN	986L	S/JOINT SJ322	418-587-02	-	418-116A	418-117	-	418-112	418-107
9	0.35	O	986L	C0903L	418-587-02	-	418-116A	418-117	-	418-112	418-107
10	0.35	OR	986L	C0903L	418-587-02	-	418-116A	418-117	-	418-112	418-107
11	0.35	BY	986L	C2054L	418-587-02	-	418-116A	418-117	-	418-112	418-107
12	0.35	BG	986L	C2054L	418-587-02	-	418-116A	418-117	-	418-112	418-107
13	0.35	BO	986L	C2054L	418-587-02	-	418-116A	418-117	-	418-112	418-107
14	0.35	BR	986L	C2054L	418-587-02	-	418-116A	418-117	-	418-112	418-107
15	0.35	BN	986L	C2054L	418-587-02	-	418-116A	418-117	-	418-112	418-107
16	0.35	BS	986L	C2054L	418-587-02	-	418-116A	418-117	-	418-112	418-107
17	0.35	BP	986L	C2054L	418-587-02	-	418-116A	418-117	-	418-112	418-107
18	0.5	B	986L	S/JOINT SJ323	418-587-02	-	418-116A	418-117	-	418-112	418-107

20	0.75	OG	986L	C0903L	418-587-02	-	418-116A	418-117	-	418-112	418-107
21	0.35	G	986L	C0903L	418-587-02	-	418-116A	418-117	-	418-112	418-107
22	0.35	GR	986L	C0903L	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0700R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Switch pack-Center-console

Location: Beneath center console RH side

Qualifier:

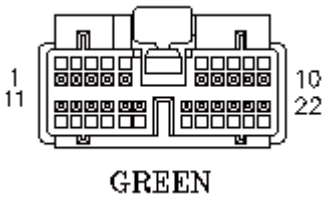

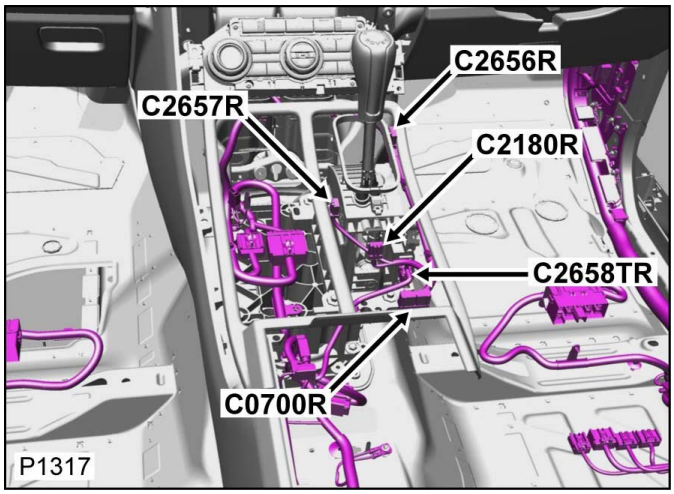

Part No.: YPC106490

Colour: GREEN

Cavities: 22WY

Harness: CONSOLE FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	YB	986R	S/JOINT SJ1047	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.35	YN	986R	S/JOINT SJ1046	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	R	986R	C2054R	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	BK	986R	C2054R	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	BW	986R	C2054R	418-587-02	-	418-116A	418-117	-	418-112	418-107
6	0.5	BG	986R	C0903R	418-587-02	-	418-116A	418-117	-	418-112	418-107
7	0.5	GB	986R	S/JOINT SJ303	418-587-02	-	418-116A	418-117	-	418-112	418-107
8	0.5	RN	986R	S/JOINT SJ322	418-587-02	-	418-116A	418-117	-	418-112	418-107
9	0.35	O	986R	C0903R	418-587-02	-	418-116A	418-117	-	418-112	418-107
10	0.35	OR	986R	C0903R	418-587-02	-	418-116A	418-117	-	418-112	418-107
11	0.5	BY	986R	C2054R	418-587-02	-	418-116A	418-117	-	418-112	418-107
12	0.5	BG	986R	C2054R	418-587-02	-	418-116A	418-117	-	418-112	418-107
13	0.5	BO	986R	C2054R	418-587-02	-	418-116A	418-117	-	418-112	418-107
14	0.5	BR	986R	C2054R	418-587-02	-	418-116A	418-117	-	418-112	418-107
15	0.5	BN	986R	C2054R	418-587-02	-	418-116A	418-117	-	418-112	418-107
16	0.5	BS	986R	C2054R	418-587-02	-	418-116A	418-117	-	418-112	418-107
17	0.35	BP	986R	C2054R	418-587-02	-	418-116A	418-117	-	418-112	418-107
18	0.5	B	986R	S/JOINT SJ323	418-587-02	-	418-116A	418-117	-	418-112	418-107

20	0.75	OG	986R	C0903R	418-587-02	-	418-116A	418-117	-	418-112	418-107
21	0.35	G	986R	C0903R	418-587-02	-	418-116A	418-117	-	418-112	418-107
22	0.35	GR	986R	C0903R	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0718


CONNECTOR HOUSING NOT SERVICEABLE

Description: Motor-Seat-Recline-Driver

Location: Under front seat squab cover

Qualifier:

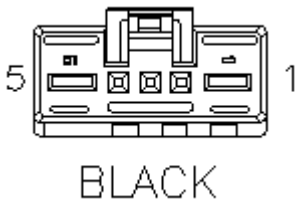

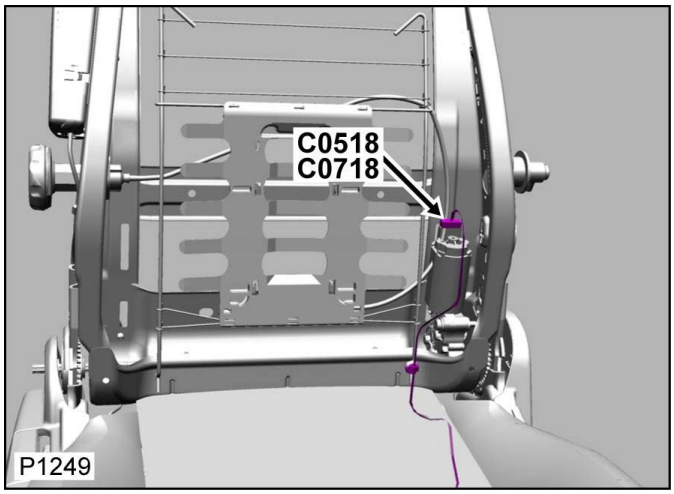

Part No.: YPC901850

Colour: BLACK

Cavities: 5WY

Harness: SEAT LINK HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	O	26	C2994	418-549-17	-	418-116A	418-117	-	418-113	418-108
2	0.5	BG	26	C2994	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.5	KU	26	C2994	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
5	1.5	S	26	C2994	418-549-17	-	418-116A	418-117	-	418-113	418-108

Click here to print


Connector: C0718


CONNECTOR HOUSING NOT SERVICEABLE

Description: Motor-Seat-Recline-Driver

Location: Under front seat squab cover

Qualifier:

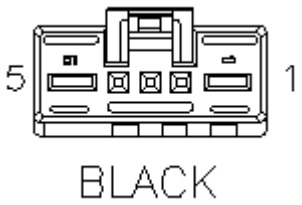

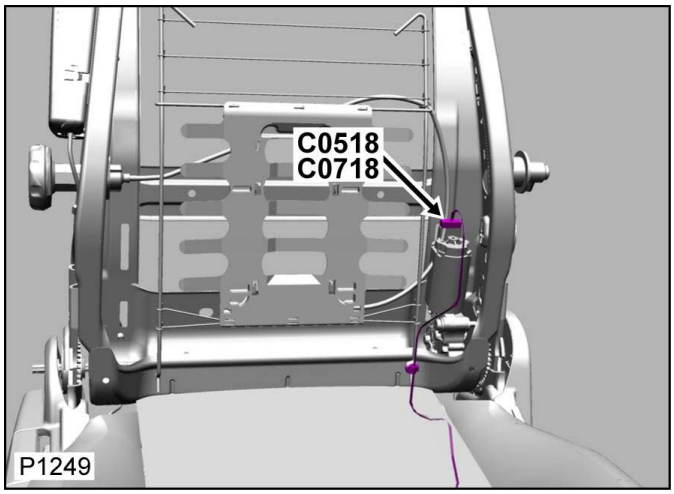

Part No.: YPC901850

Colour: BLACK

Cavities: 5WY

Harness: SEAT LINK HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	O	26	C2994	418-549-17	-	418-116A	418-117	-	418-113	418-108
2	0.5	BG	26	C2994	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.5	KU	26	C2994	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
5	1.5	S	26	C2994	418-549-17	-	418-116A	418-117	-	418-113	418-108

Click here to print

Connector: C0721

CONNECTOR HOUSING NOT SERVICEABLE

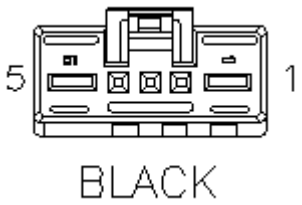

Part No.: YPC901850

Colour: BLACK


Cavities: 5WY

Harness: SEAT FRONT HARNESS

Description: Motor-Seat-Forward-rearward

Location: Beneath driver seat

Qualifier:

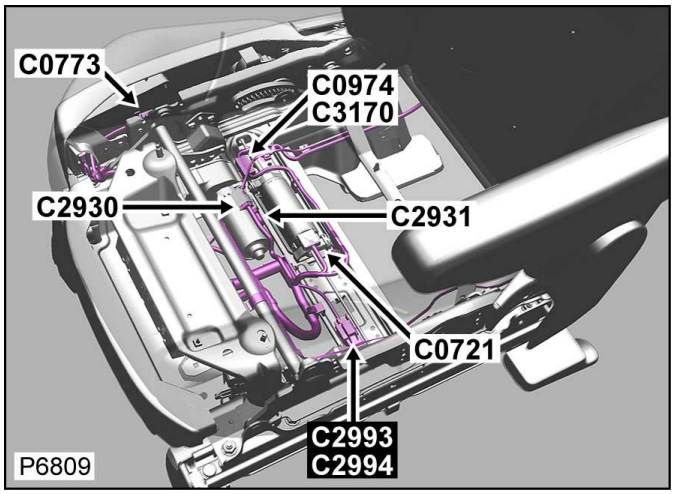


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	P	439	C0773	418-549-21	-	418-116A	418-117	-	418-112	418-107
1	1.5	P	207	C2381	418-549-17	-	418-116A	418-117	-	418-113	418-108
2	0.35	K	207	C2382	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.35	RS	207	C2382	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
5	1.5	U	207	C2381	418-549-17	-	418-116A	418-117	-	418-113	418-108
5	0.75	U	439	C0773	418-549-21	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0732

CONNECTOR HOUSING NOT SERVICEABLE

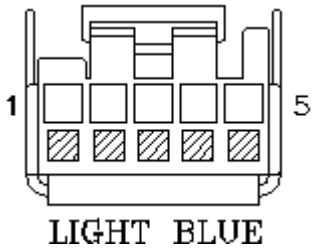

Part No.: YPC10314

Colour: LIGHT BLUE


Cavities: 5WY

Harness: REAR DOOR HARNESS

Description: Switch-Window-Rear

Location: Behind rear door trim panel

Qualifier: LH side illustrated RH side similar

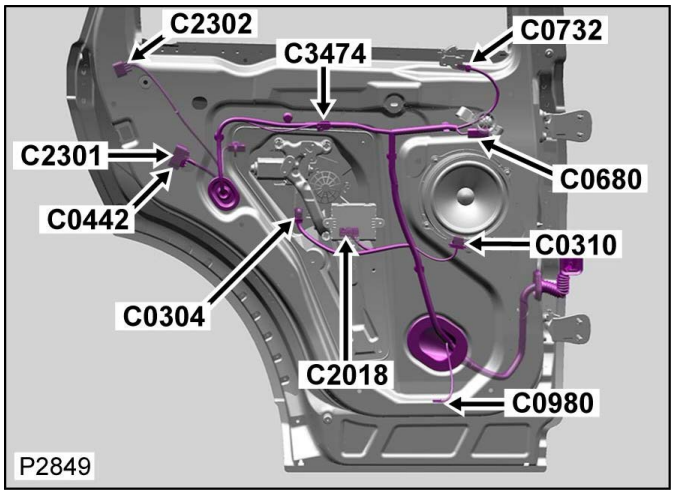


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GU	499	C2018	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.35	SP	499	C2018	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.35	NG	499	C2018	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	NW	499	C2018	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0735

CONNECTOR HOUSING NOT SERVICEABLE

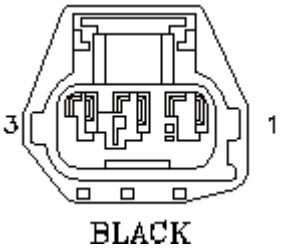

BLACK

Part No.: YPC500530

Colour: BLACK


Cavities: 3WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Water in fuel sensor

Location: Beneath rear of vehicle - Center

Qualifier:

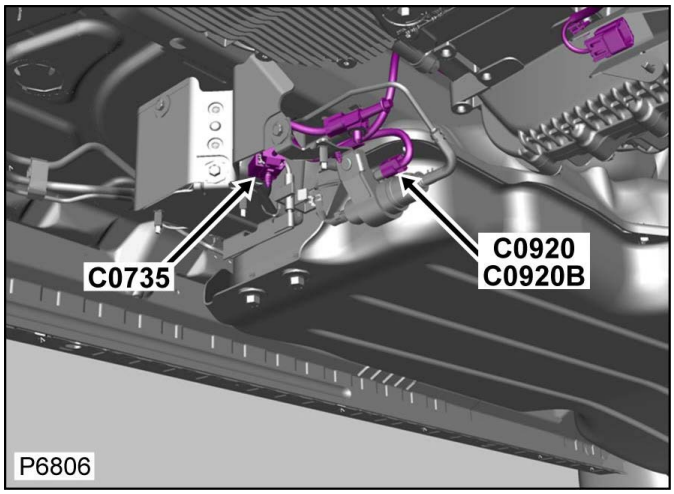


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	RU	729R	C2374J	-	-	-	-	-	-	-
1	1.0	RU	729L	C2374H	-	-	-	-	-	-	-
2	0.5	RB	729R	C2374J	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RB	729L	C2374H	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	NR	729R	C2374J	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	NR	729L	C2374H	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0736

CONNECTOR HOUSING NOT SERVICEABLE

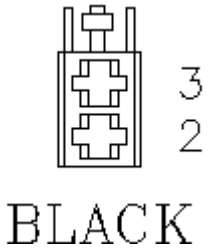

Part No.: YPC800280

Colour: BLACK


Cavities: 2WY

Harness: ROOF HARNESS

Description: Mirror-Vanity-RH

Location: Headlining - Front RH side

Qualifier:

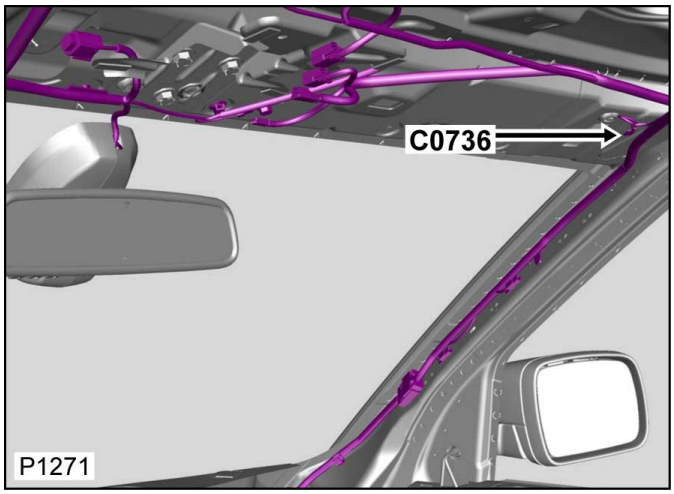


Wire Chart

CAV	CSA	COL	CCT	DESTN
2	0.75	LGW	244	S/JOINT SJ234
3	0.75	B	244	S/JOINT SJ275

Click here to print

Connector: C0737

CONNECTOR HOUSING NOT SERVICEABLE

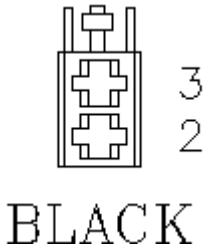

Part No.: YPC800280

Colour: BLACK


Cavities: 2WY

Harness: ROOF HARNESS

Description: Mirror-Vanity-LH

Location: Headlining - Front LH side

Qualifier:

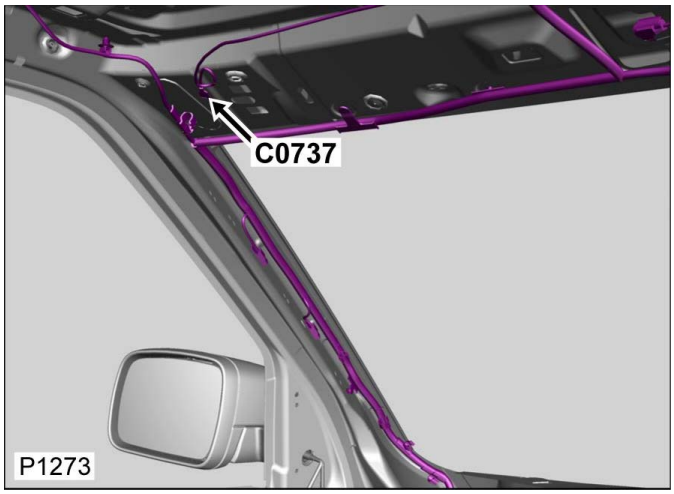

Wire Chart

CAV	CSA	COL	CCT	DESTN
2	0.75	LGW	244	S/JOINT SJ234
3	0.75	B	244	S/JOINT SJ275

Click here to print


Connector: C0740

CONNECTOR HOUSING NOT SERVICEABLE

Description: Motor-Window-Front

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated

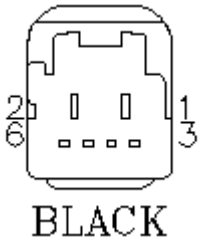


Part No.: YPC802960

Colour: BLACK

Cavities: 6WY

Harness: DOORS FRONT HARNESS

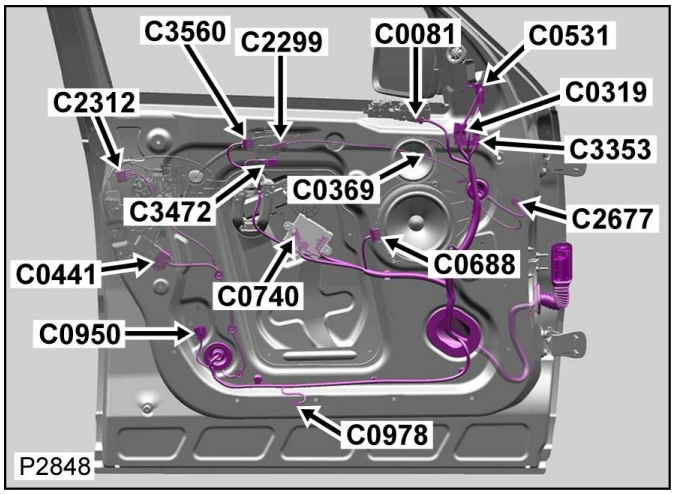


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	U	672	C2017	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
1	2.5	U	673	C2016	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
1	2.5	U	674	C2271	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
1	2.5	U	675	C2272	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	G	672	C2017	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	G	673	C2016	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	G	674	C2271	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	G	675	C2272	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
3	0.5	WN	672	C2017	-	-	-	-	-	-	-
3	0.5	WN	673	C2016	-	-	-	-	-	-	-
3	0.5	WN	674	C2271	-	-	-	-	-	-	-
3	0.5	WN	675	C2272	-	-	-	-	-	-	-
4	0.5	UW	674	C2271	-	-	-	-	-	-	-
4	0.5	UW	673	C2016	-	-	-	-	-	-	-
4	0.5	UW	672	C2017	-	-	-	-	-	-	-
4	0.5	UW	675	C2272	-	-	-	-	-	-	-
5	0.5	PG	672	C2017	-	-	-	-	-	-	-
5	0.5	PG	673	C2016	-	-	-	-	-	-	-
5	0.5	PG	674	C2271	-	-	-	-	-	-	-
5	0.5	PG	675	C2272	-	-	-	-	-	-	-
6	0.5	YU	674	C2271	-	-	-	-	-	-	-
6	0.5	YU	673	C2016	-	-	-	-	-	-	-
6	0.5	YU	672	C2017	-	-	-	-	-	-	-
6	0.5	YU	675	C2272	-	-	-	-	-	-	-

Click here to print

Connector: **C0751**

CONNECTOR HOUSING NOT SERVICEABLE

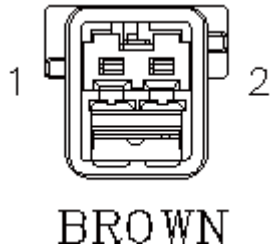

Part No.: YPC906300

Colour: BROWN


Cavities: 2WY

Harness: SEAT FRONT HARNESS

Description: Seat harness to main harness

Location: Beneath front seat

Qualifier:

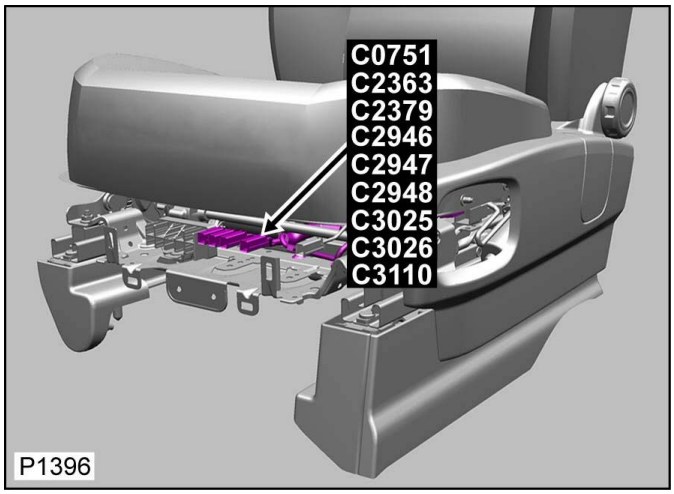


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	YW	207	C2382	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	YU	207	C2382	418-411-12	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0752

CONNECTOR HOUSING NOT SERVICEABLE

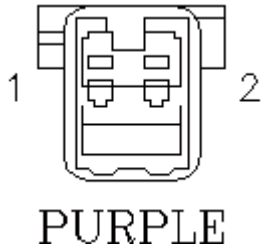

Part No.: YPC800260

Colour: PURPLE


Cavities: 2WY

Harness: SEAT FRONT HARNESS

Description: Seat harness to main harness

Location: Beneath front seat

Qualifier:

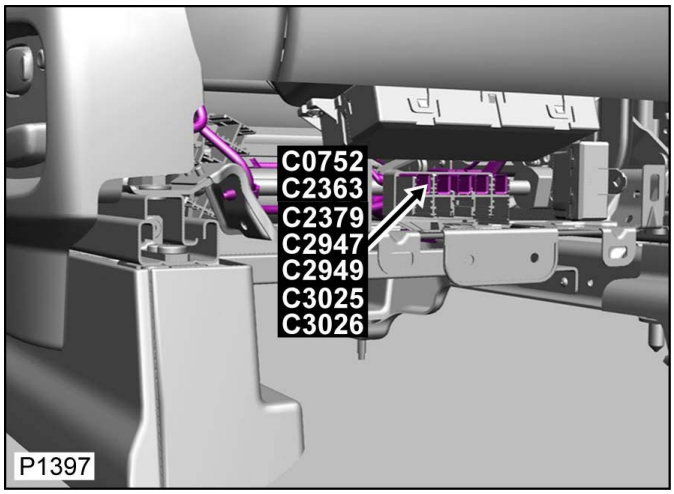

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	YN	459	C0962	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	YB	459	C0962	418-411-12	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0755


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Heated seat-Front

Location: Beneath front seat

Qualifier:



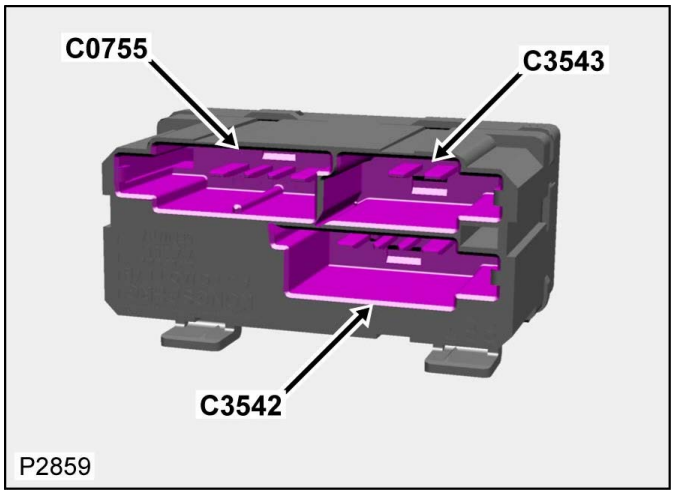

Part No.: YPC913340

Colour: GREEN

Cavities: 4WY

Harness: SEAT ASSEMBLIES HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	B	204	C2379	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	0.5	Y	204	C2379	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
4	1.5	R	204	C2379	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C0766

CONNECTOR HOUSING NOT SERVICEABLE

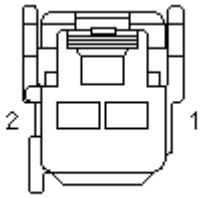

LIGHT GREY

Part No.: YPC910560

Colour: LIGHT GREY


Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Description: Instrument panel harness to A/C harness

Location: Climate control assembly-Driver side

Qualifier:

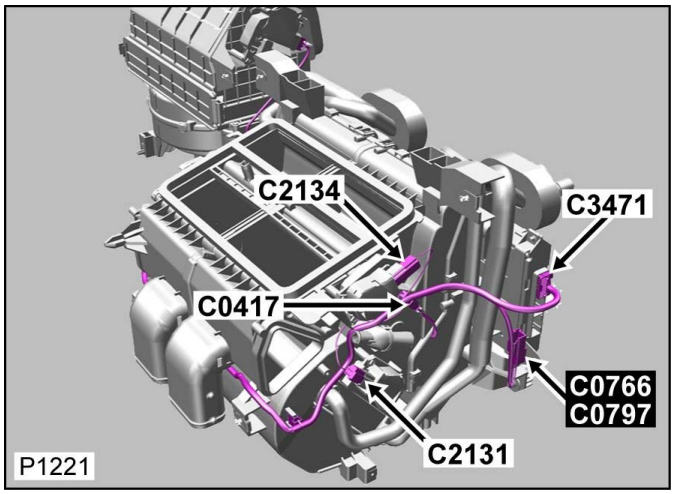


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WU	19R	C0884	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	B	204L	C3234	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	NP	204L	S/JOINT SJ687L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	NP	204R	S/JOINT SJ687R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0770

CONNECTOR HOUSING NOT SERVICEABLE

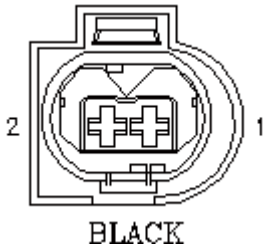

Part No.: YPC901950

Colour: BLACK


Cavities: 2WY

Harness: ARC LINK HARNESS

Description: Valve block-Dynamic response

Location: Beneath vehicle - RH side

Qualifier:

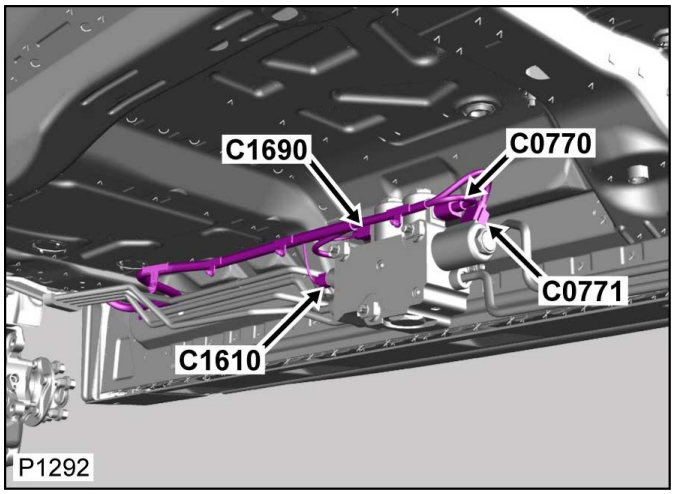


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	YB	407	C2394	418-549-18	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	GR	407	C2394	418-549-18	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0771

CONNECTOR HOUSING NOT SERVICEABLE

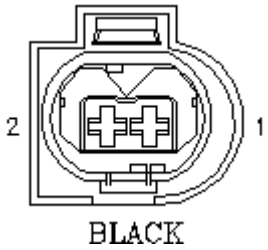

Part No.: YPC901950

Colour: BLACK


Cavities: 2WY

Harness: ARC LINK HARNESS

Description: Valve block-Dynamic response

Location: Beneath vehicle - RH side

Qualifier:

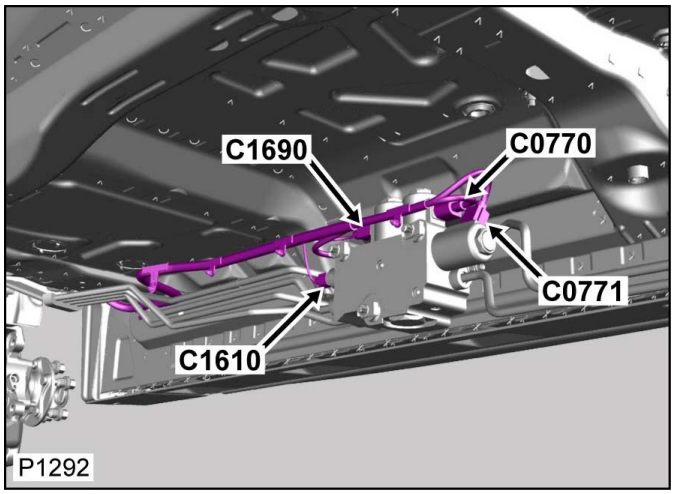

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	BG	407	C2394	418-549-18	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	P	407	C2394	418-549-18	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C0773


CONNECTOR HOUSING NOT SERVICEABLE

Description: Switch pack-Seat

Location: Beneath front seat

Qualifier:

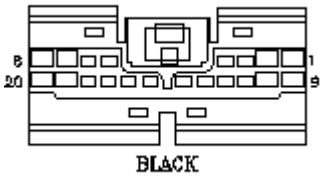

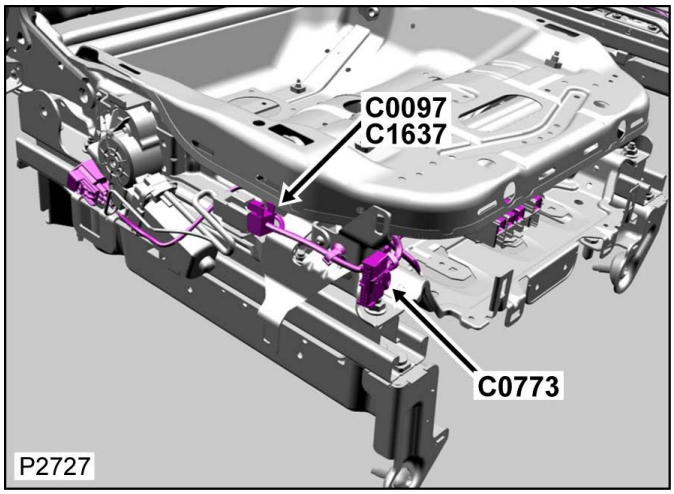

Part No.: YPC912180

Colour: BLACK

Cavities: 20WY

Harness: SEAT FRONT HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	NP	439	S/JOINT SJ1
2	0.35	S	207	C2382
2	0.5	GK	439	C3026
3	0.75	NY	480	C0974
4	0.35	Y	207	C2363
5	0.5	WG	834	C3170
5	0.75	U	480	C0974
8	0.5	GK	207	S/JOINT SJ998
8	1.5	B	439	S/JOINT SJ151
9	1.5	NP	439	S/JOINT SJ1
11	0.35	SP	207	C2363
12	0.5	B	207	S/JOINT SJ151
12	0.75	N	439	C2930
13	0.75	K	439	C2930
14	0.75	P	439	C0721
15	0.75	U	439	C0721
15	0.5	UR	834	C3170
16	0.75	Y	439	C1637
16	0.5	RU	834	C3170
17	0.75	G	439	C1637
17	0.5	SP	834	C3170
17	0.5	SP	479	C0974
18	0.75	N	439	C3030
19	0.5	NG	834	C3170
19	1.5	N	439	C3030
19	0.5	WG	479	C0974
20	1.5	B	439	C3025

Click here to print

Connector: **C0775**

CONNECTOR HOUSING NOT SERVICEABLE

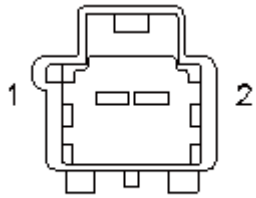

LIGHT GREY

Part No.: YPC900870

Colour: LIGHT GREY


Cavities: 2WY

Harness: SEAT LINK HARNESS

Description: Seat link harness to seat harness

Location: Beneath front passenger seat

Qualifier:

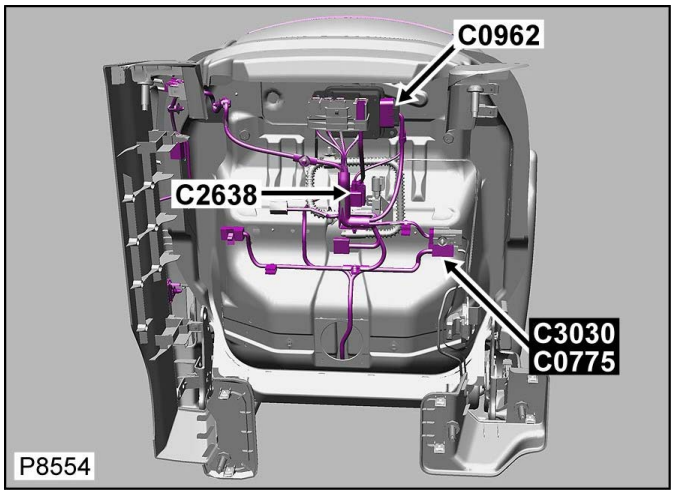


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	N	494	C0518	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	K	494	C0518	418-411-16	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: **C0775**

CONNECTOR HOUSING NOT SERVICEABLE

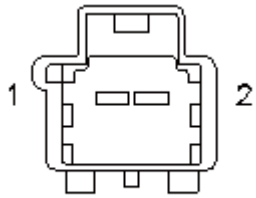

LIGHT GREY

Part No.: YPC900870

Colour: LIGHT GREY


Cavities: 2WY

Harness: SEAT LINK HARNESS

Description: Seat link harness to seat harness

Location: Beneath front passenger seat

Qualifier:

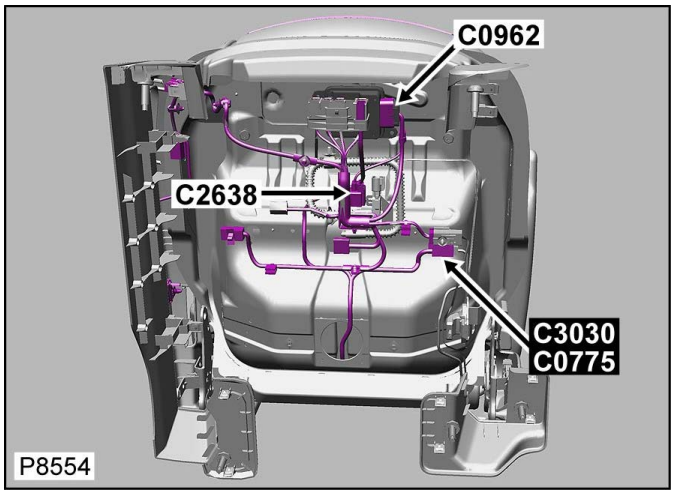


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	N	494	C0518	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	K	494	C0518	418-411-16	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C0780

CONNECTOR HOUSING NOT SERVICEABLE

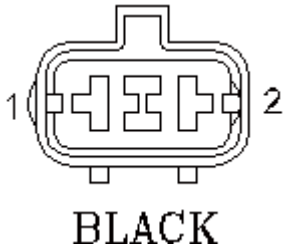

Part No.: YPC905160

Colour: BLACK


Cavities: 2WY

Harness: CHASSIS HARNESS

Description: Air supply unit

Location: Beneath vehicle - LH side

Qualifier:

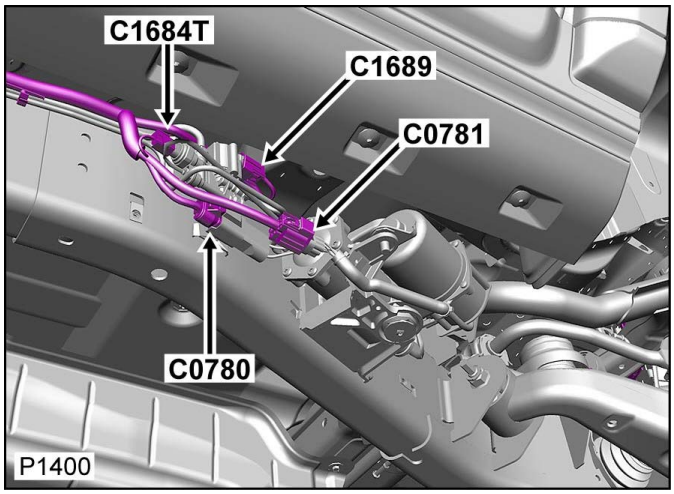


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	6.0	NR	419T	C2527T
1	6.0	NR	419S	C2527S
2	6.0	B	419T	C0561T
2	6.0	B	419S	C0561S

Click here to print

Connector: **C0781**

CONNECTOR HOUSING SERVICEABLE

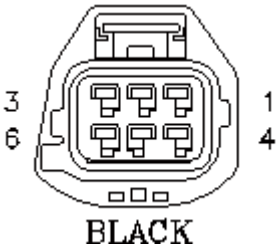

Part No.: YPC800230

Colour: BLACK


Cavities: 6WY

Harness: CHASSIS HARNESS

Description: Air supply unit

Location: Beneath vehicle - LH side

Qualifier:

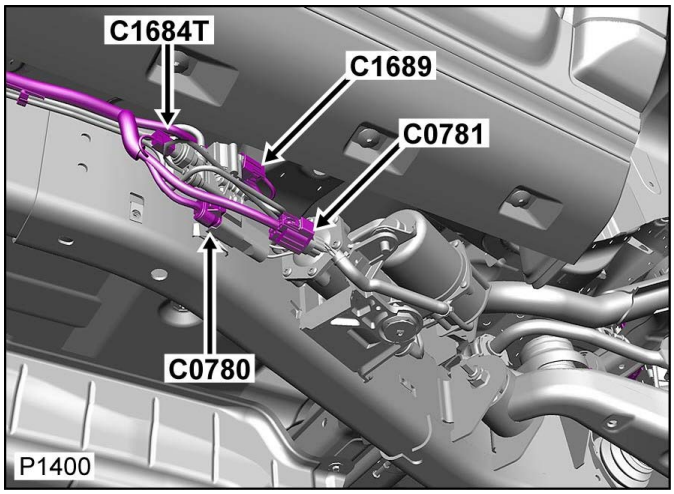


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	BW	419T	C2294T	-	-	-	-	-	-	-
1	0.75	BW	419S	C2294SB	-	-	-	-	-	-	-
2	0.5	BO	419	C0390	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	BY	419T	C2294T	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	BY	419S	C2294SB	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.75	BU	419T	C2294T	-	-	-	-	-	-	-
4	0.75	BU	419S	C2294SB	-	-	-	-	-	-	-
5	0.5	BN	419	C0390	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	BG	419T	C2294T	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	BG	419S	C2294SB	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0784T**

CONNECTOR HOUSING NOT SERVICEABLE

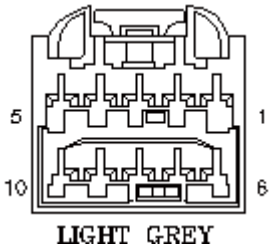

Part No.: YPC910600

Colour: LIGHT GREY


Cavities: 10WY

Harness: CABIN HARNESS

Description: Roof opening panel control module

Location: Front of headlining in the center

Qualifier:

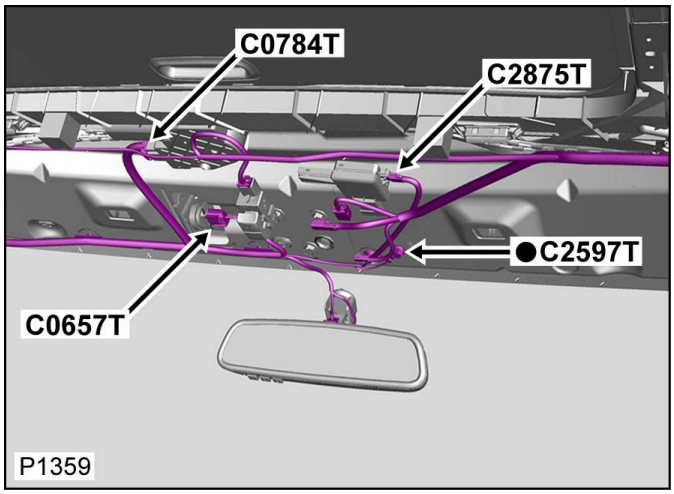

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	NR	227TL	C0585L	-	-	-	-	-	-	-
1	1.5	NR	227TR	C0585R	-	-	-	-	-	-	-
3	0.35	R	227TL	C1166L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	R	227TR	C1165	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	OY	227T	C0084	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	GW	227T	C0084	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	1.5	B	227T	C0810	-	-	-	-	-	-	-

Click here to print


Connector: C0787L

CONNECTOR HOUSING NOT SERVICEABLE


Description: Sensor-Position-Accelerator pedal

Location: Driver footwell

Qualifier:

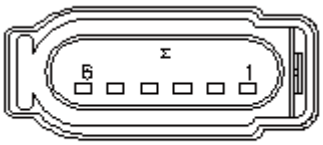

BLACK

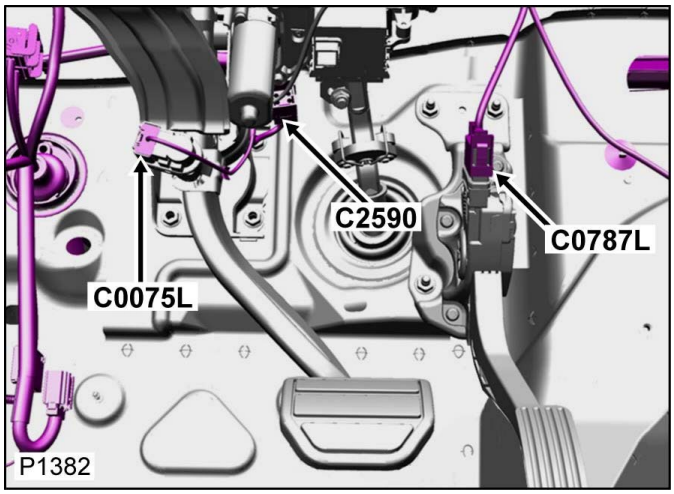

Part No.: YPC907000

Colour: BLACK

Cavities: 6WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	R	252L	C0635L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	R	798L	C0658L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	R	797L	C0872L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RB	282L	C0635L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RB	798L	C0658L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RB	797L	C0872L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	YR	282L	C0635L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	YLG	798L	C0658L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	YLG	797L	C0872L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	BG	282L	C0635L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	Y	797L	C0872L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	BG	798L	S/JOINT SJ865	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	U	282L	C0635L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	U	798L	C0658L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	U	797L	C0872L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	OY	282L	C0635L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	G	797L	C0872L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	OY	798L	S/JOINT SJ864	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C0787R

CONNECTOR HOUSING NOT SERVICEABLE


Description: Sensor-Position-Accelerator pedal

Location: Driver footwell

Qualifier:

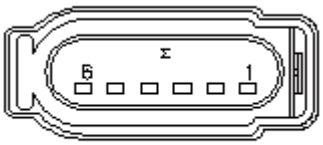

BLACK

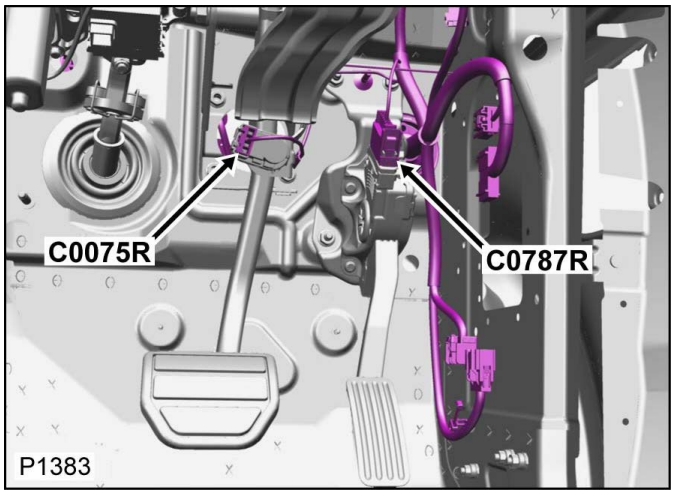

Part No.: YPC907000

Colour: BLACK

Cavities: 6WY

Harness: ENGINE COMPARTMENT HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	R	252R	C0635R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	R	798R	C0658R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	R	797R	C0872R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RB	282R	C0635R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RB	798R	C0658R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RB	797R	C0872R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	YR	282R	C0635R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	YLG	798R	C0658R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	YLG	797R	C0872R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	BG	282R	C0635R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	Y	797R	C0872R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	BG	798R	S/JOINT SJ1865	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	U	282R	C0635R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	U	798R	C0658R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	U	797R	C0872R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	OY	282R	C0635R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	G	797R	C0872R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	OY	798R	S/JOINT SJ1864	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0790L**

CONNECTOR HOUSING NOT SERVICEABLE

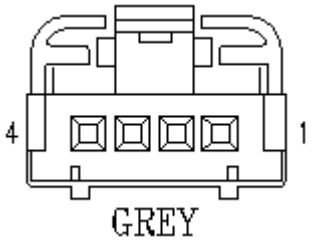

Part No.: YPC801320

Colour: GREY


Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS

Description: Sensor-Sunlight

Location: Instrument panel-center-top

Qualifier:

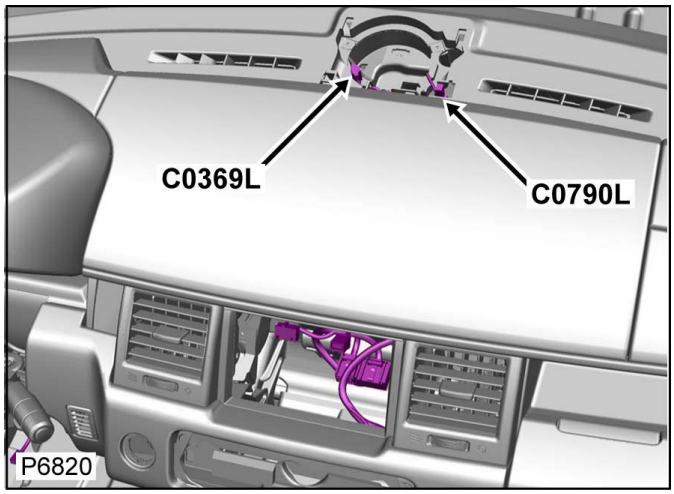


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WU	19L	C3470	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	WR	19L	C3470	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	GW	19L	C3470	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	BG	19L	S/JOINT SJ550	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0790R

CONNECTOR HOUSING NOT SERVICEABLE

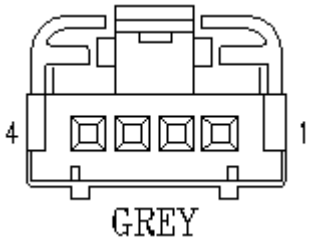

Part No.: YPC801320

Colour: GREY


Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS

Description: Sensor-Sunlight

Location: Instrument panel-center-top

Qualifier:

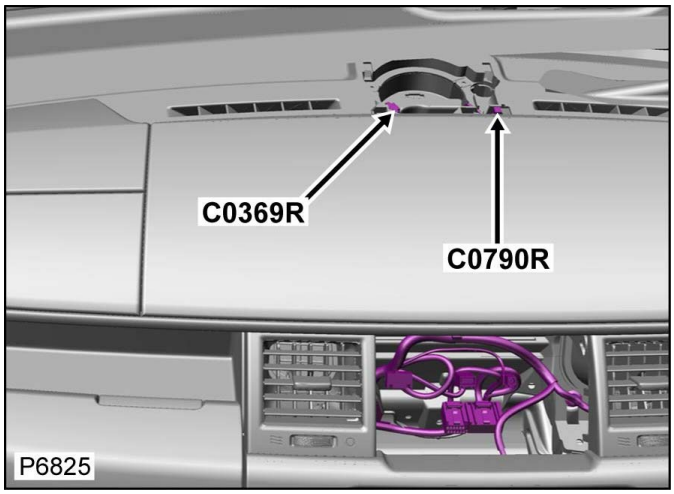


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WU	19R	C3470	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	WR	19R	C3470	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	GW	19R	C3470	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	BG	19R	S/JOINT SJ550	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0797

CONNECTOR HOUSING NOT SERVICEABLE

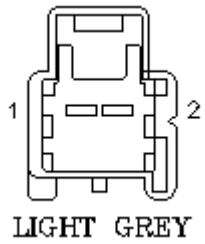

Part No.: YPC903740

Colour: LIGHT GREY


Cavities: 2WY

Harness: ATC RHD HARNESS

Description: Air conditioning (A/C) harness to instrument panel harness

Location: Climate control assembly-Driver side

Qualifier:

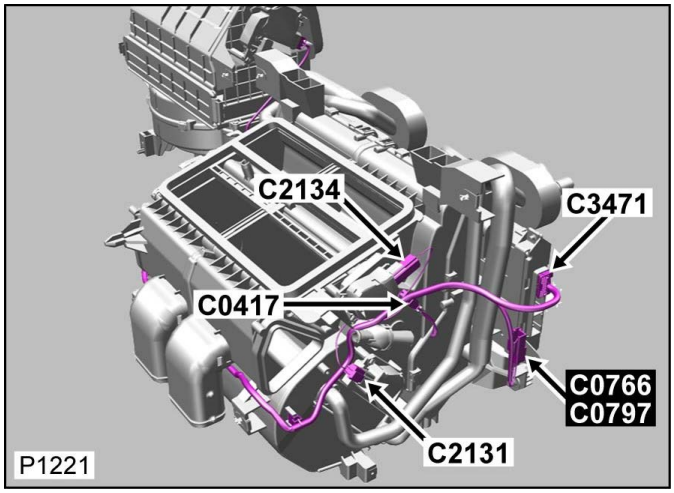

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WU	499	C3471	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RY	499	S/JOINT SJ4	418-411-12	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: **C0803**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Rear door harness to main harness

Location: In LH 'B' post

Qualifier:

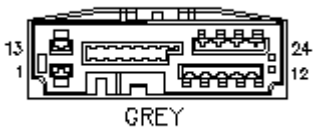

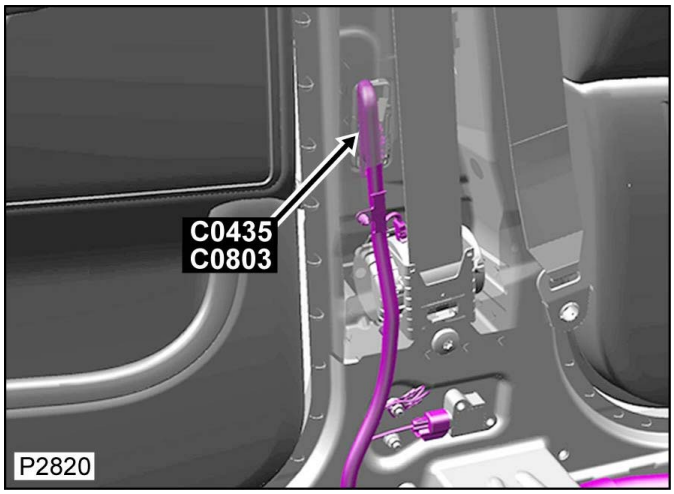

Part No.: YPC803300

Colour: GREY

Cavities: 24WY

Harness: REAR DOOR HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	B	277	C2018	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
4	0.35	B	277	C2018	-	-	-	-	-	-	-
8	1.5	WG	478L	C0310	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
9	1.5	NY	478L	C0310	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
10	1.5	GN	478L	C0680	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
11	1.5	SN	478L	C0680	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	B	277	C0442	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
13	2.5	B	277	S/JOINT SJ200	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
14	0.35	RW	811	C2301	-	-	-	-	-	-	-
15	0.35	RW	811	C2301	-	-	-	-	-	-	-
16	0.35	GR	811	C2301	-	-	-	-	-	-	-
17	0.35	WR	811	C2301	-	-	-	-	-	-	-
18	0.75	P	493	C0980	418-411-47	-	418-116A	418-117	-	418-112	418-107
19	0.5	B	827L	C3474	418-411-47	-	418-116A	418-117	-	418-112	418-107
20	0.5	B	811	C2302	418-411-47	-	418-116A	418-117	-	418-112	418-107
22	1.5	B	811	C2302	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
23	1.5	B	811	C2302	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
24	0.35	R	811	C2301	418-411-15	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0804


CONNECTOR HOUSING NOT SERVICEABLE

Description: Rear door harness to main harness

Location: In RH 'B' post

Qualifier:



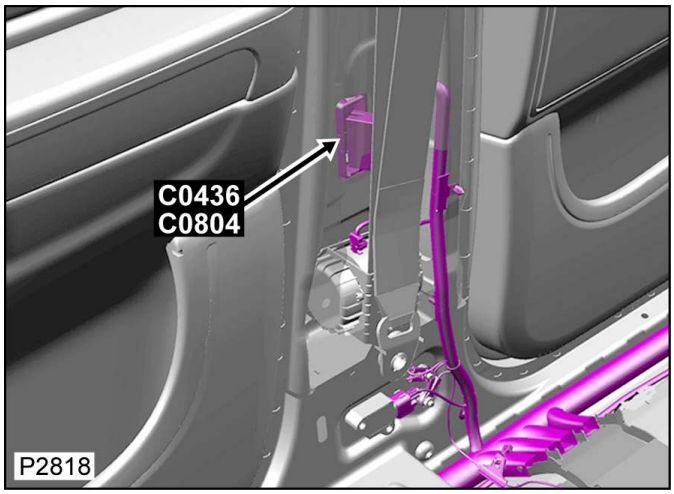

Part No.: YPC803300

Colour: GREY

Cavities: 24WY

Harness: REAR DOOR HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	B	278	C2018	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
4	0.5	B	278	C2018	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	1.5	NW	478R	C0310	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
9	1.5	NU	478R	C0310	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
10	1.5	UW	478R	C0680	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
11	1.5	PU	478R	C0680	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	B	278	C0442	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
13	2.5	B	278	S/JOINT SJ200	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
14	0.35	RW	812	C2301	-	-	-	-	-	-	-
15	0.35	RW	812	C2301	-	-	-	-	-	-	-
16	0.35	GR	812	C2301	-	-	-	-	-	-	-
17	0.35	WR	812	C2301	-	-	-	-	-	-	-
18	0.75	P	502	C0980	418-411-47	-	418-116A	418-117	-	418-112	418-107
19	0.5	B	827R	C3474	418-411-47	-	418-116A	418-117	-	418-112	418-107
20	0.5	B	812	C2302	418-411-47	-	418-116A	418-117	-	418-112	418-107
22	1.5	B	812	C2302	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
23	1.5	B	812	C2302	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
24	0.35	R	812	C2301	418-411-15	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0807

CONNECTOR HOUSING NOT SERVICEABLE

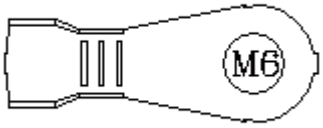

Part No.: YPG801380

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

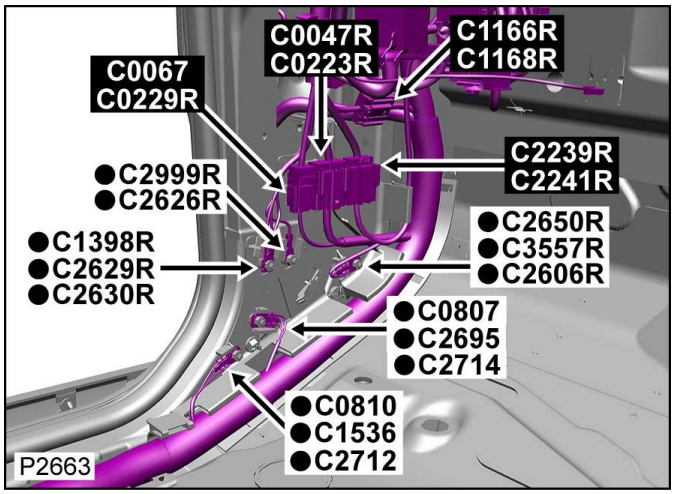


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	200R	C0585R
1	2.5	B	200R	C0585R

Click here to print

Connector: C0809

CONNECTOR HOUSING NOT SERVICEABLE

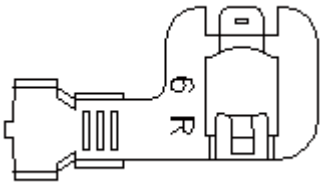

Part No.: YPG800220

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of 'B' post RH side

Qualifier:

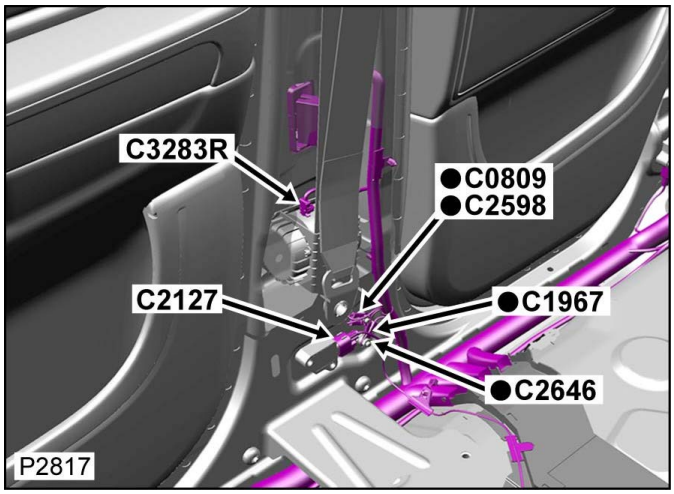


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	572	C2043
1	2.5	B	499	C0436

Click here to print

Connector: C0810

CONNECTOR HOUSING NOT SERVICEABLE

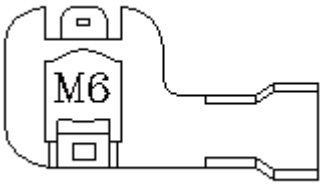

Part No.: YPG900260

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

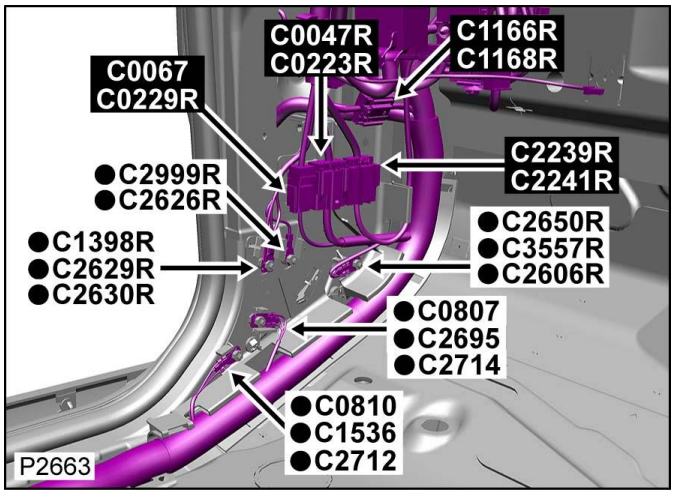


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	B	204	C2378
1	1.5	B	227S	C0784S
1	1.5	B	227T	C0784T

Click here to print

Connector: C0811

CONNECTOR HOUSING NOT SERVICEABLE

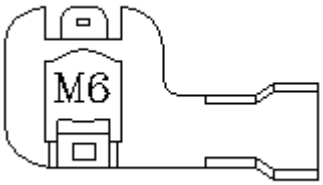

Part No.: YPG900260

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of RH 'A' post

Qualifier: LHD condition illustrated

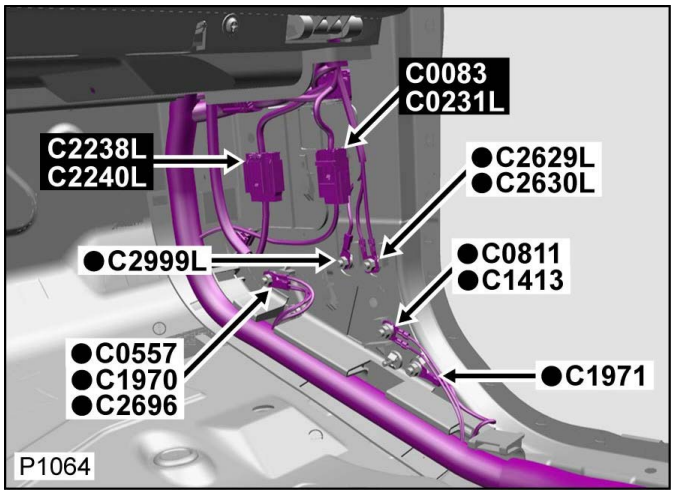

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	139L	S/JOINT SJ276
1	4.0	B	200R	S/JOINT SJ276

Click here to print

Connector: **C0812T**


CONNECTOR HOUSING SERVICEABLE

Description: Main harness to telematics harness

Location: Behind luggage compartment carpet RH side

Qualifier:



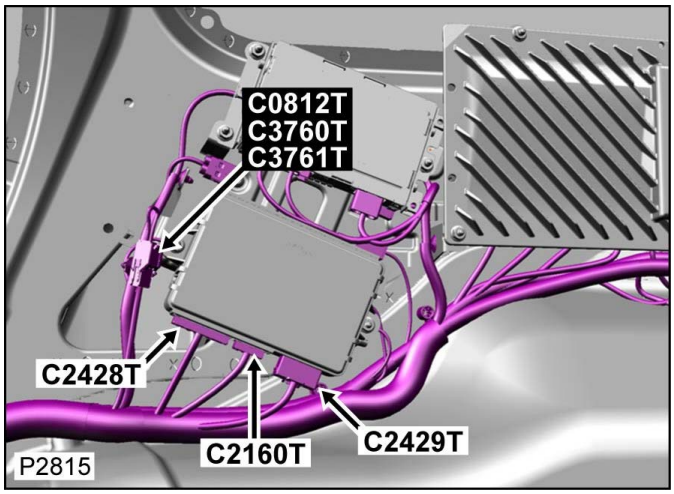

Part No.: YPC905670

Colour: GREY

Cavities: 8WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	YW	478TL	C0812T	418-411-45	-	418-116A	418-117	-	418-112	418-107
1	0.35	YW	478TR	C0812T	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.35	YW	478TL	C0812T	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.35	YW	478TR	C0812T	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.35	YU	478TL	C0812T	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.35	YU	478TR	C0812T	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.35	YU	478TL	C0812T	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.35	YU	478TR	C0812T	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: **C0820T**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Video interface-Japan

Location: Behind luggage compartment carpet RH side

Qualifier:

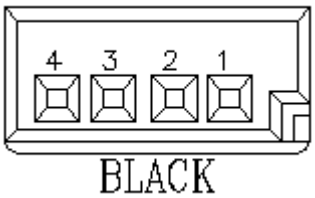

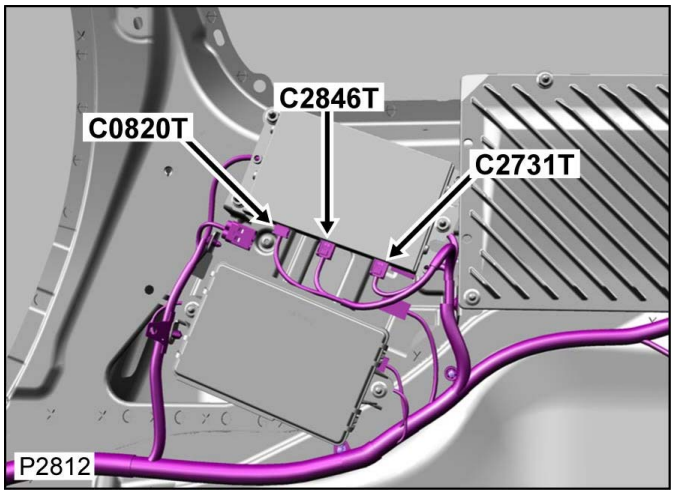

Part No.: YPC906610

Colour: BLACK

Cavities: 4WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	R	568T	S/JOINT SJ520	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.5	UO	568T	C2639	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.5	B	568T	S/JOINT SJ1	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0828

CONNECTOR HOUSING NOT SERVICEABLE

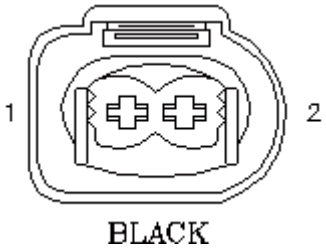

Part No.: YPC116380

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Pump-Power wash

Location: Behind LH front fender splash shield

Qualifier:

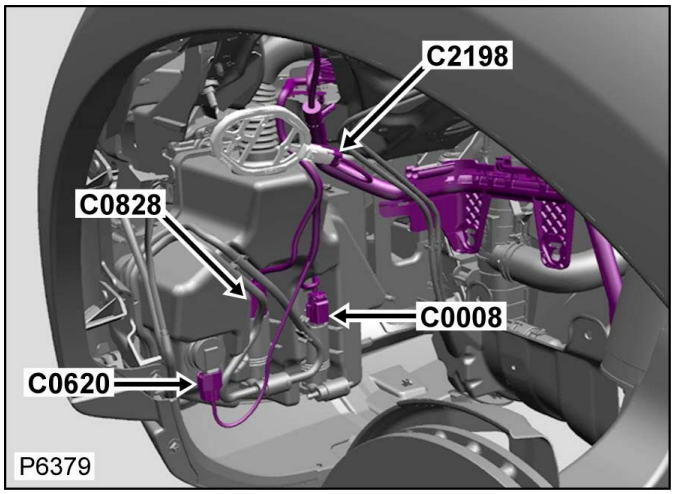


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	RLG	183L	C0570L
1	2.5	RLG	183R	C0570R
2	2.5	LGR	183L	C0570L
2	2.5	LGR	183R	C0570R

Click here to print

Connector: C0832A

CONNECTOR HOUSING NOT SERVICEABLE

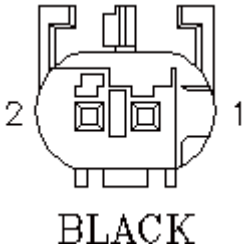

Part No.: YPC110710

Colour: BLACK


Cavities: 2WY

Harness: TAILGATE HARNESS

Description: Lamp-High mounted stop

Location: Top of taildoor

Qualifier:

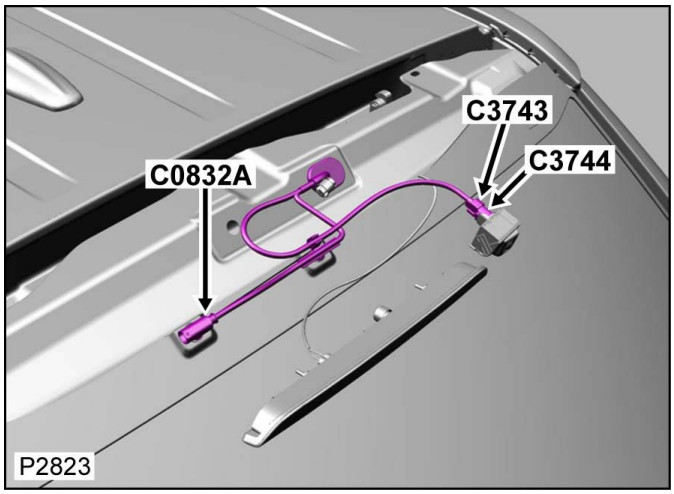

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	BP	499	C2740	418-587-03	-	418-116A	418-117	-	418-112	418-107
2	0.5	BK	499	C2740	418-587-03	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0862L

CONNECTOR HOUSING NOT SERVICEABLE

Description: Sensor-Steering-angle

Location: Underside of steering column

Qualifier:

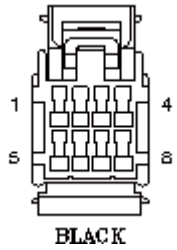


Part No.: YPC10328

Colour: BLACK

Cavities: 8WY

Harness: FACIA COMPOSITE HARNESS

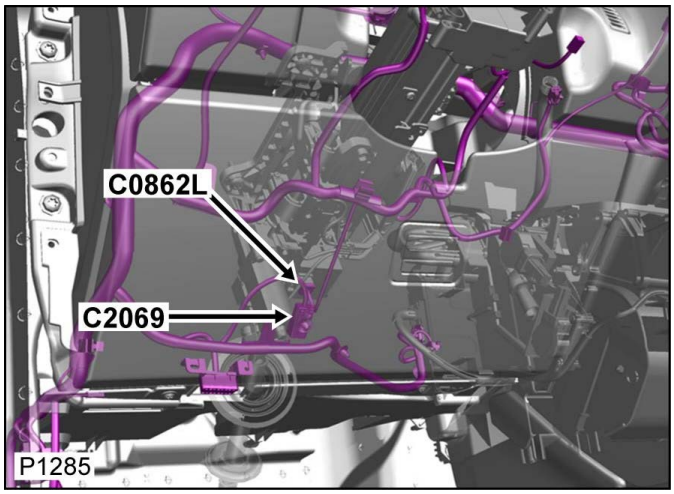


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
5	0.5	LG	409L	C2238L	418-549-61	-	418-116A	-	418-104	418-112	418-107
6	0.35	YN	409L	S/JOINT SJ850	418-549-61	-	418-116A	-	418-104	418-112	418-107
7	0.35	YB	409L	S/JOINT SJ860	418-549-61	-	418-116A	-	418-104	418-112	418-107
8	0.5	B	409L	S/JOINT SJ663L	418-549-61	-	418-116A	-	418-104	418-112	418-107

Click here to print

Connector: C0862R

CONNECTOR HOUSING NOT SERVICEABLE

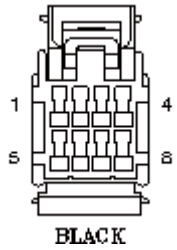

Part No.: YPC10328

Colour: BLACK


Cavities: 8WY

Harness: FACIA COMPOSITE HARNESS

Description: Sensor-Steering-angle

Location: Underside of steering column

Qualifier:

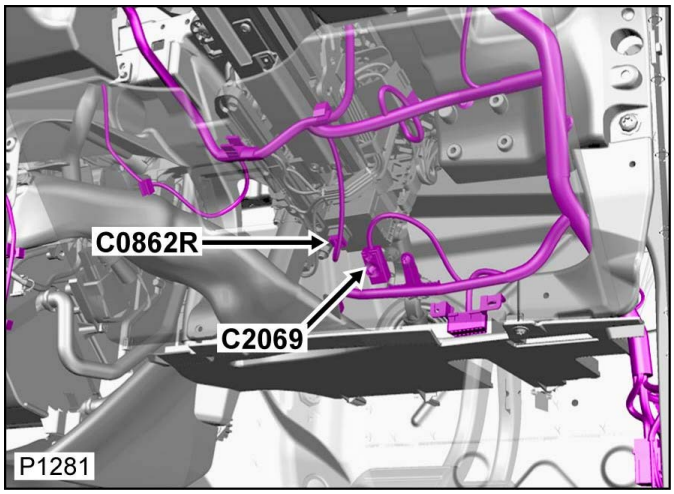

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
5	0.5	LG	409R	C2238R	418-549-61	-	418-116A	-	418-104	418-112	418-107
6	0.35	YN	409R	S/JOINT SJ850	418-549-61	-	418-116A	-	418-104	418-112	418-107
7	0.35	YB	409R	S/JOINT SJ860	418-549-61	-	418-116A	-	418-104	418-112	418-107
8	0.5	B	409R	S/JOINT SJ663R	418-549-61	-	418-116A	-	418-104	418-112	418-107

Click here to print


Connector: C0867L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Air suspension

Location: LH 'A' post

Qualifier:

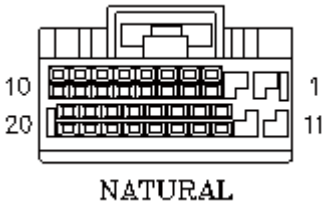

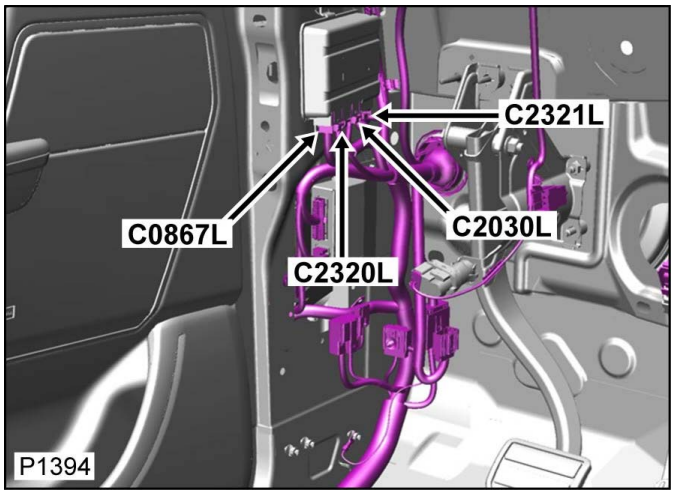

Part No.: YPC500830

Colour: NATURAL

Cavities: 20WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	BY	419L	C0376	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
2	1.0	BG	419L	C0376	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	BW	419SL	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	BW	986TL	C2053TL	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	BW	982TL	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	OY	419L	C0376	-	-	-	-	-	-	-
6	0.5	OR	419L	C0376	-	-	-	-	-	-	-
7	0.5	OB	419L	C0376	-	-	-	-	-	-	-
8	0.5	SY	419L	C0376	-	-	-	-	-	-	-
9	0.5	SU	419L	C0376	-	-	-	-	-	-	-
10	0.5	SR	419L	C0376	-	-	-	-	-	-	-
11	1.0	BP	419L	C0376	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
12	1.0	BO	419L	C0376	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
13	0.35	WK	419L	C0586L	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
14	0.35	BP	419SL	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
14	0.35	BP	986TL	C2053TL	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
14	0.35	BP	982TL	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
15	0.35	BY	419SL	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
15	0.35	BY	986TL	C2053TL	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
15	0.35	BY	982TL	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
17	0.35	YN	419L	S/JOINT SJ1007	418-411-59	-	418-116A	418-117	418-104	418-112	418-107

18	0.35	YB	419L	S/JOINT SJ1008	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
20	0.75	LGW	419L	C0585L	-	-	-	-	-	-	-

Click here to print


Connector: C0867R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Air suspension

Location: RH 'A' post

Qualifier:

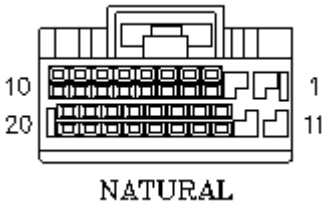

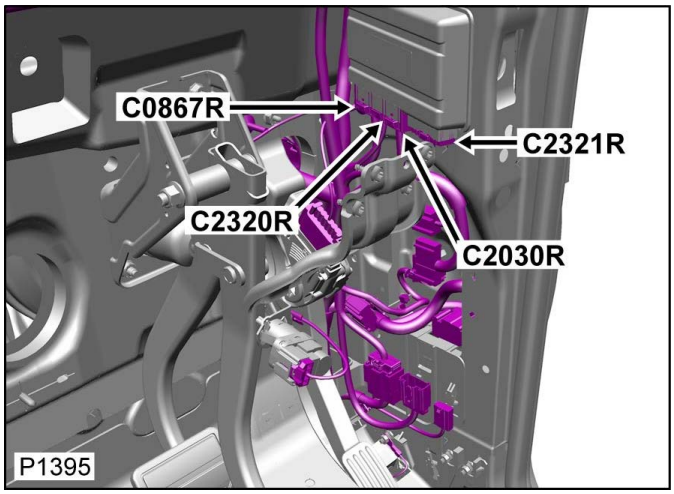

Part No.: YPC500830

Colour: NATURAL

Cavities: 20WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	BY	419R	C0376	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
2	1.0	BG	419R	C0376	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	BW	419SR	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	BW	986TR	C2053TR	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	BW	982TR	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	OY	419R	C0376	-	-	-	-	-	-	-
6	0.5	OR	419R	C0376	-	-	-	-	-	-	-
7	0.5	OB	419R	C0376	-	-	-	-	-	-	-
8	0.5	SY	419R	C0376	-	-	-	-	-	-	-
9	0.5	SU	419R	C0376	-	-	-	-	-	-	-
10	0.5	SR	419R	C0376	-	-	-	-	-	-	-
11	1.0	BP	419R	C0376	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
12	1.0	BO	419R	C0376	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
13	0.35	WK	419R	C0586R	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
14	0.35	BP	419SR	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
14	0.35	BP	986TR	C2053TR	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
14	0.35	BP	982TR	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
15	0.35	BY	419SR	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
15	0.35	BY	986TR	C2053TR	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
15	0.35	BY	982TR	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
17	0.35	YN	419R	S/JOINT SJ1001	418-411-59	-	418-116A	418-117	418-104	418-112	418-107

18	0.35	YB	419R	S/JOINT SJ1002	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
20	0.75	LGW	419R	C0585R	-	-	-	-	-	-	-

Click here to print

Connector: C0868TA


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to console harness

Location: Beneath center console LH side

Qualifier: LHD condition illustrated



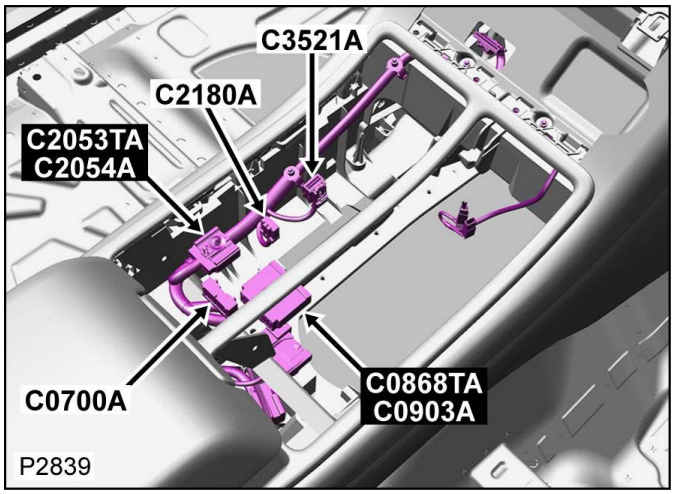

Part No.: YPC803280

Colour: GREY

Cavities: 24WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	LGW	982T	C0467	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	0.35	YW	982T	S/JOINT SJ2002	-	-	-	-	-	-	-
3	0.35	YU	982T	S/JOINT SJ2003	-	-	-	-	-	-	-
4	0.5	YG	982T	C0376	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	YU	982T	C0376	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.35	G	982TL	C2243L	-	-	-	-	-	-	-
6	0.35	G	982TR	C2243R	-	-	-	-	-	-	-
7	0.35	GR	982TL	C2243L	-	-	-	-	-	-	-
7	0.35	GR	982TR	C2242R	-	-	-	-	-	-	-
8	0.75	OG	982T	S/JOINT SJ396T	-	-	-	-	-	-	-
9	0.5	S	982TL	C2243L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	S	982TR	C2409R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	GW	982TL	C2243L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	GW	982TR	C2409R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	OG	982T	S/JOINT SJ971	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	BG	982TL	C2243L	418-411-45	-	418-116A	418-117	-	418-112	418-107
14	0.5	BG	982TR	C2243R	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.5	OG	982T	S/JOINT SJ396T	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.35	OR	982TL	C2243L	-	-	-	-	-	-	-
16	0.35	OR	982TR	C2242R	-	-	-	-	-	-	-
17	0.35	O	982TL	C2243L	-	-	-	-	-	-	-

17	0.5	OR	982TR	C2242R	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.5	GO	982TL	C2243L	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.5	GO	982TR	C2409R	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.75	PY	982TL	C2411L	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.75	PY	982TR	C1166R	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	0.35	YN	982T	S/JOINT SJ1005	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
22	0.35	YB	982T	S/JOINT SJ1006	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
23	0.5	RN	982T	S/JOINT SJ2022	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
24	2.5	B	982T	C2598	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C0868TL

CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to console harness

Location: Beneath center console RH side

Qualifier: LHD condition illustrated




Part No.: YPC803280

Colour: GREY

Cavities: 24WY

Harness: CABIN HARNESS

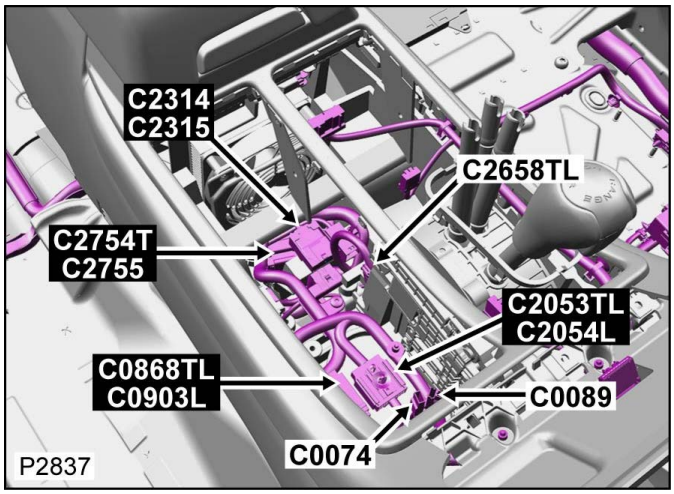

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	LGW	986TL	C0467	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	0.35	YW	986TL	S/JOINT SJ2002	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.35	YU	986TL	S/JOINT SJ2003	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	YG	986TL	C0376	-	-	-	-	-	-	-
5	0.5	YU	986TL	C0376	-	-	-	-	-	-	-
6	0.35	G	986TL	C2243L	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.35	GR	986TL	C2243L	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.75	OG	986TL	S/JOINT SJ396T	-	-	-	-	-	-	-
9	0.5	R	986TL	C2658TL	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	RG	986TL	C2658TL	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	RW	986TL	C2658TL	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	BG	986TL	C2243L	-	-	-	-	-	-	-
15	0.5	OG	986TL	S/JOINT SJ396T	-	-	-	-	-	-	-
16	0.35	OR	986TL	C2243L	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.35	O	986TL	C2243L	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.5	RU	986TL	C2658TL	-	-	-	-	-	-	-
19	0.5	RY	986TL	C2658TL	-	-	-	-	-	-	-
20	0.5	RB	986TL	C2658TL	-	-	-	-	-	-	-
21	0.35	YN	986TL	S/JOINT SJ1005	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
22	0.35	YB	986TL	S/JOINT SJ1006	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
23	0.5	RN	986TL	S/JOINT SJ2022	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

24	2.5	B	986TL	C2598	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C0868TR


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to console harness

Location: Beneath center console LH side

Qualifier:



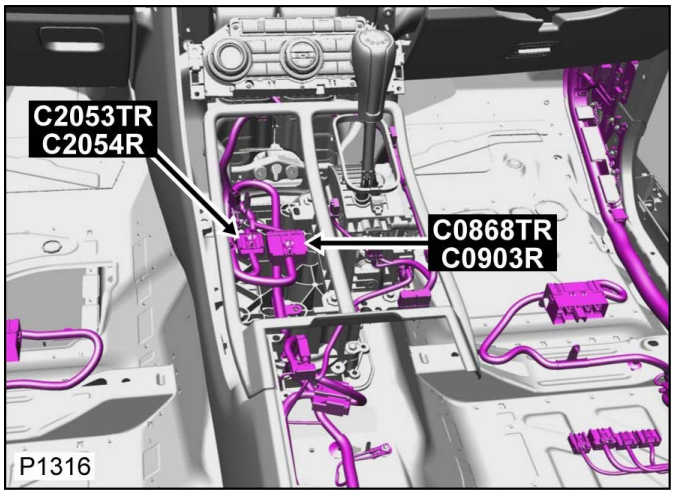

Part No.: YPC803280

Colour: GREY

Cavities: 24WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	LGW	986TR	C0467	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	0.35	YW	986TR	S/JOINT SJ2002	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.35	YU	986TR	S/JOINT SJ2003	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	YG	986TR	C0376	-	-	-	-	-	-	-
5	0.5	YU	986TR	C0376	-	-	-	-	-	-	-
6	0.35	G	986TR	C2243R	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.35	GR	986TR	C2242R	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.75	OG	986TR	S/JOINT SJ396T	-	-	-	-	-	-	-
9	0.5	R	986TR	C2658TR	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	RG	986TR	C2658TR	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	RW	986TR	C2658TR	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	BG	986TR	C2243R	-	-	-	-	-	-	-
15	0.5	GO	986TR	S/JOINT SJ396T	-	-	-	-	-	-	-
16	0.35	OR	986TR	C2242R	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.5	OR	986TR	C2242R	-	-	-	-	-	-	-
18	0.5	RU	986TR	C2658TR	-	-	-	-	-	-	-
19	0.5	RY	986TR	C2658TR	-	-	-	-	-	-	-
20	0.5	RB	986TR	C2658TR	-	-	-	-	-	-	-
21	0.35	YN	986TR	S/JOINT SJ1005	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
22	0.35	YB	986TR	S/JOINT SJ1006	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
23	0.5	RN	986TR	S/JOINT SJ2022	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

24	2.5	B	986TR	C2598	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: **C0876T**

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC501000

Colour: DARK GREY


Cavities: 8WY

Harness: CABIN HARNESS

Description: Main harness to trailer connector

Location: LH rear of vehicle

Qualifier:

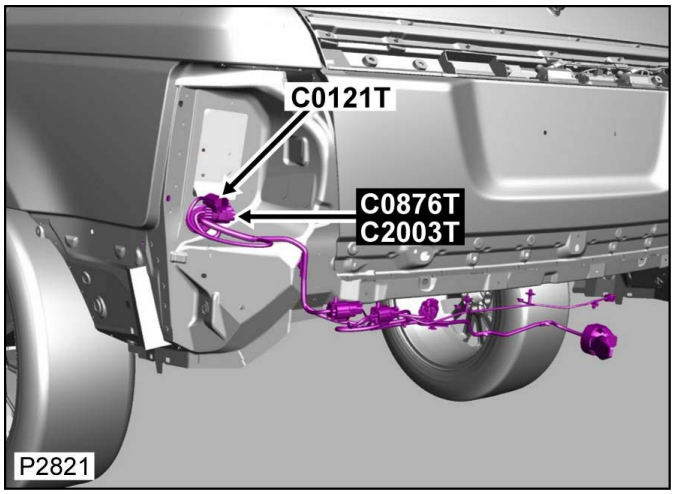


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	UW	68T	C1457	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	YG	68T	C1457	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	GW	68T	C1457	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	YB	68T	C1457	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	YS	68T	C1457	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	0.35	YO	68T	C1457	418-411-08	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C0884**

CONNECTOR HOUSING NOT SERVICEABLE

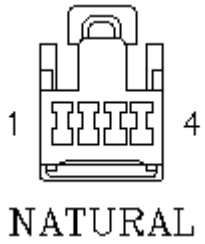

Part No.: YPC800300

Colour: NATURAL


Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS

Description: Sensor-Temperature/ Humidity

Location: Behind driver side of Instrument panel

Qualifier:

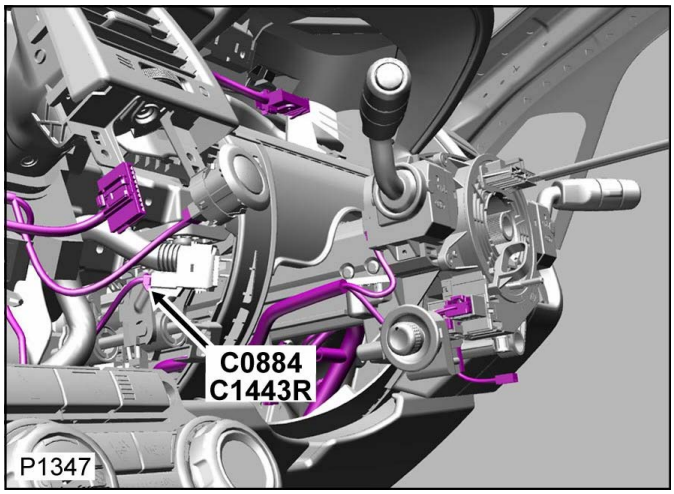

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	UY	19R	S/JOINT SJ784
2	0.5	BG	19R	S/JOINT SJ550
3	0.5	WU	19R	C0766
4	0.5	RG	19R	S/JOINT SJ880

Click here to print


Connector: **C0897**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Navigation system-Asia

Location: Beneath LH Front seat

Qualifier:

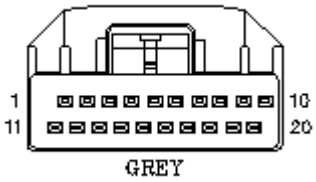

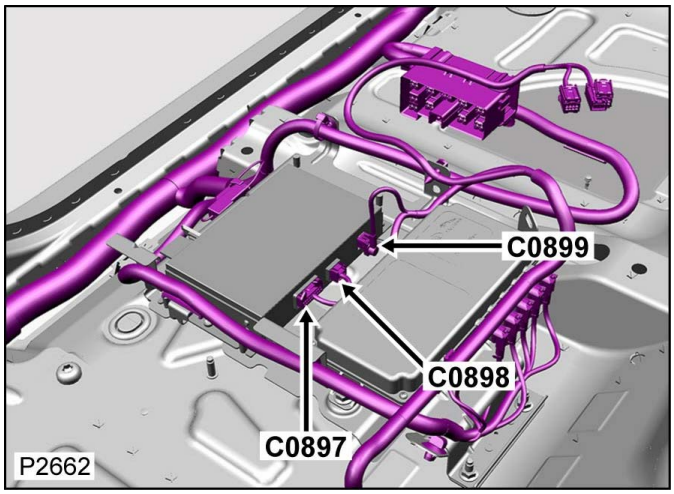

Part No.: YPC803030

Colour: GREY

Cavities: 20WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	1011	S/JOINT SJ520
5	0.35	YW	1011	S/JOINT SJ2
7	0.5	B	1011S	C2649S
7	0.5	B	1011T	C2649T
9	0.5	UG	1011S	C3761S
9	0.5	UG	1011T	C3761T
10	0.5	YO	1011S	C3761S
10	0.5	YO	1011T	C3761T
15	0.35	YU	1011	S/JOINT SJ3
20	0.5	WG	1011S	C3761S
20	0.5	WG	1011T	C3761T

Click here to print

Connector: C0898


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Navigation system-Asia

Location: Beneath LH Front seat

Qualifier:

ASSEMBLY

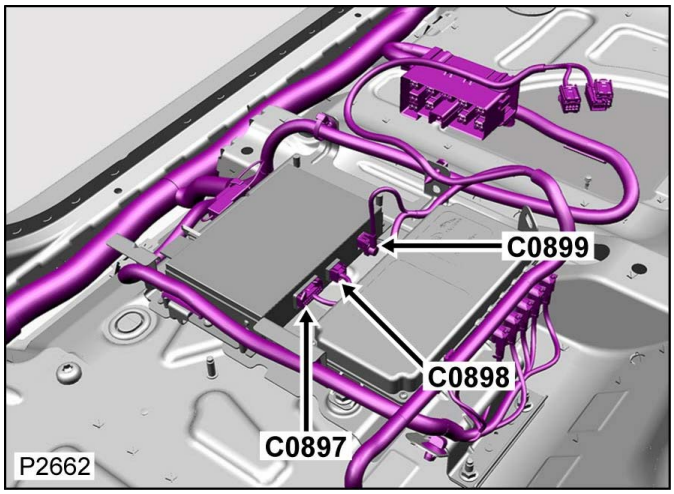

Part No.: XUD815430

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	1011	C2974
2	0.5	Y	1011	C2974
3	SCR	SCR	1011	C2974

Click here to print

Connector: C0899


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Navigation system-Asia

Location: Beneath LH Front seat

Qualifier:

ASSEMBLY

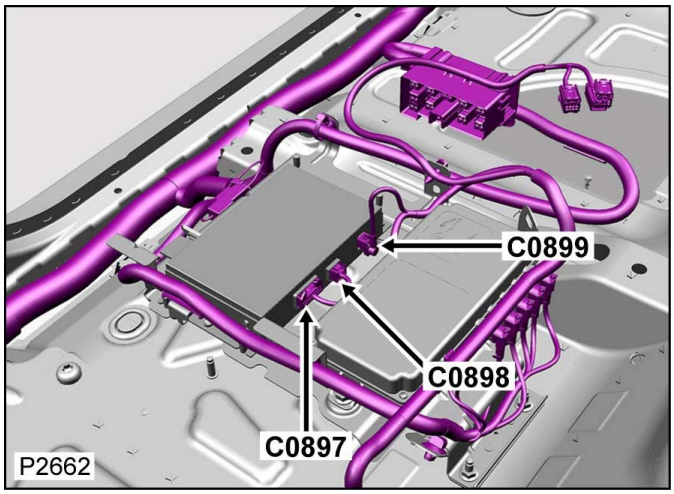

Part No.: XUD812500

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	1011S	C1598S
1S	SCR	SCR	1011S	C1598S
1	0.5	B	1011T	C1598T
1S	SCR	SCR	1011T	C1598T

Click here to print

Connector: **C0903A**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Console harness to main harness

Location: Beneath center console LH side

Qualifier: LHD condition illustrated



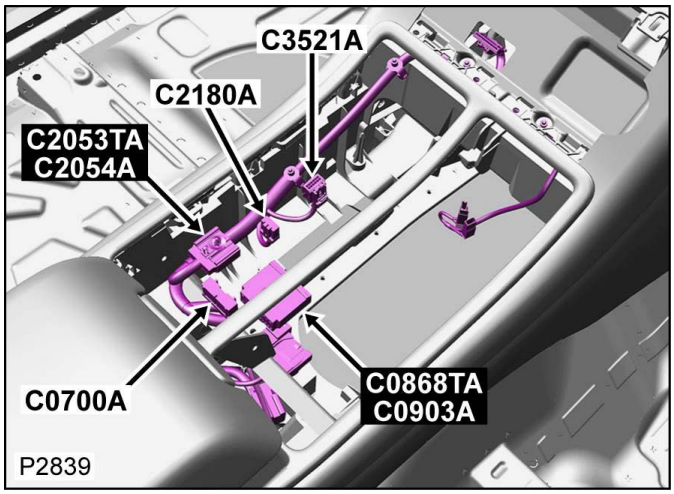

Part No.: YPC803300

Colour: GREY

Cavities: 24WY

Harness: CONSOLE FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	LGW	982L	C0089	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
2	0.35	YW	982L	S/JOINT SJ2012	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.35	YU	982L	S/JOINT SJ2013	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.5	YG	982L	C2180A	-	-	-	-	-	-	-
5	0.5	YU	982L	C2180A	-	-	-	-	-	-	-
6	0.35	G	982L	C0700A	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.35	GR	982L	C0700A	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.75	OG	982L	C0700A	-	-	-	-	-	-	-
9	0.5	S	982L	C3521A	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	GW	982L	C3521A	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	RB	982L	C3521A	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	BG	982L	C0700A	-	-	-	-	-	-	-
15	0.5	GB	982L	S/JOINT SJ303	-	-	-	-	-	-	-
16	0.35	OR	982L	C0700A	418-411-47	-	418-116A	418-117	-	418-112	418-107
17	0.35	O	982L	C0700A	418-411-47	-	418-116A	418-117	-	418-112	418-107
18	0.5	GO	982L	C3521A	-	-	-	-	-	-	-
19	0.75	PY	982L	C3521A	-	-	-	-	-	-	-
21	0.35	YN	982L	S/JOINT SJ1032	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
22	0.35	YB	982L	S/JOINT SJ1033	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
23	0.5	RN	982L	S/JOINT SJ322	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
24	2.5	B	982L	S/JOINT SJ323	418-411-16	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: **C0903B**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Console harness to main harness

Location: Beneath center console RH side

Qualifier: RHD condition illustrated



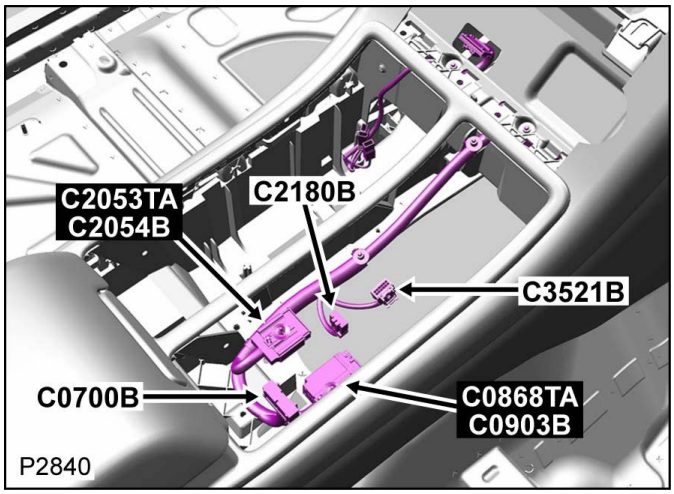

Part No.: YPC803300

Colour: GREY

Cavities: 24WY

Harness: CONSOLE FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	LGW	982R	C0089	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
2	0.35	YW	982R	S/JOINT SJ2012	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.35	YU	982R	S/JOINT SJ2013	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.5	YG	982R	C2180B	-	-	-	-	-	-	-
5	0.5	YU	982R	C2180B	-	-	-	-	-	-	-
6	0.35	G	982R	C0700B	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.35	GR	982R	C0700B	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.75	OG	982R	C0700B	-	-	-	-	-	-	-
9	0.5	S	982R	C3521B	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	GW	982R	C3521B	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	RB	982R	C3521B	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	BG	982R	C0700B	-	-	-	-	-	-	-
15	0.5	GB	982R	S/JOINT SJ303	-	-	-	-	-	-	-
16	0.35	OR	982R	C0700B	418-411-47	-	418-116A	418-117	-	418-112	418-107
17	0.35	O	982R	C0700B	418-411-47	-	418-116A	418-117	-	418-112	418-107
18	0.5	GO	982R	C3521B	-	-	-	-	-	-	-
19	0.75	PY	982R	C3521B	-	-	-	-	-	-	-
21	0.35	YN	982R	S/JOINT SJ1036	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
22	0.35	YB	982R	S/JOINT SJ1037	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
23	0.5	RN	982R	S/JOINT SJ322	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
24	2.5	B	982R	S/JOINT SJ323	418-411-16	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C0903L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Console harness to main harness

Location: Beneath center console RH side

Qualifier: LHD condition illustrated



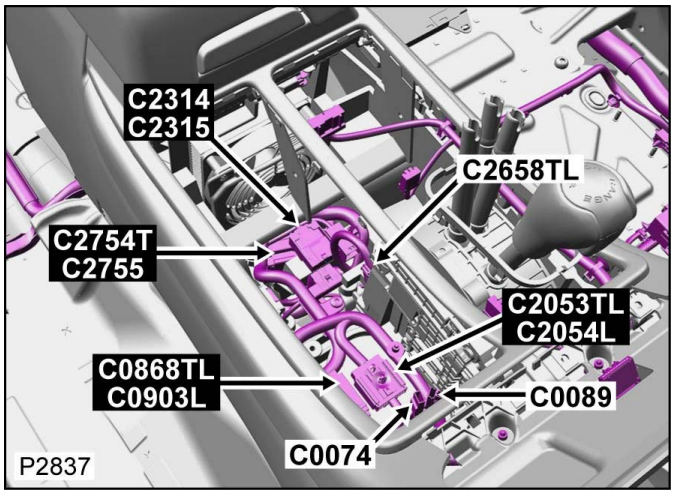

Part No.: YPC803300

Colour: GREY

Cavities: 24WY

Harness: CONSOLE FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	LGW	986L	C0089	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
2	0.35	YW	986L	S/JOINT SJ2012	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.35	YU	986L	S/JOINT SJ2013	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.5	YG	986L	C2180L	-	-	-	-	-	-	-
5	0.5	YU	986L	C2180L	-	-	-	-	-	-	-
6	0.35	G	986L	C0700L	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.35	GR	986L	C0700L	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.75	OG	986L	C0700L	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	R	986L	C2656L	-	-	-	-	-	-	-
10	0.35	RG	986L	C2656L	-	-	-	-	-	-	-
11	0.35	RW	986L	C2656L	-	-	-	-	-	-	-
14	0.5	BG	986L	C0700L	-	-	-	-	-	-	-
15	0.5	GB	986L	S/JOINT SJ303	-	-	-	-	-	-	-
16	0.35	OR	986L	C0700L	418-411-47	-	418-116A	418-117	-	418-112	418-107
17	0.35	O	986L	C0700L	418-411-47	-	418-116A	418-117	-	418-112	418-107
18	0.35	RU	986L	C2656L	418-411-47	-	418-116A	418-117	-	418-112	418-107
19	0.5	RY	986L	C2657L	-	-	-	-	-	-	-
20	0.5	RB	986L	S/JOINT SJ998	-	-	-	-	-	-	-
21	0.35	YN	986L	S/JOINT SJ1044	-	-	-	-	-	-	-
22	0.35	YB	986L	S/JOINT SJ1045	-	-	-	-	-	-	-
23	0.5	RN	986L	S/JOINT SJ322	-	-	-	-	-	-	-

24	2.5	B	986L	S/JOINT SJ323	418-411-16	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C0903R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Console harness to main harness

Location: Beneath center console LH side

Qualifier:



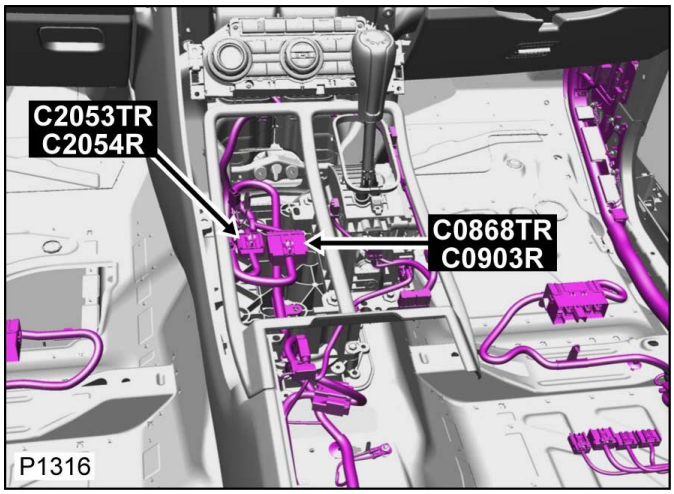

Part No.: YPC803300

Colour: GREY

Cavities: 24WY

Harness: CONSOLE FRONT HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	LGW	986R	C0089	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
2	0.35	YW	986R	S/JOINT SJ2012	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.35	YU	986R	S/JOINT SJ2013	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.5	YG	986R	C2180R	-	-	-	-	-	-	-
5	0.5	YU	986R	C2180R	-	-	-	-	-	-	-
6	0.35	G	986R	C0700R	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.35	GR	986R	C0700R	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.75	OG	986R	C0700R	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	R	986R	C2656R	-	-	-	-	-	-	-
10	0.5	RG	986R	C2656R	-	-	-	-	-	-	-
11	0.5	RW	986R	C2656R	-	-	-	-	-	-	-
14	0.5	BG	986R	C0700R	-	-	-	-	-	-	-
15	0.5	GB	986R	S/JOINT SJ303	-	-	-	-	-	-	-
16	0.35	OR	986R	C0700R	418-411-47	-	418-116A	418-117	-	418-112	418-107
17	0.35	O	986R	C0700R	418-411-47	-	418-116A	418-117	-	418-112	418-107
18	0.5	RU	986R	C2656R	-	-	-	-	-	-	-
19	0.5	RY	986R	C2657R	-	-	-	-	-	-	-
20	0.5	RB	986R	S/JOINT SJ304	-	-	-	-	-	-	-
21	0.35	YN	986R	S/JOINT SJ1046	-	-	-	-	-	-	-
22	0.35	YB	986R	S/JOINT SJ1047	-	-	-	-	-	-	-
23	0.5	RN	986R	S/JOINT SJ322	-	-	-	-	-	-	-
24	2.5	B	986R	S/JOINT	418-411-16	-	418-116A	418-117	418-104	418-113	418-

Click here to print

Connector: C0904

CONNECTOR HOUSING NOT SERVICEABLE

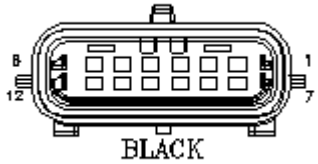

Part No.: YPC913110

Colour: BLACK


Cavities: 12WY

Harness: KNOCK SENSORS PETROL HARNESS

Description: Link harness to engine harness - PV8

Location: Rear RH side of engine

Qualifier:

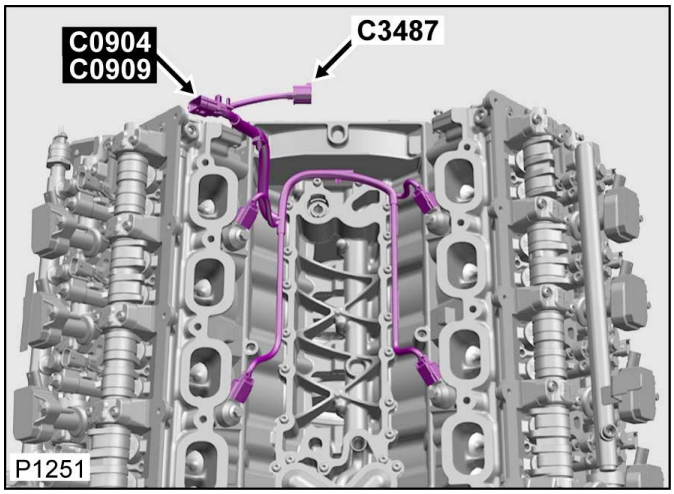

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	PO	ALL	C0150
2	0.5	WN	ALL	C0150
3	0.5	NU	ALL	C3046
4	0.5	NG	ALL	C3046
5	0.5	P	ALL	C2722
6	0.5	W	ALL	C2722
7	0.5	U	ALL	C2723
8	0.5	G	ALL	C2723
9	0.5	S	ALL	C3487
10	0.5	G	ALL	C3487

Click here to print

Connector: **C0904B**

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC903100

Colour: BLACK


Cavities: 2WY

Harness: CRANK LINK HARNESS

Description: Link harness to engine harness - PV8

Location: LH side of engine

Qualifier:

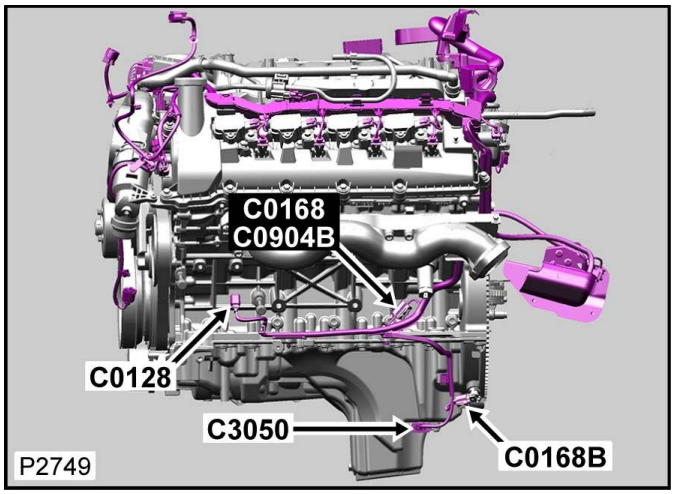

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	ALL	C0168B	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	O	ALL	C0168B	418-411-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0908

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC500600

Colour: DARK GREY


Cavities: 4WY

Harness: TRANSMISSION AUTO-PETROL HARNESS

Description: Sensor-Heated oxygen-Post catalyst-Left bank 2

Location: LH side of gearbox

Qualifier:

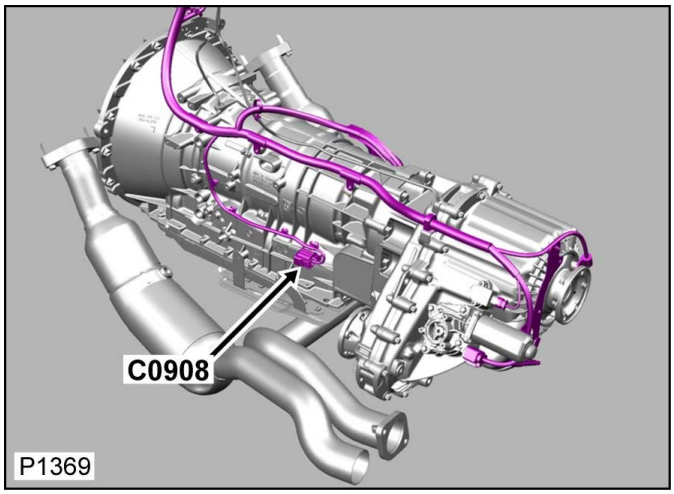

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	WR	282L	C3427L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
1	1.5	WR	282R	C3427R	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
2	1.0	G	282L	C3427L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
2	1.0	G	282R	C3427R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	RB	282L	C3427L	-	-	-	-	-	-	-
3	0.5	RB	282R	C3427R	-	-	-	-	-	-	-
4	0.5	WU	282L	C3427L	-	-	-	-	-	-	-
4	0.5	WU	282R	C3427R	-	-	-	-	-	-	-

Click here to print


Connector: **C0909**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine harness to link harness - PV8

Location: Top of engine

Qualifier:

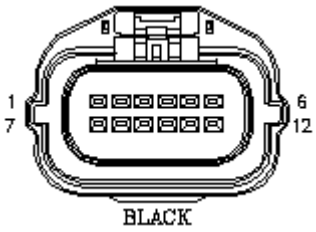

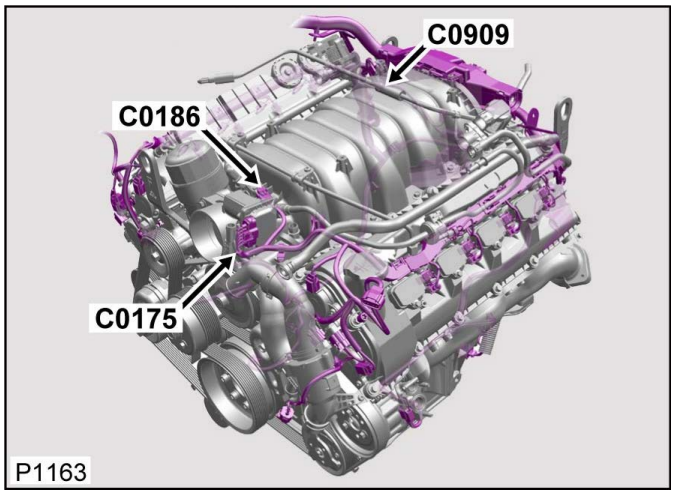

Part No.: YPC912810

Colour: BLACK

Cavities: 12WY

Harness: ENGINE PETROL AJ133 HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	PO	ALL	C0634
2	0.5	WN	ALL	C0634
3	0.5	NU	ALL	C0634
4	0.5	NG	ALL	C0634
5	0.5	P	ALL	C0634
6	0.5	W	ALL	C0634
7	0.5	U	ALL	C0634
8	0.5	G	ALL	C0634
9	0.5	S	ALL	S/JOINT PIS88
10	0.5	G	ALL	C0634

Click here to print


Connector: C0925

CONNECTOR HOUSING NOT SERVICEABLE

Description: Fuel fired booster heater

Location: Front LH side of engine compartment

Qualifier:

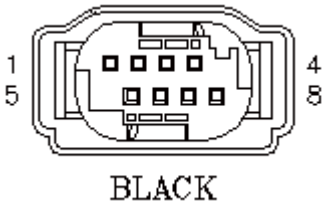


Part No.: YPC108040

Colour: BLACK

Cavities: 8WY

Harness: ENGINE COMPARTMENT HARNESS

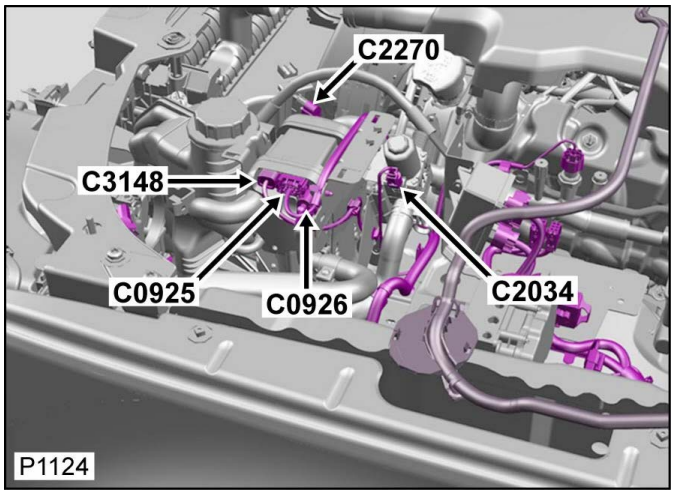


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	0.5	R	97L	C2245L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	R	97R	C2410R	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	YU	97	S/JOINT SJ423	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
5	0.75	WU	816L	C2373L	-	-	-	-	-	-	-
5	0.5	WU	815L	C3424L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
5	0.75	WU	816R	C2373R	-	-	-	-	-	-	-
5	0.5	WU	815R	C3424R	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	YW	97	S/JOINT SJ422	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0926

CONNECTOR HOUSING NOT SERVICEABLE

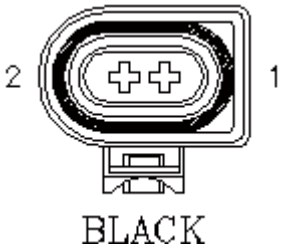

Part No.: YPC800410

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Fuel fired booster heater

Location: Front LH side of engine compartment

Qualifier:

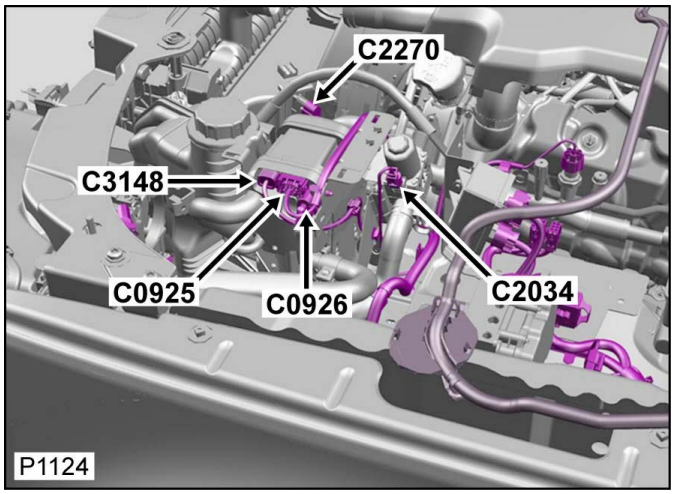


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	PN	97L	C0570L
1	2.5	PN	97R	C0570R
2	2.5	B	97	S/JOINT SJ9

Click here to print

Connector: **C0934**

CONNECTOR HOUSING SERVICEABLE

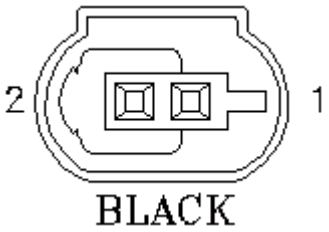

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Heater-Washer-jet-LH

Location: Underside of bonnet

Qualifier:

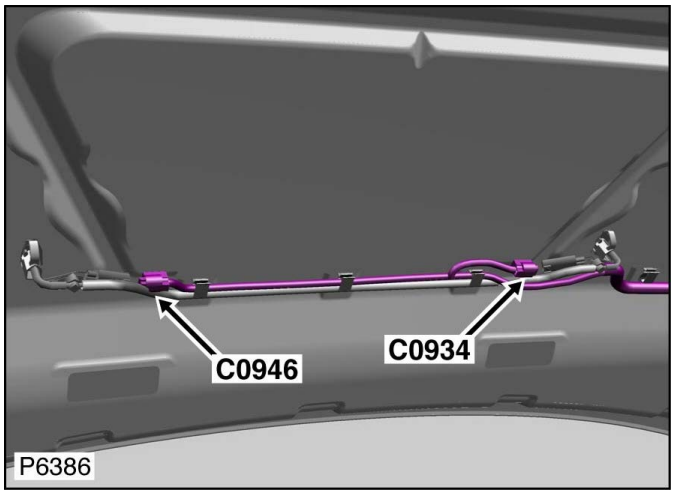


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	NY	113	S/JOINT SJ170	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	B	113	S/JOINT SJ171	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0942T

CONNECTOR HOUSING NOT SERVICEABLE

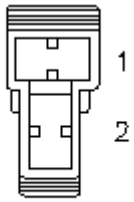

ORANGE

Part No.: YPC500340

Colour: ORANGE


Cavities: 2WY

Harness: CABIN HARNESS

Description: Socket-Accessory-Rear

Location: LH 'D' post

Qualifier:

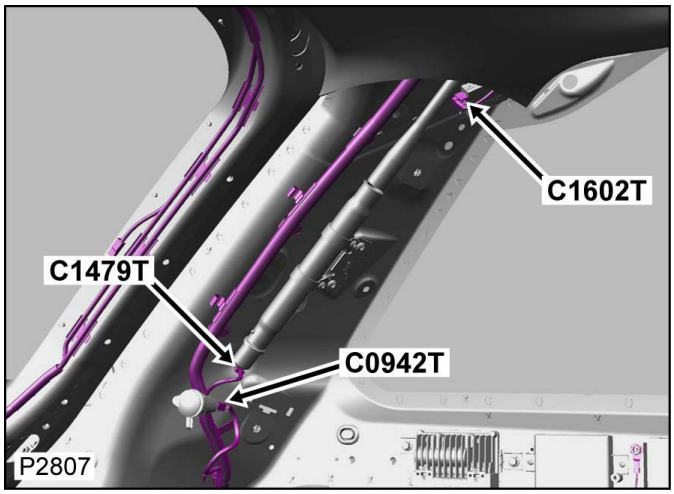


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	13T	C2920T
2	2.5	PG	13T	S/JOINT SJ222

Click here to print

Connector: **C0946**

CONNECTOR HOUSING SERVICEABLE

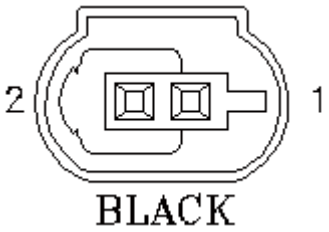

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Heater-Washer-jet-RH

Location: Underside of bonnet

Qualifier:

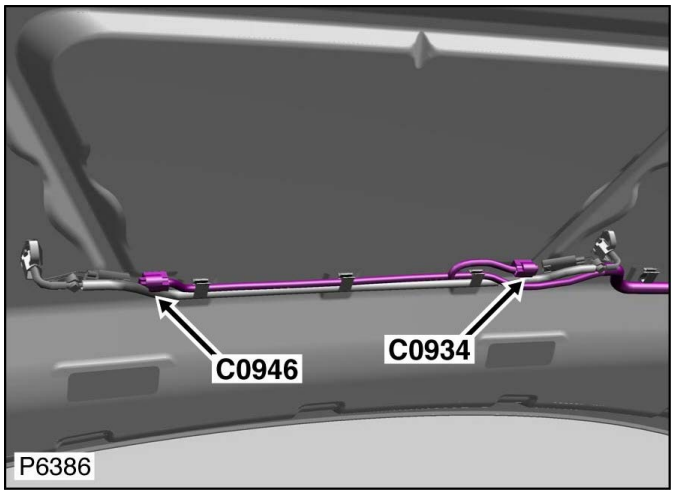


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	NY	113	S/JOINT SJ170	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	B	113	S/JOINT SJ171	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C0950

CONNECTOR HOUSING NOT SERVICEABLE

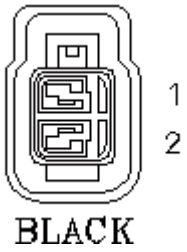

Part No.: YPC500750

Colour: BLACK


Cavities: 2WY

Harness: DOORS FRONT HARNESS

Description: Sensor-Side impact-Front door

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated

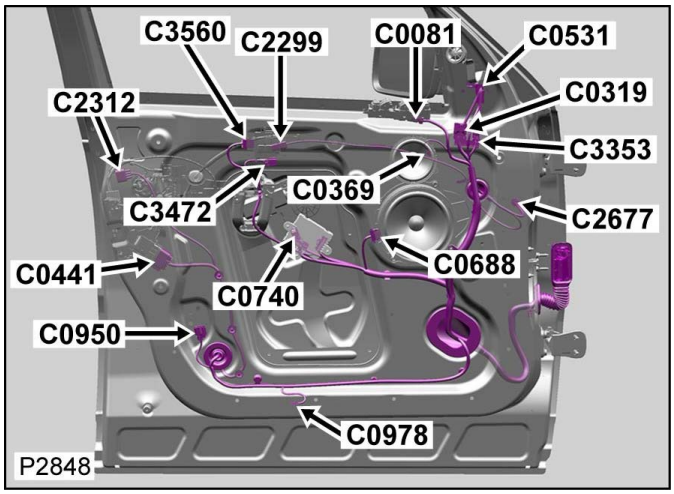

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WLG	787	C0440	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	WLG	788	C0440	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	NLG	787	C0440	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	NLG	788	C0440	418-411-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C0957


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Parking aid

Location: Behind luggage compartment carpet LH side

Qualifier:

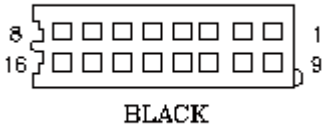

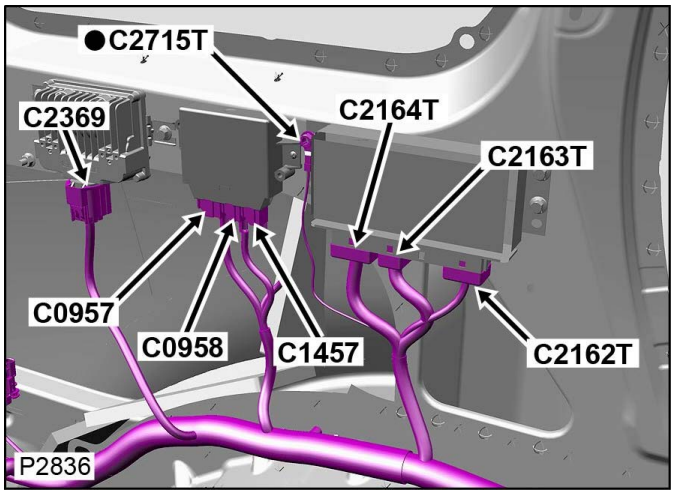

Part No.: YPC802550

Colour: BLACK

Cavities: 16WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	NK	171	S/JOINT SJ227	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.35	NU	171SL	C1166L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.35	NU	171SR	C1166R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.35	NU	986TL	C2053TL	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.35	NU	982T	C2053TA	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.35	NU	986TR	C2053TR	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
7	0.35	YU	171	S/JOINT SJ2007	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
8	0.35	B	171	S/JOINT SJ8	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
13	0.35	RS	171SL	C1166L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
13	0.35	RS	171SR	C1166R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
13	0.35	RS	986TL	C2053TL	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
13	0.35	RS	982T	C2053TA	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
13	0.35	RS	986TR	C2053TR	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
14	0.35	YW	171	S/JOINT SJ2006	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0958

CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Parking aid

Location: Behind luggage compartment carpet LH side

Qualifier:

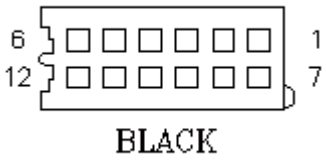


Part No.: YPC802340

Colour: BLACK

Cavities: 12WY

Harness: CABIN HARNESS

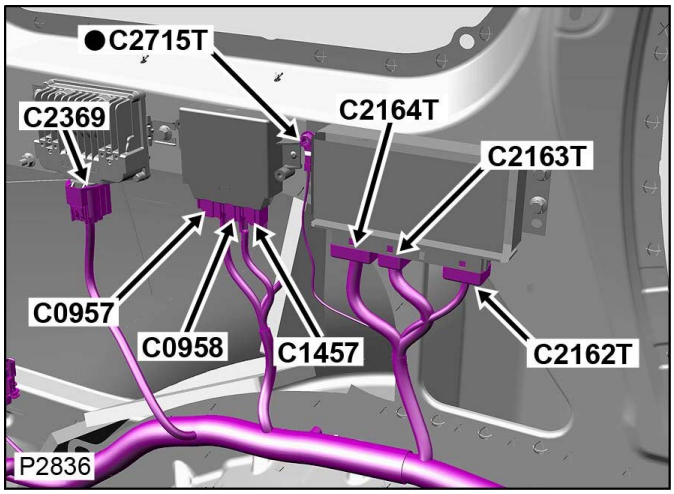


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	GW	171L	C2242L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
1	0.35	GW	171R	C2242R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.35	UW	171L	C2242L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.35	UW	171R	C2242R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
5	0.35	YO	171L	C2242L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
5	0.35	YO	171R	C2242R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
6	0.35	YS	171L	C2242L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
6	0.35	YS	171R	C2242R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
7	0.35	YB	171L	C2242L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
7	0.35	YB	171R	C2242R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
8	0.35	YG	171L	C2242L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
8	0.35	YG	171R	C2242R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: **C0961T**

CONNECTOR HOUSING NOT SERVICEABLE

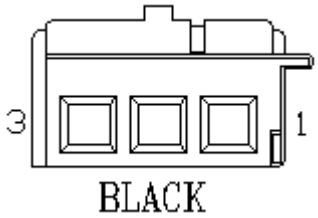

Part No.: YPC911670

Colour: BLACK


Cavities: 3WY

Harness: CABIN HARNESS

Description: Sensor-Rain-Ambient light

Location: Rear view mirror

Qualifier:

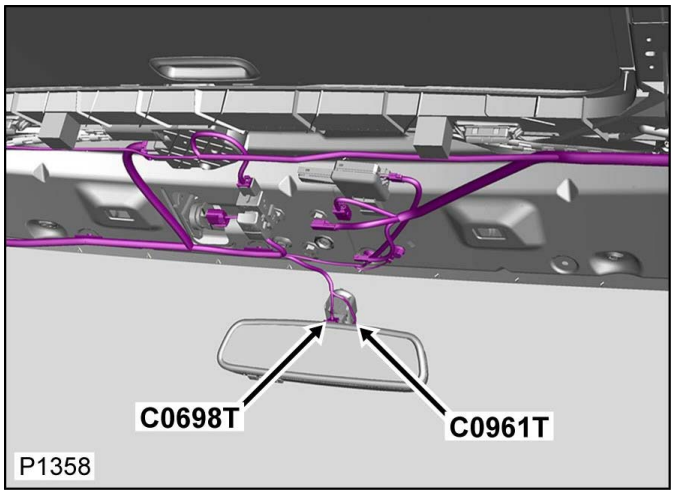

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	G	499T	S/JOINT SJ224	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.35	G	499T	S/JOINT SJ869	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
3	0.5	B	499T	C2714	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0962

CONNECTOR HOUSING NOT SERVICEABLE



BLACK

Part No.: YPC801790

Colour: BLACK


Cavities: 18WY

Harness: SEAT FRONT HARNESS

Description: Sensor-Occupancy-detection

Location: Beneath front passenger seat

Qualifier:

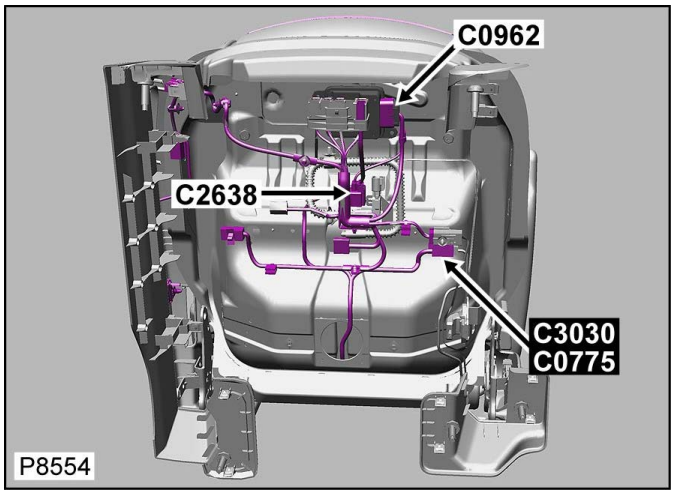


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	RW	459	C2363	418-411-70	-	418-116A	418-117	-	418-112	418-107
3	0.5	KU	459	C2638	418-411-70	-	418-116A	418-117	-	418-112	418-107
4	0.5	P	459	C2638	418-411-70	-	418-116A	418-117	-	418-112	418-107
5	0.5	G	459	C2638	418-411-70	-	418-116A	418-117	-	418-112	418-107
9	0.35	YB	459	C0752	418-411-48	-	418-116A	418-117	418-104	418-113	418-108
11	0.5	G	459	C2128	418-411-70	-	418-116A	418-117	-	418-112	418-107
12	0.5	KO	459	C2128	418-411-70	-	418-116A	418-117	-	418-112	418-107
13	0.5	BK	459	C2128	418-411-70	-	418-116A	418-117	-	418-112	418-107
14	0.5	B	459	C2363	418-411-70	-	418-116A	418-117	-	418-112	418-107
18	0.35	YN	459	C0752	418-411-48	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C0963

CONNECTOR HOUSING NOT SERVICEABLE

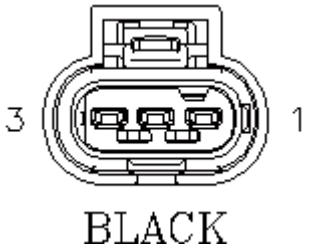

Part No.: YPC908700

Colour: BLACK


Cavities: 3WY

Harness: BUMPER REAR HARNESS

Description: Sensor-Parking aid-Outer-Rear-LH

Location: Behind LH side of rear bumper

Qualifier:

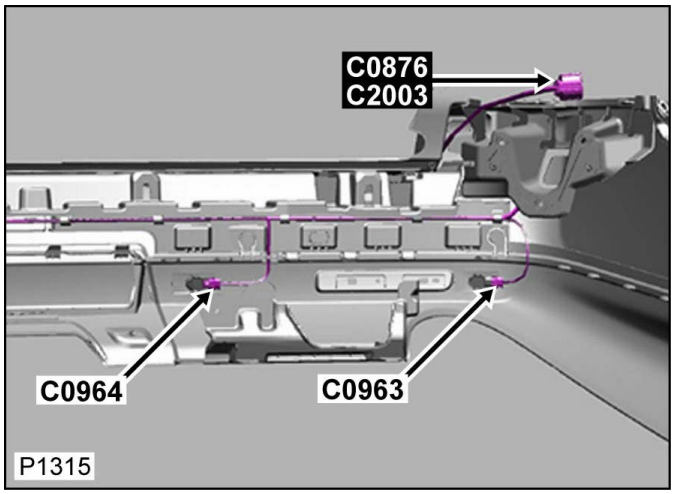


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	N	68	S/JOINT SJ401
2	0.35	R	68	C2003
3	0.35	B	68	S/JOINT SJ400

Click here to print

Connector: C0964

CONNECTOR HOUSING NOT SERVICEABLE

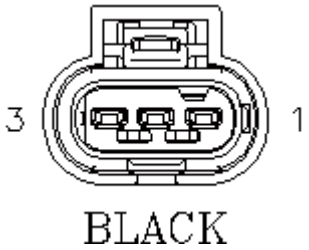

Part No.: YPC908700

Colour: BLACK


Cavities: 3WY

Harness: BUMPER REAR HARNESS

Description: Sensor-Parking aid-Inner-Rear-LH

Location: Behind LH side of rear bumper

Qualifier:

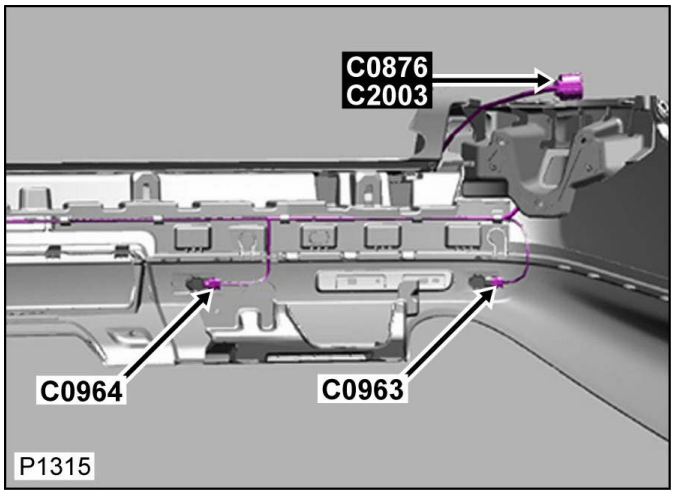

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	N	68	S/JOINT SJ401
2	0.35	Y	68	C2003
3	0.35	B	68	S/JOINT SJ400

Click here to print


Connector: **C0965**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Sensor-Parking aid-Inner-Rear-RH

Location: Behind RH side of rear bumper

Qualifier:

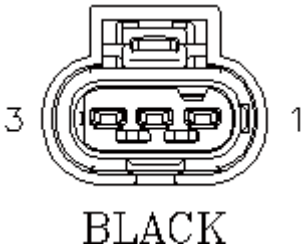

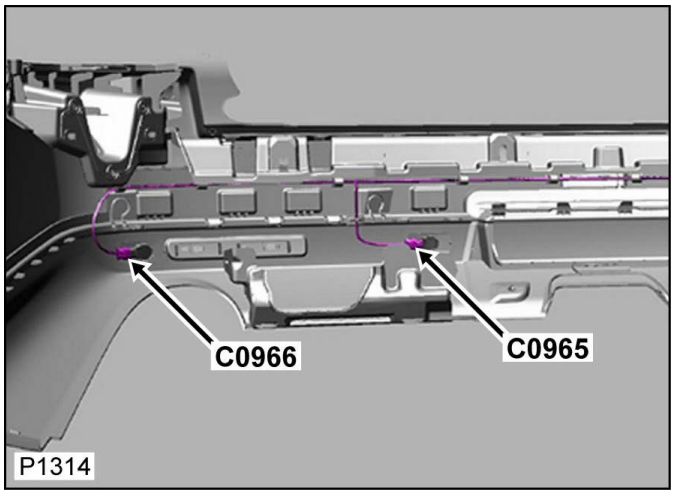

Part No.: YPC908700

Colour: BLACK

Cavities: 3WY

Harness: BUMPER REAR HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	N	68	S/JOINT SJ401
2	0.35	G	68	C2003
3	0.35	B	68	S/JOINT SJ400

Click here to print

Connector: **C0966**

CONNECTOR HOUSING NOT SERVICEABLE

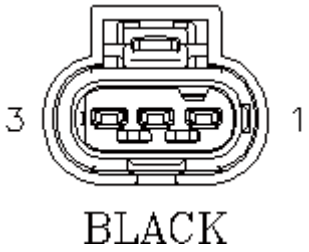

Part No.: YPC908700

Colour: BLACK


Cavities: 3WY

Harness: BUMPER REAR HARNESS

Description: Sensor-Parking aid-Outer-Rear-RH

Location: Behind RH side of rear bumper

Qualifier:

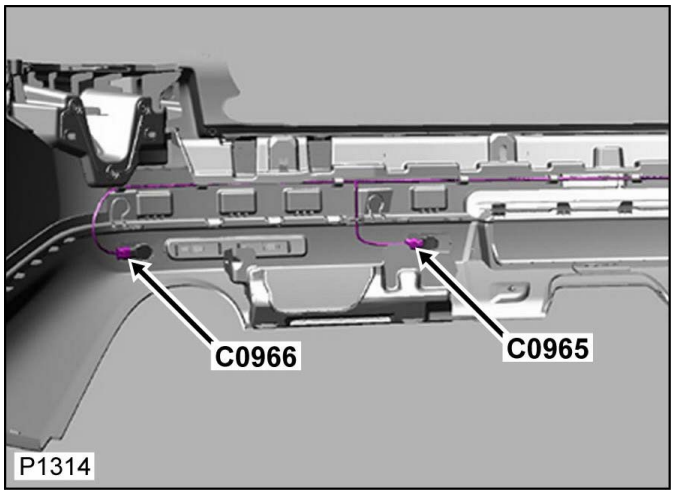


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	N	68	S/JOINT SJ401
2	0.35	U	68	C2003
3	0.35	B	68	S/JOINT SJ400

Click here to print

Connector: **C0968**

CONNECTOR HOUSING NOT SERVICEABLE

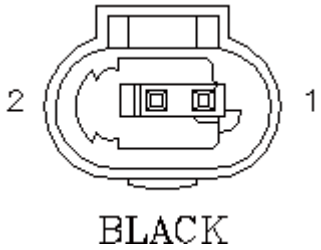

Part No.: YPC800100

Colour: BLACK


Cavities: 2WY

Harness: CHASSIS HARNESS

Description: Sensor-Pad wear-Rear-RH

Location: Below RH rear wheelarch

Qualifier:

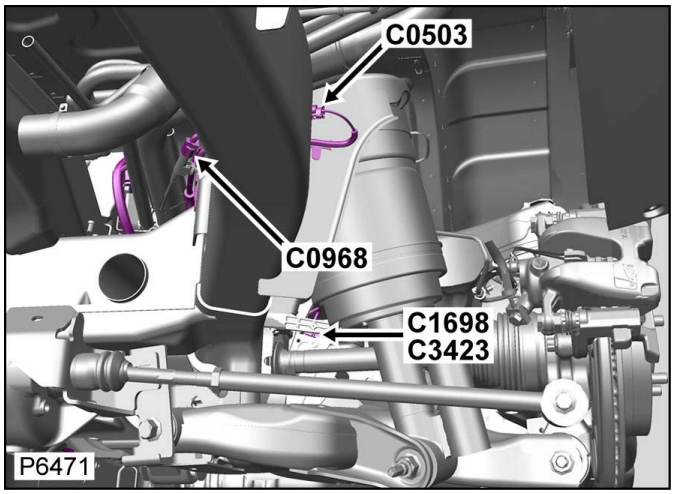

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	R	131	C0390	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	131T	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	131S	C2294SB	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C0974

CONNECTOR HOUSING NOT SERVICEABLE

Description: Pump-Lumbar

Location: Beneath driver seat

Qualifier:

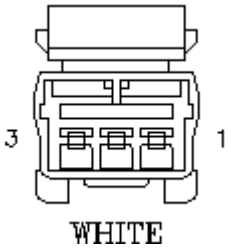


Part No.: YPC10272

Colour: WHITE

Cavities: 3WY

Harness: SEAT FRONT HARNESS

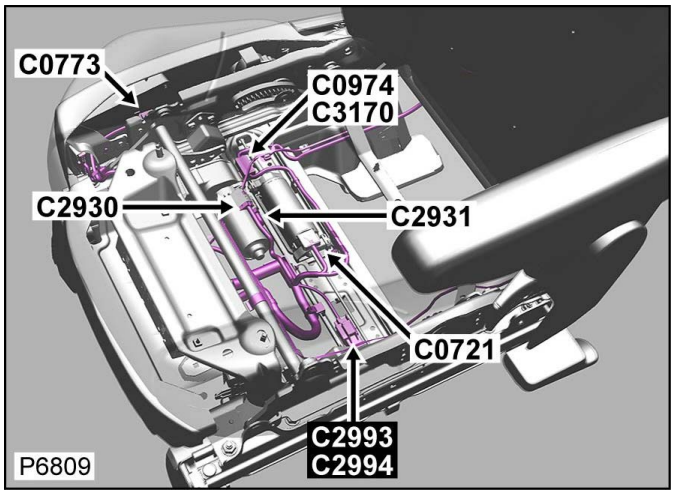


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	SP	479	C0773	-	-	-	-	-	-	-
1	0.75	U	480	C0773	418-549-64	-	418-116A	-	418-104	418-112	418-107
2	0.5	B	479	S/JOINT SJ151	-	-	-	-	-	-	-
2	0.75	B	480	S/JOINT SJ151	418-549-64	-	418-116A	-	418-104	418-112	418-107
3	0.5	WG	479	C0773	-	-	-	-	-	-	-
3	0.75	NY	480	C0773	418-549-64	-	418-116A	-	418-104	418-112	418-107

Click here to print

Connector: **C0978**

CONNECTOR HOUSING SERVICEABLE

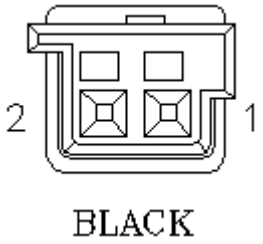

BLACK

Part No.: YPC802690

Colour: BLACK


Cavities: 2WY

Harness: DOORS FRONT HARNESS

Description: Lamp-Puddle-Front

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated

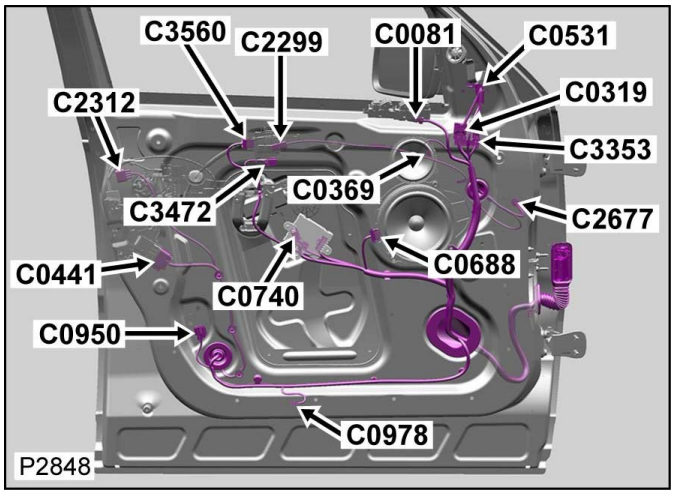


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	134	S/JOINT SJ840	-	-	-	-	-	-	-
2	0.35	US	672	C2017	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.35	US	673	C2016	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.35	US	674	C2271	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.35	US	675	C2272	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: **C0980**

CONNECTOR HOUSING SERVICEABLE

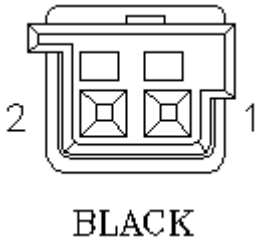

BLACK

Part No.: YPC802690

Colour: BLACK


Cavities: 2WY

Harness: REAR DOOR HARNESS

Description: Lamp-Puddle-Rear

Location: Behind rear door trim panel

Qualifier: LH side illustrated RH side similar

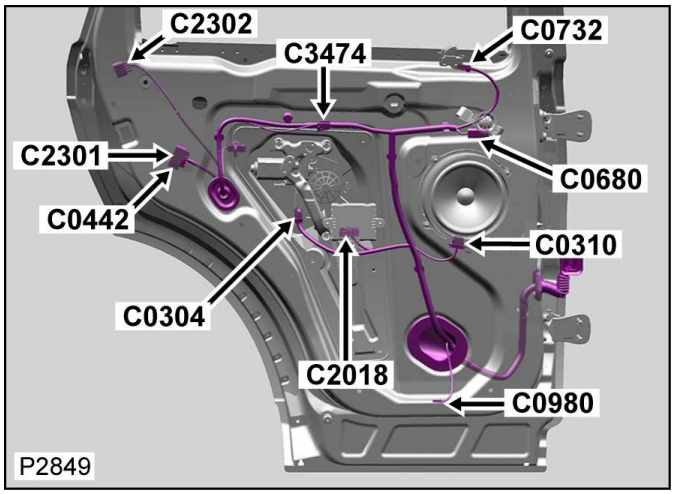


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	134	S/JOINT SJ200	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.75	P	502	C0804	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.75	P	493	C0803	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0999M

CONNECTOR HOUSING NOT SERVICEABLE

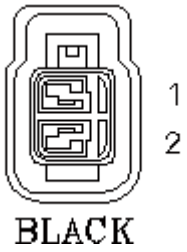

Part No.: YPC500750

Colour: BLACK


Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Valve-Solenoid-Refrigerant - DV6

Location: LH side of engine

Qualifier:

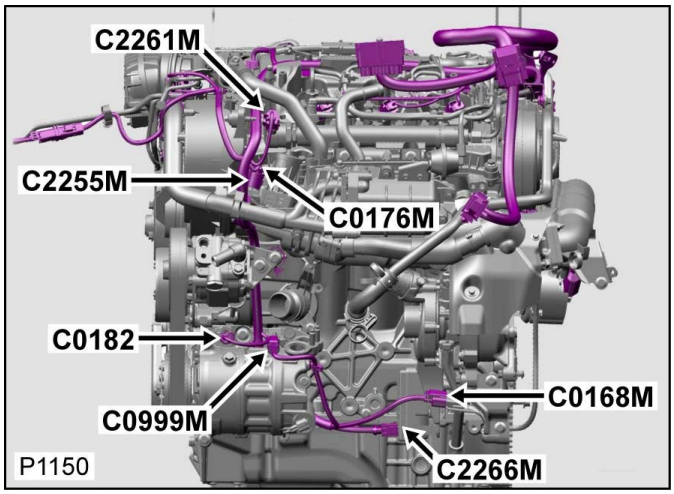


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	PW	798	C3069M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	1.0	BG	798	C3069M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1000

CONNECTOR HOUSING NOT SERVICEABLE

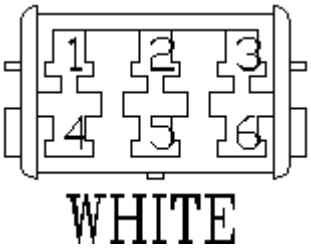

Part No.: YQC100760

Colour: WHITE


Cavities: 6WY

Harness: CABIN HARNESS

Description: Header-Connector

Location: Behind luggage compartment carpet LH side

Qualifier:

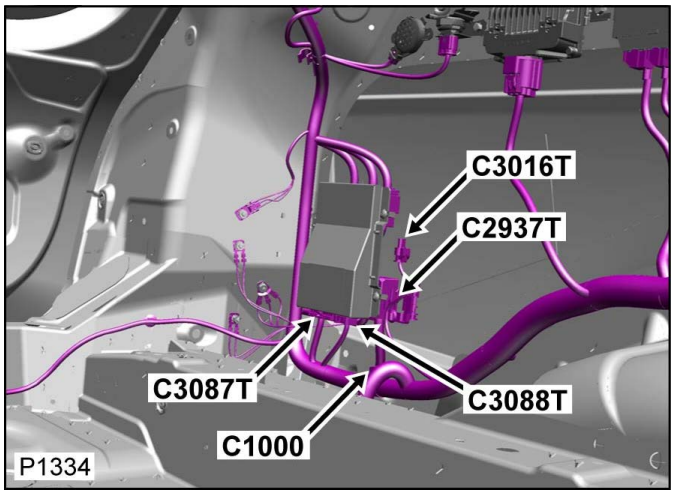

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	YW	499S	S/JOINT SJ2006	418-549-45	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	YW	478SL	S/JOINT SJ2008	418-549-45	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	YW	125SL	S/JOINT SJ2010	418-549-45	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	YW	200SR	S/JOINT SJ2010	418-549-45	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	YU	499S	S/JOINT SJ2007	418-549-45	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	YU	478SL	S/JOINT SJ2009	418-549-45	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	YU	125SL	S/JOINT SJ2011	418-549-45	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	YU	200SR	S/JOINT SJ2011	418-549-45	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C1111


CONNECTOR HOUSING NOT SERVICEABLE

Description: Lamp-Map-LH

Location: Rear of headlining - LH side

Qualifier:



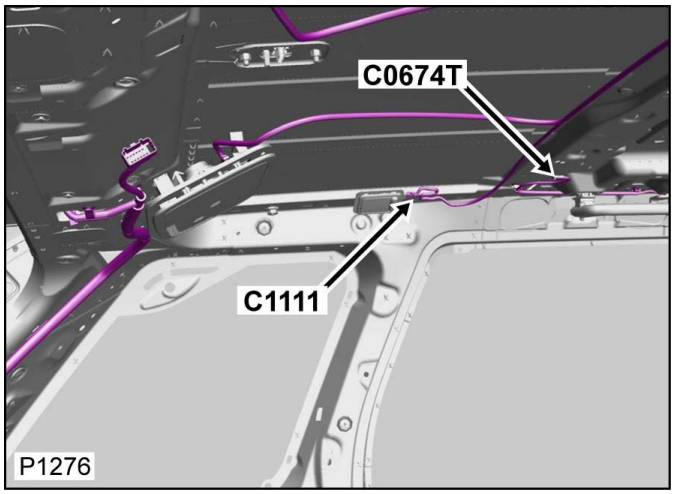

Part No.: YPC901790

Colour: BLACK

Cavities: 3WY

Harness: ROOF HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	LGW	134	S/JOINT SJ234	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
3	0.75	B	134	S/JOINT SJ275	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C1112

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC901790

Colour: BLACK


Cavities: 3WY

Harness: ROOF HARNESS

Description: Lamp-Map-RH

Location: Rear of headlining - RH side

Qualifier:

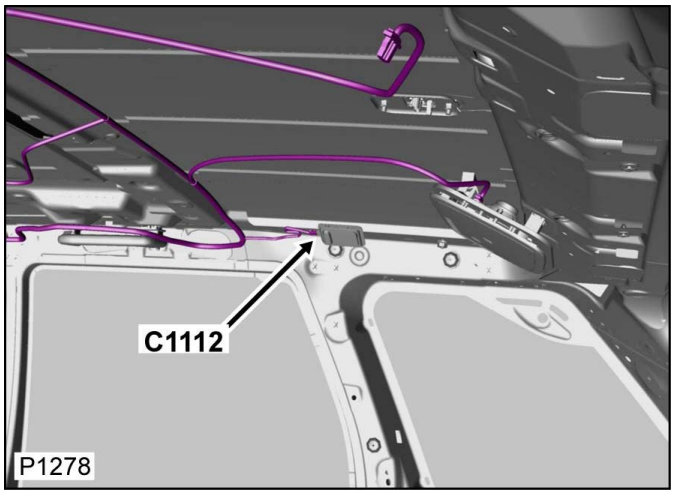

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	LGW	134	S/JOINT SJ234	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
3	0.75	B	134	S/JOINT SJ275	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C1165

CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to instrument panel harness

Location: RH 'A' post

Qualifier:

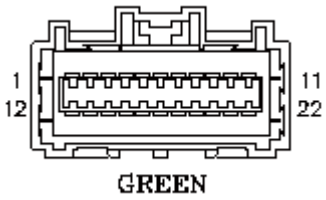


Part No.: YPC900460

Colour: GREEN

Cavities: 22WY

Harness: CABIN HARNESS

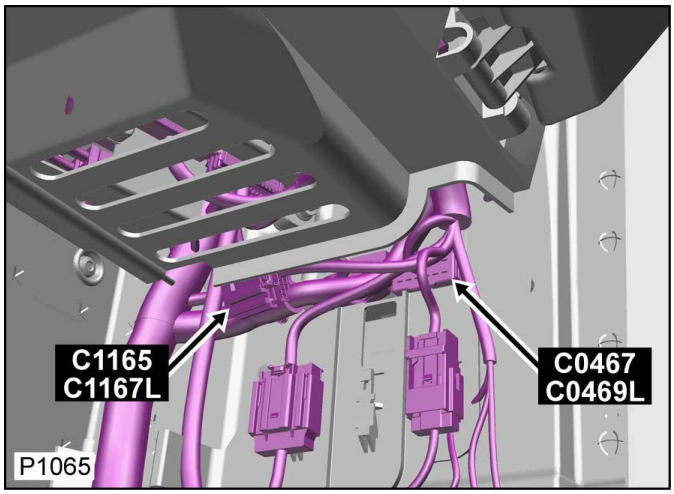

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	499	C0084	-	-	-	-	-	-	-
2	0.5	R	499	C0084	-	-	-	-	-	-	-
4	0.5	R	499S	C2754S	-	-	-	-	-	-	-
4	0.5	R	499T	C2754T	-	-	-	-	-	-	-
5	0.5	U	499S	C2754S	-	-	-	-	-	-	-
5	0.5	U	499T	C2754T	-	-	-	-	-	-	-
7	0.35	YN	162L	S/JOINT SJ1005	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.35	YN	319L	S/JOINT SJ1003	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.35	YN	419R	S/JOINT SJ1001	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.35	YB	162L	S/JOINT SJ1006	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.35	YB	319L	S/JOINT SJ1004	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.35	YB	419R	S/JOINT SJ1002	418-411-47	-	418-116A	418-117	-	418-112	418-107
9	0.75	P	134L	S/JOINT SJ38	-	-	-	-	-	-	-
9	0.35	YW	200R	S/JOINT SJ2000	418-411-47	-	418-116A	418-117	-	418-112	418-107
10	0.35	YU	200R	S/JOINT SJ2001	418-411-47	-	418-116A	418-117	-	418-112	418-107
11	0.35	UW	810S	C2160S	418-411-47	-	418-116A	418-117	-	418-112	418-107
11	0.35	UW	810T	C2160T	418-411-47	-	418-116A	418-117	-	418-112	418-107
12	0.35	UK	810S	C2160S	418-411-47	-	418-116A	418-117	-	418-112	418-107
12	0.35	UK	810T	C2160T	418-411-47	-	418-116A	418-117	-	418-112	418-107
13	0.35	UR	410SR	C3643S	418-411-47	-	418-116A	418-117	-	418-112	418-107
13	0.35	RG	919SR	C2160S	418-411-47	-	418-116A	418-117	-	418-112	418-107

13	0.35	RG	810T	C2160T	418-411-47	-	418-116A	418-117	-	418-112	418-107
14	0.35	RU	410SR	C3643S	418-411-47	-	418-116A	418-117	-	418-112	418-107
14	0.35	RU	919SR	C2160S	418-411-47	-	418-116A	418-117	-	418-112	418-107
14	0.35	RU	810T	C2160T	418-411-47	-	418-116A	418-117	-	418-112	418-107
15	0.5	R	410S	C2428S	-	-	-	-	-	-	-
15	0.5	R	410T	C2428T	-	-	-	-	-	-	-
16	0.5	YG	216	S/JOINT SJ225	-	-	-	-	-	-	-
17	0.5	PU	134	C0084	-	-	-	-	-	-	-
18	0.35	NP	204L	C2368	418-411-47	-	418-116A	418-117	-	418-112	418-107
18	0.35	NP	204R	C2378	418-411-47	-	418-116A	418-117	-	418-112	418-107
19	0.35	G	499	S/JOINT SJ869	418-411-47	-	418-116A	418-117	-	418-112	418-107
20	0.5	PU	986SL	C2658S	-	-	-	-	-	-	-
20	0.5	R	227SR	C0784S	-	-	-	-	-	-	-
20	0.5	PU	986TL	C2658TL	-	-	-	-	-	-	-
20	0.35	R	227TR	C0784T	418-411-47	-	418-116A	418-117	-	418-112	418-107
21	0.75	R	139L	S/JOINT SJ971	-	-	-	-	-	-	-
21	0.5	B	200SR	C0615S	-	-	-	-	-	-	-
21	0.5	R	410TR	C2428T	-	-	-	-	-	-	-
22	0.5	BS	499S	C0117S	-	-	-	-	-	-	-
22	0.5	BS	200TR	C2739T	-	-	-	-	-	-	-

Click here to print


Connector: C1166L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to instrument panel harness

Location: LH 'A' post

Qualifier:

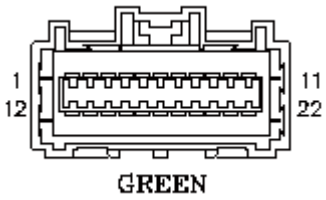

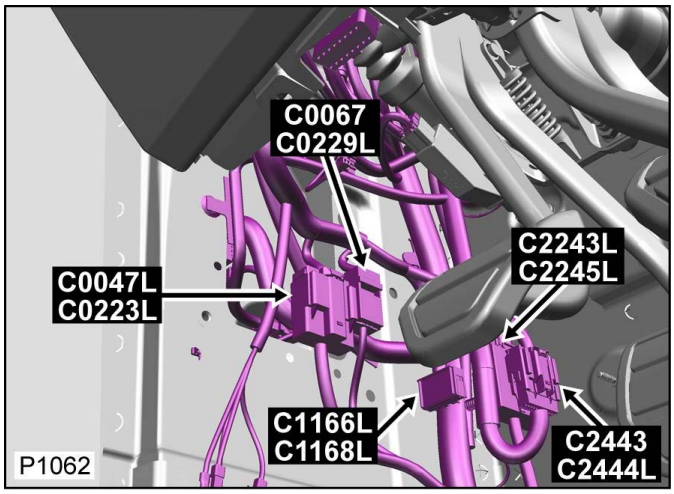

Part No.: YPC900460

Colour: GREEN

Cavities: 22WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	G	784L	C3339	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.5	R	21SL	S/JOINT SJ395S	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.35	RS	171SL	C0957	-	-	-	-	-	-	-
4	0.35	NU	171SL	C0957	-	-	-	-	-	-	-
5	0.35	WG	204L	C2378	-	-	-	-	-	-	-
6	0.35	RU	216L	C1649	-	-	-	-	-	-	-
7	0.35	RY	216L	C0256	-	-	-	-	-	-	-
8	0.35	G	216SL	C1649	-	-	-	-	-	-	-
9	0.5	G	139L	S/JOINT SJ224	418-411-47	-	418-116A	418-117	-	418-112	418-107
10	0.35	SN	591SL	C2875S	-	-	-	-	-	-	-
10	0.35	SN	591TL	C2875T	-	-	-	-	-	-	-
11	0.5	R	227SL	C0784S	418-411-47	-	418-116A	418-117	-	418-112	418-107
11	0.35	R	227TL	C0784T	-	-	-	-	-	-	-
12	0.5	B	139SL	C0615S	418-411-47	-	418-116A	418-117	-	418-112	418-107
12	0.5	BS	139TL	C2739T	418-411-47	-	418-116A	418-117	-	418-112	418-107
13	0.5	R	410TL	C2428T	418-411-47	-	418-116A	418-117	-	418-112	418-107
14	0.5	LGR	986TL	C2053TL	418-411-47	-	418-116A	418-117	-	418-112	418-107
14	0.5	LGR	982TL	C2053TA	418-411-47	-	418-116A	418-117	-	418-112	418-107
15	0.5	GP	986TL	C2053TL	418-411-47	-	418-116A	418-117	-	418-112	418-107
15	0.5	GP	982TL	C2053TA	418-411-47	-	418-116A	418-117	-	418-112	418-107
16	0.35	UR	410SL	C3643S	-	-	-	-	-	-	-
16	0.35	RG	919SL	C2160S	-	-	-	-	-	-	-
17	0.35	RU	410SL	C3643S	-	-	-	-	-	-	-

17	0.35	RU	919SL	C2160S	-	-	-	-	-	-	-
18	0.5	UG	478SL	C3760S	418-411-47	-	418-116A	418-117	-	418-112	418-107
18	0.5	UG	478TL	C3760T	418-411-47	-	418-116A	418-117	-	418-112	418-107
19	0.35	YW	139L	S/JOINT SJ2010	-	-	-	-	-	-	-
20	0.35	YU	139L	S/JOINT SJ2011	-	-	-	-	-	-	-
21	0.5	YO	478SL	C3760S	418-411-47	-	418-116A	418-117	-	418-112	418-107
21	0.5	YO	478TL	C3760T	418-411-47	-	418-116A	418-117	-	418-112	418-107
22	0.5	WG	478SL	C3760S	418-411-47	-	418-116A	418-117	-	418-112	418-107
22	0.5	WG	478TL	C3760T	418-411-47	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C1166R

CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to instrument panel harness

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

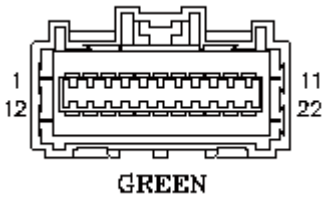


Part No.: YPC900460

Colour: GREEN

Cavities: 22WY

Harness: CABIN HARNESS

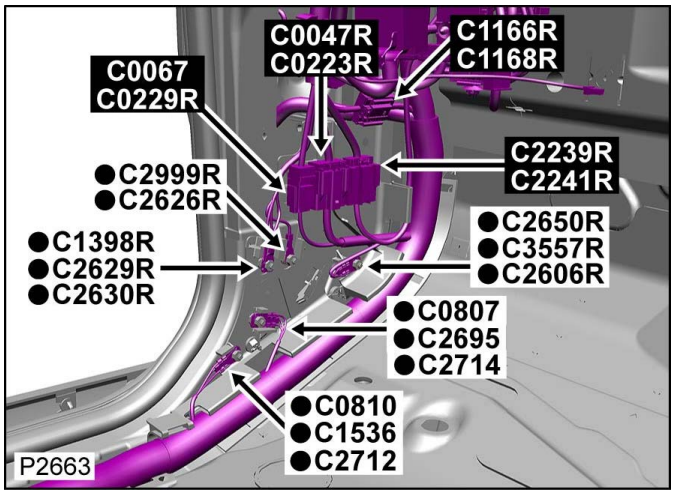

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	NU	171SR	C0957	-	-	-	-	-	-	-
1	0.35	BY	245TR	S/JOINT SJ249T	-	-	-	-	-	-	-
2	0.35	RS	171SR	C0957	-	-	-	-	-	-	-
2	0.35	BU	245TR	S/JOINT SJ248T	-	-	-	-	-	-	-
3	0.5	G	784R	C3339	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.5	R	21SR	S/JOINT SJ395S	418-411-47	-	418-116A	418-117	-	418-112	418-107
5	0.75	RW	216R	C1649	418-411-47	-	418-116A	418-117	-	418-112	418-107
6	0.5	GK	200R	S/JOINT SJ14	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.35	WG	204R	C2368	-	-	-	-	-	-	-
8	0.5	UG	478SR	C3760S	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.5	UG	478TR	C3760T	418-411-47	-	418-116A	418-117	-	418-112	418-107
9	0.5	YO	478SR	C3760S	418-411-47	-	418-116A	418-117	-	418-112	418-107
9	0.5	YO	478TR	C3760T	418-411-47	-	418-116A	418-117	-	418-112	418-107
10	0.5	PU	986SR	C2658S	418-411-47	-	418-116A	418-117	-	418-112	418-107
10	0.5	PU	986TR	C2658TR	418-411-47	-	418-116A	418-117	-	418-112	418-107
11	0.5	RN	200R	S/JOINT SJ52	418-411-47	-	418-116A	418-117	-	418-112	418-107
12	0.75	P	134R	S/JOINT SJ38	418-411-47	-	418-116A	418-117	-	418-112	418-107
13	0.5	WG	478SR	C3760S	418-411-47	-	418-116A	418-117	-	418-112	418-107
13	0.5	WG	478TR	C3760T	418-411-47	-	418-116A	418-117	-	418-112	418-107
											418-

14	0.5	LGR	986TR	C2053TR	418-411-47	-	418-116A	418-117	-	418-112	107
14	0.5	LGR	982TR	C2053TA	418-411-47	-	418-116A	418-117	-	418-112	418-107
15	0.5	GP	986TR	C2053TR	418-411-47	-	418-116A	418-117	-	418-112	418-107
15	0.5	GP	982TR	C2053TA	418-411-47	-	418-116A	418-117	-	418-112	418-107
16	0.75	R	200R	S/JOINT SJ971	418-411-47	-	418-116A	418-117	-	418-112	418-107
17	0.75	PY	982SR	C0868S	418-411-47	-	418-116A	418-117	-	418-112	418-107
17	0.75	PY	982TR	C0868TA	418-411-47	-	418-116A	418-117	-	418-112	418-107
18	0.35	SN	591SR	C2875S	-	-	-	-	-	-	-
18	0.35	SN	591TR	C2875T	-	-	-	-	-	-	-
19	0.5	KR	41R	S/JOINT SJ871	418-411-47	-	418-116A	418-117	-	418-112	418-107
20	0.5	YK	41R	S/JOINT SJ870	418-411-47	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: **C1167L**


CONNECTOR HOUSING SERVICEABLE

Description: Instrument panel harness to main harness

Location: RH 'A' post

Qualifier:

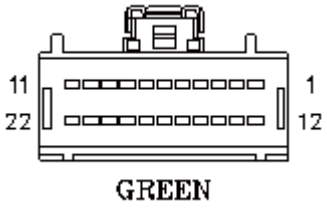

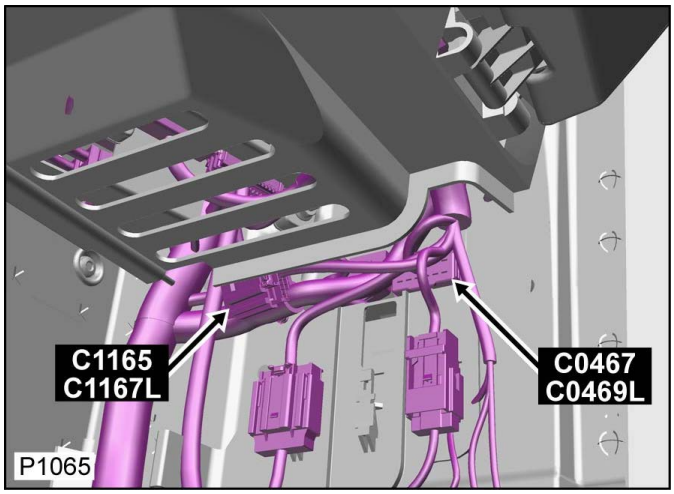

Part No.: YPC900550

Colour: GREEN

Cavities: 22WY

Harness: FACIA COMPOSITE HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	124L	C2115	418-411-45	-	418-116A	418-117	-	418-112	418-107
1	0.5	B	125L	C3481	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	R	124L	C2115	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	R	125L	C3481	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	R	124SL	C2115	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	R	125L	C3481	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	R	124TL	C2115	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	U	124SL	C2115	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	U	125L	C3481	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	U	124TL	C2115	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.35	YN	139L	S/JOINT SJ852	-	-	-	-	-	-	-
8	0.35	YB	139L	S/JOINT SJ862	-	-	-	-	-	-	-
9	0.75	P	134L	S/JOINT SJ740	418-411-45	-	418-116A	418-117	-	418-112	418-107
11	0.35	UR	139SL	C3019SL	-	-	-	-	-	-	-
11	0.35	UR	139TL	C3019TL	-	-	-	-	-	-	-
12	0.35	RU	139SL	C3019SL	-	-	-	-	-	-	-
12	0.35	RU	139TL	C3019TL	-	-	-	-	-	-	-
13	0.35	UR	139TL	C3023TL	-	-	-	-	-	-	-
14	0.35	RU	139TL	C3023TL	-	-	-	-	-	-	-
15	0.5	R	139L	C0580	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.5	YG	216L	C0580	418-411-45	-	418-116A	418-117	-	418-112	418-107

17	0.5	PU	134L	C0580	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.35	NP	204L	S/JOINT SJ687L	-	-	-	-	-	-	-
19	0.35	G	139L	S/JOINT SJ223L	-	-	-	-	-	-	-
20	0.5	LGW	28L	S/JOINT SJ14	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	0.75	R	139L	C0582	418-411-45	-	418-116A	418-117	-	418-112	418-107
22	0.5	BS	139SL	C0580	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: **C1167R**

CONNECTOR HOUSING SERVICEABLE

Description: Instrument panel harness to main harness

Location: Base of RH 'A' post

Qualifier: RHD condition illustrated

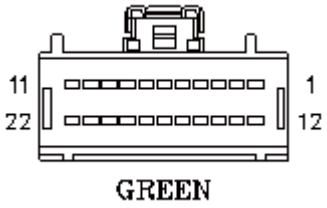


Part No.: YPC900550

Colour: GREEN

Cavities: 22WY

Harness: FACIA COMPOSITE HARNESS

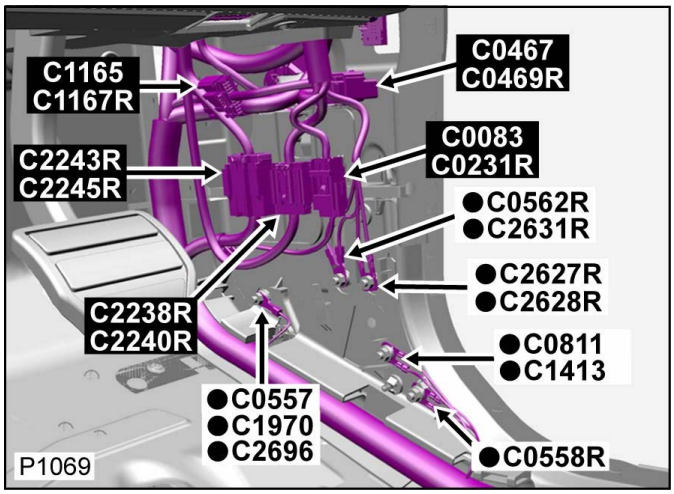

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	124R	C2115	418-411-45	-	418-116A	418-117	-	418-112	418-107
1	0.5	B	125R	C3481	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	R	124R	C2115	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	R	125R	C3481	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	R	124SR	C2115	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	R	125R	C3481	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	R	124TR	C2115	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	U	124SR	C2115	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	U	125R	C3481	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	U	124TR	C2115	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.35	YN	200R	S/JOINT SJ852	-	-	-	-	-	-	-
8	0.35	YB	200R	S/JOINT SJ862	-	-	-	-	-	-	-
9	0.35	YW	200SR	S/JOINT SJ964	-	-	-	-	-	-	-
9	0.35	YW	200TR	S/JOINT SJ966	-	-	-	-	-	-	-
10	0.35	YU	200SR	S/JOINT SJ974	-	-	-	-	-	-	-
10	0.35	YU	200TR	S/JOINT SJ976	-	-	-	-	-	-	-
11	0.35	UR	200SR	C3019SR	-	-	-	-	-	-	-
11	0.35	UR	200TR	C3019TR	-	-	-	-	-	-	-
12	0.35	RU	200SR	C3019SR	-	-	-	-	-	-	-
12	0.35	RU	200TR	C3019TR	-	-	-	-	-	-	-

13	0.35	UR	200SR	C3023SR	-	-	-	-	-	-	-
13	0.35	UR	200TR	C3023TR	-	-	-	-	-	-	-
14	0.35	RU	200SR	C3023SR	-	-	-	-	-	-	-
14	0.35	RU	200TR	C3023TR	-	-	-	-	-	-	-
15	0.5	R	200R	C0580	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.5	YG	216R	C0580	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.5	PU	134R	C0580	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.35	NP	204R	S/JOINT SJ687R	-	-	-	-	-	-	-
19	0.35	G	200R	S/JOINT SJ223R	-	-	-	-	-	-	-
20	0.35	R	200R	C0580	-	-	-	-	-	-	-
21	0.5	BS	200SR	C0580	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	0.5	R	200TR	C0580	418-411-45	-	418-116A	418-117	-	418-112	418-107
22	0.5	BS	200SR	C0580	418-411-45	-	418-116A	418-117	-	418-112	418-107
22	0.5	BS	200TR	C0580	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: **C1168L**


CONNECTOR HOUSING SERVICEABLE

Description: Instrument panel harness to main harness

Location: LH 'A' post

Qualifier:

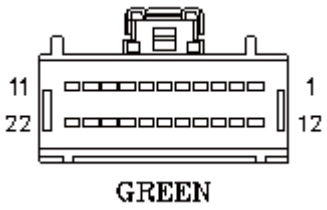

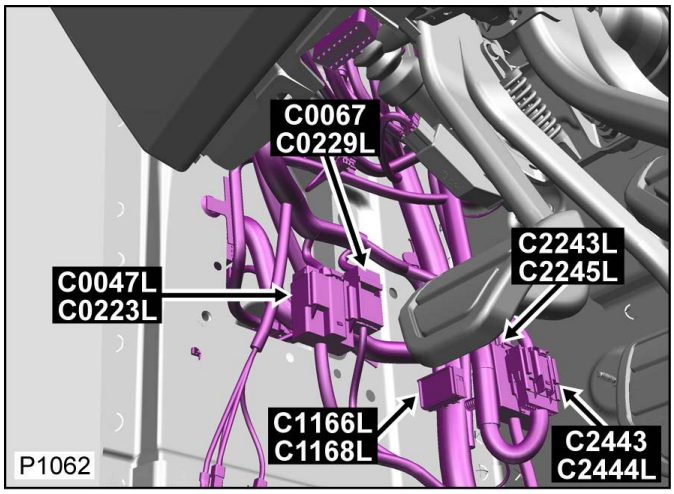

Part No.: YPC900550

Colour: GREEN

Cavities: 22WY

Harness: FACIA COMPOSITE HARNESS

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	G	139L	C0582	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	NP	21L	S/JOINT SJ687L	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.35	RS	171SL	C1629SL	-	-	-	-	-	-	-
4	0.35	NU	171SL	C1629SL	-	-	-	-	-	-	-
5	0.35	WG	204L	S/JOINT SJ687L	-	-	-	-	-	-	-
6	0.5	RU	216L	C2992	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.5	RY	216L	C2992	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.35	G	216SL	C1629SL	-	-	-	-	-	-	-
9	0.5	G	139L	C0582	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.5	SN	591L	C0580	418-411-45	-	418-116A	418-117	-	418-112	418-107
11	0.35	R	139L	C0580	-	-	-	-	-	-	-
12	0.5	BS	139SL	C0580	418-411-45	-	418-116A	418-117	-	418-112	418-107
12	0.5	BS	139TL	C0580	418-411-45	-	418-116A	418-117	-	418-112	418-107
13	0.5	R	139TL	C0580	418-411-45	-	418-116A	418-117	-	418-112	418-107
14	0.35	LGR	139TL	C0581	-	-	-	-	-	-	-
15	0.5	GP	139TL	S/JOINT SJ553	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.35	UR	139SL	C3023SL	-	-	-	-	-	-	-
17	0.35	RU	139SL	C3023SL	-	-	-	-	-	-	-
18	0.5	UG	124L	C2819L	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.35	YW	139L	S/JOINT SJ730	-	-	-	-	-	-	-
20	0.35	YU	139L	S/JOINT SJ731	-	-	-	-	-	-	-

21	0.5	YO	124L	S/JOINT SJ1201	418-411-45	-	418-116A	418-117	-	418-112	418-107
22	0.5	WG	124L	S/JOINT SJ1202	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: **C1168R**

CONNECTOR HOUSING SERVICEABLE

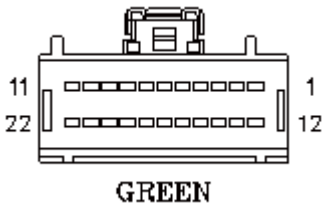

Part No.: YPC900550

Colour: GREEN


Cavities: 22WY

Harness: FACIA COMPOSITE HARNESS

Description: Instrument panel harness to main harness

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

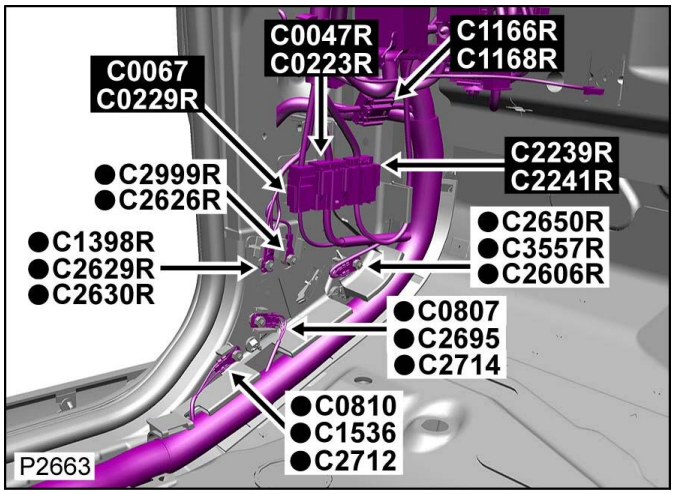

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	NU	171SR	C1629SR	418-411-45	-	418-116A	418-117	-	418-112	418-107
1	0.35	BY	200TR	C2239R	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.35	RS	171SR	C1629SR	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.35	BU	200TR	C2239R	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	G	200R	C0582	-	-	-	-	-	-	-
4	0.5	NP	21R	S/JOINT SJ687R	-	-	-	-	-	-	-
5	0.75	RW	216R	C0582	-	-	-	-	-	-	-
6	0.5	GK	200R	S/JOINT SJ552	-	-	-	-	-	-	-
7	0.35	NP	204R	S/JOINT SJ687R	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.5	UG	124R	C2819R	-	-	-	-	-	-	-
9	0.5	YO	124R	S/JOINT SJ1201	-	-	-	-	-	-	-
10	0.5	LGW	28R	S/JOINT SJ14	-	-	-	-	-	-	-
11	0.5	RN	200R	S/JOINT SJ117	-	-	-	-	-	-	-
12	0.75	P	134R	S/JOINT SJ740	-	-	-	-	-	-	-
13	0.5	WG	124R	S/JOINT SJ1202	-	-	-	-	-	-	-
14	0.35	LGR	200TR	C0581	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.5	GP	200TR	S/JOINT SJ553	-	-	-	-	-	-	-
16	0.75	R	200R	C0582	-	-	-	-	-	-	-
17	0.75	PY	200R	C2239R	-	-	-	-	-	-	-
18	0.5	SN	591R	C0580	-	-	-	-	-	-	-
19	0.35	KR	41R	C0581	418-411-45	-	418-116A	418-117	-	418-112	418-107

20	0.35	YK	41R	C0581	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C1170L

CONNECTOR HOUSING NOT SERVICEABLE

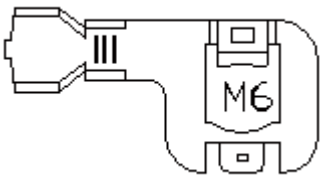

Part No.: YPG900270

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: LHD condition illustrated

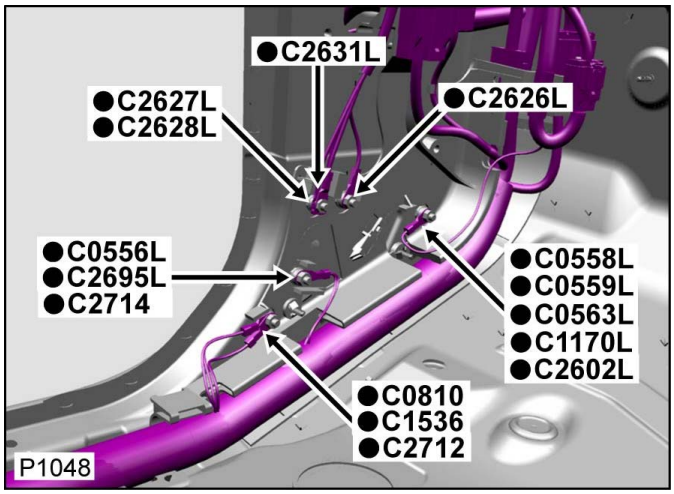


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	B	921L	C1656L

Click here to print

Connector: C1170T

CONNECTOR HOUSING NOT SERVICEABLE

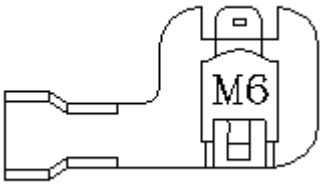

Part No.: YPG900310

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of 'D' post RH side

Qualifier:

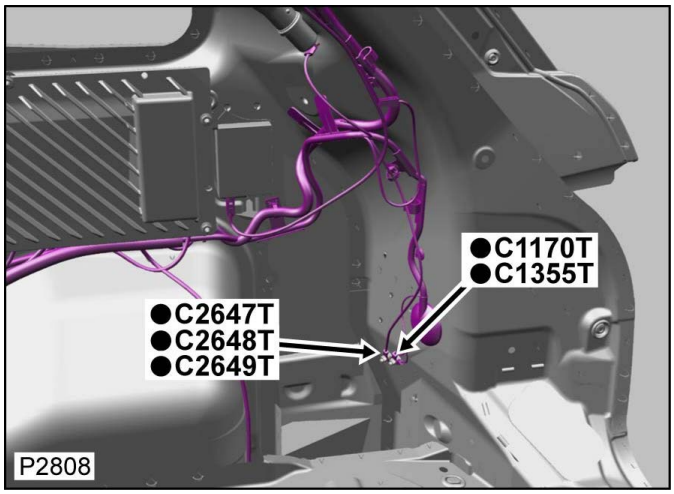

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	B	134T	C0119T
1	0.5	B	97T	C2046T

Click here to print

Connector: C1184


CONNECTOR HOUSING NOT SERVICEABLE

Description: Instrument panel harness to main harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

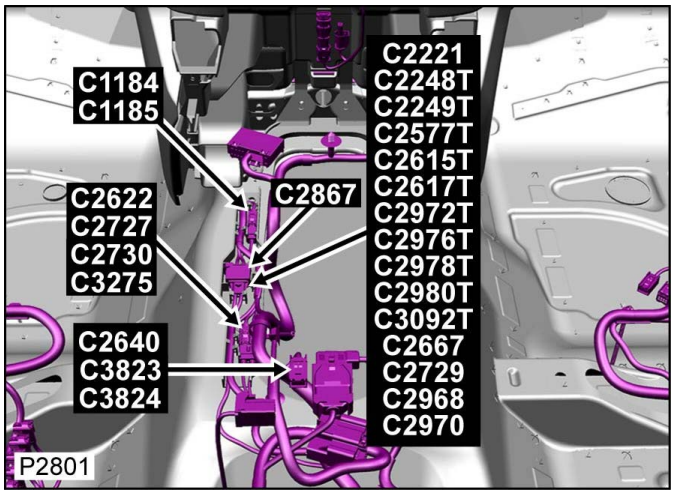

Part No.: XUD815120

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE LINK HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	784	C2820
1S	0.5	SCR	784	C2820

Click here to print

Connector: C1185


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to instrument panel harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

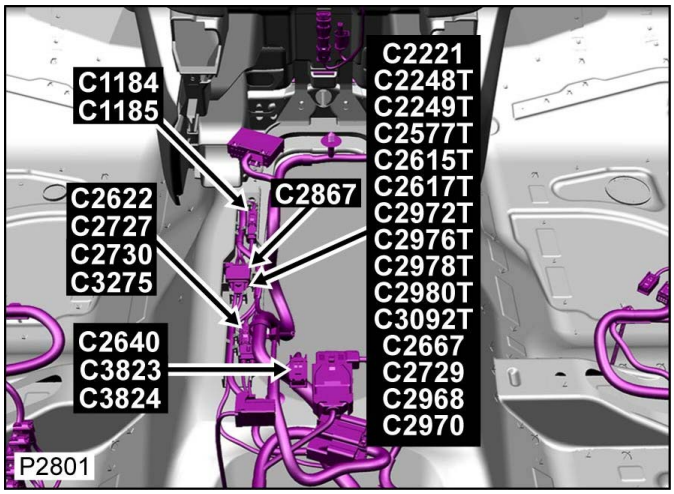

Part No.: XUD812470

Colour: NO COLOUR

Cavities: 1WY

Harness: CABIN HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	784	C3338
1S	SCR	SCR	784	C3338
1	0.5	B	510S	C0144S
1S	SCR	SCR	510S	C0144S
1	0.5	B	510T	C0144T
1S	SCR	SCR	510T	C0144T

Click here to print

Connector: C1254


CONNECTOR HOUSING NOT SERVICEABLE

Description: Clock spring

Location: In center of steering wheel

Qualifier:

No connector face
Geen connector-vooraanzicht
Pas de face de connecteur
Kein diagramm
Senza faccia connettore
Sem imagen dos pinos da ficha
No hay cara de conector

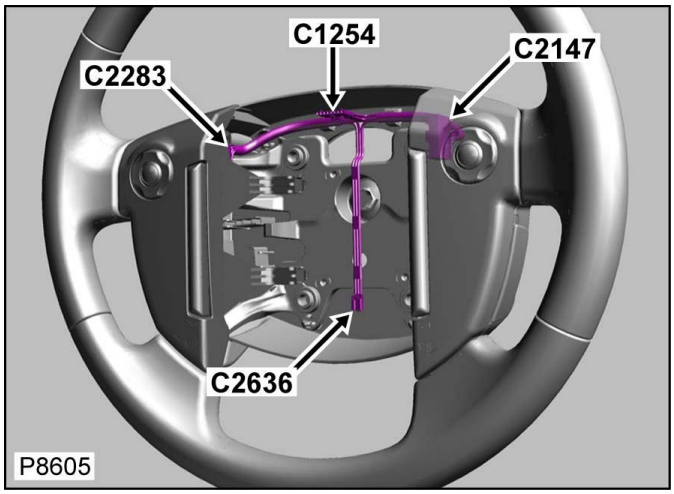

Part No.: RE-L08-1A

Colour:

Cavities:

Harness: STEERING WHEEL HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	G	499	C2283
2	0.35	O	499	C2283
3	0.35	B	499	C2636
4	0.35	LU	499	C2283
5	0.35	Y	499	C2147
6	0.35	U	499	C2147
7	0.35	W	499	C2283

Click here to print


Connector: C1323

CONNECTOR HOUSING NOT SERVICEABLE


Description: Capacitor - PV8

Location: Rear RH side of engine

Qualifier:

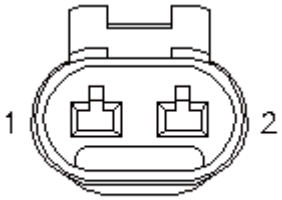

WATER BLUE

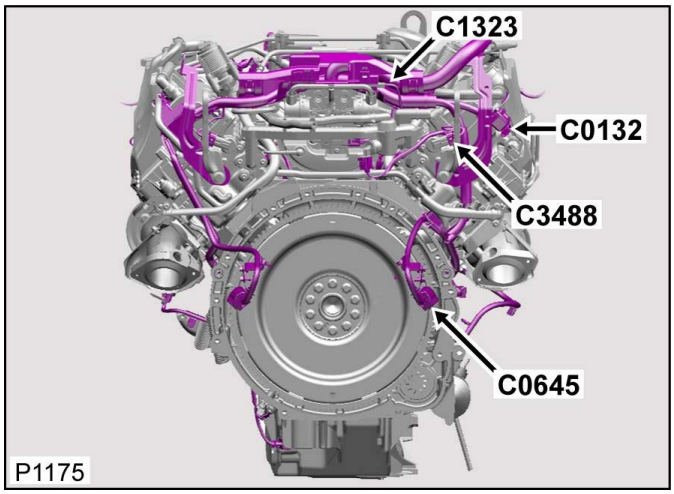

Part No.: YPC911010

Colour: WATERBLUE

Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	W	ALL	S/JOINT PIS28
2	1.0	B	ALL	C3555

Click here to print


Connector: C1339

CONNECTOR HOUSING NOT SERVICEABLE


Description: Pump-Leak detection

Location: Beneath rear of vehicle - Center

Qualifier:

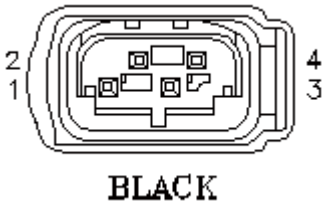

BLACK

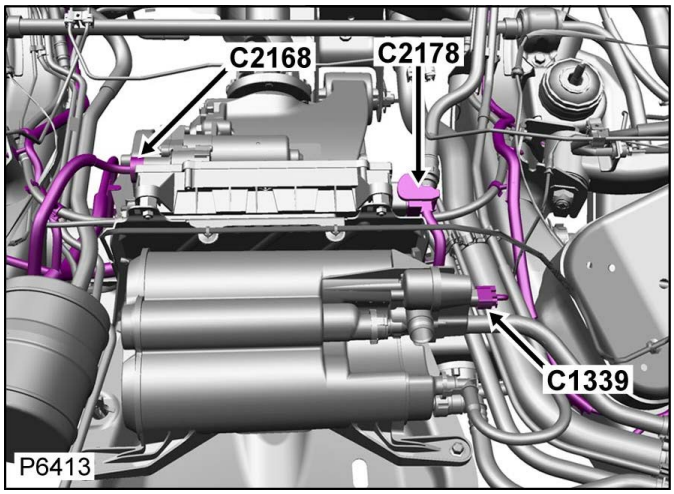

Part No.: YPC800590

Colour: BLACK

Cavities: 4WY

Harness: CHASSIS HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	Y	382T	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	Y	382S	C2294SB	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	G	382T	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	G	382S	C2294SB	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	R	382T	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	R	382S	C2294SB	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
4	0.75	NK	382T	C2294T	-	-	-	-	-	-	-
4	0.75	NK	382S	C2294SB	-	-	-	-	-	-	-

Click here to print

Connector: C1352

CONNECTOR HOUSING NOT SERVICEABLE

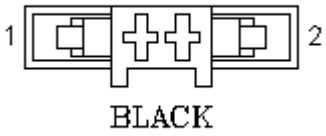

Part No.: YPC113640

Colour: BLACK


Cavities: 2WY

Harness: TAILGATE HARNESS

Description: Sub-woofer

Location: RH side of taildoor, behind trim panel

Qualifier:

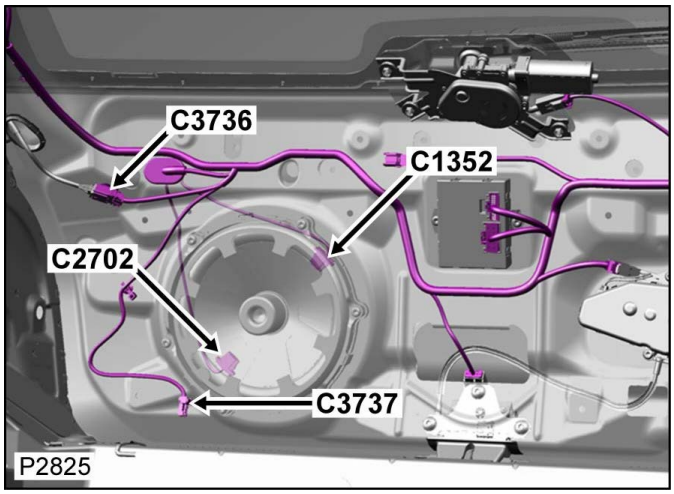


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	G	499	C0384
2	1.5	GW	499	C0384

Click here to print

Connector: C1355T

CONNECTOR HOUSING NOT SERVICEABLE

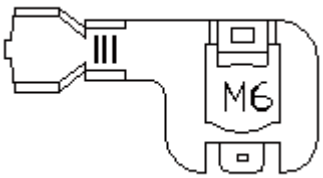

Part No.: YPG900270

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of 'D' post RH side

Qualifier:

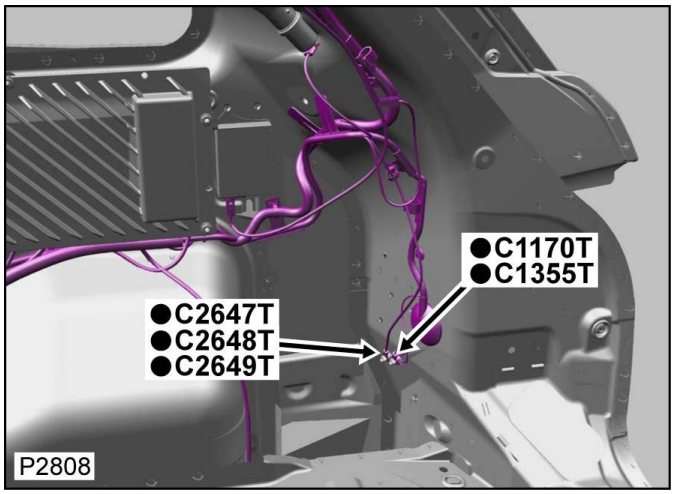

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	B	499T	C0125T
1	0.5	B	478T	C2415T

Click here to print


Connector: C1381

CONNECTOR HOUSING NOT SERVICEABLE

Description: Trailer pick-up (12N/12S)

Location: Behind Center of rear bumper

Qualifier:

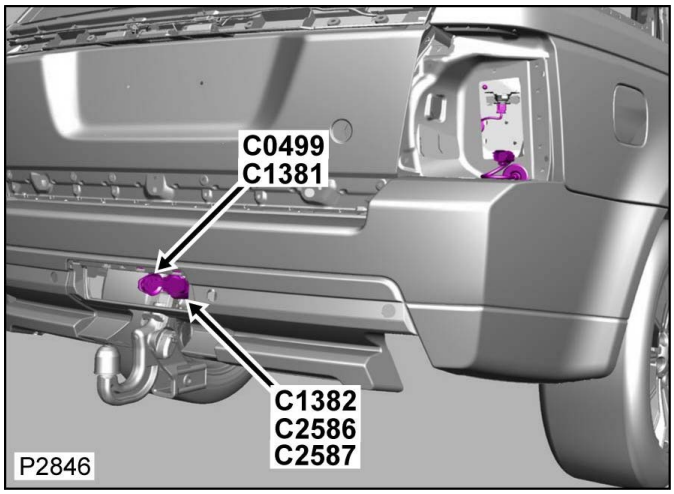

ASSEMBLY

Part No.: XUD802590

Colour: BLACK

Cavities: 7WY

Harness: TOWING SOCKET 12S HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	YN	ALL	C1416
3	2.5	W	ALL	C1416
4	2.5	UK	ALL	C1416
6	2.5	RW	ALL	C1416
7	2.5	W	ALL	C1416

Click here to print


Connector: C1382


CONNECTOR HOUSING NOT SERVICEABLE

Description: Trailer pick-up (12N/12S)

Location: Behind Center of rear bumper

Qualifier:

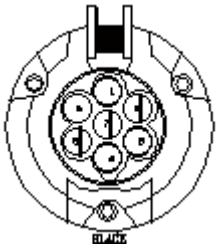

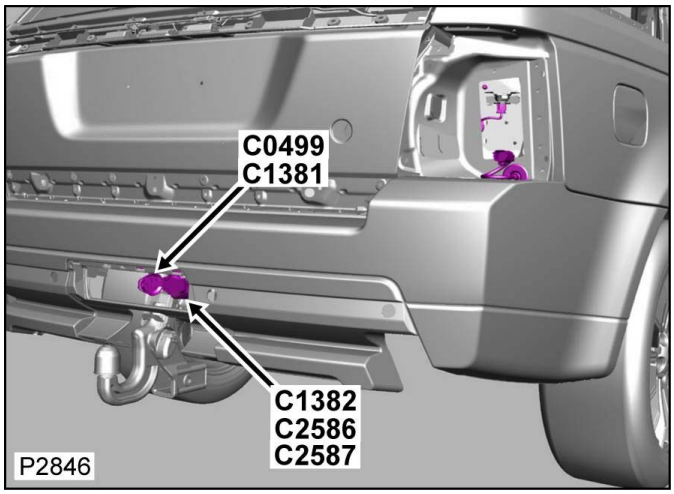

Part No.: XUD800210

Colour: NO COLOUR

Cavities: 7WY

Harness: TOWING SOCKET 12N HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	Y	ALL	C1414
2	1.5	U	ALL	C1415
3	2.5	W	ALL	C1414
4	2.5	G	ALL	C1414
5	1.5	N	ALL	C1415
6	1.5	R	ALL	C1415
7	1.5	B	ALL	C1415

Click here to print

Connector: **C1388T**

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC800060

Colour: DARK GREY


Cavities: 6WY

Harness: CABIN HARNESS

Description: Main harness to trailer connector

Location: Behind LH side of rear bumper

Qualifier:

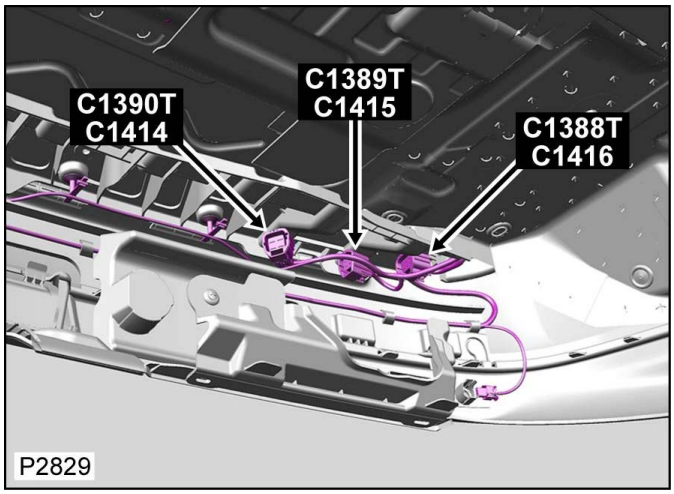

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	R	162T	C2937T	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	YN	162TL	C0585L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	YN	200TR	C0585R	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
4	2.5	UK	139TL	C0585L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
4	2.5	UK	200TR	C0585R	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
5	2.5	W	162T	C2921T	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
6	2.5	W	162T	C2700T	418-411-19	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: **C1389T**

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC500600

Colour: DARK GREY


Cavities: 4WY

Harness: CABIN HARNESS

Description: Main harness to trailer connector

Location: Behind LH side of rear bumper

Qualifier:

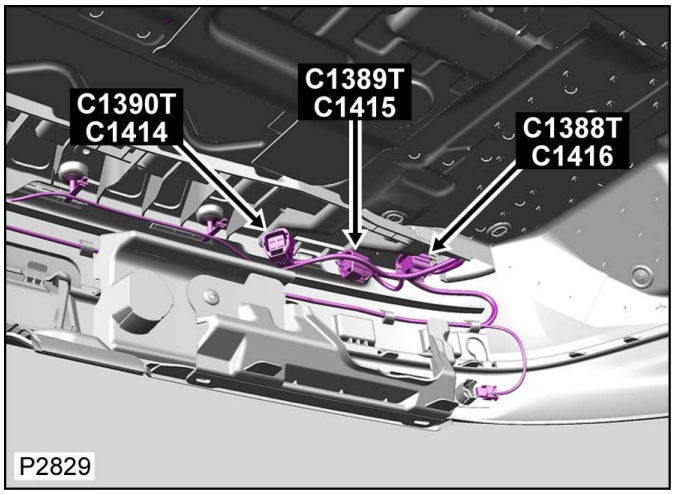

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	R	162TL	C0585L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
1	1.5	YN	319TL	C0585L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
1	1.5	R	200TR	C0585R	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	U	162TL	C0585L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	Y	319TL	C0585L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	U	200TR	C0585R	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	G	319TL	C0585L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	N	162T	S/JOINT SJ571T	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
4	1.5	N	415T	S/JOINT SJ318	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
4	1.5	B	162T	S/JOINT SJ571T	418-411-19	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: **C1390T**

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC800070

Colour: DARK GREY


Cavities: 4WY

Harness: CABIN HARNESS

Description: Main harness to trailer connector

Location: Behind LH side of rear bumper

Qualifier:

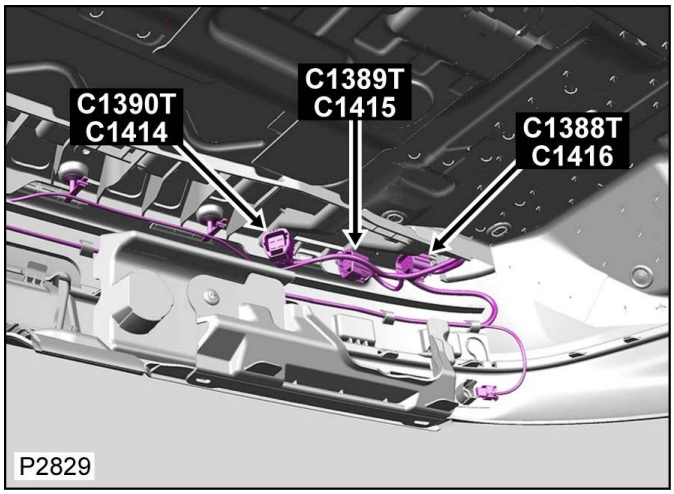

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	W	162T	C2692T	418-411-37	-	418-116A	418-117	418-104	418-113	418-108
1	2.5	R	319TL	C2937T	418-411-37	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	Y	162TL	C0585L	418-411-37	-	418-116A	418-117	418-104	418-113	418-108
2	6.0	W	319TL	C0565T	-	-	-	-	-	-	-
2	1.5	Y	200TR	C0585R	418-411-37	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	G	162TL	C0585L	418-411-37	-	418-116A	418-117	418-104	418-113	418-108
3	2.5	U	415T	C2243L	418-411-37	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	G	200TR	C0585R	418-411-37	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C1393L

CONNECTOR HOUSING NOT SERVICEABLE


Description: Switch-Steering column-Lighting

Location: Behind steering column cowl LH side

Qualifier:

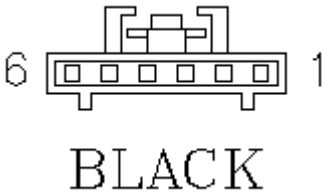

BLACK

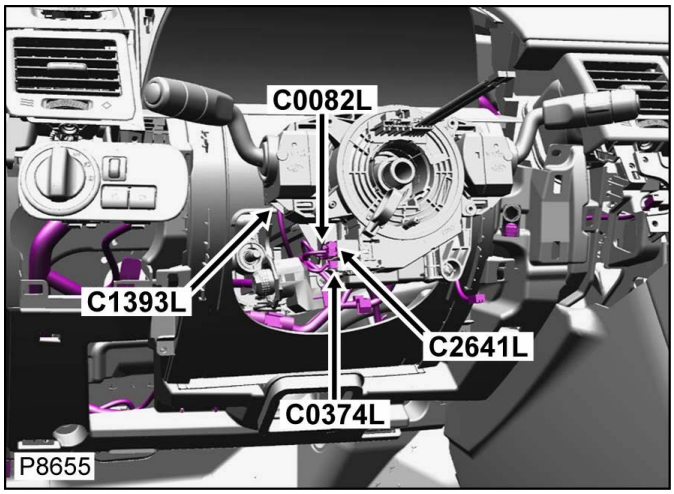

Part No.: YPC801000

Colour: BLACK

Cavities: 6WY

Harness: FACIA COMPOSITE HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	B	139L	S/JOINT SJ663L
2	0.35	GW	139L	C0581
3	0.35	GR	139L	C0581
4	0.35	UR	139L	C0581
5	0.35	R	139L	C0581
6	0.35	UR	139L	C0581

Click here to print


Connector: C1393R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Switch-Steering column-Lighting

Location: Behind steering column cowl LH side

Qualifier:

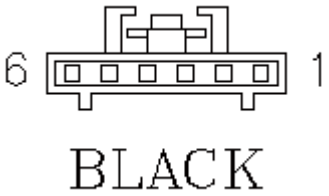

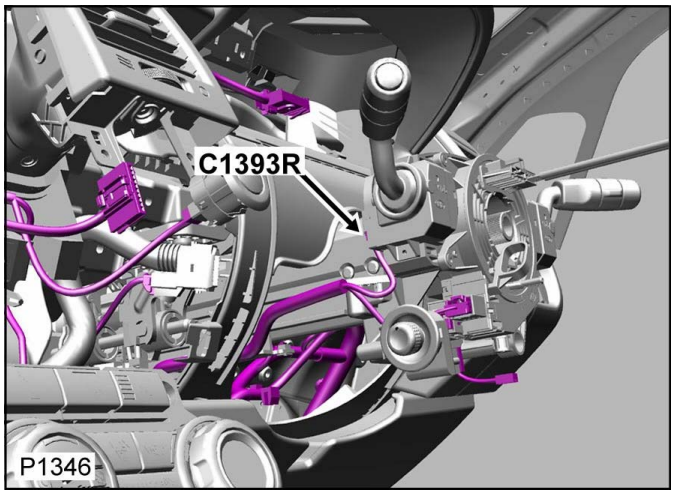

Part No.: YPC801000

Colour: BLACK

Cavities: 6WY

Harness: FACIA COMPOSITE HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	B	200R	S/JOINT SJ663R
2	0.35	GW	200R	C0581
3	0.35	GR	200R	C0581
4	0.35	UR	200R	C0581
5	0.35	R	200R	C0581
6	0.35	UR	200R	C0581

Click here to print

Connector: C1396L

CONNECTOR HOUSING NOT SERVICEABLE

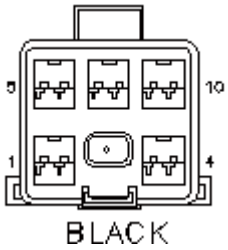

Part No.: YPC901770

Colour: BLACK


Cavities: 10WY

Harness: FACIA COMPOSITE HARNESS

Description: Assembly-Steering column

Location: RH side of steering column

Qualifier:

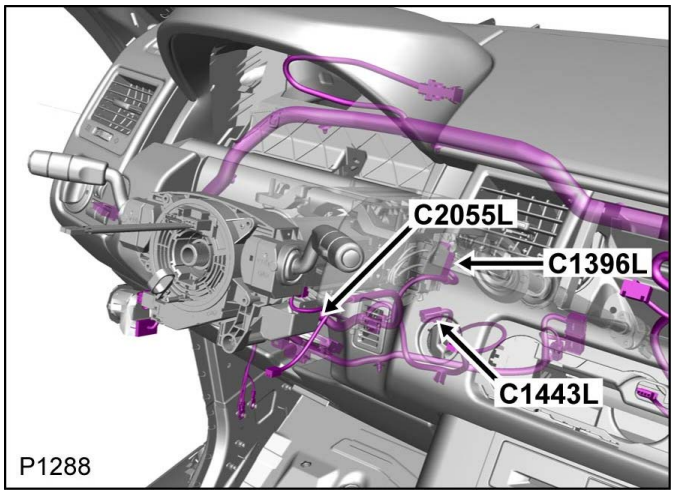


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	U	406L	C0581	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	406L	S/JOINT SJ663L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
3	1.5	BU	406L	C0582	-	-	-	-	-	-	-
4	1.5	UB	406L	C0582	-	-	-	-	-	-	-
5	0.35	NR	406L	S/JOINT SJ870L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
6	0.35	R	406L	C0581	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	G	406L	C0580	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
8	0.35	R	406L	C0580	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	B	406L	C0581	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	B	406L	S/JOINT SJ663L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1396R

CONNECTOR HOUSING NOT SERVICEABLE

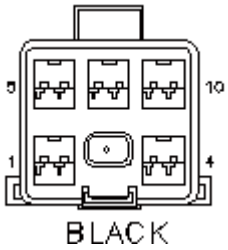

Part No.: YPC901770

Colour: BLACK


Cavities: 10WY

Harness: FACIA COMPOSITE HARNESS

Description: Assembly-Steering column

Location: RH side of steering column

Qualifier:

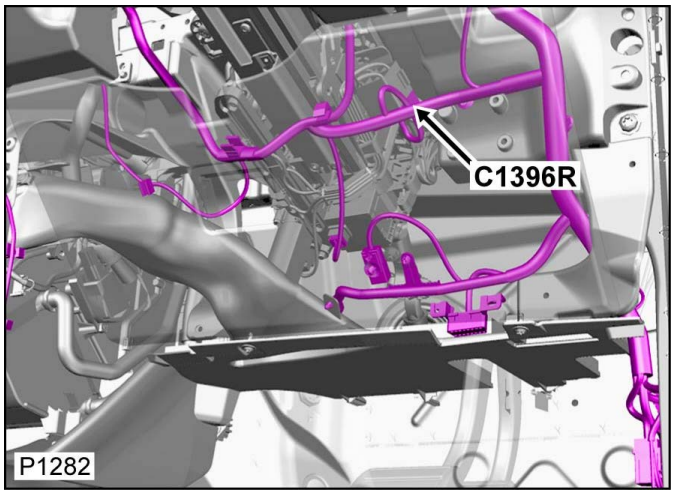


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	U	406R	C0581	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	406R	S/JOINT SJ663R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
3	1.5	BU	406R	C0582	-	-	-	-	-	-	-
4	1.5	UB	406R	C0582	-	-	-	-	-	-	-
5	0.35	NR	406R	S/JOINT SJ870R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
6	0.35	R	406R	C0581	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	G	406R	C0580	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
8	0.35	R	406R	C0580	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	B	406R	C0581	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	B	406R	S/JOINT SJ663R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1398R

CONNECTOR HOUSING NOT SERVICEABLE

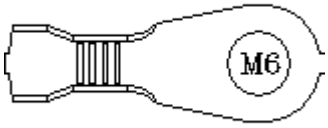

Part No.: YPG800650

Colour: TIN PLATED


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

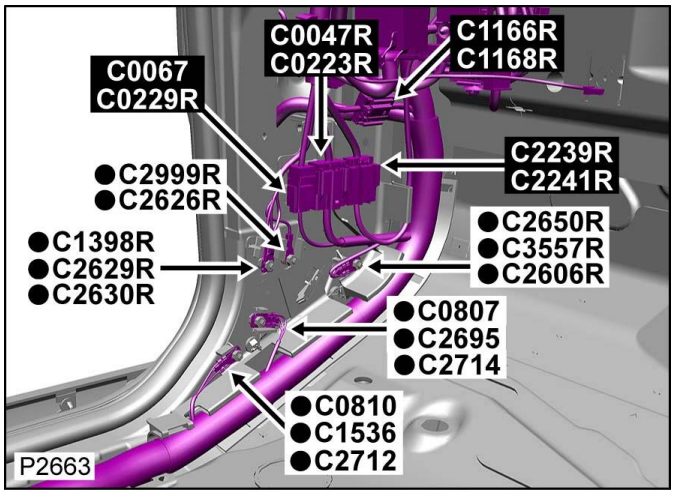


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	125R	C3481

Click here to print

Connector: C1401

CONNECTOR HOUSING NOT SERVICEABLE

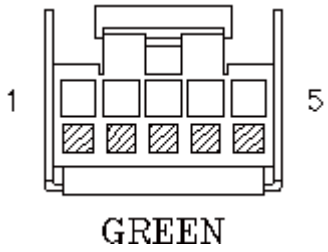

Part No.: YPC10182

Colour: GREEN


Cavities: 5WY

Harness: CONSOLE REAR HARNESS

Description: Switch-Seat heat-Rear-LH

Location: In rear of center console

Qualifier:

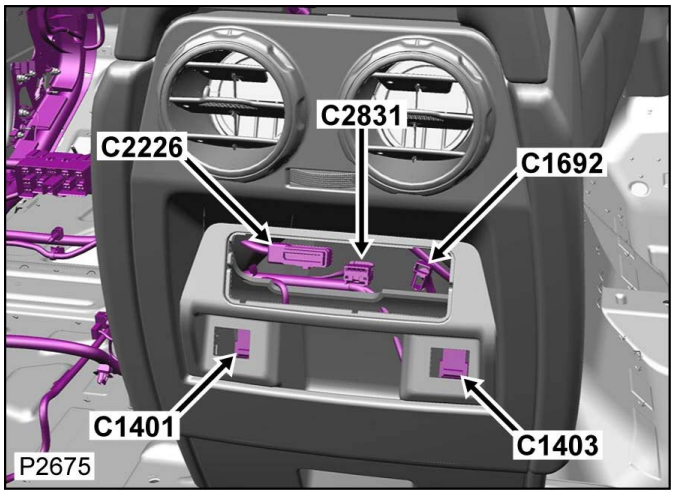

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	572	S/JOINT SJ301	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.5	UK	572	C2755	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	G	572	C2755	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	U	572	C2755	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	RN	572	S/JOINT SJ300	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: **C1403**

CONNECTOR HOUSING NOT SERVICEABLE

Description: Switch-Seat heat-Rear-RH

Location: In rear of center console

Qualifier:

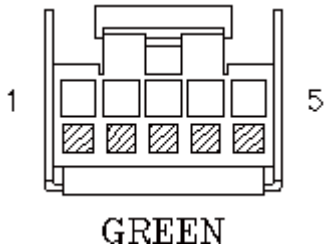


Part No.: YPC10182

Colour: GREEN

Cavities: 5WY

Harness: CONSOLE REAR HARNESS

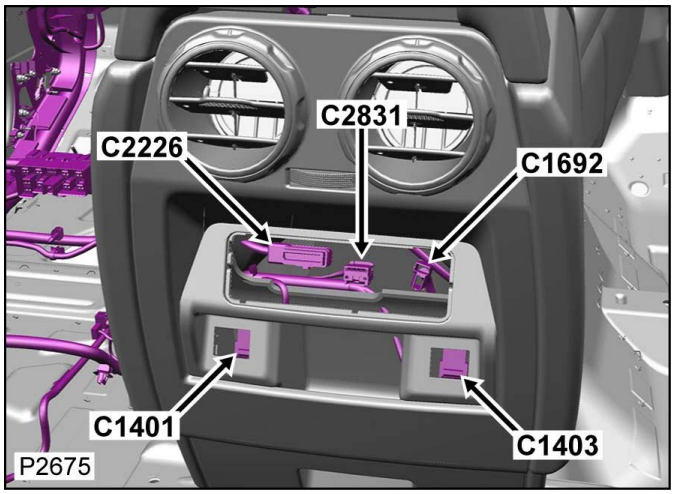


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	572	S/JOINT SJ301	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.5	UK	572	C2755	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	G	572	C2755	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	U	572	C2755	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	RN	572	S/JOINT SJ300	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C1408

CONNECTOR HOUSING NOT SERVICEABLE

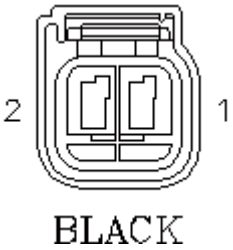

BLACK

Part No.: YPC800380

Colour: BLACK


Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Capacitor

Location: RH side of gearbox

Qualifier:

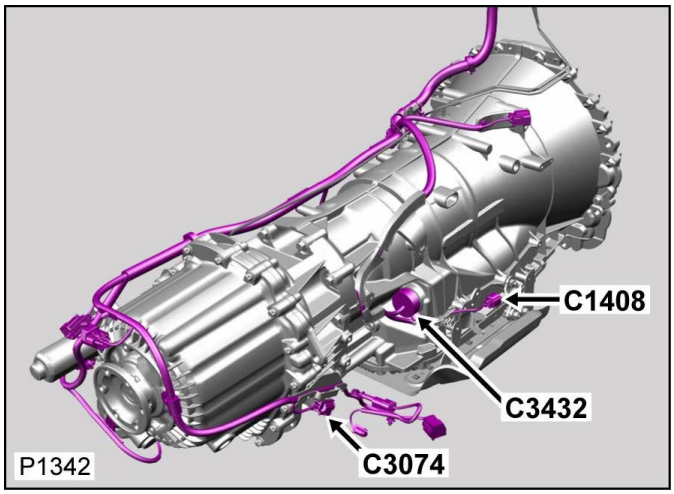


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	PY	797	S/JOINT SJ4410	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	1.0	B	797	S/JOINT SJ4409	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1413

CONNECTOR HOUSING NOT SERVICEABLE

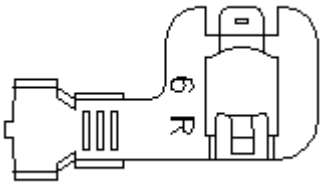

Part No.: YPG800220

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of RH 'A' post

Qualifier: LHD condition illustrated

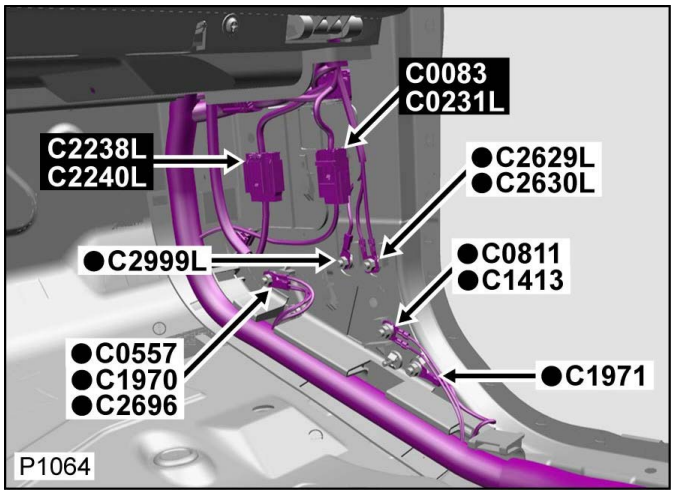

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	499	C0398

Click here to print

Connector: C1414

CONNECTOR HOUSING NOT SERVICEABLE



DARK GREY

Part No.: YPC800050

Colour: DARK GREY


Cavities: 4WY

Harness: TOWING SOCKET 12N HARNESS

Description: Trailer harness to main harness

Location: Behind LH side of rear bumper

Qualifier:

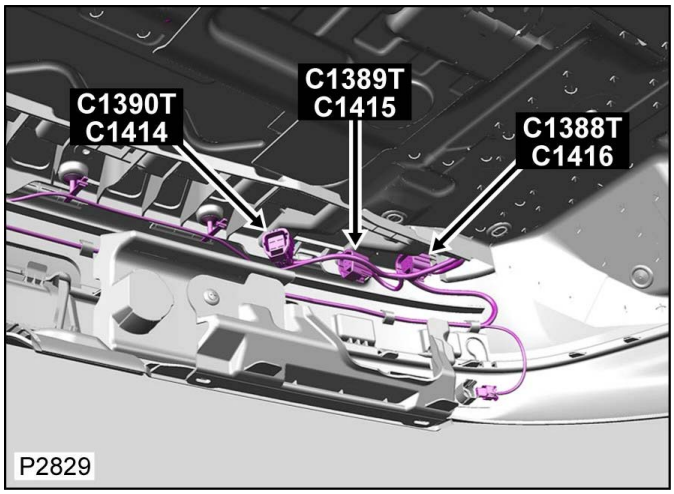


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	W	ALL	C1382
2	2.5	Y	ALL	C1382
3	2.5	G	ALL	C1382

Click here to print

Connector: C1415

CONNECTOR HOUSING NOT SERVICEABLE

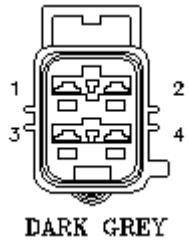

DARK GREY

Part No.: YPC900130

Colour: DARK GREY


Cavities: 4WY

Harness: TOWING SOCKET 12N HARNESS

Description: Trailer harness to main harness

Location: Behind LH side of rear bumper

Qualifier:

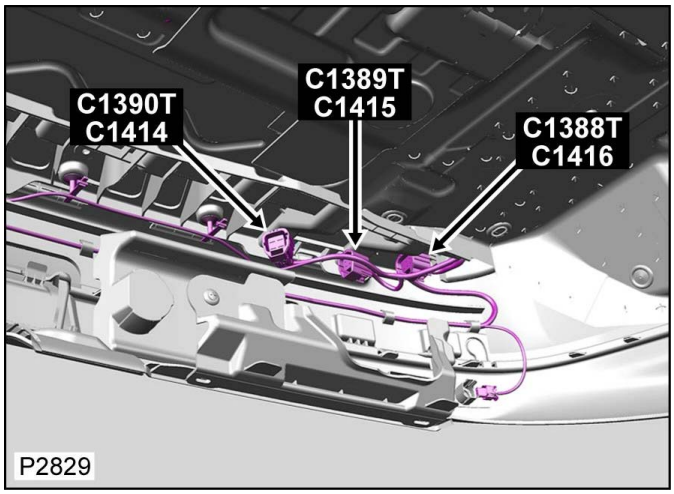

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	R	ALL	C1382	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	U	ALL	C1382	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	N	ALL	C1382	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
4	1.5	B	ALL	C1382	418-411-18	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: **C1416**

CONNECTOR HOUSING SERVICEABLE



Part No.: YPC900900

Colour: DARK GREY


Cavities: 6WY

Harness: TOWING SOCKET 12S HARNESS

Description: Trailer harness to main harness

Location: Behind LH side of rear bumper

Qualifier:

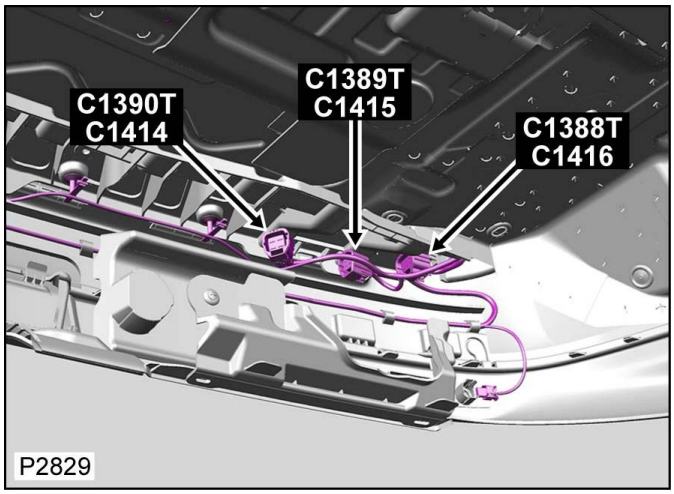


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	RW	ALL	C1381	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	YN	ALL	C1381	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
4	2.5	UK	ALL	C1381	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
5	2.5	W	ALL	C1381	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
6	2.5	W	ALL	C1381	418-411-18	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C1443L

CONNECTOR HOUSING NOT SERVICEABLE

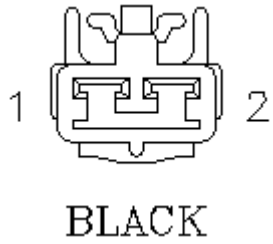

BLACK

Part No.: YPC124600

Colour: BLACK


Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Description: Sensor-Temperature-In-car

Location: RH side of steering column

Qualifier:

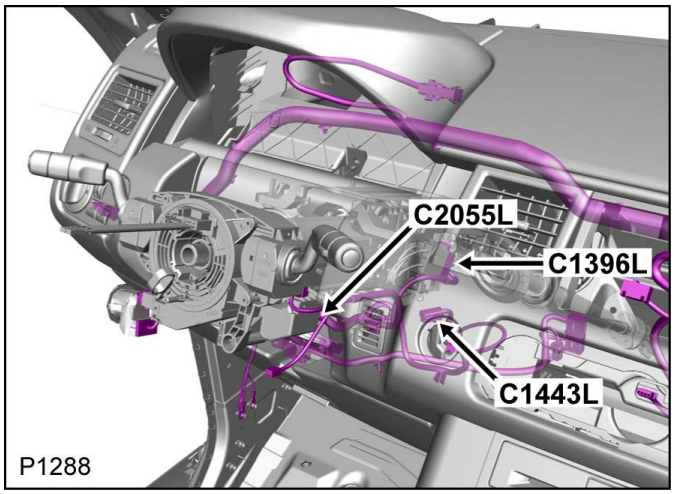

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	BG	19L	S/JOINT SJ550	418-411-33	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	UY	19L	C3470	418-411-33	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: **C1443R**

CONNECTOR HOUSING NOT SERVICEABLE

Description: Sensor-Temperature-In-car

Location: Behind driver side of Instrument panel

Qualifier:

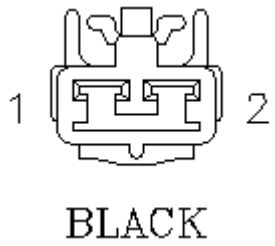


BLACK

Part No.: YPC124600

Colour: BLACK

Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

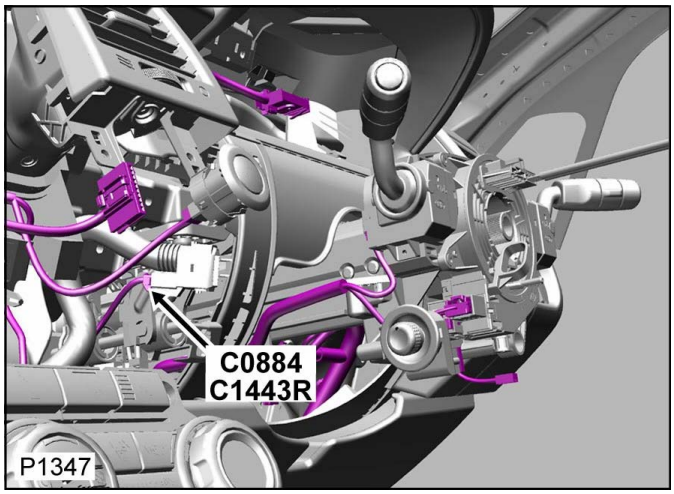

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	BG	19R	S/JOINT SJ550	418-411-33	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	UY	19R	S/JOINT SJ784	418-411-33	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C1457

CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Parking aid

Location: Behind luggage compartment carpet LH side

Qualifier:

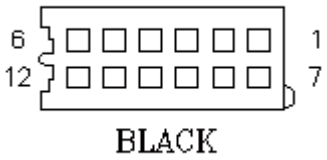


Part No.: YPC802340

Colour: BLACK

Cavities: 12WY

Harness: CABIN HARNESS

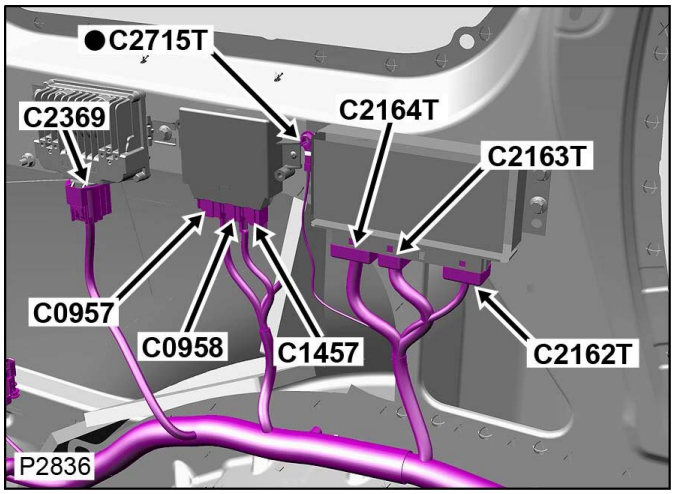


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	0.35	YS	171S	C0876S	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.35	YS	68T	C0876T	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
3	0.35	YB	171S	C0876S	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
3	0.35	YB	68T	C0876T	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.35	YO	171S	C0876S	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.35	YO	68T	C0876T	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
5	0.35	YG	171S	C0876S	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
5	0.35	YG	68T	C0876T	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
8	0.35	GW	171S	C0876S	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
8	0.35	GW	68T	C0876T	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
11	0.35	UW	171S	C0876S	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
11	0.35	UW	68T	C0876T	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C1462

CONNECTOR HOUSING NOT SERVICEABLE

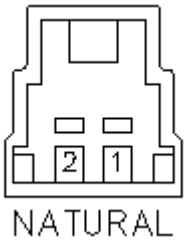

Part No.: YPC900180

Colour: NATURAL


Cavities: 2WY

Harness: ROOF HARNESS

Description: Lamp-Interior-Front

Location: Behind Center headlining

Qualifier:

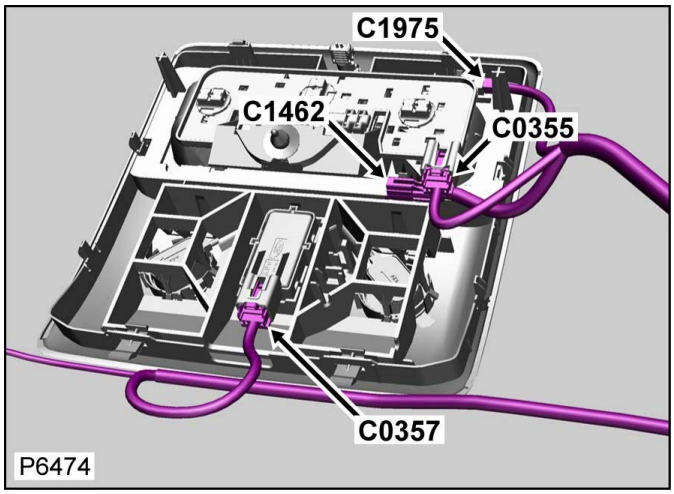


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	124	C0610
2	0.5	R	124	C0610

Click here to print

Connector: C1465

CONNECTOR HOUSING NOT SERVICEABLE

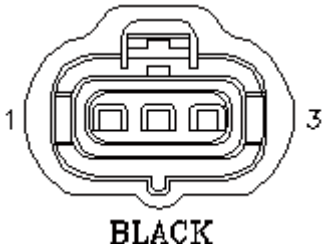

Part No.: YPC19170

Colour: BLACK


Cavities: 3WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Sensor-Pressure-Air Conditioning

Location: Front LH side of engine compartment

Qualifier:

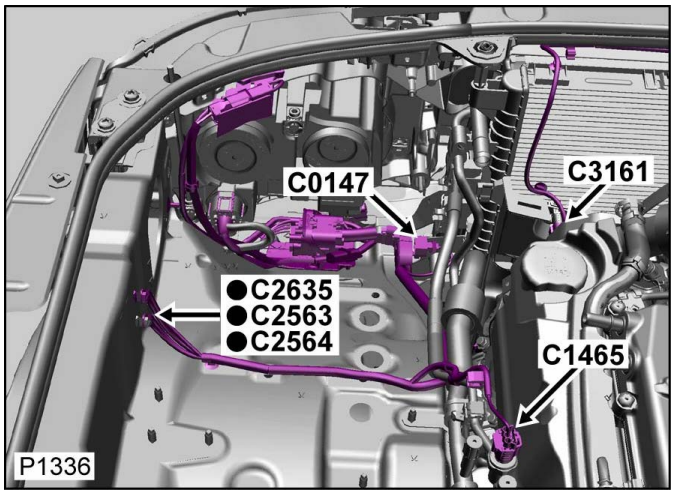


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	WU	805L	C2444L
1	0.5	WU	805R	C2241R
2	0.5	UN	805L	C2444L
2	0.5	UN	805R	C2241R
3	0.5	R	805L	C2444L
3	0.5	R	805R	C2241R

Click here to print

Connector: C1479T

CONNECTOR HOUSING NOT SERVICEABLE

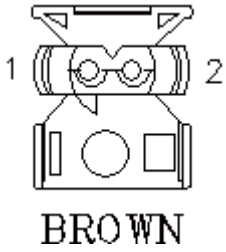

Part No.: XUD802740

Colour: RW/BW


Cavities: 1WY

Harness: CABIN HARNESS

Description: Air bag-Side curtain-LH

Location: LH 'D' post

Qualifier:

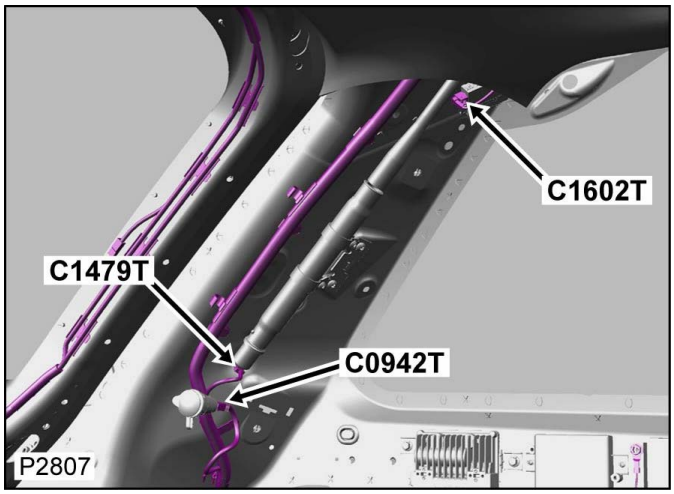


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	RW	216T	C0256
2	0.5	BW	216T	C0256

Click here to print

Connector: C1480T

CONNECTOR HOUSING NOT SERVICEABLE

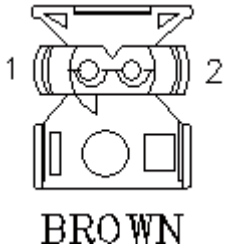

Part No.: XUD802750

Colour: SW/NB


Cavities: 1WY

Harness: CABIN HARNESS

Description: Air bag-Side curtain-RH

Location: RH 'D' post

Qualifier:

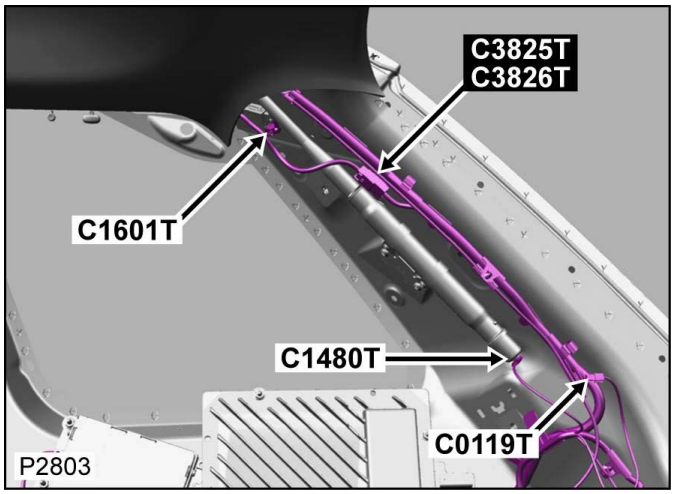


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	BU	216T	C0256
2	0.5	GU	216T	C0256

Click here to print

Connector: C1500

CONNECTOR HOUSING NOT SERVICEABLE

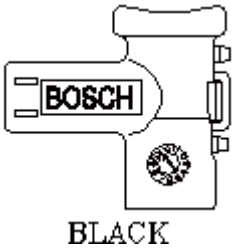

BLACK

Part No.: YPC910510

Colour: BLACK


Cavities: 1WY

Harness: GLOWPLUG LINK V6 LHS HARNESS

Description: Glow plug

Location: Top of engine - LH side

Qualifier:

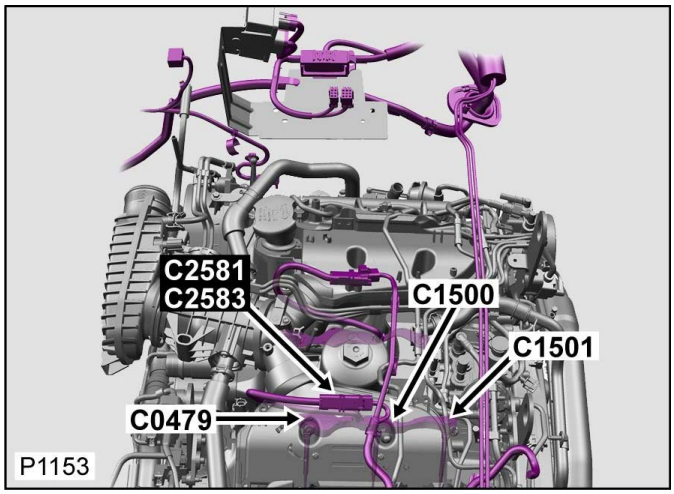


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	GR	695	C2583

Click here to print

Connector: C1501

CONNECTOR HOUSING NOT SERVICEABLE

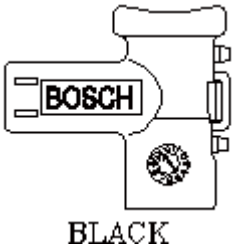

BLACK

Part No.: YPC910510

Colour: BLACK


Cavities: 1WY

Harness: GLOWPLUG LINK V6 LHS HARNESS

Description: Glow plug

Location: Top of engine - LH side

Qualifier:

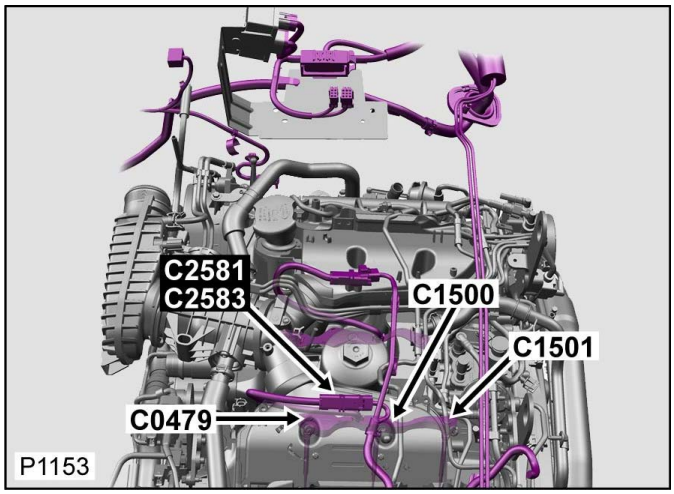


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	GU	695	C2583

Click here to print

Connector: C1526M

CONNECTOR HOUSING NOT SERVICEABLE

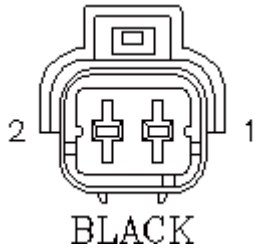

Part No.: YPC910280

Colour: BLACK


Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Engine harness to link harness

Location: Behind radiator

Qualifier:

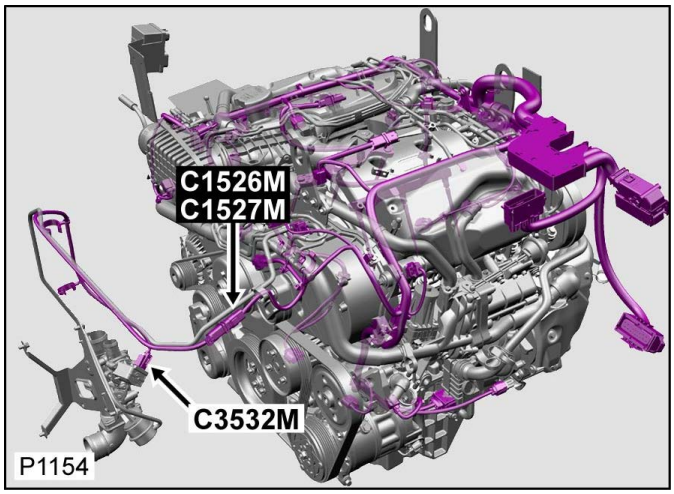


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	OS	798	S/JOINT SJ1
2	0.75	GP	798	C0659M

Click here to print

Connector: C1527M

CONNECTOR HOUSING NOT SERVICEABLE

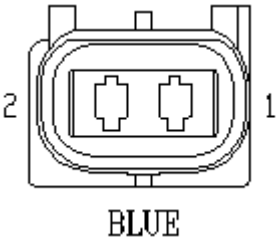

Part No.: YPC803760

Colour: BLUE


Cavities: 2WY

Harness: T5 ELECTRIC RECIRC JUMPER HARNESS

Description: Link harness to engine harness

Location: Behind radiator

Qualifier:

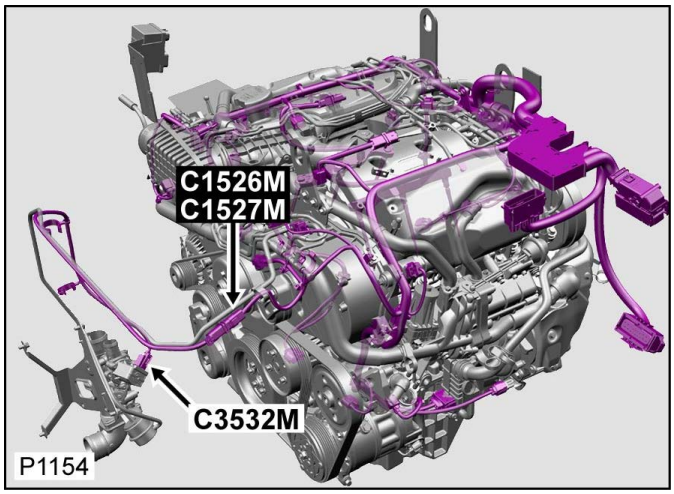


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	RD-YE	499	C3532M
2	0.75	BN-RD	499	C3532M

Click here to print

Connector: C1535L

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG101610

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Rear LH side of engine compartment

Qualifier:

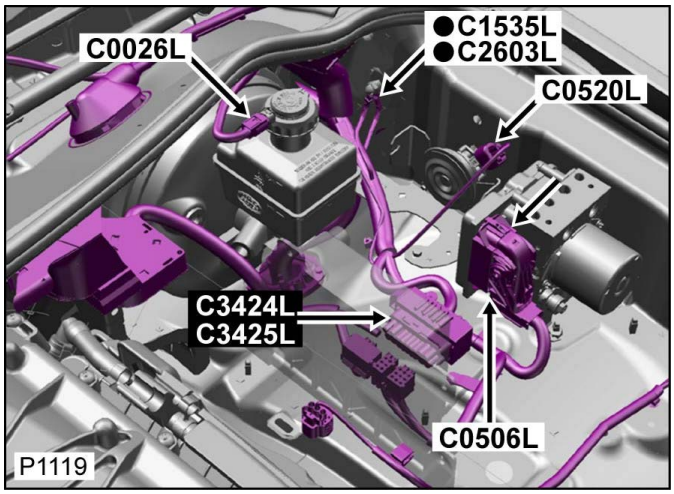


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	139L	S/JOINT SJ248

Click here to print

Connector: C1535R

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG101610

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Rear RH side of engine compartment

Qualifier:

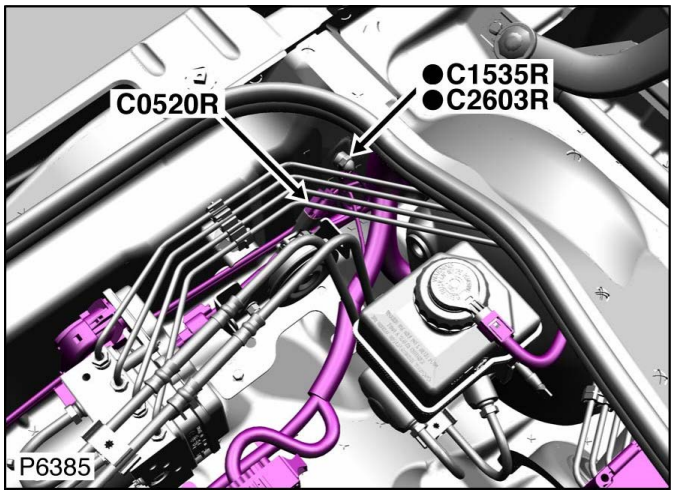


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	200R	S/JOINT SJ1248

Click here to print

Connector: C1536

CONNECTOR HOUSING NOT SERVICEABLE

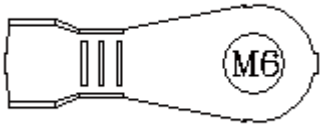

Part No.: YPG801380

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

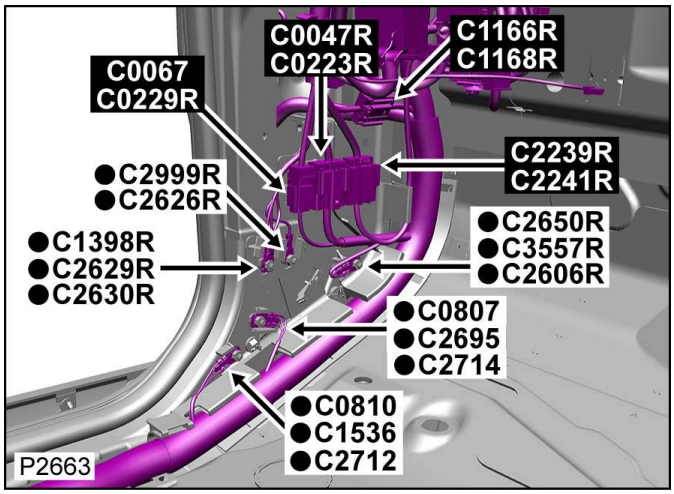


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	499	C0396

Click here to print

Connector: C1542

CONNECTOR HOUSING NOT SERVICEABLE

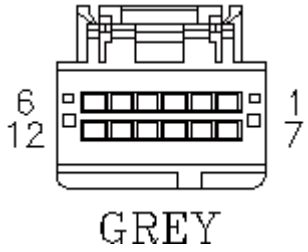

Part No.: YPC902630

Colour: GREY


Cavities: 12WY

Harness: ICE/NAVIGATION HARNESS

Description: Module-Navigation system-Japan

Location: Beneath LH Front seat

Qualifier:

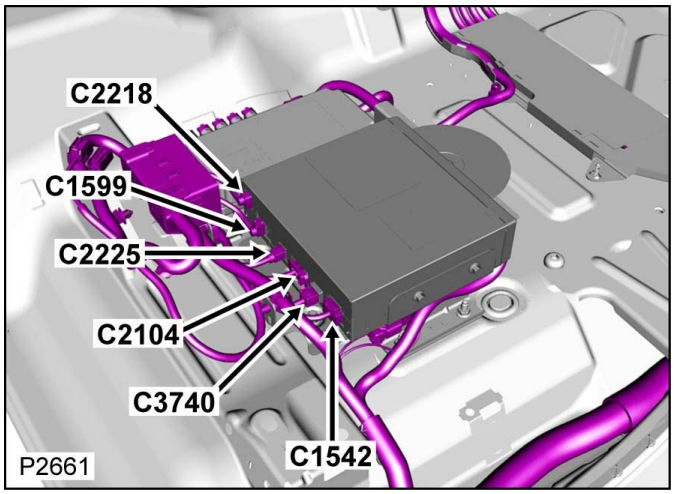


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
6	0.5	R	568	S/JOINT SJ520	418-411-45	-	418-116A	418-117	-	418-112	418-107
11	0.5	B	568	S/JOINT SJ1	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C1547L

CONNECTOR HOUSING NOT SERVICEABLE

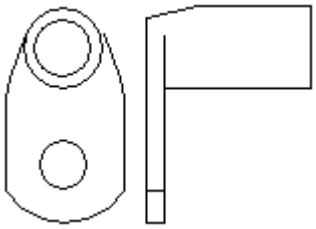

Part No.: YPG800690

Colour: TIN PLATED


Cavities: 1WY

Harness: EARTH STRAP ENGINE-CHASSIS-BIW PETROL V8 HARNESS

Description: Ground point

Location: RH side of engine

Qualifier:

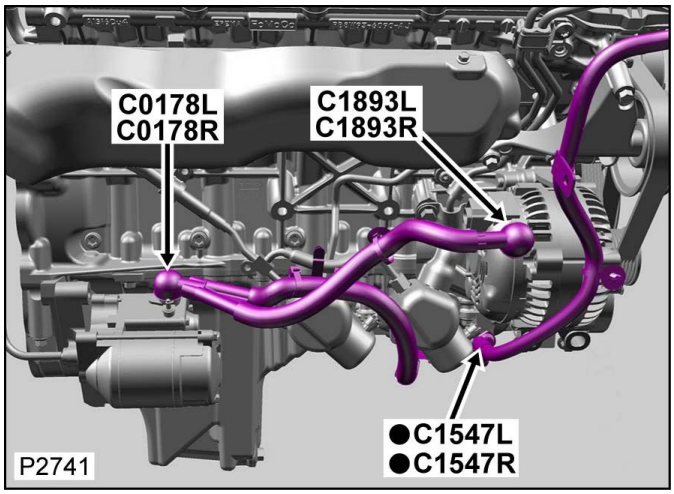


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0	B	499	C2934L

Click here to print

Connector: C1547M

CONNECTOR HOUSING NOT SERVICEABLE

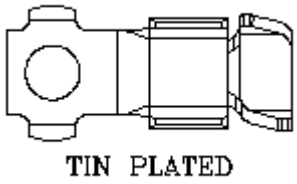

Part No.: YPG900020

Colour: TIN PLATED


Cavities: 1WY

Harness: EARTH STRAP ENGINE-CHASSIS-BIW DIESEL V6 3.0L HARNESS

Description: Ground point

Location: RH side of engine

Qualifier:

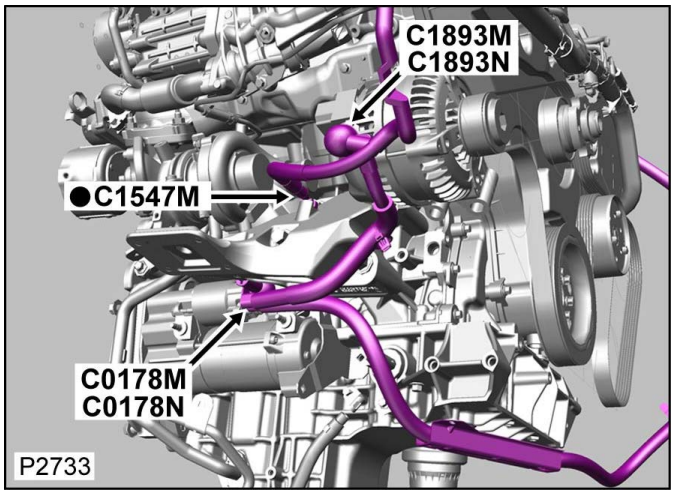


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0	B	499	C2934M

Click here to print

Connector: C1547R

CONNECTOR HOUSING NOT SERVICEABLE

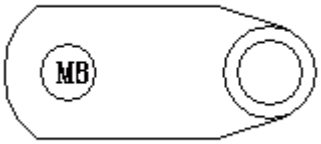

Part No.: YPG801330

Colour: TIN PLATED


Cavities: 1WY

Harness: EARTH STRAP ENGINE-CHASSIS-BIW PETROL V8 RHD HARNESS

Description: Ground point

Location: RH side of engine

Qualifier:

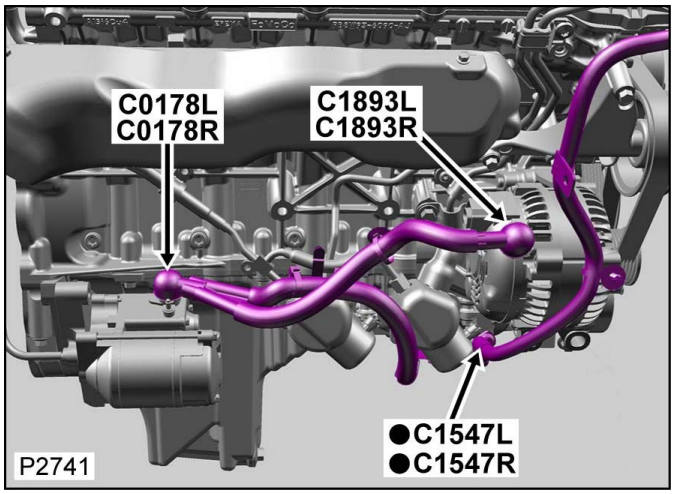


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0	B	499	C2934R

Click here to print

Connector: C1559

CONNECTOR HOUSING NOT SERVICEABLE

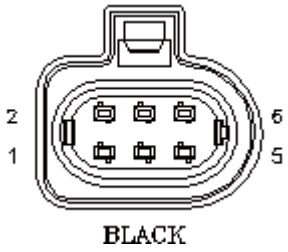

Part No.: YPC910470

Colour: BLACK


Cavities: 6WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Heated oxygen-Pre catalyst-Left bank 2

Location: LH side of gearbox

Qualifier:

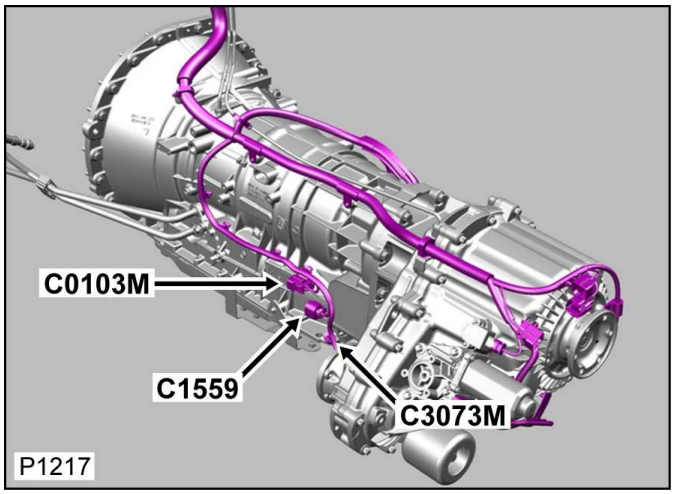


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	UN	993L	C2759M
1	0.5	UN	993R	C2759N
2	0.5	SP	993L	C2759M
2	0.5	SK	993R	C2759N
3	0.75	WO	993L	C2759M
3	0.75	WO	993R	C2759N
4	0.75	B	993L	C3427M
4	0.75	B	993R	C3427N
5	0.5	SO	993L	C2759M
5	0.5	SO	993R	C2759N
6	0.5	G	993L	C2759M
6	0.5	G	993R	C2759N

Click here to print

Connector: C1559A

CONNECTOR HOUSING NOT SERVICEABLE

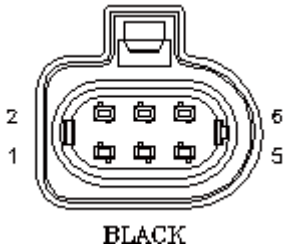

Part No.: YPC910470

Colour: BLACK


Cavities: 6WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Oxygen-Pre catalyst

Location: LH side of gearbox

Qualifier:

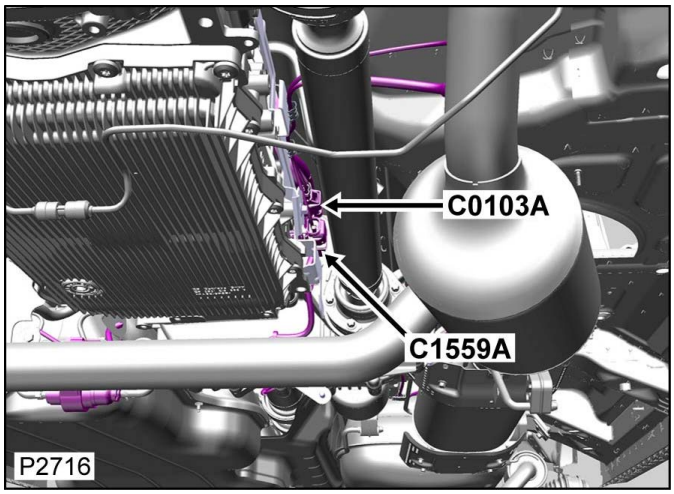

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	UN	982L	C2759P
1	0.5	UN	982R	C2759Q
2	0.5	SP	982L	C2759P
2	0.5	SP	982R	C2759Q
3	0.75	WO	982L	C2759P
3	0.75	WO	982R	C2759Q
4	0.75	B	982L	C3427P
4	0.75	B	982R	C3427Q
5	0.5	SO	982L	C2759P
5	0.5	SO	982R	C2759Q
6	0.5	G	982L	C2759P
6	0.5	G	982R	C2759Q

Click here to print


Connector: C1598T

CONNECTOR HOUSING NOT SERVICEABLE

Description: GPS antenna

Location: Rear of headlining

Qualifier:

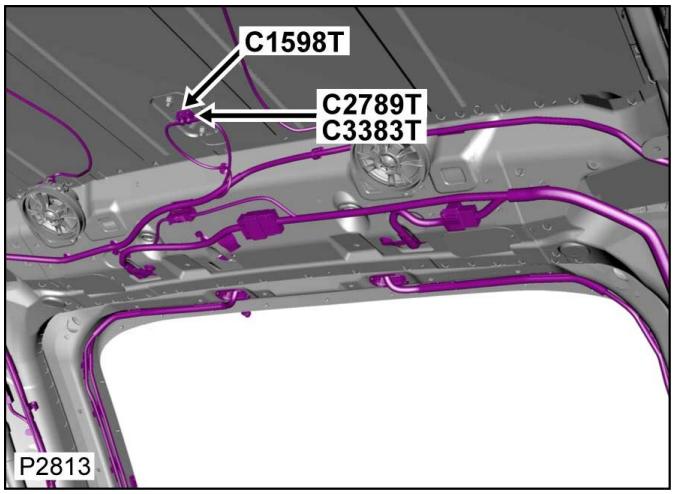

ASSEMBLY

Part No.: XUD812350

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	148T	C2730
1S	SCR	SCR	148T	C2730
1	0.5	B	1011T	C0899
1S	SCR	SCR	1011T	C0899
1	0.5	B	568T	C1599
1S	SCR	SCR	568T	C1599
1	0.5	B	1058T	C3275
1S	SCR	SCR	1058T	C3275
1	0.5	B	1056T	C2970
1S	SCR	SCR	1056T	C2970
1	0.5	B	1029T	C2970
1S	SCR	SCR	1029T	C2970

Click here to print


Connector: C1599

CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Navigation system-Japan

Location: Beneath LH Front seat

Qualifier:

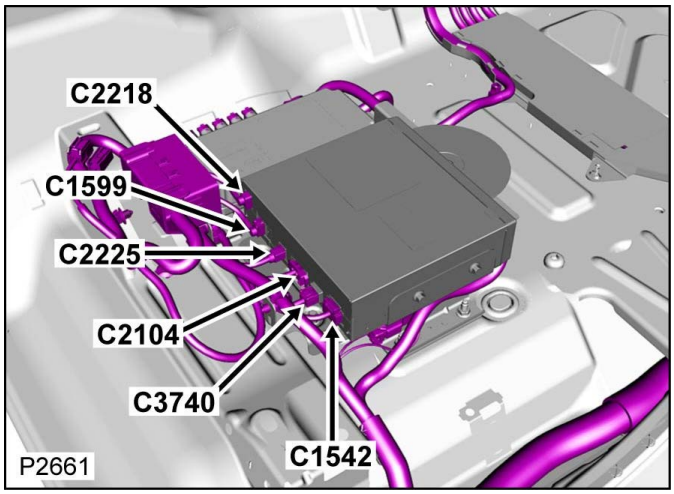

ASSEMBLY

Part No.: XUD812520

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	568S	C1598S
1S	SCR	SCR	568S	C1598S
1	0.5	B	568T	C1598T
1S	SCR	SCR	568T	C1598T

Click here to print

Connector: C1600T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Antenna-TV

Location: Rear of headlining - RH side

Qualifier:

ASSEMBLY

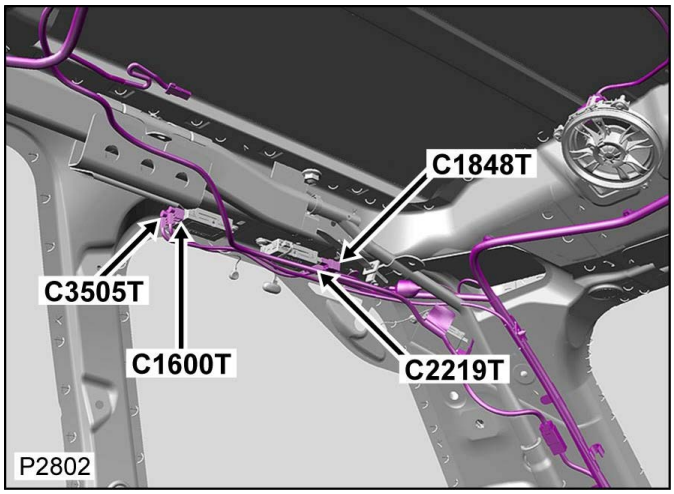

Part No.: XUD812400

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	310T	C2987
1S	SCR	SCR	310T	C2987

Click here to print

Connector: C1601T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Antenna-TV

Location: RH 'D' post

Qualifier:

ASSEMBLY

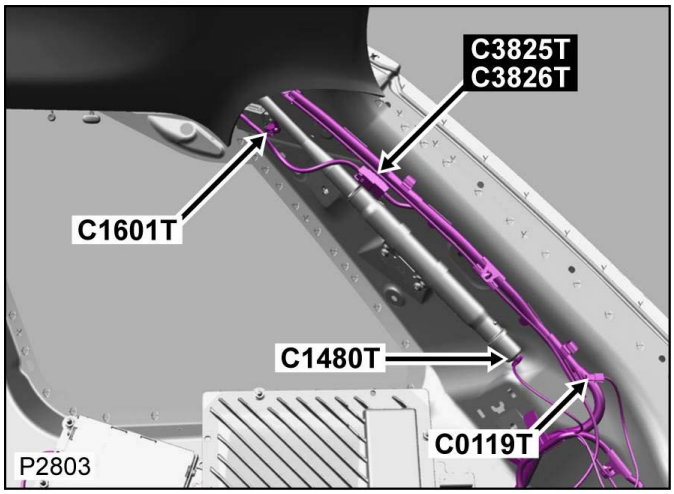

Part No.: XUD812400

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	310T	C2987
1S	SCR	SCR	310T	C2987

Click here to print


Connector: C1602T

CONNECTOR HOUSING NOT SERVICEABLE

Description: Antenna-TV

Location: LH 'D' post

Qualifier:

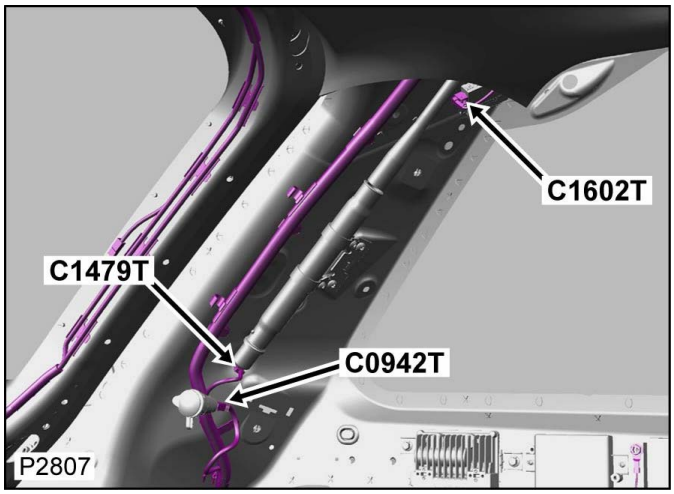

ASSEMBLY

Part No.: XUD812390

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	310T	C2228
1S	SCR	SCR	310T	C2228

Click here to print


Connector: C1603T

CONNECTOR HOUSING NOT SERVICEABLE

Description: Antenna-TV

Location: Rear of headlining - LH side

Qualifier:

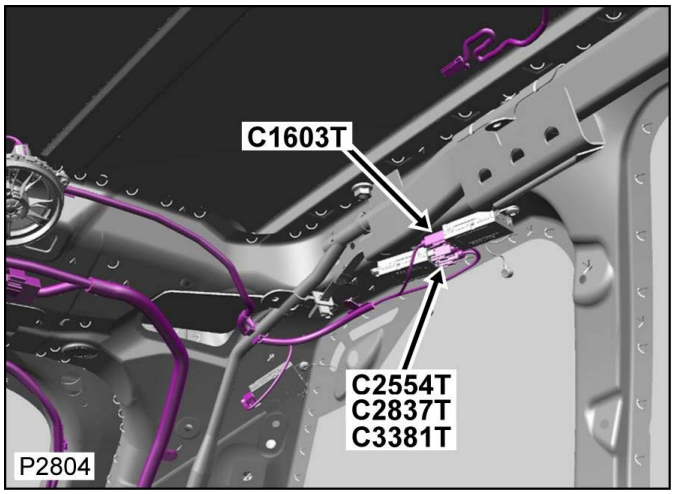

ASSEMBLY

Part No.: XUD812390

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	310T	C2228
1S	SCR	SCR	310T	C2228

Click here to print

Connector: C1610

CONNECTOR HOUSING NOT SERVICEABLE

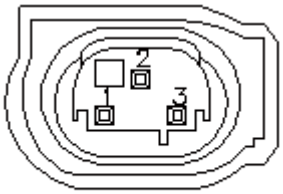

GREY

Part No.: YPC906030

Colour: GREY


Cavities: 3WY

Harness: ARC LINK HARNESS

Description: Valve block-Dynamic response

Location: Beneath vehicle - RH side

Qualifier:

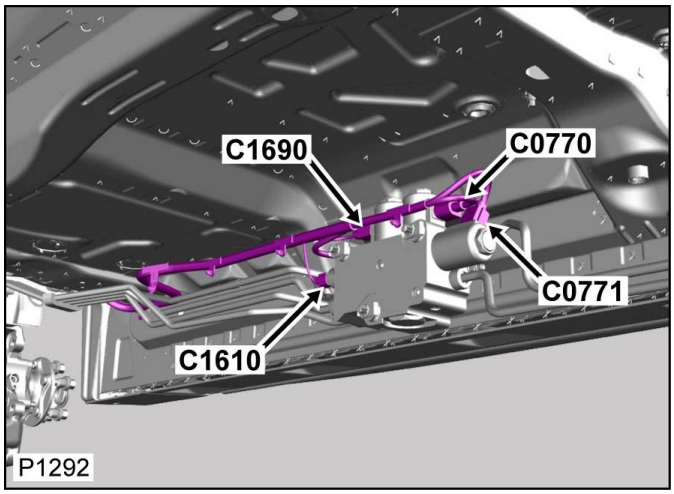


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	YG	407	C2394	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	YS	407	C2394	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	Y	407	C2394	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1623TL

CONNECTOR HOUSING NOT SERVICEABLE

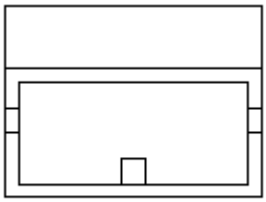

BLACK

Part No.: AAU1010

Colour: BLACK


Cavities: 1WY

Harness: CABIN HARNESS

Description: Windshield RH heater element

Location: RH 'A' post

Qualifier:

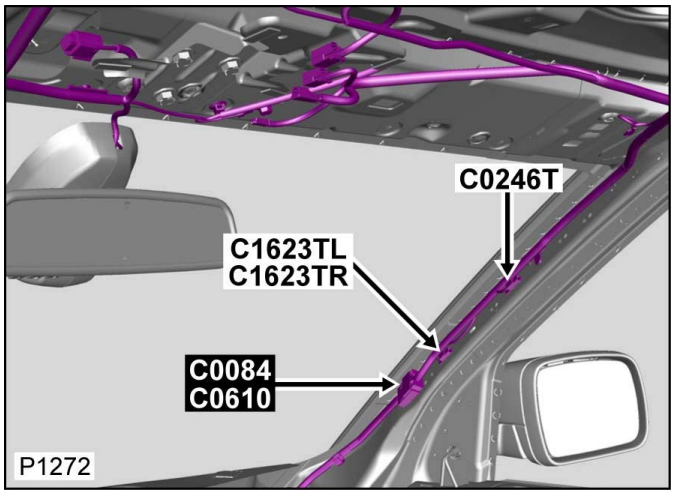


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	PS	109TL	C2242L

Click here to print

Connector: C1623TR

CONNECTOR HOUSING NOT SERVICEABLE

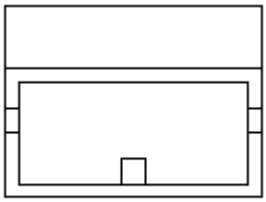

BLACK

Part No.: AAU1010

Colour: BLACK


Cavities: 1WY

Harness: CABIN HARNESS

Description: Windshield RH heater element

Location: RH 'A' post

Qualifier:

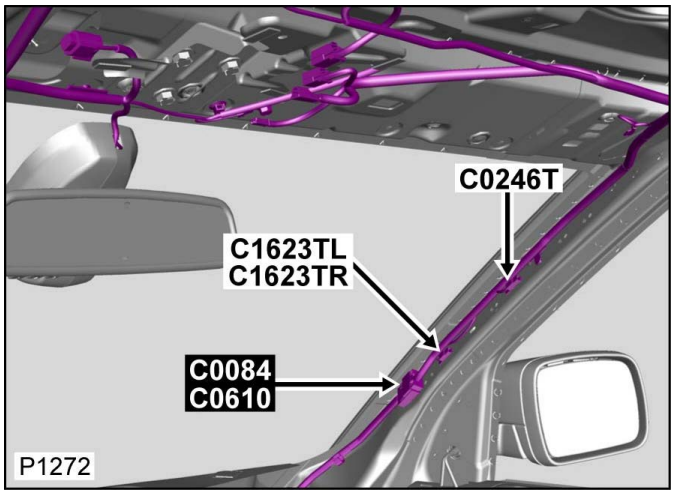

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	PS	109TR	C2243R

Click here to print


Connector: C1624T

CONNECTOR HOUSING NOT SERVICEABLE

Description: Windshield LH heater element

Location: LH 'A' post

Qualifier:

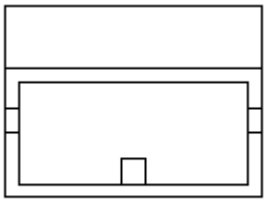


BLACK

Part No.: AAU1010

Colour: BLACK

Cavities: 1WY

Harness: CABIN HARNESS

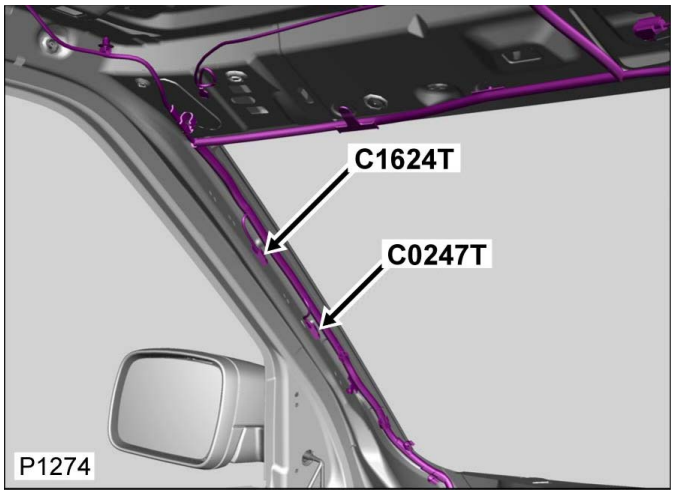

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	PK	109TL	C2243L
1	4.0	PK	109TR	C2242R

Click here to print


Connector: C1629L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Switch pack-Center Instrument panel

Location: Behind heater control panel

Qualifier:

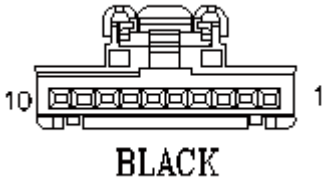

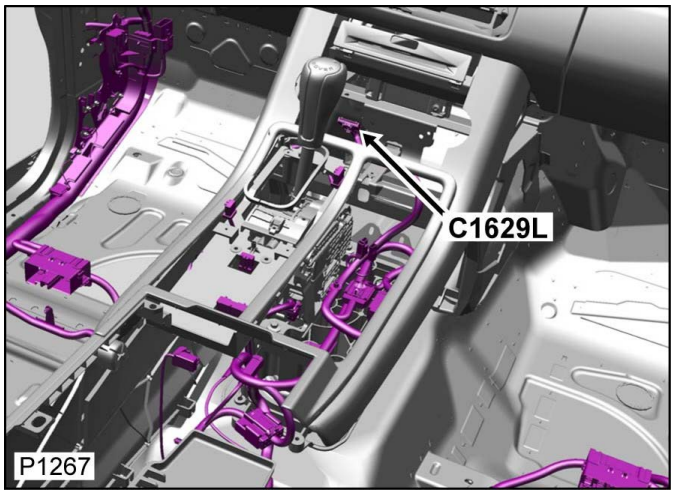

Part No.: YPC908690

Colour: BLACK

Cavities: 10WY

Harness: CONSOLE FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	139L	S/JOINT SJ323	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	NU	986L	C2054L	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	NU	982L	C2054A	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.35	YW	139L	S/JOINT SJ2012	-	-	-	-	-	-	-
4	0.35	YU	139L	S/JOINT SJ2013	-	-	-	-	-	-	-
5	0.5	R	986L	C2054L	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	R	982L	C2054A	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.5	LGR	986L	C2054L	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.5	LGR	982L	C2054A	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.5	G	986L	C2054L	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.5	G	982L	C2054A	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.5	GB	139L	S/JOINT SJ303	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.5	RS	986L	C2054L	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.5	RS	982L	C2054A	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.5	GP	986L	C2054L	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.5	GP	982L	C2054A	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: **C1629R**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Switch pack-Center Instrument panel

Location: Behind heater control panel

Qualifier:

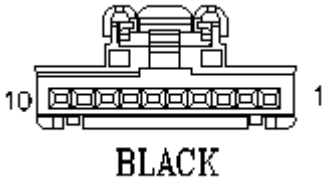

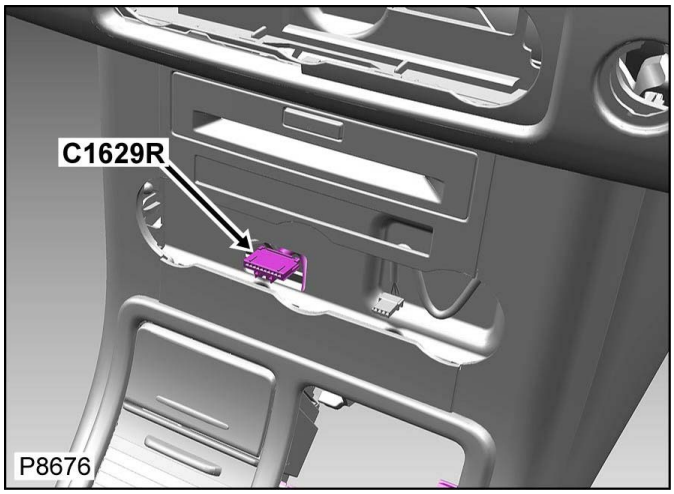

Part No.: YPC908690

Colour: BLACK

Cavities: 10WY

Harness: CONSOLE FRONT HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	200R	S/JOINT SJ323	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	NU	986R	C2054R	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	NU	982R	C2054B	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.35	YW	200R	S/JOINT SJ2012	-	-	-	-	-	-	-
4	0.35	YU	200R	S/JOINT SJ2013	-	-	-	-	-	-	-
5	0.5	R	986R	C2054R	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	R	982R	C2054B	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.5	LGR	986R	C2054R	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.5	LGR	982R	C2054B	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.5	G	986R	C2054R	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.5	G	982R	C2054B	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.5	GB	200R	S/JOINT SJ303	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.5	RS	986R	C2054R	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.5	RS	982R	C2054B	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.5	GP	986R	C2054R	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.5	GP	982R	C2054B	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C1637

CONNECTOR HOUSING NOT SERVICEABLE

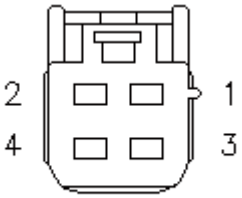

GREEN

Part No.: YPC800430

Colour: GREEN


Cavities: 4WY

Harness: SEAT FRONT HARNESS

Description: Motor-Seat height-Front

Location: Beneath front seat

Qualifier:

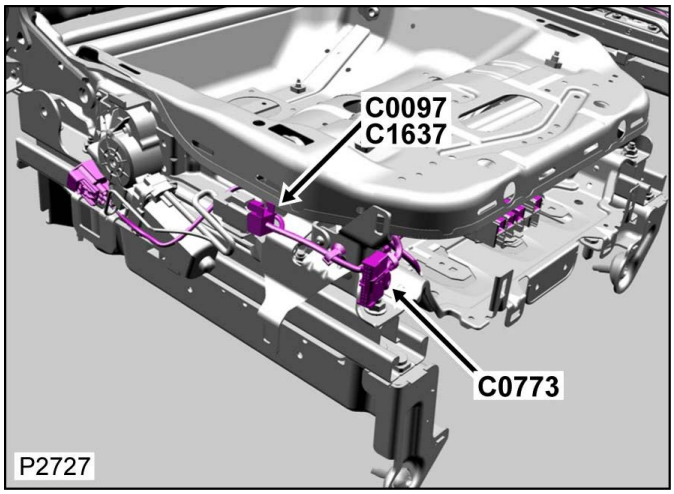

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	Y	439	C0773	418-587-10	-	418-116A	418-117	-	418-112	418-107
2	0.75	G	439	C0773	418-587-10	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C1641


CONNECTOR HOUSING NOT SERVICEABLE

Description: Battery

Location: Rear LH side of engine compartment

Qualifier:



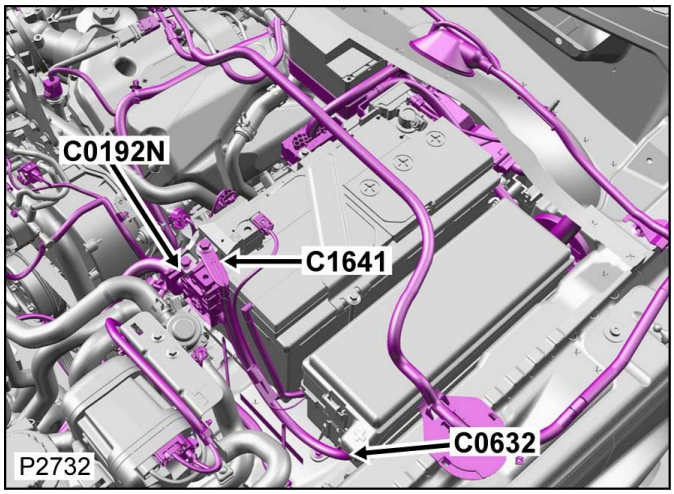

Part No.: YPG800330

Colour: TIN PLATED

Cavities: 1WY

Harness: BATTERY TO FUSEBOX RHD HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	35.0	R	499	C0632

Click here to print


Connector: C1649

CONNECTOR HOUSING NOT SERVICEABLE

Description: Restraints Control Module (RCM)

Location: Behind center console

Qualifier:

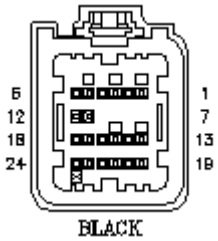


Part No.: YPC803180

Colour: BLACK

Cavities: 24WY

Harness: CABIN HARNESS

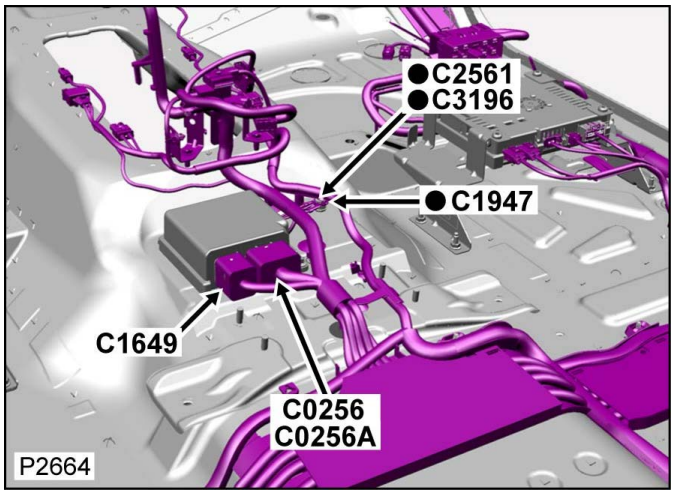

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	RY	216L	C0067	418-411-70	-	418-116A	418-117	-	418-112	418-107
1	0.5	RY	216R	C0083	418-411-70	-	418-116A	418-117	-	418-112	418-107
2	0.5	R	216L	C0067	418-411-70	-	418-116A	418-117	-	418-112	418-107
2	0.5	R	216R	C0083	418-411-70	-	418-116A	418-117	-	418-112	418-107
3	0.5	BU	216L	C0083	418-411-70	-	418-116A	418-117	-	418-112	418-107
3	0.5	BU	216R	C0067	418-411-70	-	418-116A	418-117	-	418-112	418-107
4	0.5	GU	216L	C0083	418-411-70	-	418-116A	418-117	-	418-112	418-107
4	0.5	GU	216R	C0067	418-411-70	-	418-116A	418-117	-	418-112	418-107
5	0.5	RG	216L	C0067	418-411-70	-	418-116A	418-117	-	418-112	418-107
5	0.5	RG	216R	C0083	418-411-70	-	418-116A	418-117	-	418-112	418-107
6	0.5	RB	216L	C0067	418-411-70	-	418-116A	418-117	-	418-112	418-107
6	0.5	RB	216R	C0083	418-411-70	-	418-116A	418-117	-	418-112	418-107
12	0.75	RW	216L	S/JOINT SJ17	418-411-70	-	418-116A	418-117	-	418-112	418-107
12	0.75	RW	216R	C1166R	418-411-70	-	418-116A	418-117	-	418-112	418-107
13	0.5	BR	216L	C0083	418-411-70	-	418-116A	418-117	-	418-112	418-107
13	0.5	BR	216R	C0067	418-411-70	-	418-116A	418-117	-	418-112	418-107
14	0.5	GO	216L	C0083	418-411-70	-	418-116A	418-117	-	418-112	418-107
14	0.5	GO	216R	C0067	418-411-70	-	418-116A	418-117	-	418-112	418-107

15	0.35	G	216SL	C1166L	418-411-48	-	418-116A	418-117	418-104	418-113	418-108
15	0.35	G	216SR	C0047R	418-411-48	-	418-116A	418-117	418-104	418-113	418-108
15	0.35	G	986TL	C2053TL	418-411-48	-	418-116A	418-117	418-104	418-113	418-108
15	0.35	G	982T	C2053TA	418-411-48	-	418-116A	418-117	418-104	418-113	418-108
15	0.5	G	986TR	C2053TR	418-411-70	-	418-116A	418-117	-	418-112	418-107
16	0.35	RU	216L	C1166L	418-411-48	-	418-116A	418-117	418-104	418-113	418-108
16	0.35	RU	216R	C0047R	418-411-48	-	418-116A	418-117	418-104	418-113	418-108
17	0.5	YG	216	S/JOINT SJ225	418-411-70	-	418-116A	418-117	-	418-112	418-107
18	0.5	B	216	C1947	418-411-70	-	418-116A	418-117	-	418-112	418-107
19	0.5	W	216L	C2242L	418-411-70	-	418-116A	418-117	-	418-112	418-107
19	0.5	W	216R	C2243R	418-411-70	-	418-116A	418-117	-	418-112	418-107
20	0.5	N	216L	C2242L	418-411-70	-	418-116A	418-117	-	418-112	418-107
20	0.5	N	216R	C2243R	418-411-70	-	418-116A	418-117	-	418-112	418-107
21	0.5	KO	216L	C2242L	418-411-70	-	418-116A	418-117	-	418-112	418-107
21	0.5	KO	216R	C2409R	418-411-70	-	418-116A	418-117	-	418-112	418-107
22	0.5	PLG	216L	C2242L	418-411-70	-	418-116A	418-117	-	418-112	418-107
22	0.5	PLG	216R	C2409R	418-411-70	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C1652

CONNECTOR HOUSING NOT SERVICEABLE

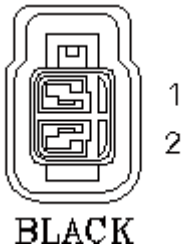

Part No.: YPC500750

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Sensor-Front impact-LH side

Location: Behind LH headlamp

Qualifier:

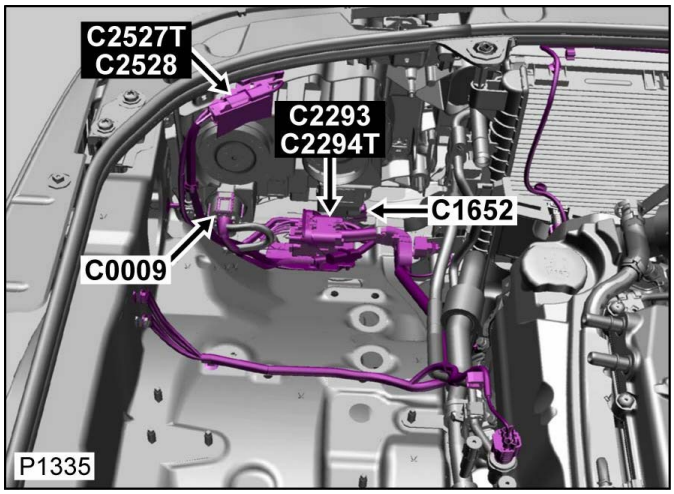


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	KO	139L	C2244L	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	KO	200R	C2410R	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	PLG	139L	C2244L	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	PLG	200R	C2410R	418-411-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1653

CONNECTOR HOUSING NOT SERVICEABLE

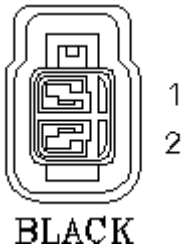

Part No.: YPC500750

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Sensor-Front impact-RH side

Location: Front RH side of engine compartment

Qualifier:

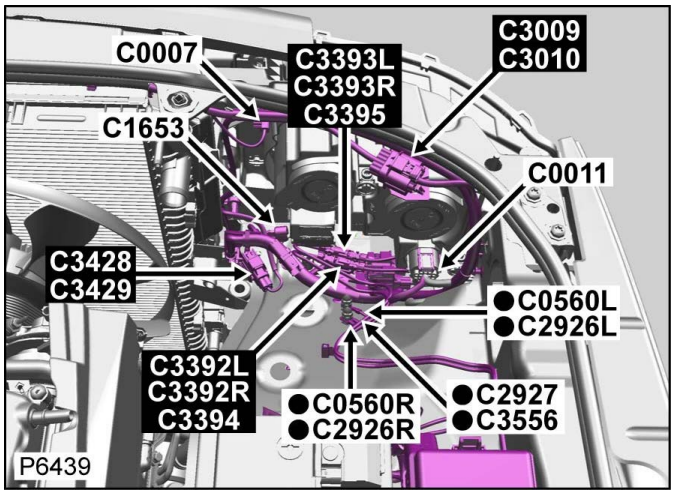


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	W	139L	C2244L	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	W	200R	C2245R	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	N	139L	C2244L	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	N	200R	C2245R	418-411-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1654T

CONNECTOR HOUSING NOT SERVICEABLE

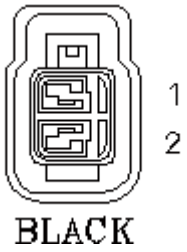

Part No.: YPC500750

Colour: BLACK


Cavities: 2WY

Harness: CABIN HARNESS

Description: Sensor-Side impact-LH side-Rear

Location: Base of 'C' post - LH side

Qualifier:

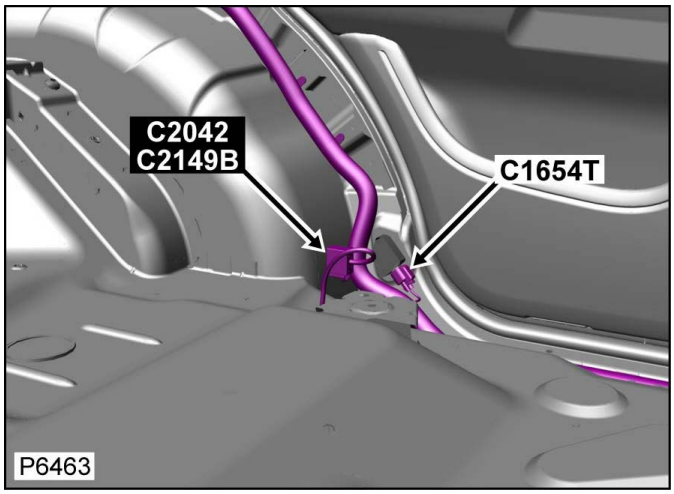


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	P	216T	C0256	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	GW	216T	C0256	418-411-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1655T

CONNECTOR HOUSING NOT SERVICEABLE

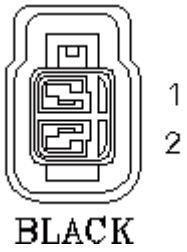

Part No.: YPC500750

Colour: BLACK


Cavities: 2WY

Harness: CABIN HARNESS

Description: Sensor-Side impact-RH side-Rear

Location: Base of 'C' post RH side

Qualifier:

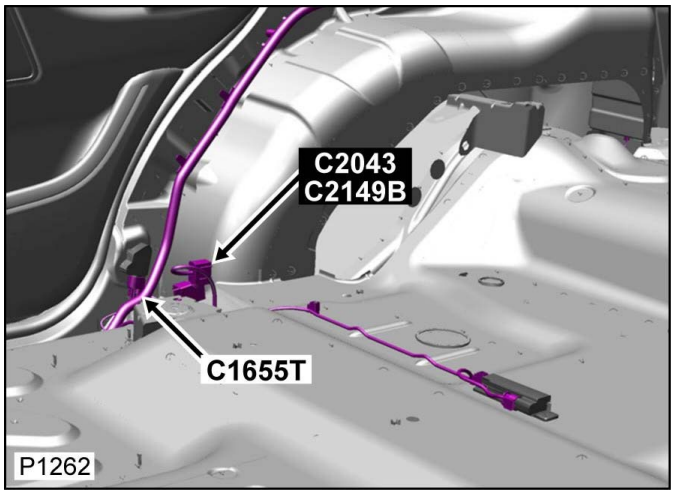

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WR	216T	C0256	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	UW	216T	C0256	418-411-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1656L

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC900450

Colour: GREY


Cavities: 4WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Sensor-Yaw Rate

Location: Beneath center console

Qualifier:

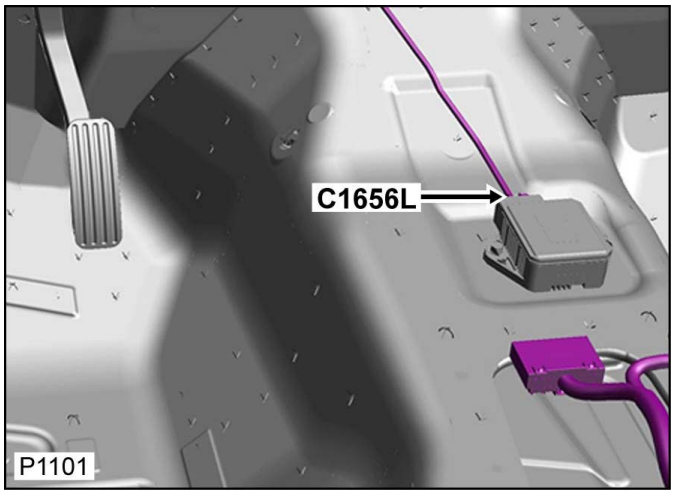

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	921L	C1170L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
1	0.75	B	808L	C0559L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
1	0.75	B	423L	C0558L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	G	413L	C0506L	-	-	-	-	-	-	-
3	0.5	GW	413L	C0506L	-	-	-	-	-	-	-
4	0.75	LG	413L	S/JOINT SJ109	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1656R

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC900450

Colour: GREY


Cavities: 4WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Sensor-Yaw Rate

Location: Beneath center console

Qualifier:

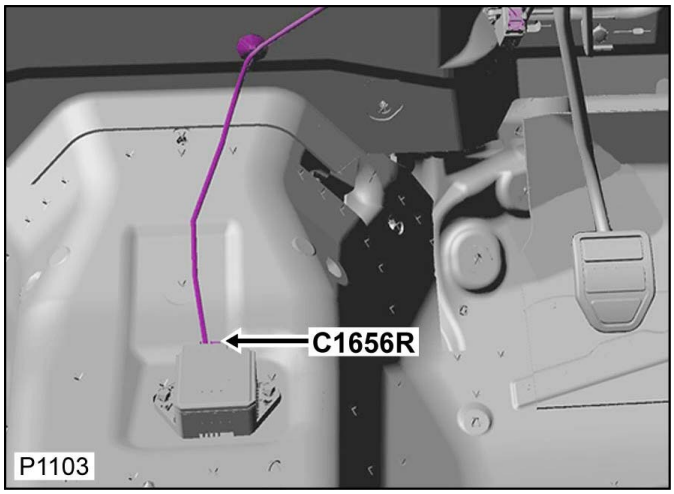


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	413R	C2602R	-	-	-	-	-	-	-
2	0.5	G	413R	C0506R	-	-	-	-	-	-	-
3	0.5	GW	413R	C0506R	-	-	-	-	-	-	-
4	0.75	LG	413R	S/JOINT SJ1109	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1661

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG800460

Colour: TIN PLATED


Cavities: 1WY

Harness: BATTERY MONITOR RHD HARNESS

Description: Ground point

Location: Rear LH side of engine compartment

Qualifier:

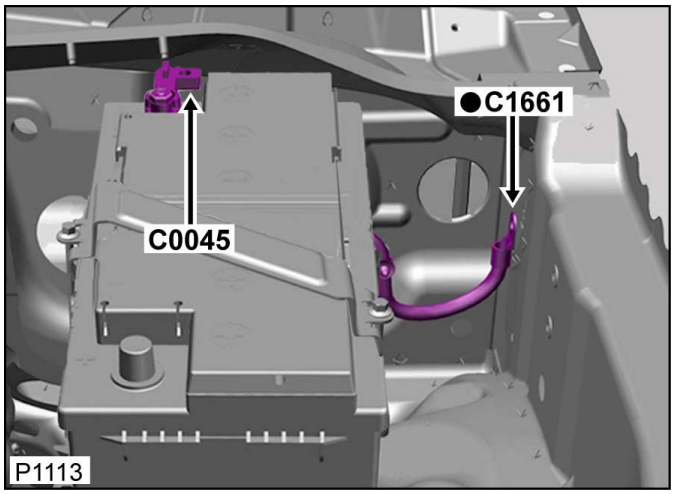


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0	B	ALL	C3589

Click here to print

Connector: C1661

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG800460

Colour: TIN PLATED


Cavities: 1WY

Harness: BATTERY MONITOR LHD HARNESS

Description: Ground point

Location: Rear RH side of engine compartment

Qualifier:

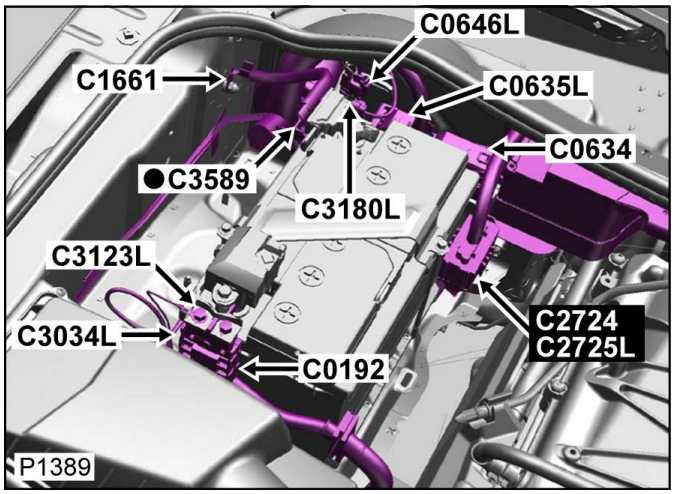

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0	B	ALL	C3589

Click here to print


Connector: C1684T

CONNECTOR HOUSING NOT SERVICEABLE

Description: Reservoir control valve

Location: Beneath vehicle - LH side

Qualifier:

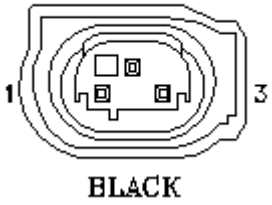


Part No.: YPC500350

Colour: BLACK

Cavities: 3WY

Harness: CHASSIS HARNESS

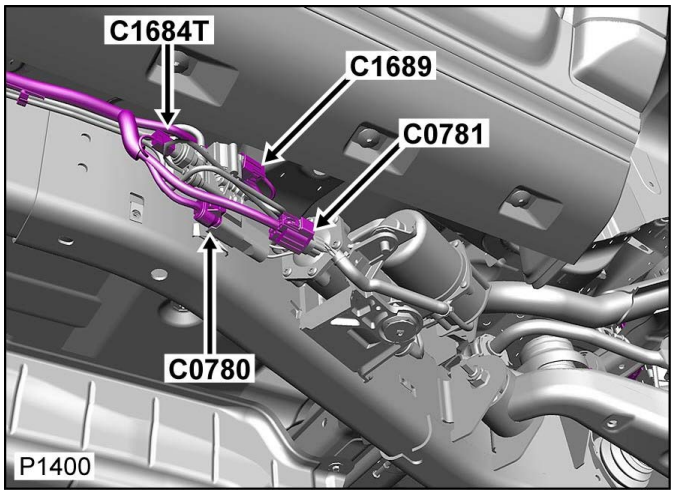


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	YK	419T	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	OS	419T	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	YB	419T	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C1689**

CONNECTOR HOUSING SERVICEABLE

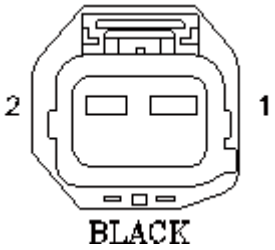

Part No.: YPC500550

Colour: BLACK


Cavities: 2WY

Harness: CHASSIS HARNESS

Description: Reservoir control valve

Location: Beneath vehicle - LH side

Qualifier:

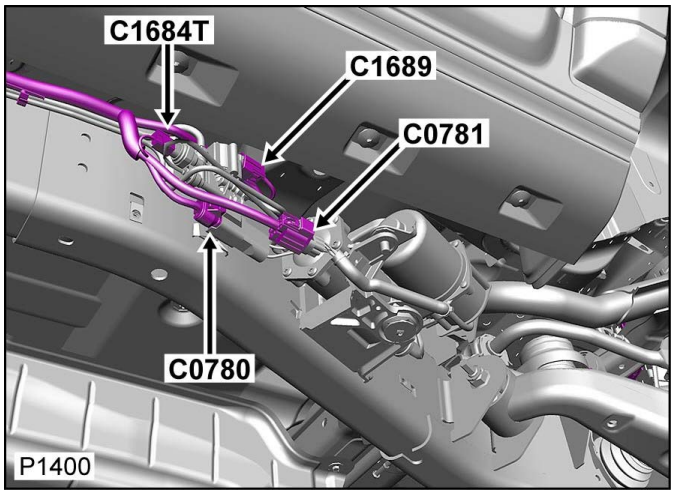

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	BW	419T	C2294T	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	1.0	BW	419S	C2294SB	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	1.0	B	419T	C2294T	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	1.0	B	419S	C2294SB	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C1690

CONNECTOR HOUSING NOT SERVICEABLE

Description: Valve block-Dynamic response

Location: Beneath vehicle - RH side

Qualifier:

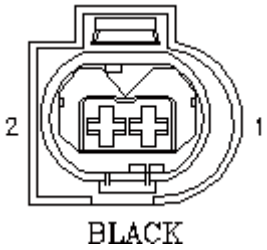


Part No.: YPC901950

Colour: BLACK

Cavities: 2WY

Harness: ARC LINK HARNESS

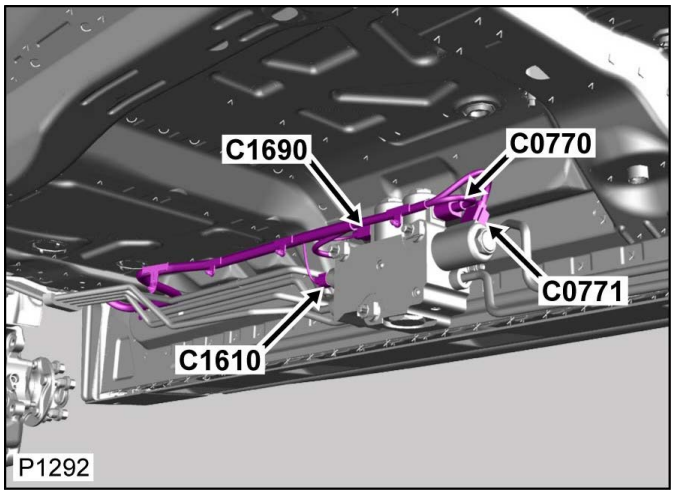


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	OG	407	C2394	418-549-18	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	GR	407	C2394	418-549-18	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1692

CONNECTOR HOUSING NOT SERVICEABLE

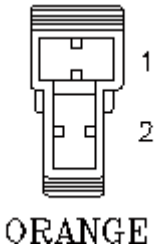

Part No.: YPC500340

Colour: ORANGE


Cavities: 2WY

Harness: CONSOLE REAR HARNESS

Description: Socket-Accessory-Center

Location: In rear of center console

Qualifier:

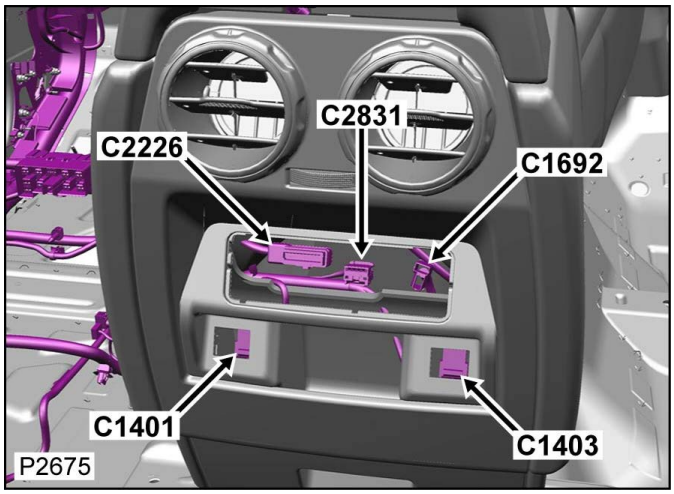


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	B	13	C2755
2	1.5	PG	13	C2755

Click here to print

Connector: **C1696T**

CONNECTOR HOUSING SERVICEABLE

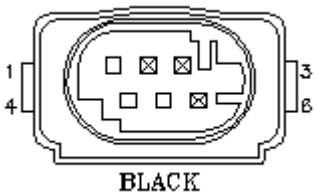

Part No.: YPC803250

Colour: BLACK


Cavities: 3WY

Harness: CHASSIS HARNESS

Description: Sensor-Height-Front-LH

Location: Below LH front wheelarch

Qualifier:

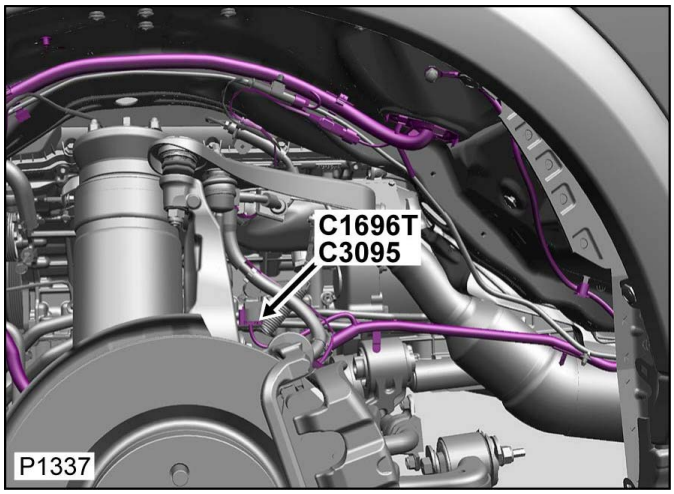


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	SB	826T	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	SO	826T	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	SG	826T	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1697

CONNECTOR HOUSING SERVICEABLE

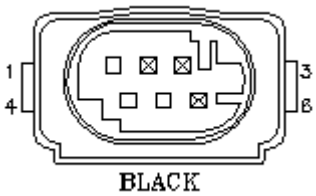

Part No.: YPC803250

Colour: BLACK


Cavities: 3WY

Harness: AIR SUSPENSION HARNESS

Description: Sensor-Height-Front-RH

Location: Behind RH front fender splash shield

Qualifier:

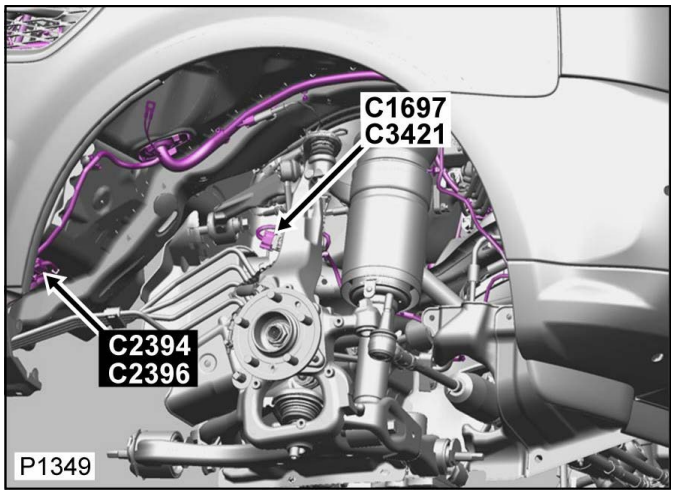


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	SR	809	C3010	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	SU	809	C3010	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	SY	809	C3010	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C1698**

CONNECTOR HOUSING SERVICEABLE

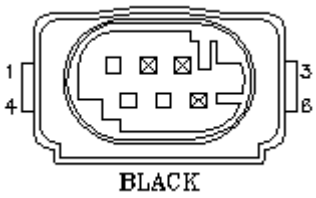

Part No.: YPC803250

Colour: BLACK


Cavities: 3WY

Harness: CHASSIS HARNESS

Description: Sensor-Height-Rear-RH

Location: Below RH rear wheelarch

Qualifier:

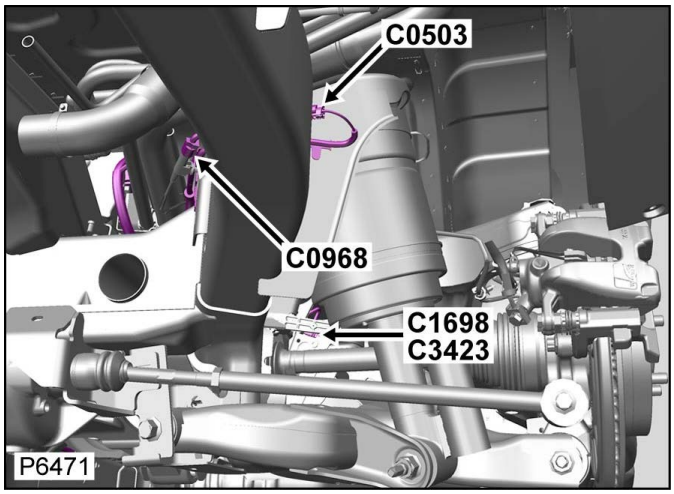


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	SR	826	C0390	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	SU	826	C0390	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	SY	826	C0390	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C1699**

CONNECTOR HOUSING SERVICEABLE

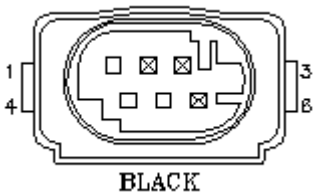

Part No.: YPC803250

Colour: BLACK


Cavities: 3WY

Harness: CHASSIS HARNESS

Description: Sensor-Height-Rear-LH

Location: Below LH rear wheelarch

Qualifier:

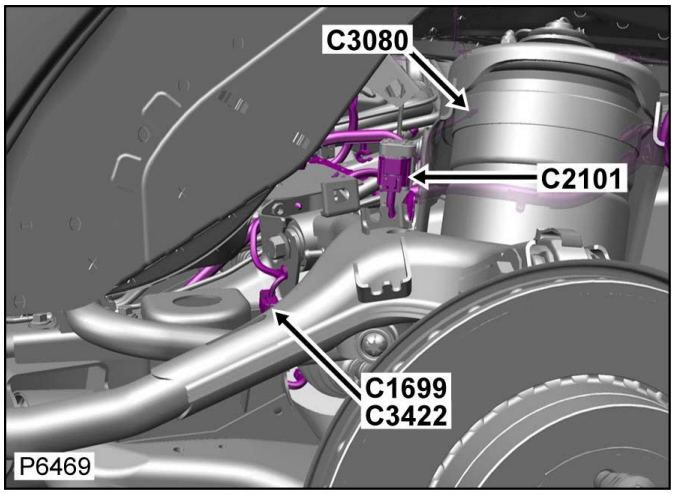


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	OB	826	C0390	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	OR	826	C0390	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	OY	826	C0390	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1770

CONNECTOR HOUSING NOT SERVICEABLE

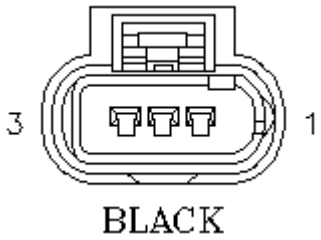

Part No.: YPC913370

Colour: BLACK


Cavities: 3WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Ignition coil-4 - PV8

Location: Top of engine - LH side

Qualifier:

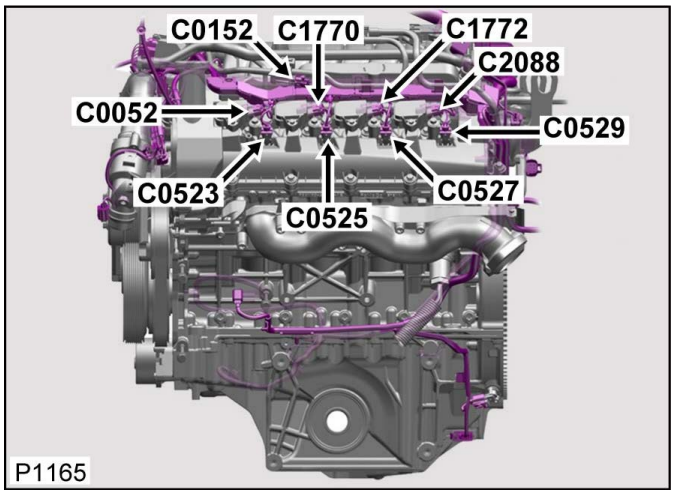


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	PN	ALL	C0634
2	0.5	B	ALL	S/JOINT PIS21
3	0.5	W	ALL	S/JOINT PIS27

Click here to print

Connector: C1771

CONNECTOR HOUSING NOT SERVICEABLE

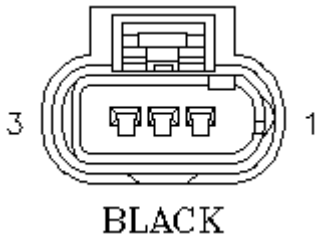

Part No.: YPC913370

Colour: BLACK


Cavities: 3WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Ignition coil-5 - PV8

Location: Top of engine - RH side

Qualifier:

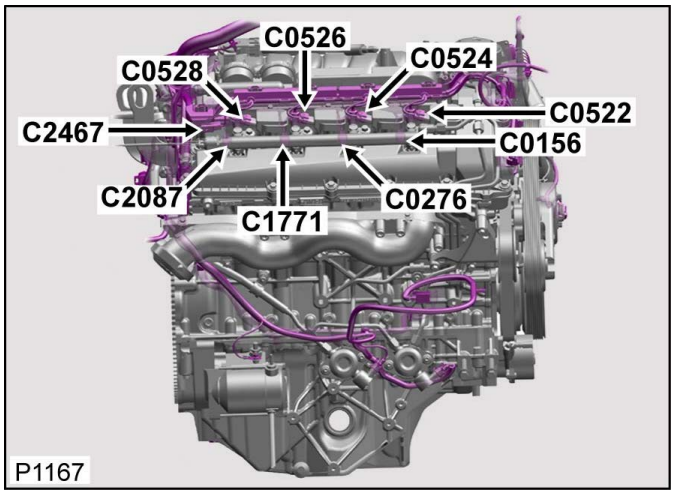


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	UO	ALL	C0634
2	0.5	B	ALL	S/JOINT PIS26
3	0.5	W	ALL	S/JOINT PIS20

Click here to print

Connector: C1772

CONNECTOR HOUSING NOT SERVICEABLE

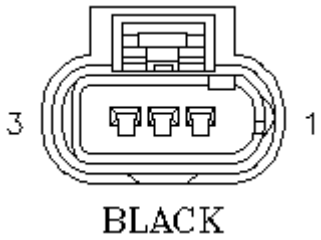

Part No.: YPC913370

Colour: BLACK


Cavities: 3WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Ignition coil-6 - PV8

Location: Top of engine - LH side

Qualifier:

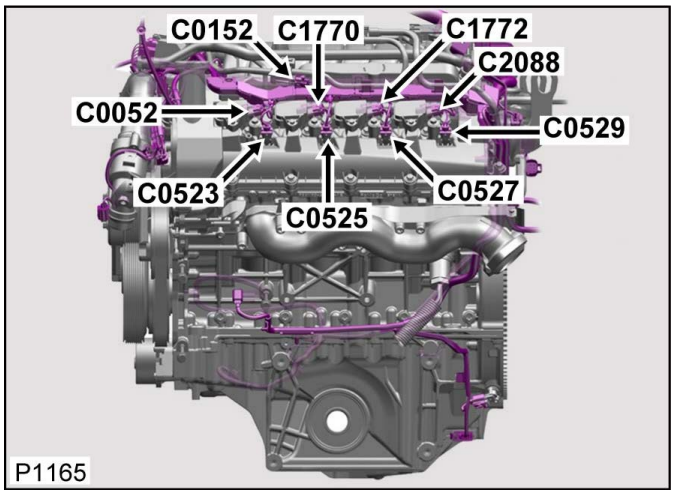


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	YS	ALL	C0634
2	0.5	B	ALL	S/JOINT PIS21
3	0.5	W	ALL	S/JOINT PIS27

Click here to print

Connector: C1773T

CONNECTOR HOUSING NOT SERVICEABLE

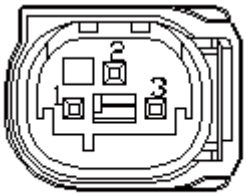

BLACK

Part No.: YPC802330

Colour: BLACK


Cavities: 3WY

Harness: CABIN HARNESS

Description: Accelerometer-Rear left

Location: Behind luggage compartment carpet LH side

Qualifier:

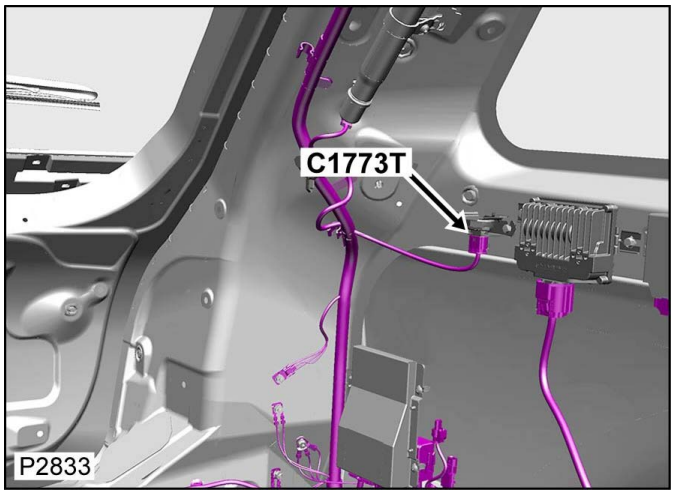

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	BR	245T	C3087T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	BW	245T	S/JOINT SJ251T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	BG	245T	S/JOINT SJ250T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1848T


CONNECTOR HOUSING NOT SERVICEABLE

Description: AM/FM diversity antenna amplifier

Location: Rear of headlining - RH side

Qualifier:

ASSEMBLY

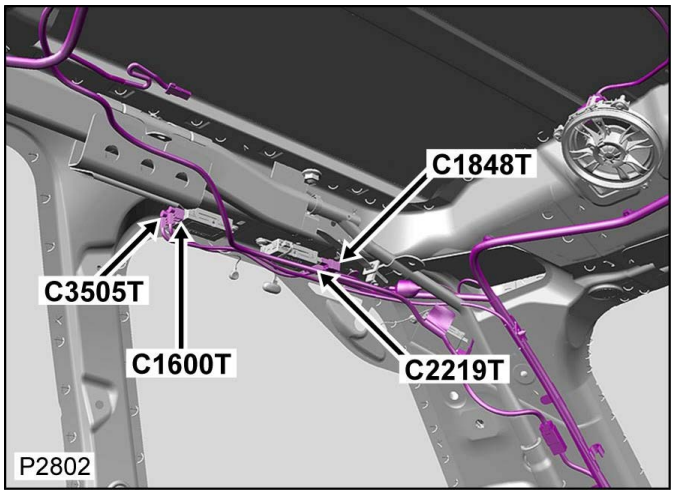

Part No.: XUD812340

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	1031T	C2616
1S	SCR	SCR	1031T	C2616

Click here to print

Connector: C1855L

CONNECTOR HOUSING NOT SERVICEABLE

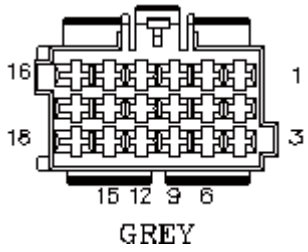

Part No.: YPC114200

Colour: GREY


Cavities: 18WY

Harness: TRANSMISSION AUTO-PETROL HARNESS

Description: Module-Control-Transfer case

Location: Driver side of engine compartment

Qualifier:

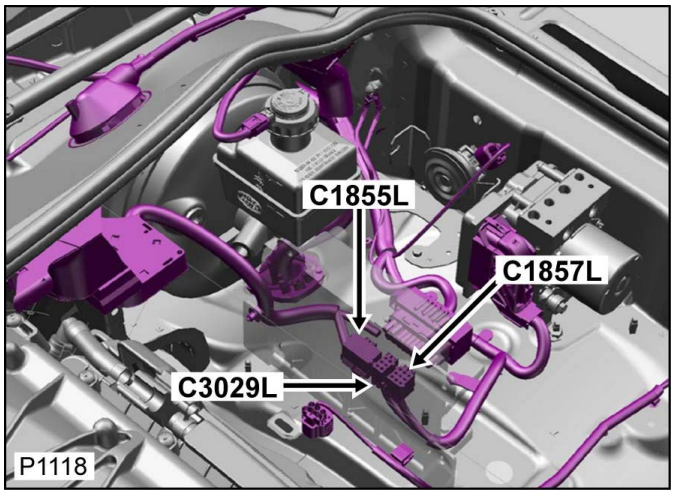


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GR	282L	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RY	282L	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	UR	282L	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	WR	282L	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	GY	282L	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	RY	282L	C2169	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	UR	282L	C2169	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
9	1.0	S	282L	C2165	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	R	282L	C2169	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
12	1.0	G	282L	C2165	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
15	2.5	N	282L	C2167	418-549-57	-	418-116A	418-117	418-104	418-113	418-108
18	2.5	R	282L	C2167	418-549-57	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C1855M

CONNECTOR HOUSING NOT SERVICEABLE

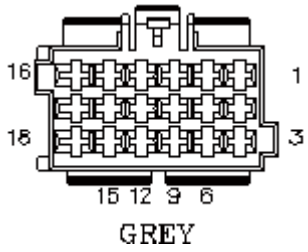

Part No.: YPC114200

Colour: GREY


Cavities: 18WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Module-Control-Transfer case

Location: Rear LH side of engine compartment

Qualifier:

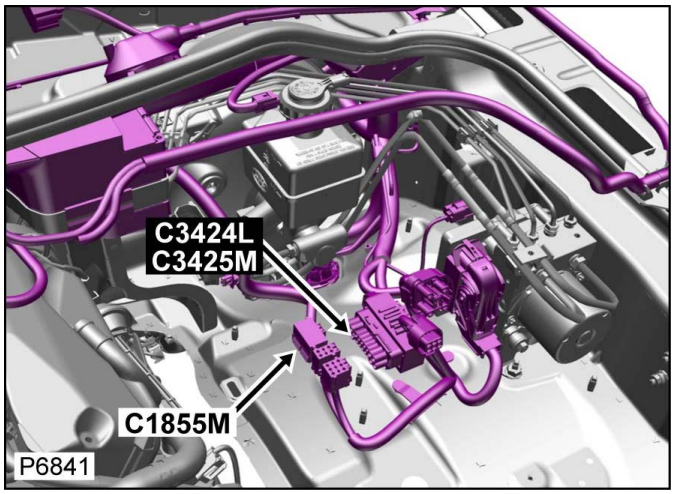


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GR	993L	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RY	993L	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	UR	993L	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	WR	993L	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	GY	993L	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	RY	993L	C2169	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	UR	993L	C2169	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
9	1.0	S	993L	C2165	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	R	993L	C2169	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
12	1.0	G	993L	C2165	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
15	2.5	N	993L	C2167	418-549-57	-	418-116A	418-117	418-104	418-113	418-108
18	2.5	R	993L	C2167	418-549-57	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C1855N

CONNECTOR HOUSING NOT SERVICEABLE

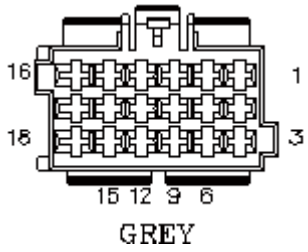

Part No.: YPC114200

Colour: GREY


Cavities: 18WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Module-Control-Transfer case

Location: Driver side of engine compartment

Qualifier:

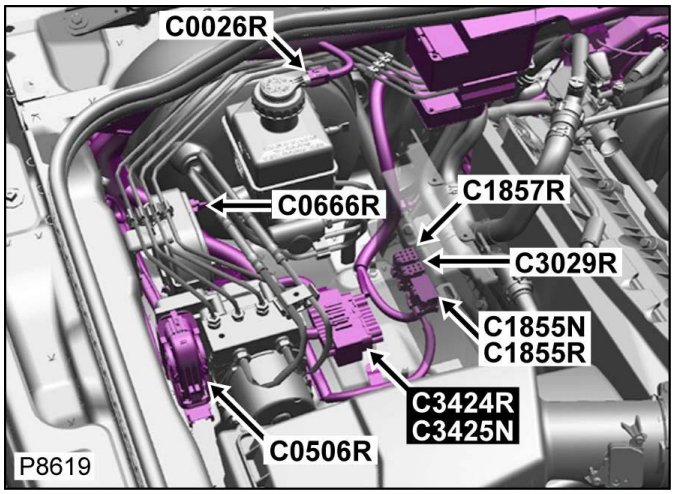


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GR	993R	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RY	993R	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	UR	993R	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	WR	993R	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	GY	993R	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	RY	993R	C2169	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	UR	993R	C2169	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
9	1.0	S	993R	C2165	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	R	993R	C2169	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
12	1.0	G	993R	C2165	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
15	2.5	N	993R	C2167	418-549-57	-	418-116A	418-117	418-104	418-113	418-108
18	2.5	R	993R	C2167	418-549-57	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C1855P

CONNECTOR HOUSING NOT SERVICEABLE

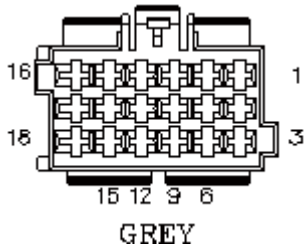

Part No.: YPC114200

Colour: GREY


Cavities: 18WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Module-Control-Transfer case

Location: Rear LH side of engine compartment

Qualifier: LHD condition illustrated

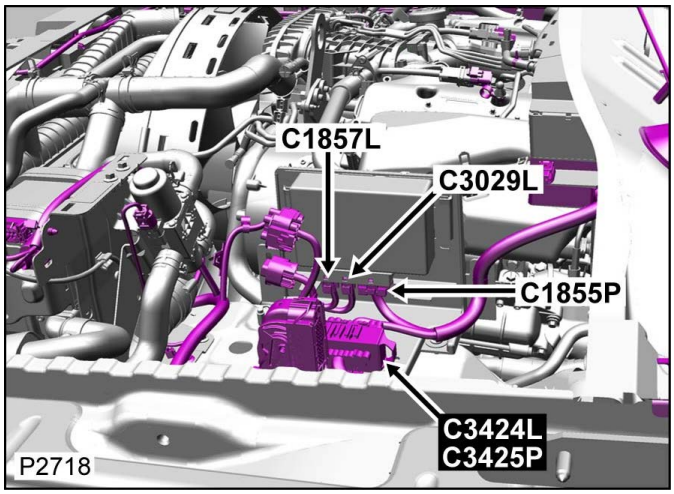


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GR	982L	C2167A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RY	982L	C2167A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	UR	982L	C2167A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	WR	982L	C2167A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	GY	982L	C2167A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	RY	982L	C2169A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	UR	982L	C2169A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
9	1.0	S	982L	C2165A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	R	982L	C2169A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
12	1.0	G	982L	C2165A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
15	2.5	N	982L	C2167A	418-549-57	-	418-116A	418-117	418-104	418-113	418-108
18	2.5	R	982L	C2167A	418-549-57	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C1855Q

CONNECTOR HOUSING NOT SERVICEABLE

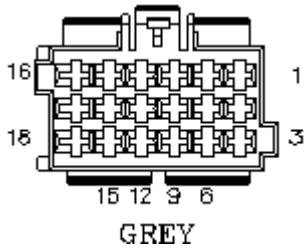

Part No.: YPC114200

Colour: GREY


Cavities: 18WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Module-Control-Transfer case

Location: RH side of engine compartment

Qualifier: RHD condition illustrated

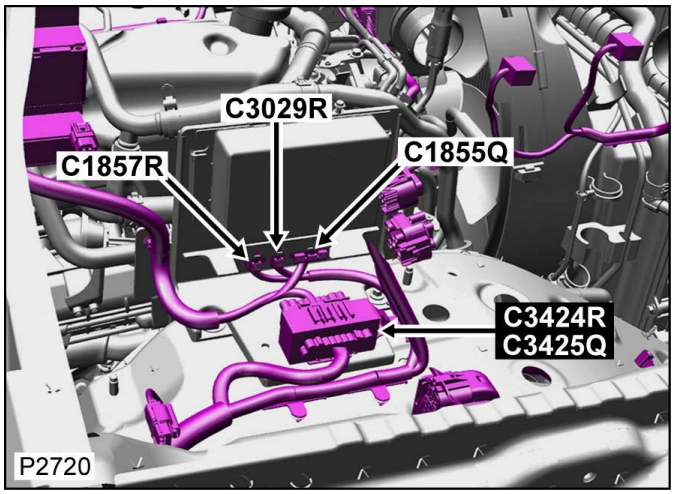


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GR	982R	C2167A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RY	982R	C2167A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	UR	982R	C2167A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	WR	982R	C2167A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	GY	982R	C2167A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	RY	982R	C2169A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	UR	982R	C2169A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
9	1.0	S	982R	C2165A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	R	982R	C2169A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
12	1.0	G	982R	C2165A	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
15	2.5	N	982R	C2167A	418-549-57	-	418-116A	418-117	418-104	418-113	418-108
18	2.5	R	982R	C2167A	418-549-57	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C1855R

CONNECTOR HOUSING NOT SERVICEABLE

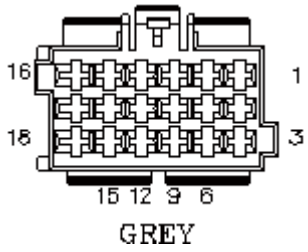

Part No.: YPC114200

Colour: GREY


Cavities: 18WY

Harness: TRANSMISSION AUTO-PETROL HARNESS

Description: Module-Control-Transfer case

Location: Rear RH side of engine compartment

Qualifier:

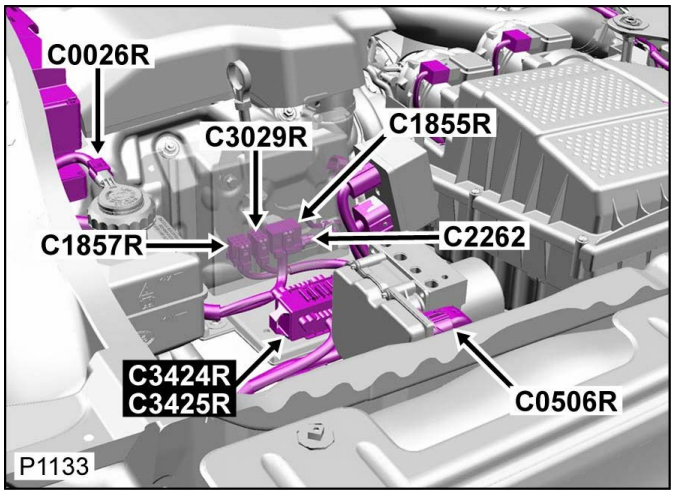


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GR	282R	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RY	282R	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	UR	282R	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	WR	282R	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	GY	282R	C2167	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	RY	282R	C2169	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	UR	282R	C2169	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
9	1.0	S	282R	C2165	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	R	282R	C2169	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
12	1.0	G	282R	C2165	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
15	2.5	N	282R	C2167	418-549-57	-	418-116A	418-117	418-104	418-113	418-108
18	2.5	R	282R	C2167	418-549-57	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: **C1857L**

CONNECTOR HOUSING SERVICEABLE

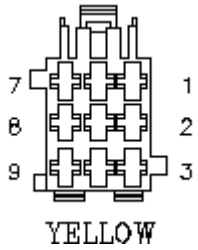

Part No.: YPC114170

Colour: YELLOW


Cavities: 9WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Module-Control-Transfer case

Location: Driver side of engine compartment

Qualifier:

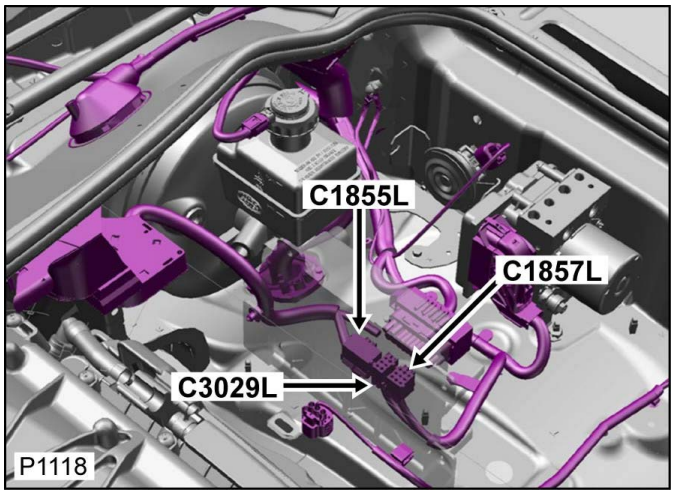


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
3	0.5	YB	1004L	C2444L	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	YB	407L	S/JOINT SJ276	-	-	-	-	-	-	-
4	0.5	OR	139L	C2245L	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	O	139L	C2245L	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	YN	1004L	C2444L	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
6	0.35	YN	407L	S/JOINT SJ274	-	-	-	-	-	-	-
8	0.5	G	139L	C2245L	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	GR	139L	C2245L	418-549-55	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C1857R**

CONNECTOR HOUSING SERVICEABLE

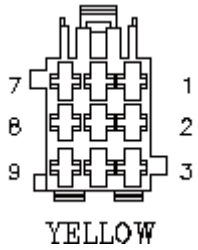

Part No.: YPC114170

Colour: YELLOW


Cavities: 9WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Module-Control-Transfer case

Location: RH side of engine compartment

Qualifier: RHD condition illustrated

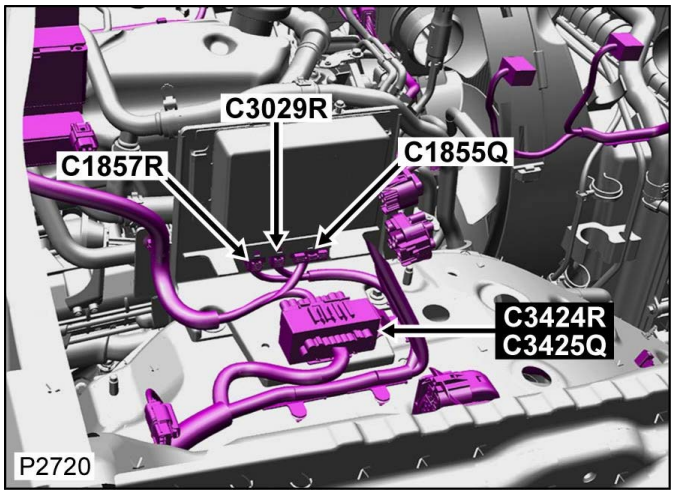


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
3	0.5	YB	1005R	C2240R	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	YB	405R	S/JOINT SJ177	-	-	-	-	-	-	-
4	0.5	OR	200R	C2244R	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	O	200R	C2244R	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	YN	1005R	C2240R	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
6	0.35	YN	405R	S/JOINT SJ176	-	-	-	-	-	-	-
8	0.5	G	200R	C2245R	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	GR	200R	C2244R	418-549-55	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1893N

CONNECTOR HOUSING NOT SERVICEABLE

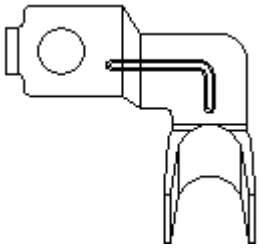

Part No.: YPG800150

Colour: TIN PLATED


Cavities: 1WY

Harness: BATTERY POSITIVE DIESEL V6 3.0L RHD HARNESS

Description: Alternator-generator - DV6 (3.0L)

Location: RH side of engine

Qualifier:

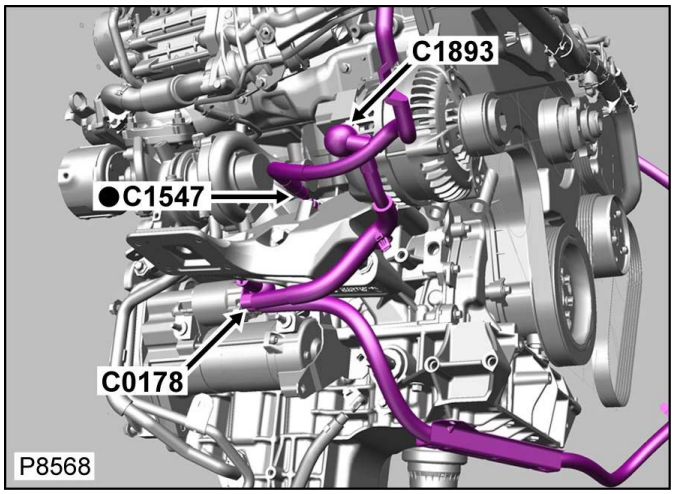


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	35.0T	R	ALL	C0178N

Click here to print

Connector: C1893R

CONNECTOR HOUSING NOT SERVICEABLE

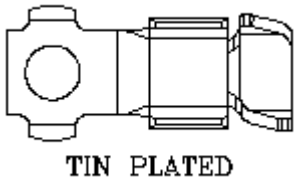

Part No.: YPG900020

Colour: TIN PLATED


Cavities: 1WY

Harness: BATTERY POSITIVE PETROL V8 RHD HARNESS

Description: Alternator-generator - PV8

Location: RH side of engine

Qualifier:

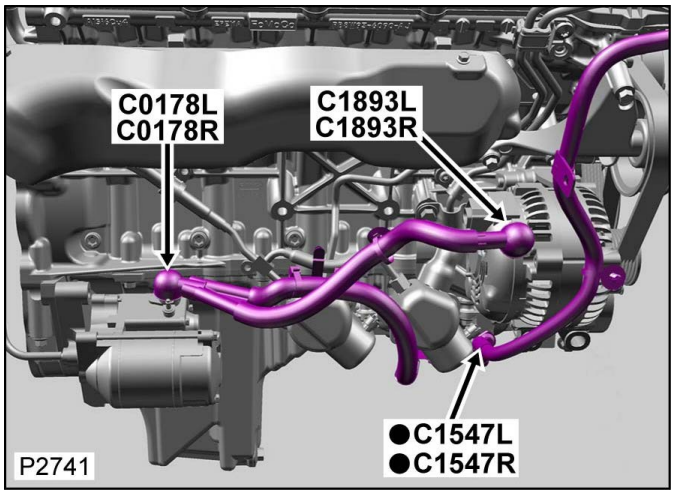

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	35.0T	R	ALL	C0178R

Click here to print


Connector: C1947


CONNECTOR HOUSING NOT SERVICEABLE

Description: Ground point

Location: Behind center console

Qualifier:

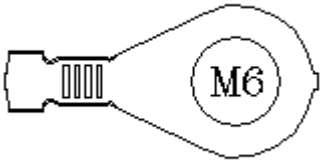

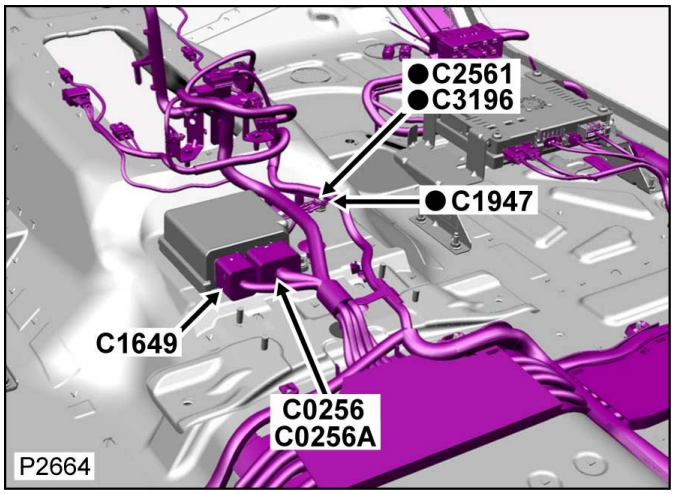

Part No.: YPG101120

Colour: TIN PLATED

Cavities: 1WY

Harness: CABIN HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	216	C1649

Click here to print

Connector: C1948

CONNECTOR HOUSING NOT SERVICEABLE

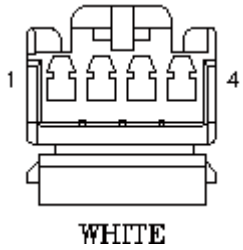

Part No.: YPC10204

Colour: WHITE


Cavities: 4WY

Harness: STEERING WHEEL HARNESS

Description: Clock spring

Location: In center of steering wheel

Qualifier:

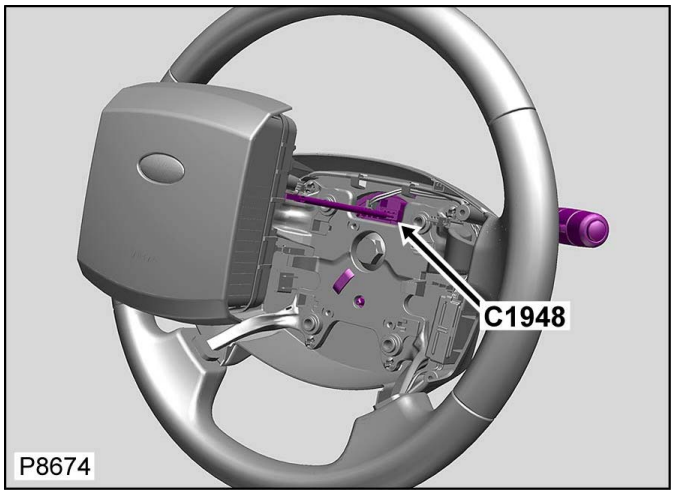


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	PN	499	C0257	418-549-62	-	418-116A	-	418-104	418-112	418-107
2	0.5	YG	499	C0257	418-549-62	-	418-116A	-	418-104	418-112	418-107
3	0.5	W	499	C0406	418-549-62	-	418-116A	-	418-104	418-112	418-107
4	0.5	U	499	C0406	418-549-62	-	418-116A	-	418-104	418-112	418-107

Click here to print

Connector: C1967

CONNECTOR HOUSING NOT SERVICEABLE

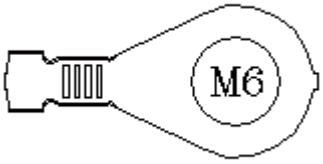

Part No.: YPG101120

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of 'B' post RH side

Qualifier:

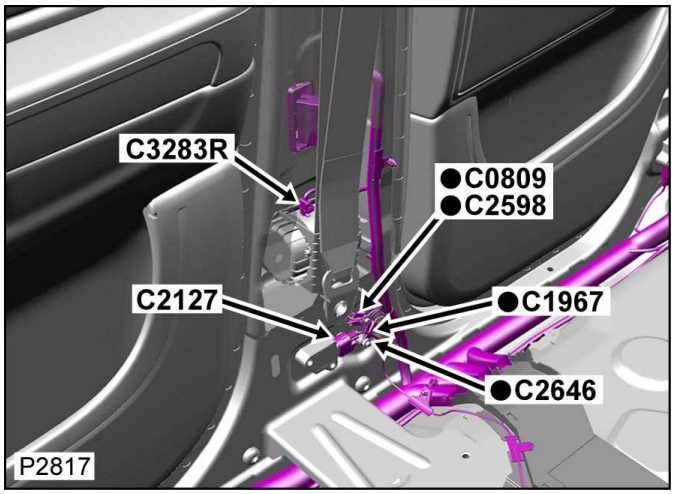


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	810S	C2428S
1	0.5	B	810T	C2428T
1	0.5	B	986TL	C2658TL
1	0.5	B	986TR	C2658TR

Click here to print

Connector: C1970

CONNECTOR HOUSING NOT SERVICEABLE

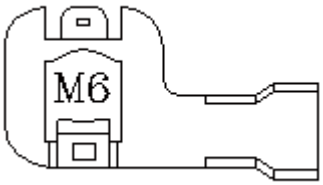

Part No.: YPG900260

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of RH 'A' post

Qualifier: LHD condition illustrated

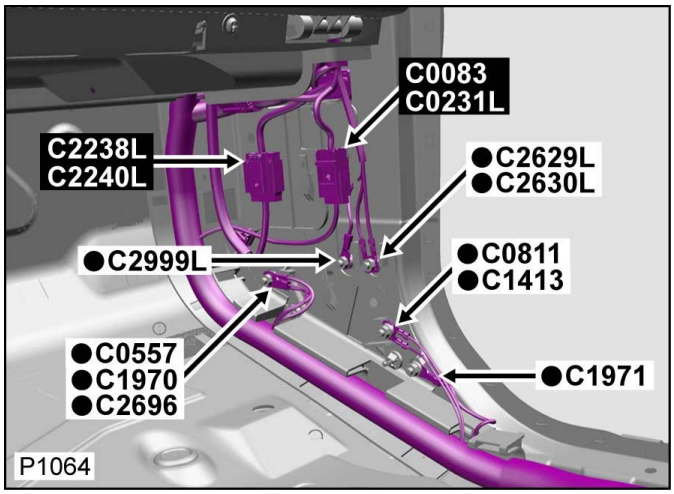


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	499	S/JOINT SJ2024

Click here to print

Connector: C1971

CONNECTOR HOUSING NOT SERVICEABLE

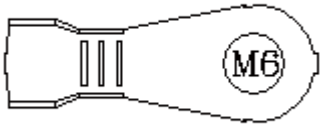

Part No.: YPG801380

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of RH 'A' post

Qualifier: LHD condition illustrated

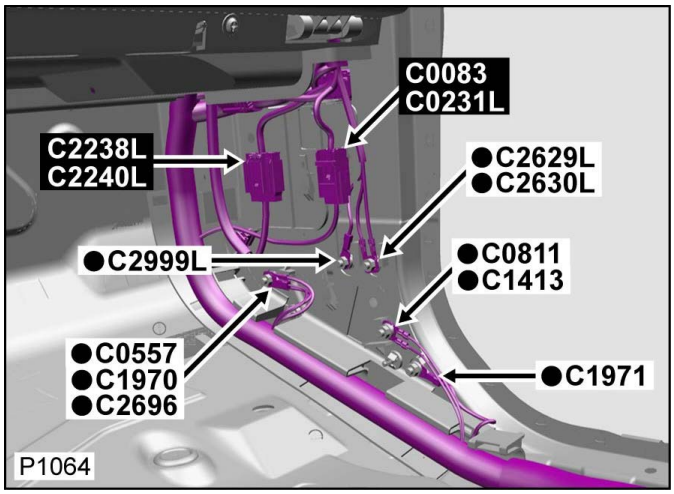


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	139L	C0585L
1	2.5	B	139L	C0585L

Click here to print

Connector: **C1975**

CONNECTOR HOUSING SERVICEABLE

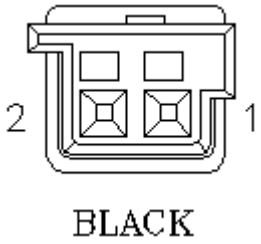

BLACK

Part No.: YPC802690

Colour: BLACK


Cavities: 2WY

Harness: ROOF HARNESS

Description: Lamp-Interior-Front

Location: Behind Center headlining

Qualifier:

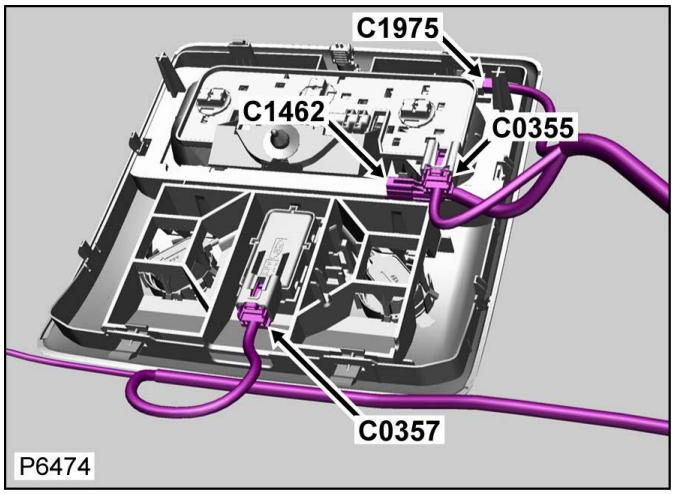


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	134	S/JOINT SJ275	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.5	RN	134	S/JOINT SJ237	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2003

CONNECTOR HOUSING NOT SERVICEABLE

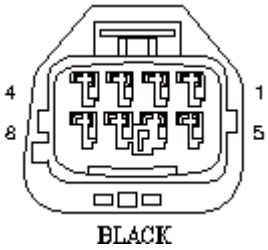

Part No.: YPC900240

Colour: BLACK


Cavities: 8WY

Harness: BUMPER REAR HARNESS

Description: PDC harness to main harness

Location: LH rear of vehicle

Qualifier:

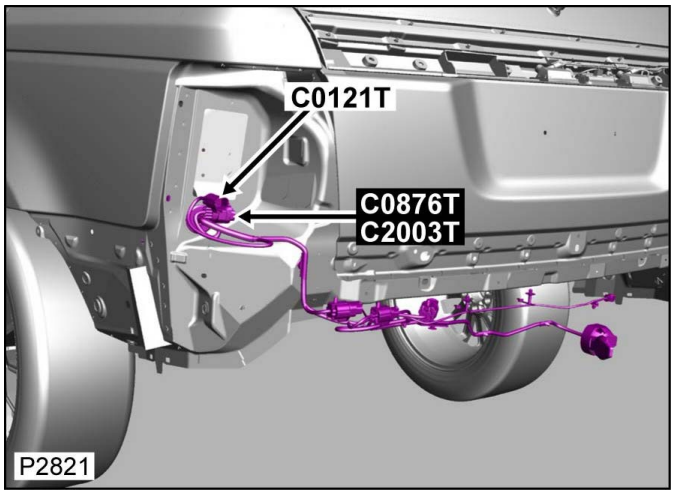

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	N	68	S/JOINT SJ401	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	R	68	C0963	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	B	68	S/JOINT SJ400	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	Y	68	C0964	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	G	68	C0965	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.35	U	68	C0966	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2003T

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC908130

Colour: DARK GREY


Cavities: 8WY

Harness: CABIN HARNESS

Description: Trailer harness to main harness

Location: LH rear of vehicle

Qualifier:

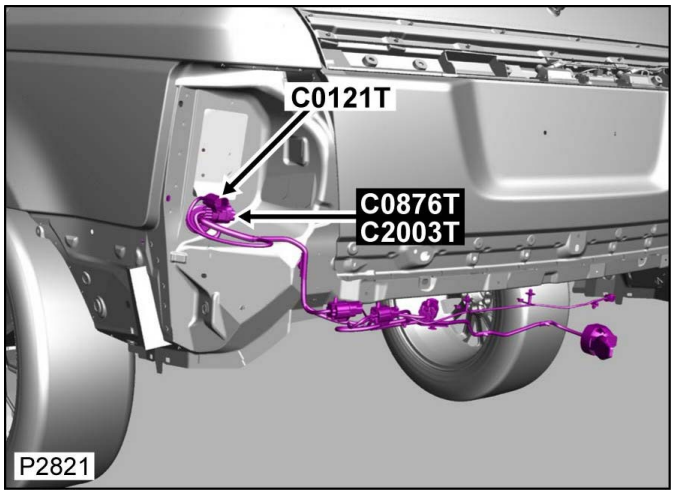

Click here to print

Connector: C2016


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Passenger door

Location: Behind passenger door trim panel

Qualifier: LHD condition illustrated



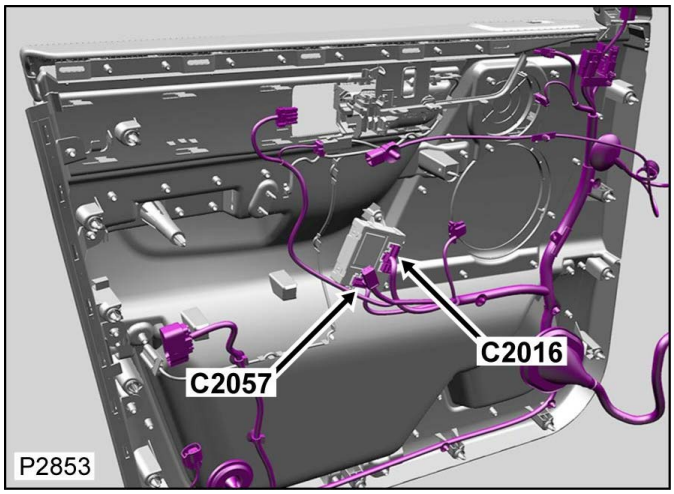

Part No.: YPC908680

Colour: GREY

Cavities: 22WY

Harness: DOORS FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	G	673	C0740	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	B	673	C3646	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
3	0.35	US	673	C0978	-	-	-	-	-	-	-
4	0.5	RN	673	S/JOINT SJ841	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	UW	673	C0740	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.5	YU	673	C0740	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.75	B	673	C0441	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.75	B	673	C0441	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.75	B	673	C0441	418-411-45	-	418-116A	418-117	-	418-112	418-107
11	0.35	GO	673	C0087	-	-	-	-	-	-	-
12	2.5	U	673	C0740	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
13	2.5	B	673	S/JOINT SJ840	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
15	0.35	B	673	C0441	-	-	-	-	-	-	-
16	0.5	PG	673	C0740	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.5	WN	673	C0740	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.5	G	673	C0087	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.5	B	673	S/JOINT SJ19	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	0.35	B	673	C0441	-	-	-	-	-	-	-
22	0.35	NY	673	C0087	-	-	-	-	-	-	-

Click here to print


Connector: C2017


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Driver door

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated



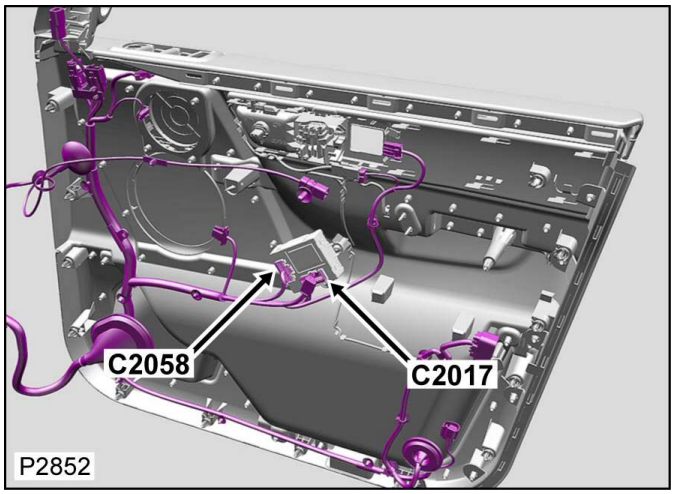

Part No.: YPC908660

Colour: BLACK

Cavities: 22WY

Harness: DOORS FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	G	672	C0740	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	B	672	C0439	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
3	0.35	US	672	C0978	-	-	-	-	-	-	-
4	0.5	B	672	C3560	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	YU	672	C0740	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.5	UW	672	C0740	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.75	B	672	C0441	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.75	B	672	C0441	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.75	B	672	C0441	418-411-45	-	418-116A	418-117	-	418-112	418-107
12	2.5	U	672	C0740	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
13	2.5	B	672	S/JOINT SJ840	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
15	0.35	B	672	C0441	-	-	-	-	-	-	-
16	0.5	PG	672	C0740	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.5	WN	672	C0740	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.35	B	672	S/JOINT SJ19	-	-	-	-	-	-	-
21	0.35	B	672	C0441	-	-	-	-	-	-	-

Click here to print


Connector: C2018


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Rear Door

Location: Behind rear door trim panel

Qualifier: LH side illustrated RH side similar



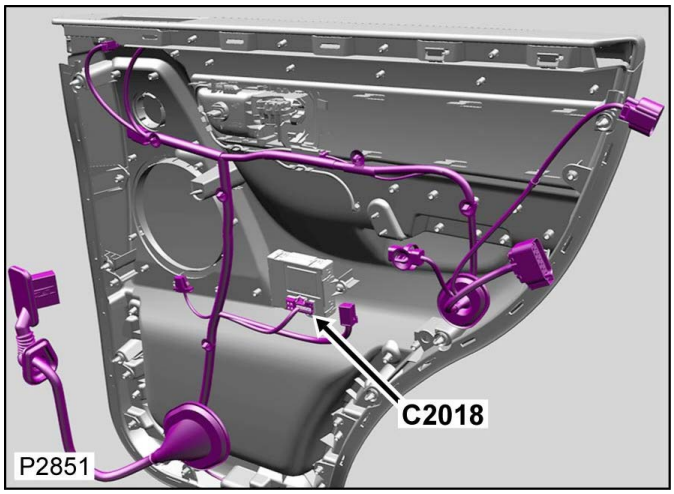

Part No.: YPC908660

Colour: BLACK

Cavities: 22WY

Harness: REAR DOOR HARNESS

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	PO	499	C0304	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	B	277	C0803	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	B	278	C0804	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
4	0.5	GU	499	C0732	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	US	278	C0304	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	NY	277	C0304	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.5	NY	278	C0304	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.5	US	277	C0304	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.75	B	278	C0442	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.75	B	277	C0442	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.75	B	499	C0442	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.75	B	278	C0442	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.75	B	277	C0442	418-411-45	-	418-116A	418-117	-	418-112	418-107
11	0.35	NG	499	C0732	-	-	-	-	-	-	-
12	2.5	SN	499	C0304	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
13	2.5	B	499	S/JOINT SJ200	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
15	0.35	B	278	C0442	-	-	-	-	-	-	-
15	0.35	B	277	C0442	-	-	-	-	-	-	-
16	0.5	SP	499	C0304	418-411-45	-	418-116A	418-117	-	418-112	418-107
											418-

17	0.5	NG	499	C0304	418-411-45	-	418-116A	418-117	-	418-112	107
18	0.5	NW	499	C0732	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.35	B	277	C0803	-	-	-	-	-	-	-
20	0.5	B	278	C0804	418-411-45	-	418-116A	418-117	-	418-112	418-107
22	0.35	SP	499	C0732	-	-	-	-	-	-	-

Click here to print

Connector: C2025

CONNECTOR HOUSING NOT SERVICEABLE

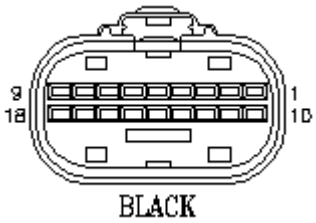

Part No.: YPC913290

Colour: BLACK


Cavities: 18WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Sensor-Speed control

Location: In front of radiator

Qualifier:

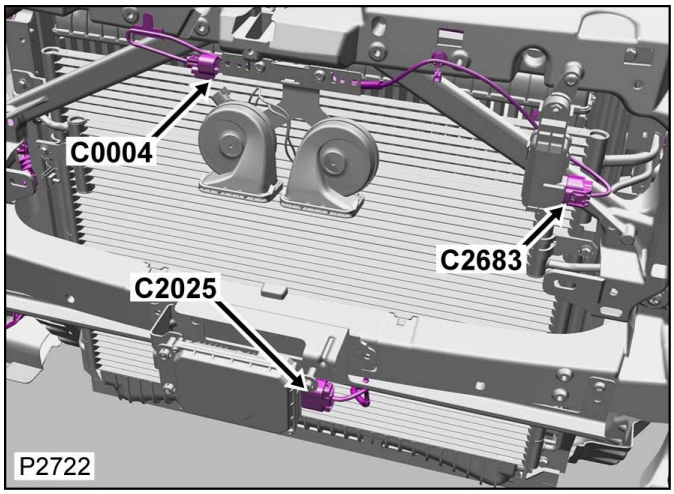

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	PO	809L	C0570L	418-411-45	-	418-116A	418-117	-	418-112	418-107
1	0.75	PO	245L	S/JOINT SJ8	418-411-45	-	418-116A	418-117	-	418-112	418-107
1	0.75	PO	809R	C0570R	418-411-45	-	418-116A	418-117	-	418-112	418-107
1	0.75	PO	245R	S/JOINT SJ1008	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	405	S/JOINT SJ877	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.35	YB	405	S/JOINT SJ177	-	-	-	-	-	-	-
8	0.35	YN	405	S/JOINT SJ176	-	-	-	-	-	-	-
10	0.5	WR	405L	C0583L	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.5	WR	405R	C0583R	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2030L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Air suspension

Location: LH 'A' post

Qualifier:

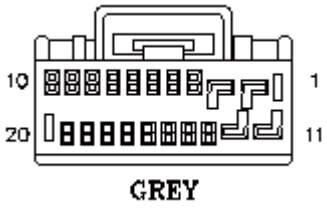

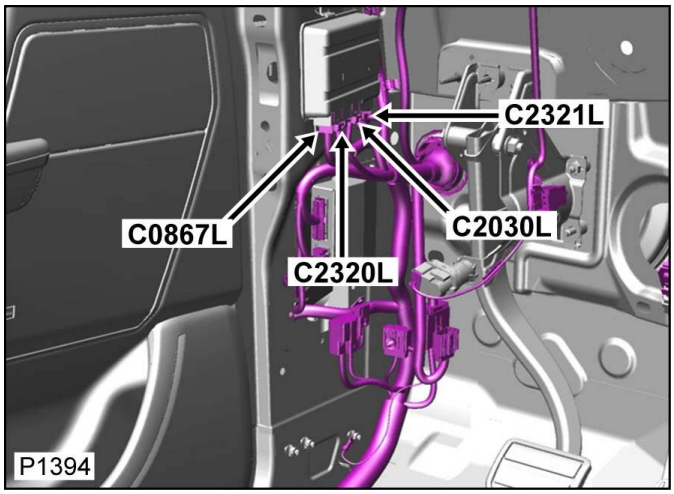

Part No.: YPC500440

Colour: GREY

Cavities: 20WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	BW	419L	C0376	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	BO	419L	C0376	-	-	-	-	-	-	-
7	0.5	BN	419L	C0376	-	-	-	-	-	-	-
8	0.35	BO	419SL	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
8	0.35	BO	986TL	C2053TL	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
8	0.35	BO	982TL	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	BS	419SL	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	BS	986TL	C2053TL	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	BS	982TL	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	BG	419SL	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	BG	986TL	C2053TL	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	BG	982TL	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
11	1.0	BU	419L	C0376	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
17	0.35	BN	419SL	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
17	0.35	BN	986TL	C2053TL	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
17	0.35	BN	982TL	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
18	0.35	BR	419SL	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
18	0.35	BR	986TL	C2053TL	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
18	0.35	BR	982TL	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107

20	0.35	BK	419SL	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
20	0.35	BK	986TL	C2053TL	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
20	0.35	BK	982TL	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C2030R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Air suspension

Location: RH 'A' post

Qualifier:

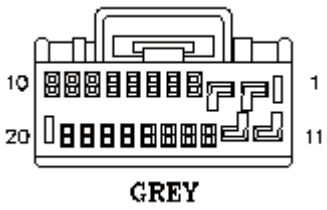

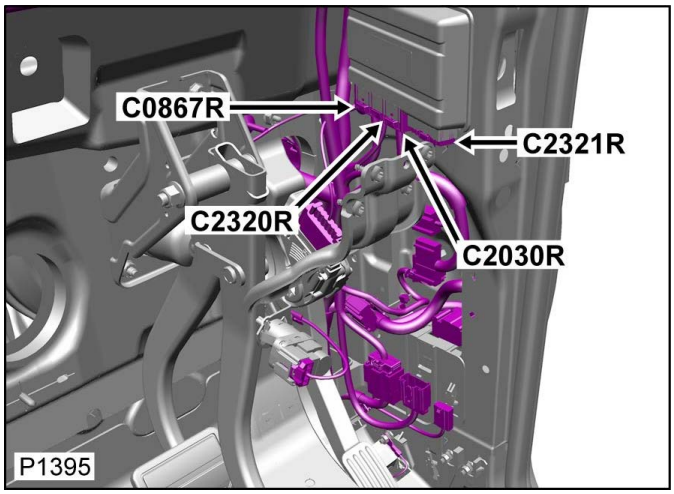

Part No.: YPC500440

Colour: GREY

Cavities: 20WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	BW	419R	C0376	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	BO	419R	C0376	-	-	-	-	-	-	-
7	0.5	BN	419R	C0376	-	-	-	-	-	-	-
8	0.35	BO	419SR	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
8	0.35	BO	986TR	C2053TR	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
8	0.35	BO	982TR	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	BS	419SR	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	BS	986TR	C2053TR	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	BS	982TR	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	BG	419SR	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	BG	986TR	C2053TR	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	BG	982TR	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
11	1.0	BU	419R	C0376	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
17	0.35	BN	419SR	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
17	0.35	BN	986TR	C2053TR	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
17	0.35	BN	982TR	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
18	0.35	BR	419SR	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
18	0.35	BR	986TR	C2053TR	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
18	0.35	BR	982TR	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107

20	0.35	BK	419SR	C2053S	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
20	0.35	BK	986TR	C2053TR	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
20	0.35	BK	982TR	C2053TA	418-411-59	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C2034**

CONNECTOR HOUSING SERVICEABLE

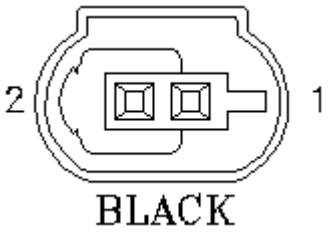

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Valve-Water circuit-closure

Location: Front LH side of engine compartment

Qualifier:

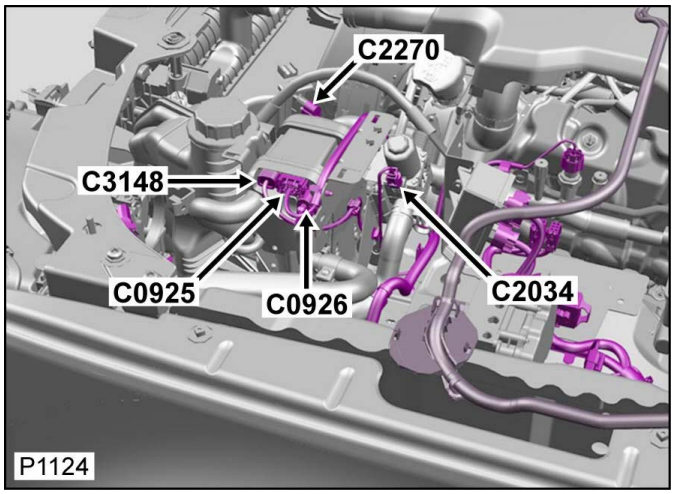


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	798	S/JOINT SJ9	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	RB	798L	C2444L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	RB	798R	C2240R	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2038A

CONNECTOR HOUSING NOT SERVICEABLE

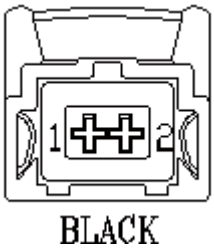

BLACK

Part No.: YPC801840

Colour: BLACK


Cavities: 2WY

Harness: AIR SUSPENSION HARNESS

Description: Solenoid-Power steering

Location: Lower LH front of engine compartment

Qualifier:

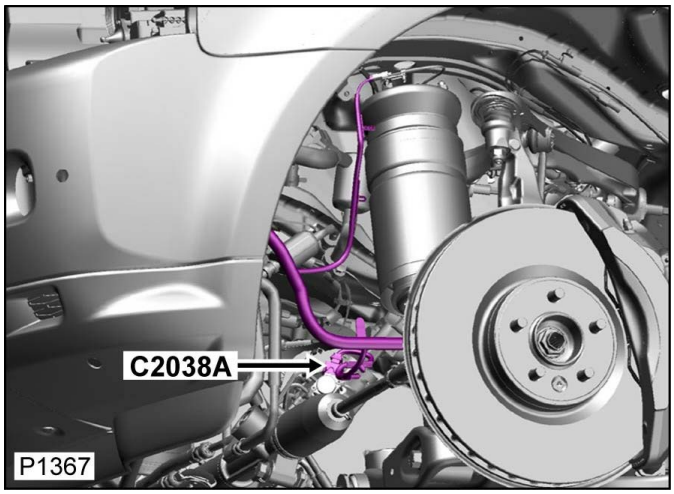


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	R	825	C3010	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	BR	825	C3010	418-411-68	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2038B

CONNECTOR HOUSING NOT SERVICEABLE

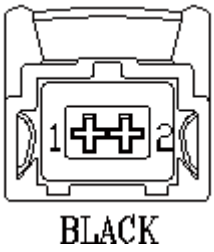

BLACK

Part No.: YPC801840

Colour: BLACK


Cavities: 2WY

Harness: CHASSIS HARNESS

Description: Solenoid-Power steering

Location: Lower RH front of engine compartment

Qualifier:

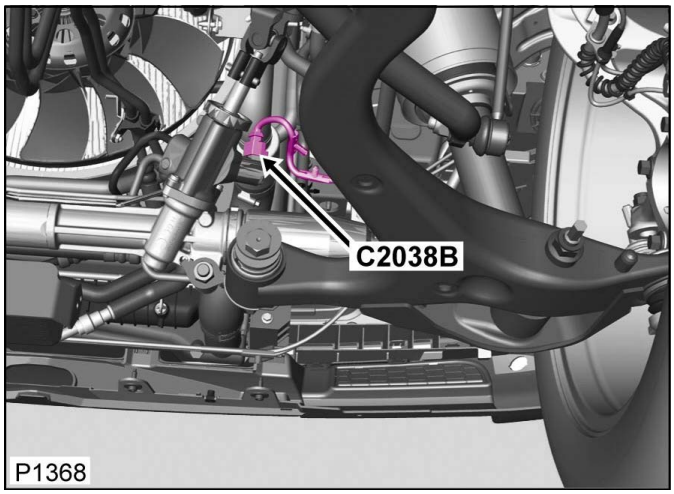

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	R	825	C2294T	418-411-68	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	BR	825	C2294T	418-411-68	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C2041

CONNECTOR HOUSING NOT SERVICEABLE

Description: Heater-Steering wheel

Location: In center of steering wheel

Qualifier:

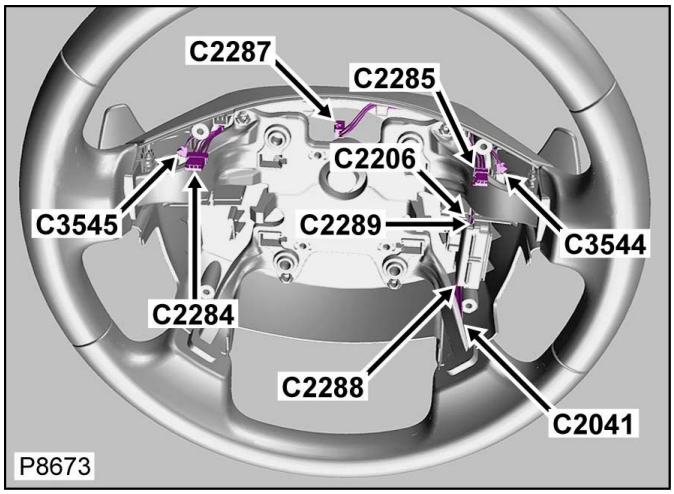

ASSEMBLY

Part No.: CASSY

Colour: NO COLOUR

Cavities: 1WY

Harness: STEERING WHEEL HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	W	-	C2288
2	0.35	S	-	C2288
3	0.35	R	-	C2288
4	0.35	R	-	C2288

Click here to print

Connector: C2042

CONNECTOR HOUSING NOT SERVICEABLE

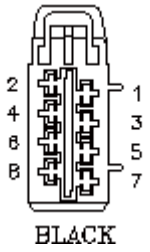

Part No.: YPC901240

Colour: BLACK


Cavities: 8WY

Harness: CABIN HARNESS

Description: Main harness to rear seat harness

Location: Beneath rear seat

Qualifier:

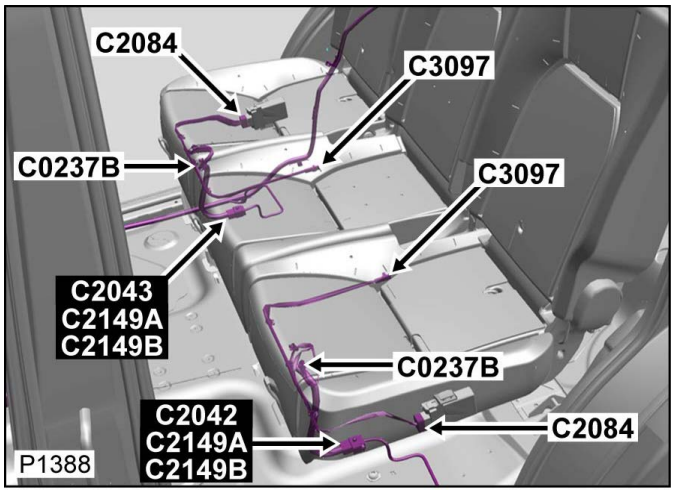


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	UK	572S	C2754S	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
1	0.35	UK	572T	C2754T	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	G	572S	C2754S	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	G	572T	C2754T	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	U	572S	C2754S	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	U	572T	C2754T	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
4	2.5	B	572	C2565	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
5	2.5	LGW	572	S/JOINT SJ23	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C2043

CONNECTOR HOUSING NOT SERVICEABLE

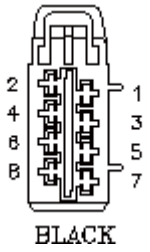

Part No.: YPC901240

Colour: BLACK


Cavities: 8WY

Harness: CABIN HARNESS

Description: Main harness to rear seat harness

Location: Beneath rear seat

Qualifier:

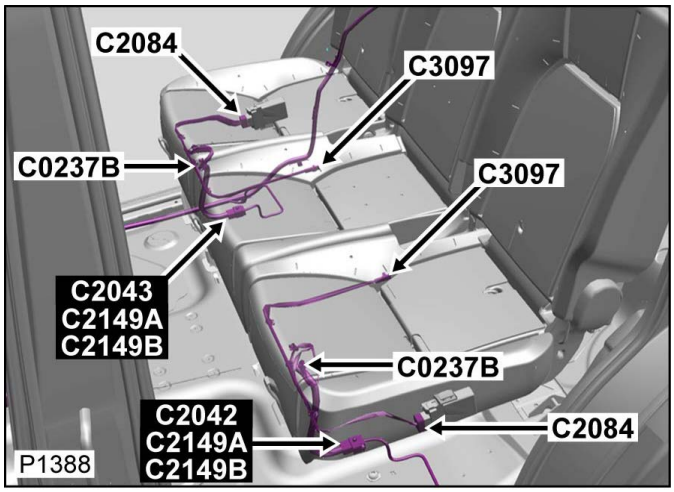

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	UK	572S	C2754S	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
1	0.35	UK	572T	C2754T	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	G	572S	C2754S	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	G	572T	C2754T	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	U	572S	C2754S	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	U	572T	C2754T	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
4	2.5	B	572	C0809	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
5	2.5	LGW	572	S/JOINT SJ23	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C2046T

CONNECTOR HOUSING NOT SERVICEABLE


Description: Fuel fired booster heater receiver

Location: Behind luggage compartment carpet RH side

Qualifier:

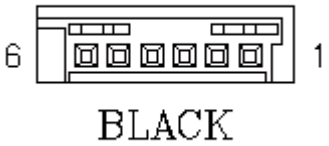

BLACK

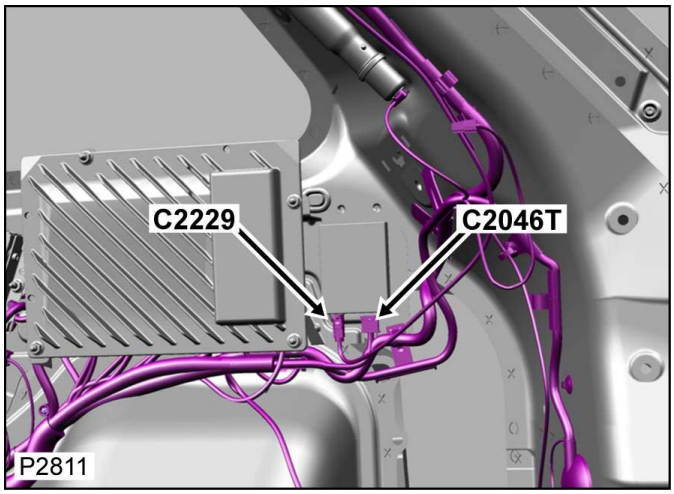

Part No.: YPC800830

Colour: BLACK

Cavities: 6WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	PN	97TL	C2411L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
1	0.5	PN	97TR	C2409R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.5	R	97TL	C2243L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.5	R	97TR	C2409R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
6	0.5	B	97T	C1170T	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2053TA


CONNECTOR HOUSING SERVICEABLE

Description: Main harness to console harness

Location: Beneath center console LH side

Qualifier: LHD condition illustrated

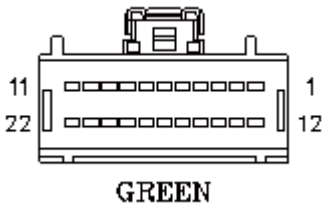

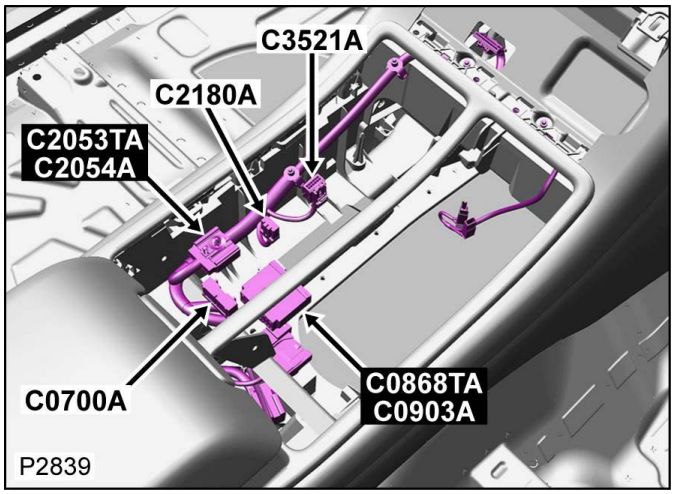

Part No.: YPC900550

Colour: GREEN

Cavities: 22WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	BY	982TL	C0867L	418-411-45	-	418-116A	418-117	-	418-112	418-107
1	0.35	BY	982TR	C0867R	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.35	BG	982TL	C2030L	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.35	BG	982TR	C2030R	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.35	BN	982TL	C2030L	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.35	BN	982TR	C2030R	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.35	BR	982TL	C2030L	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.35	BR	982TR	C2030R	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.35	BO	982TL	C2030L	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.35	BO	982TR	C2030R	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.35	BS	982TL	C2030L	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.35	BS	982TR	C2030R	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.5	R	982T	C0376	-	-	-	-	-	-	-
8	0.35	BW	982TL	C0867L	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.35	BW	982TR	C0867R	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.35	BK	982TL	C2030L	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.35	BK	982TR	C2030R	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.35	YN	1045TR	S/JOINT SJ1009	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.35	YN	1043TR	S/JOINT	418-411-45	-	418-116A	418-117	-	418-112	418-

				SJ1009							107
10	0.35	YN	982TL	S/JOINT SJ1007	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.5	YN	1037TR	C0376	-	-	-	-	-	-	-
10	0.35	YN	1035TR	S/JOINT SJ1011T	418-411-45	-	418-116A	418-117	-	418-112	418-107
11	0.35	YB	1045TR	S/JOINT SJ1010	418-411-45	-	418-116A	418-117	-	418-112	418-107
11	0.35	YB	1043TR	S/JOINT SJ1010	418-411-45	-	418-116A	418-117	-	418-112	418-107
11	0.35	YB	982TL	S/JOINT SJ1008	418-411-45	-	418-116A	418-117	-	418-112	418-107
11	0.5	YB	1037TR	C0376	-	-	-	-	-	-	-
11	0.35	YB	1035TR	S/JOINT SJ1012T	418-411-45	-	418-116A	418-117	-	418-112	418-107
12	0.35	RS	982T	C0957	418-411-45	-	418-116A	418-117	-	418-112	418-107
13	0.35	NU	982T	C0957	418-411-45	-	418-116A	418-117	-	418-112	418-107
14	0.5	LGR	982TL	C1166L	-	-	-	-	-	-	-
14	0.5	LGR	982TR	C1166R	-	-	-	-	-	-	-
15	0.5	GP	982TL	C1166L	-	-	-	-	-	-	-
15	0.5	GP	982TR	C1166R	-	-	-	-	-	-	-
16	0.35	YW	982T	S/JOINT SJ2006	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.35	YU	982T	S/JOINT SJ2007	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.35	G	982T	C1649	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.35	R	982TL	C2243L	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.5	R	982TR	C2242R	-	-	-	-	-	-	-
20	0.5	Y	982T	C0376	-	-	-	-	-	-	-
21	0.5	R	982T	C0467	-	-	-	-	-	-	-
22	0.35	BP	982TL	C0867L	418-411-45	-	418-116A	418-117	-	418-112	418-107
22	0.35	BP	982TR	C0867R	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: **C2053TL**

CONNECTOR HOUSING SERVICEABLE

Description: Main harness to console harness

Location: Beneath center console RH side

Qualifier: LHD condition illustrated

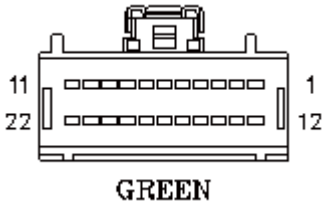


Part No.: YPC900550

Colour: GREEN

Cavities: 22WY

Harness: CABIN HARNESS

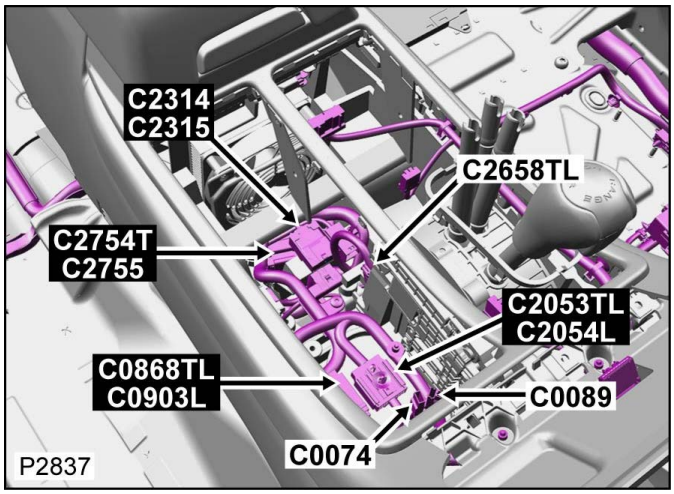

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	BY	986TL	C0867L	-	-	-	-	-	-	-
2	0.35	BG	986TL	C2030L	-	-	-	-	-	-	-
3	0.35	BN	986TL	C2030L	-	-	-	-	-	-	-
4	0.35	BR	986TL	C2030L	-	-	-	-	-	-	-
5	0.35	BO	986TL	C2030L	-	-	-	-	-	-	-
6	0.35	BS	986TL	C2030L	-	-	-	-	-	-	-
7	0.5	R	986TL	C0376	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.35	BW	986TL	C0867L	-	-	-	-	-	-	-
9	0.35	BK	986TL	C2030L	-	-	-	-	-	-	-
10	0.35	YN	986TL	S/JOINT SJ1007	-	-	-	-	-	-	-
11	0.35	YB	986TL	S/JOINT SJ1008	-	-	-	-	-	-	-
12	0.35	RS	986TL	C0957	-	-	-	-	-	-	-
13	0.35	NU	986TL	C0957	-	-	-	-	-	-	-
14	0.5	LGR	986TL	C1166L	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.5	GP	986TL	C1166L	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.35	YW	986TL	S/JOINT SJ2006	-	-	-	-	-	-	-
17	0.35	YU	986TL	S/JOINT SJ2007	-	-	-	-	-	-	-
18	0.35	G	986TL	C1649	-	-	-	-	-	-	-
19	0.35	R	986TL	C2243L	-	-	-	-	-	-	-
20	0.5	Y	986TL	C0376	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	0.5	R	986TL	C0467	418-411-45	-	418-116A	418-117	-	418-112	418-107
22	0.35	BP	986TL	C0867L	-	-	-	-	-	-	-

Click here to print


Connector: **C2053TR**


CONNECTOR HOUSING SERVICEABLE

Description: Main harness to console harness

Location: Beneath center console LH side

Qualifier:

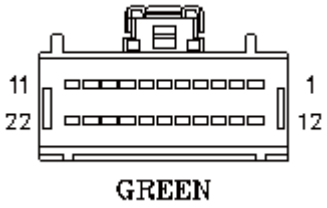

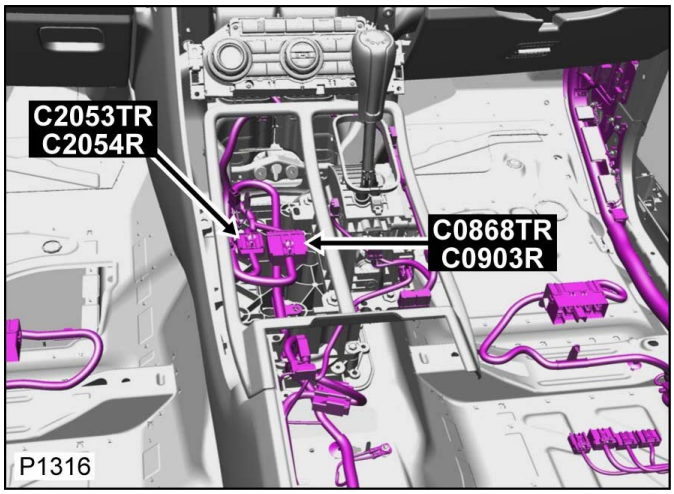

Part No.: YPC900550

Colour: GREEN

Cavities: 22WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	BY	986TR	C0867R	-	-	-	-	-	-	-
2	0.35	BG	986TR	C2030R	-	-	-	-	-	-	-
3	0.35	BN	986TR	C2030R	-	-	-	-	-	-	-
4	0.35	BR	986TR	C2030R	-	-	-	-	-	-	-
5	0.35	BO	986TR	C2030R	-	-	-	-	-	-	-
6	0.35	BS	986TR	C2030R	-	-	-	-	-	-	-
7	0.5	R	986TR	C0376	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.35	BW	986TR	C0867R	-	-	-	-	-	-	-
9	0.35	BK	986TR	C2030R	-	-	-	-	-	-	-
10	0.35	YN	1044TR	S/JOINT SJ1009	-	-	-	-	-	-	-
10	0.35	YN	1042TR	S/JOINT SJ1009	-	-	-	-	-	-	-
10	0.5	YN	1036TR	C0376	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.35	YN	1034TR	S/JOINT SJ1011T	-	-	-	-	-	-	-
11	0.35	YB	1044TR	S/JOINT SJ1010	-	-	-	-	-	-	-
11	0.35	YB	1042TR	S/JOINT SJ1010	-	-	-	-	-	-	-
11	0.5	YB	1036TR	C0376	418-411-45	-	418-116A	418-117	-	418-112	418-107
11	0.35	YB	1034TR	S/JOINT SJ1012T	-	-	-	-	-	-	-
12	0.35	RS	986TR	C0957	-	-	-	-	-	-	-
13	0.35	NU	986TR	C0957	-	-	-	-	-	-	-
14	0.5	LGR	986TR	C1166R	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.5	GP	986TR	C1166R	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.35	YW	986TR	S/JOINT SJ2006	-	-	-	-	-	-	-
				S/JOINT							

17	0.35	YU	986TR	SJ2007	-	-	-	-	-	-	-
18	0.5	G	986TR	C1649	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.5	R	986TR	C2242R	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.5	Y	986TR	C0376	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	0.5	R	986TR	C0467	418-411-45	-	418-116A	418-117	-	418-112	418-107
22	0.35	BP	986TR	C0867R	-	-	-	-	-	-	-

Click here to print


Connector: C2054A


CONNECTOR HOUSING NOT SERVICEABLE

Description: Console harness to main harness

Location: Beneath center console LH side

Qualifier: LHD condition illustrated

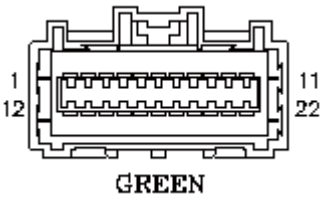

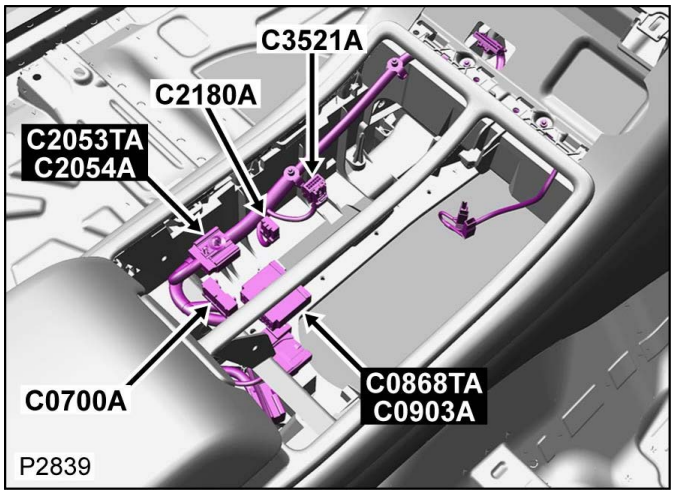

Part No.: YPC900460

Colour: GREEN

Cavities: 22WY

Harness: CONSOLE FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	BY	982L	C0700A	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.35	BG	982L	C0700A	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.35	BN	982L	C0700A	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.35	BR	982L	C0700A	418-411-47	-	418-116A	418-117	-	418-112	418-107
5	0.35	BO	982L	C0700A	418-411-47	-	418-116A	418-117	-	418-112	418-107
6	0.35	BS	982L	C0700A	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.5	R	982L	C2180A	-	-	-	-	-	-	-
8	0.35	BW	982L	C0700A	418-411-47	-	418-116A	418-117	-	418-112	418-107
9	0.35	BK	982L	C0700A	418-411-47	-	418-116A	418-117	-	418-112	418-107
10	0.35	YN	982L	S/JOINT SJ1030	418-411-47	-	418-116A	418-117	-	418-112	418-107
11	0.35	YB	982L	S/JOINT SJ1031	418-411-47	-	418-116A	418-117	-	418-112	418-107
12	0.5	RS	982L	C1629L	-	-	-	-	-	-	-
13	0.5	NU	982L	C1629L	-	-	-	-	-	-	-
14	0.5	LGR	982L	C1629L	-	-	-	-	-	-	-
15	0.5	GP	982L	C1629L	-	-	-	-	-	-	-
16	0.35	YW	982L	S/JOINT SJ2012	418-411-47	-	418-116A	418-117	-	418-112	418-107
17	0.35	YU	982L	S/JOINT SJ2013	418-411-47	-	418-116A	418-117	-	418-112	418-107
18	0.5	G	982L	C1629L	-	-	-	-	-	-	-
19	0.5	R	982L	C0700A	-	-	-	-	-	-	-
20	0.5	Y	982L	C2180A	-	-	-	-	-	-	-
21	0.5	R	982L	C1629L	-	-	-	-	-	-	-
22	0.35	BP	982L	C0700A	418-411-47	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2054B

CONNECTOR HOUSING NOT SERVICEABLE

Description: Console harness to main harness

Location: Beneath center console RH side

Qualifier: RHD condition illustrated

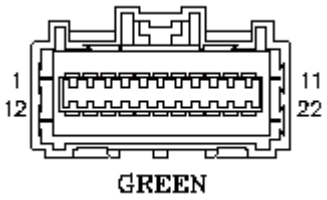


Part No.: YPC900460

Colour: GREEN

Cavities: 22WY

Harness: CONSOLE FRONT HARNESS

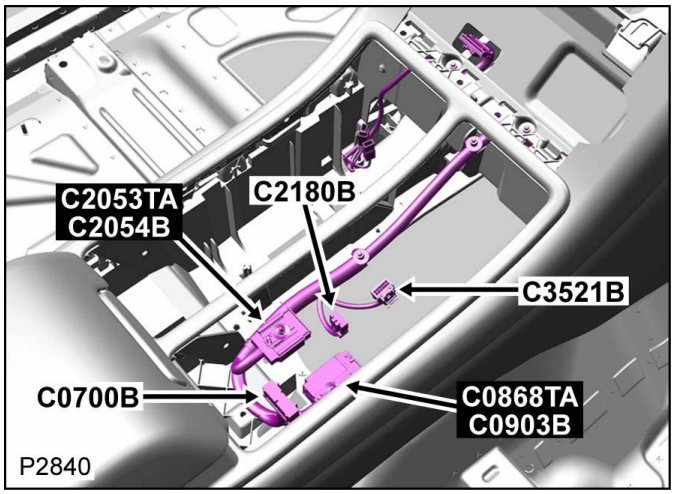

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	BY	982R	C0700B	-	-	-	-	-	-	-
2	0.5	BG	982R	C0700B	-	-	-	-	-	-	-
3	0.5	BN	982R	C0700B	-	-	-	-	-	-	-
4	0.5	BR	982R	C0700B	-	-	-	-	-	-	-
5	0.5	BO	982R	C0700B	-	-	-	-	-	-	-
6	0.5	BS	982R	C0700B	-	-	-	-	-	-	-
7	0.5	R	982R	C2180B	-	-	-	-	-	-	-
8	0.5	BW	982R	C0700B	-	-	-	-	-	-	-
9	0.5	BK	982R	C0700B	-	-	-	-	-	-	-
10	0.35	YN	982R	S/JOINT SJ1038	418-411-47	-	418-116A	418-117	-	418-112	418-107
11	0.35	YB	982R	S/JOINT SJ1039	418-411-47	-	418-116A	418-117	-	418-112	418-107
12	0.5	RS	982R	C1629R	-	-	-	-	-	-	-
13	0.5	NU	982R	C1629R	-	-	-	-	-	-	-
14	0.5	LGR	982R	C1629R	-	-	-	-	-	-	-
15	0.5	GP	982R	C1629R	-	-	-	-	-	-	-
16	0.35	YW	982R	S/JOINT SJ2012	418-411-47	-	418-116A	418-117	-	418-112	418-107
17	0.35	YU	982R	S/JOINT SJ2013	418-411-47	-	418-116A	418-117	-	418-112	418-107
18	0.5	G	982R	C1629R	-	-	-	-	-	-	-
19	0.5	R	982R	C0700B	-	-	-	-	-	-	-
20	0.5	Y	982R	C2180B	-	-	-	-	-	-	-
21	0.5	R	982R	C1629R	-	-	-	-	-	-	-
22	0.35	BP	982R	C0700B	418-411-47	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2054L

CONNECTOR HOUSING NOT SERVICEABLE

Description: Console harness to main harness

Location: Beneath center console RH side

Qualifier: LHD condition illustrated

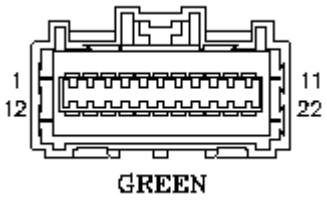


Part No.: YPC900460

Colour: GREEN

Cavities: 22WY

Harness: CONSOLE FRONT HARNESS

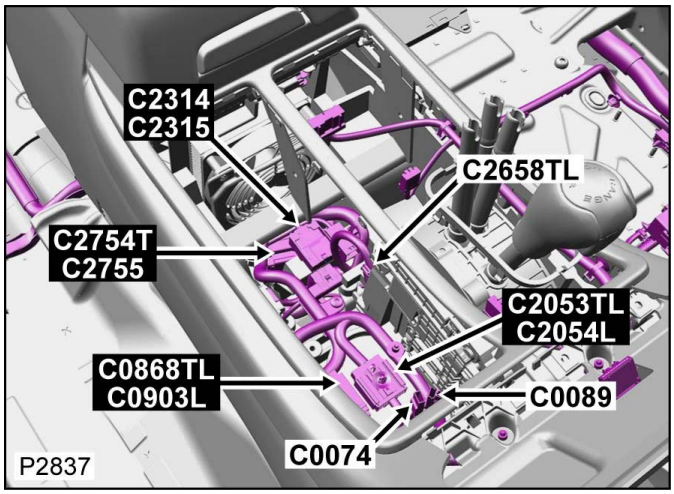

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	BY	986L	C0700L	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.35	BG	986L	C0700L	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.35	BN	986L	C0700L	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.35	BR	986L	C0700L	418-411-47	-	418-116A	418-117	-	418-112	418-107
5	0.35	BO	986L	C0700L	418-411-47	-	418-116A	418-117	-	418-112	418-107
6	0.35	BS	986L	C0700L	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.5	R	986L	C2180L	-	-	-	-	-	-	-
8	0.35	BW	986L	C0700L	418-411-47	-	418-116A	418-117	-	418-112	418-107
9	0.35	BK	986L	C0700L	418-411-47	-	418-116A	418-117	-	418-112	418-107
10	0.35	YN	986L	S/JOINT SJ1044	418-411-47	-	418-116A	418-117	-	418-112	418-107
11	0.35	YB	986L	S/JOINT SJ1045	418-411-47	-	418-116A	418-117	-	418-112	418-107
12	0.5	RS	986L	C1629L	-	-	-	-	-	-	-
13	0.5	NU	986L	C1629L	-	-	-	-	-	-	-
14	0.5	LGR	986L	C1629L	-	-	-	-	-	-	-
15	0.5	GP	986L	C1629L	-	-	-	-	-	-	-
16	0.35	YW	986L	S/JOINT SJ2012	418-411-47	-	418-116A	418-117	-	418-112	418-107
17	0.35	YU	986L	S/JOINT SJ2013	418-411-47	-	418-116A	418-117	-	418-112	418-107
18	0.5	G	986L	C1629L	-	-	-	-	-	-	-
19	0.5	R	986L	C0700L	-	-	-	-	-	-	-
20	0.5	Y	986L	C2180L	-	-	-	-	-	-	-
21	0.5	R	986L	C1629L	-	-	-	-	-	-	-
22	0.35	BP	986L	C0700L	418-411-47	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2054R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Console harness to main harness

Location: Beneath center console LH side

Qualifier:

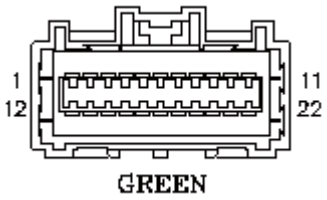

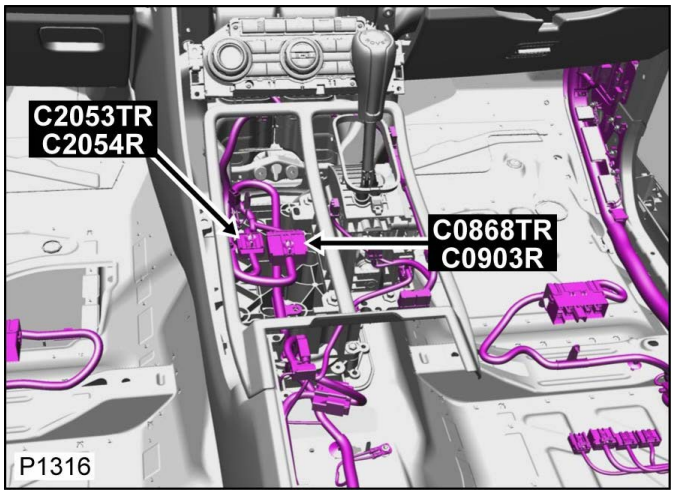

Part No.: YPC900460

Colour: GREEN

Cavities: 22WY

Harness: CONSOLE FRONT HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	BY	986R	C0700R	-	-	-	-	-	-	-
2	0.5	BG	986R	C0700R	-	-	-	-	-	-	-
3	0.5	BN	986R	C0700R	-	-	-	-	-	-	-
4	0.5	BR	986R	C0700R	-	-	-	-	-	-	-
5	0.5	BO	986R	C0700R	-	-	-	-	-	-	-
6	0.5	BS	986R	C0700R	-	-	-	-	-	-	-
7	0.5	R	986R	C2180R	-	-	-	-	-	-	-
8	0.5	BW	986R	C0700R	-	-	-	-	-	-	-
9	0.5	BK	986R	C0700R	-	-	-	-	-	-	-
10	0.35	YN	986R	S/JOINT SJ1046	418-411-47	-	418-116A	418-117	-	418-112	418-107
11	0.35	YB	986R	S/JOINT SJ1047	418-411-47	-	418-116A	418-117	-	418-112	418-107
12	0.5	RS	986R	C1629R	-	-	-	-	-	-	-
13	0.5	NU	986R	C1629R	-	-	-	-	-	-	-
14	0.5	LGR	986R	C1629R	-	-	-	-	-	-	-
15	0.5	GP	986R	C1629R	-	-	-	-	-	-	-
16	0.35	YW	986R	S/JOINT SJ2012	418-411-47	-	418-116A	418-117	-	418-112	418-107
17	0.35	YU	986R	S/JOINT SJ2013	418-411-47	-	418-116A	418-117	-	418-112	418-107
18	0.5	G	986R	C1629R	-	-	-	-	-	-	-
19	0.5	R	986R	C0700R	-	-	-	-	-	-	-
20	0.5	Y	986R	C2180R	-	-	-	-	-	-	-
21	0.5	R	986R	C1629R	-	-	-	-	-	-	-
22	0.35	BP	986R	C0700R	418-411-47	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2055L

CONNECTOR HOUSING NOT SERVICEABLE

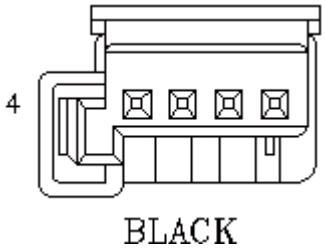

Part No.: YPC901840

Colour: BLACK


Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS

Description: Module-Steering column lock

Location: RH side of steering column

Qualifier:

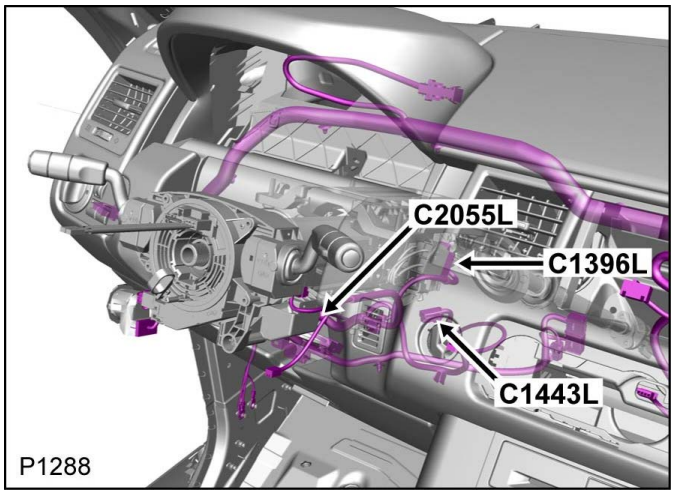


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	777L	C0230	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.5	R	777L	C0582	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
3	0.5	YB	777L	S/JOINT SJ863	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.5	YN	777L	S/JOINT SJ853	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2055R

CONNECTOR HOUSING NOT SERVICEABLE

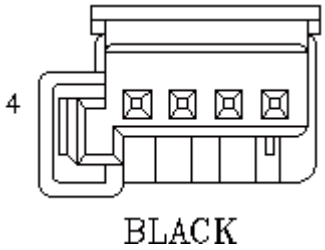

Part No.: YPC901840

Colour: BLACK


Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS

Description: Module-Steering column lock

Location: RH side of steering column

Qualifier:

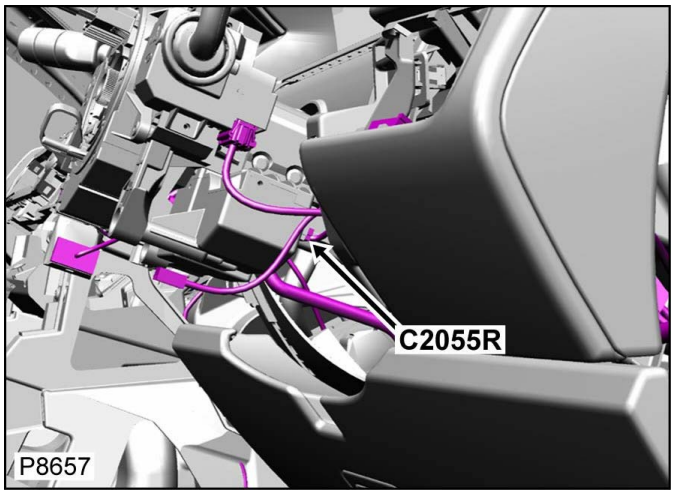

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	777R	C0230	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.5	R	777R	C0582	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
3	0.5	YB	777R	S/JOINT SJ863	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.5	YN	777R	S/JOINT SJ853	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: **C2057**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Passenger door

Location: Behind passenger door trim panel

Qualifier: LHD condition illustrated

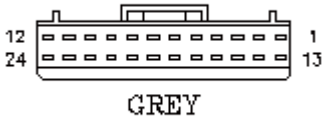

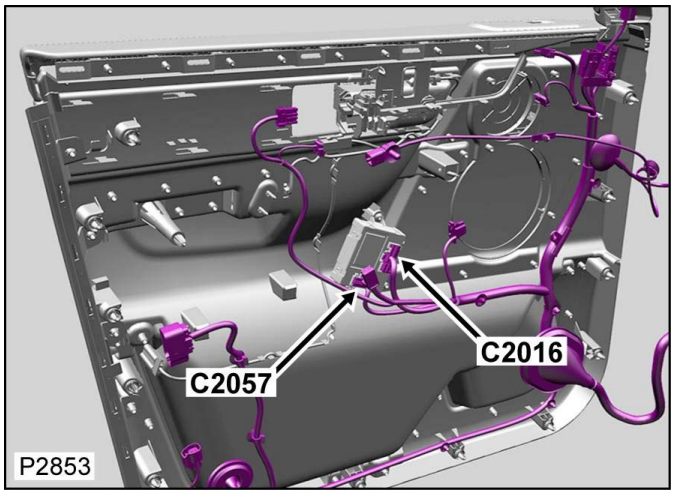

Part No.: YPC908650

Colour: GREY

Cavities: 24WY

Harness: DOORS FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
3	0.35	B	673	C3646	-	-	-	-	-	-	-
6	0.35	SP	673	C0319	-	-	-	-	-	-	-
7	0.35	Y	673	C0319	-	-	-	-	-	-	-
8	0.5	WN	673	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.5	GW	673	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.35	WO	673	C0319	-	-	-	-	-	-	-
11	0.5	GW	673	C2677	418-411-45	-	418-116A	418-117	-	418-112	418-107
12	0.5	P	673	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.35	B	673	C3646	-	-	-	-	-	-	-
17	0.5	BN	673	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.35	UO	673	C0319	-	-	-	-	-	-	-
19	0.35	NG	673	C0319	-	-	-	-	-	-	-
22	0.35	B	673	C0441	-	-	-	-	-	-	-
23	0.35	YO	673	C0319	-	-	-	-	-	-	-
24	0.5	WP	673	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2058


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Driver door

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated

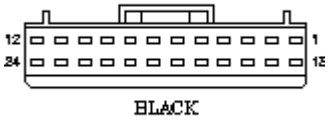

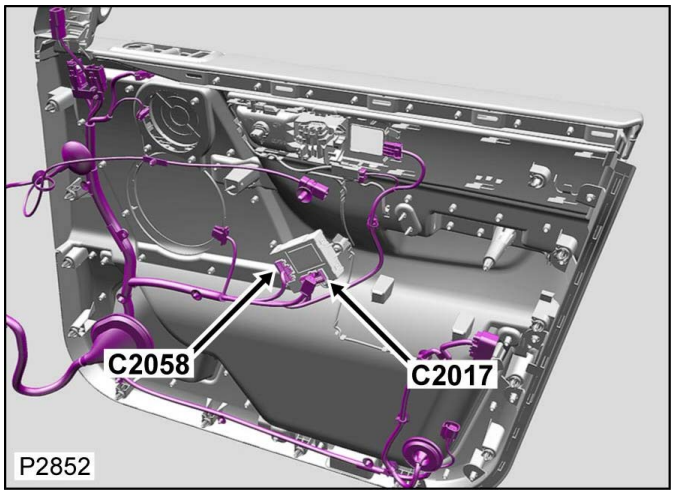

Part No.: YPC908640

Colour: BLACK

Cavities: 24WY

Harness: DOORS FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
3	0.35	B	672	C0439	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.35	SP	672	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.35	Y	672	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.5	WN	672	C0319	-	-	-	-	-	-	-
9	0.5	GW	672	C0319	-	-	-	-	-	-	-
10	0.35	WO	672	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
11	0.5	GW	672	C2677	-	-	-	-	-	-	-
12	0.5	P	672	C0319	-	-	-	-	-	-	-
15	0.35	B	672	C0439	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.5	BN	672	C0319	-	-	-	-	-	-	-
18	0.35	UO	672	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.35	NG	672	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
22	0.35	B	672	C0441	418-411-45	-	418-116A	418-117	-	418-112	418-107
23	0.35	YO	672	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
24	0.5	WP	672	C0319	-	-	-	-	-	-	-

Click here to print


Connector: C2084


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Heated seat-Rear

Location: Beneath rear seat

Qualifier:

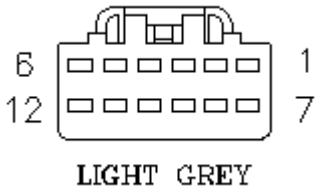

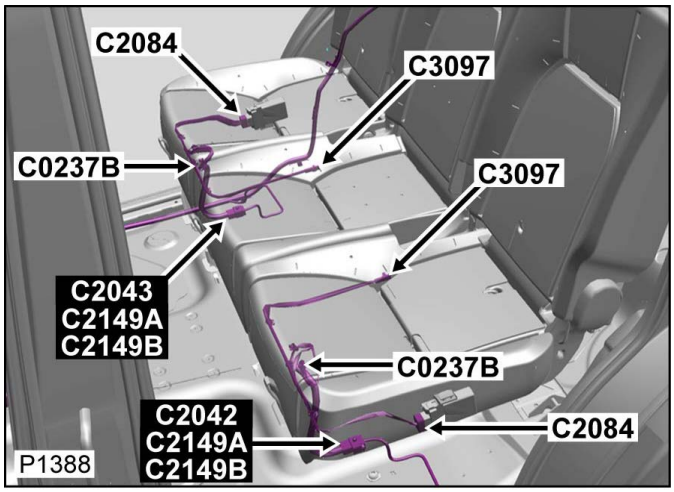

Part No.: YPC904030

Colour: LIGHT GREY

Cavities: 12WY

Harness: SEAT REAR HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	B	592	C2149A	-	-	-	-	-	-	-
1	1.5	B	572	C2149B	-	-	-	-	-	-	-
3	0.5	BG	592	C0237A	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	BG	572	C0237B	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	LG	592	C0237A	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	LG	572	C0237B	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
5	1.5	LGW	592	S/JOINT SJ112	-	-	-	-	-	-	-
5	1.5	LGW	572	S/JOINT SJ111	-	-	-	-	-	-	-
6	1.5	K	592	C0237A	-	-	-	-	-	-	-
6	1.5	K	572	C0237B	-	-	-	-	-	-	-
7	1.5	UK	592	C3096	-	-	-	-	-	-	-
7	1.5	UK	572	C3097	-	-	-	-	-	-	-
8	0.5	UK	592	C2149A	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
8	0.35	UK	572	C2149B	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	G	592	C2149A	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	G	572	C2149B	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	U	592	C2149A	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	U	572	C2149B	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
12	1.5	LGW	592	S/JOINT SJ112	-	-	-	-	-	-	-
12	1.5	LGW	572	S/JOINT SJ111	-	-	-	-	-	-	-

Click here to print

Connector: C2087

CONNECTOR HOUSING NOT SERVICEABLE

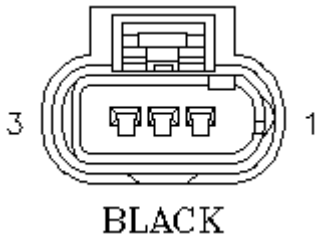

Part No.: YPC913370

Colour: BLACK


Cavities: 3WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Ignition coil-7 - PV8

Location: Top of engine - RH side

Qualifier:

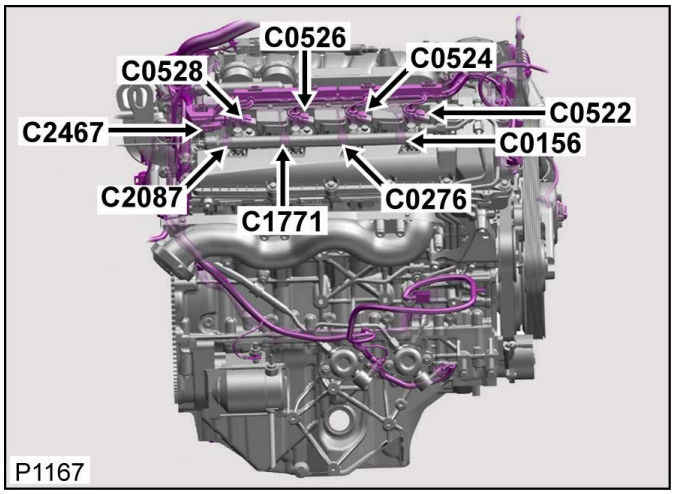


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	GP	ALL	C0634
2	0.5	B	ALL	S/JOINT PIS26
3	0.5	W	ALL	S/JOINT PIS20

Click here to print

Connector: C2088

CONNECTOR HOUSING NOT SERVICEABLE

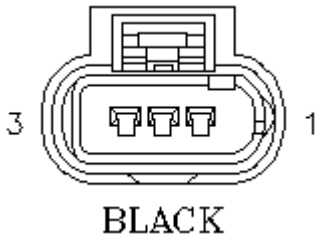

Part No.: YPC913370

Colour: BLACK


Cavities: 3WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Ignition coil-8 - PV8

Location: Top of engine - LH side

Qualifier:

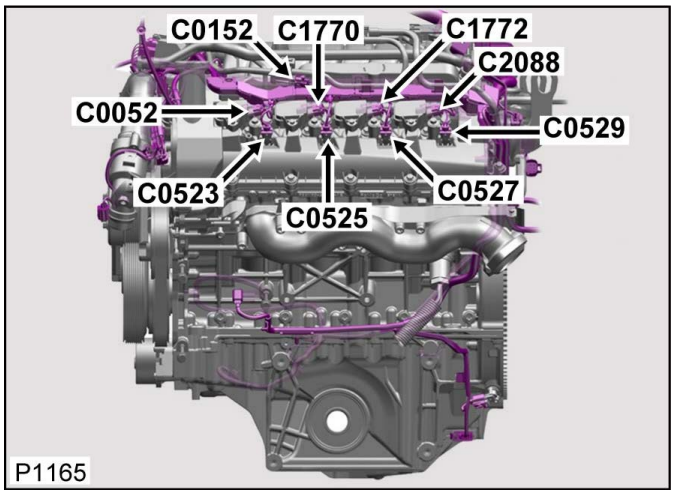


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	UN	ALL	C0634
2	0.5	B	ALL	S/JOINT PIS21
3	0.5	W	ALL	S/JOINT PIS27

Click here to print

Connector: **C2099**

CONNECTOR HOUSING SERVICEABLE

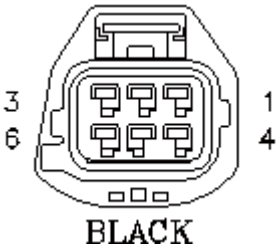

Part No.: YPC800230

Colour: BLACK


Cavities: 6WY

Harness: AIR SUSPENSION HARNESS

Description: Front control valve

Location: Behind RH side of front bumper

Qualifier:

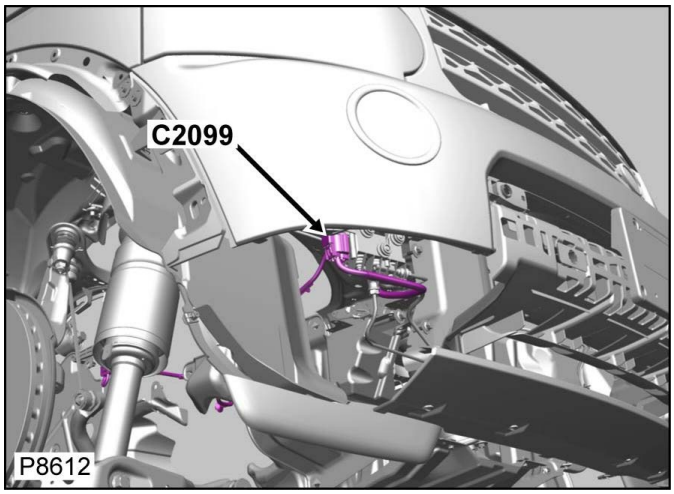


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	BY	419	C3010	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	1.0	BG	419	C3010	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	1.0	BP	419	C3010	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	1.0	BW	419	C3010	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	1.0	BU	419	C3010	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	1.0	BO	419	C3010	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C2101**

CONNECTOR HOUSING SERVICEABLE

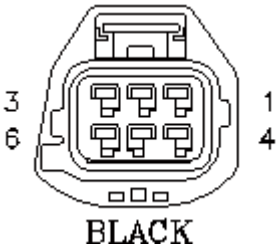

Part No.: YPC800230

Colour: BLACK


Cavities: 6WY

Harness: CHASSIS HARNESS

Description: Rear control valve

Location: Below LH rear wheelarch

Qualifier:

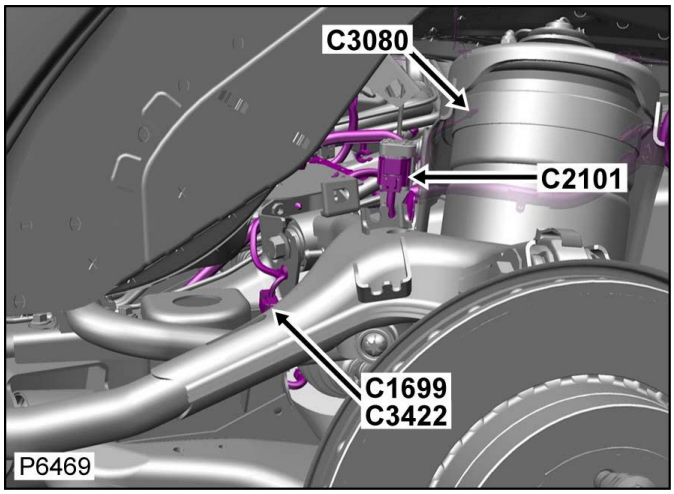

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	BP	419	C0390	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	1.0	BO	419	C0390	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	1.0	BY	419	C0390	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	1.0	BW	419	C0390	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	1.0	BU	419	C0390	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	1.0	BG	419	C0390	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C2102T

CONNECTOR HOUSING NOT SERVICEABLE

Description: Amplifier-power

Location: Behind luggage compartment carpet RH side

Qualifier:

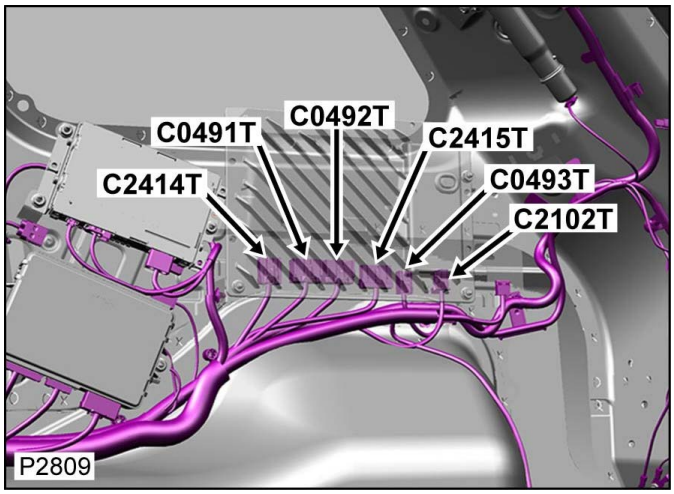

ASSEMBLY

Part No.: XUD812750

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	656T	C2249T
1	POF	O	658T	C2972T
1	POF	O	689T	C2980T
1	POF	O	866T	C3092T
1	POF	O	659T	C2577T
1	POF	O	662T	C2248T
1	POF	O	869T	C2615T
1	POF	O	687T	C2617T
1	POF	O	1039T	C2978T
1	POF	O	1038T	C2976T
2	POF	O	656T	C2249T
2	POF	O	658T	C3759T
2	POF	O	689T	C2106
2	POF	O	866T	C3759T
2	POF	O	659T	C2491T
2	POF	O	662T	C3759T
2	POF	O	869T	C3759T
2	POF	O	687T	C2491T
2	POF	O	1039T	C2491T
2	POF	O	1038T	C2106

Click here to print


Connector: C2104

CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Navigation system-Japan

Location: Beneath LH Front seat

Qualifier:

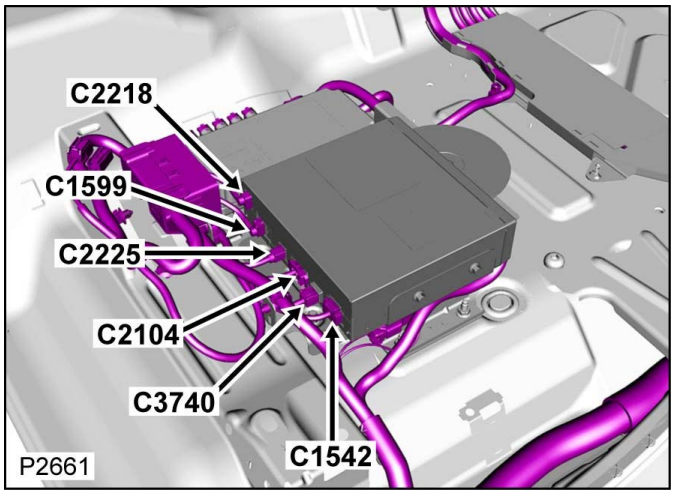

ASSEMBLY

Part No.: XUD812700

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	1039S	C2106
1	POF	O	1038S	C2106
1	POF	O	1039T	C2106
1	POF	O	1038T	C2106
2	POF	O	1039S	C2978S
2	POF	O	1038S	C2976S
2	POF	O	1039T	C2978T
2	POF	O	1038T	C2976T

Click here to print

Connector: C2105


CONNECTOR HOUSING NOT SERVICEABLE

Description: Audio head unit

Location: Behind front touch screen display

Qualifier:

ASSEMBLY

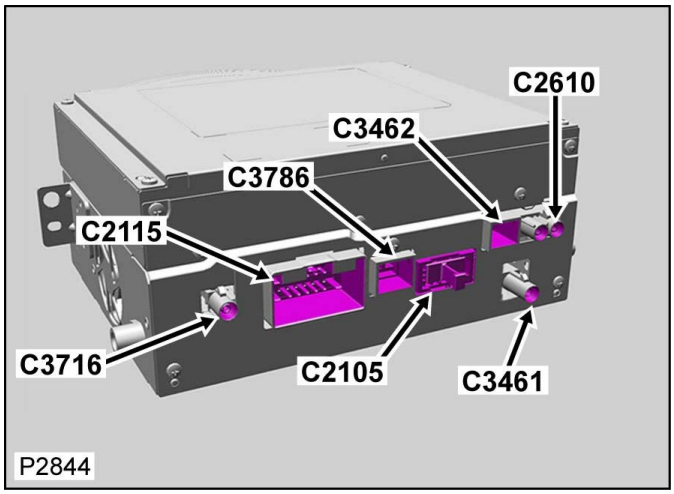

Part No.: XUD812600

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE LINK HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	452	C2825
2	POF	O	452	C2867

Click here to print

Connector: C2106


CONNECTOR HOUSING NOT SERVICEABLE

Description: Receiver-Television

Location: Beneath RH Front seat

Qualifier:

ASSEMBLY

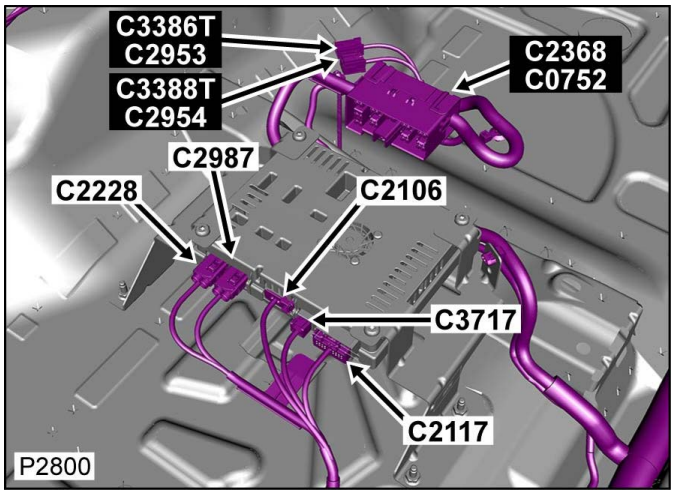

Part No.: XUD812630

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	689S	C2102S
1	POF	O	866S	C3759S
1	POF	O	869S	C2491S
1	POF	O	687S	C2491S
1	POF	O	1039S	C2491S
1	POF	O	1038S	C2102S
1	POF	O	689T	C2102T
1	POF	O	866T	C3759T
1	POF	O	869T	C2491T
1	POF	O	687T	C2491T
1	POF	O	1039T	C2491T
1	POF	O	1038T	C2102T
2	POF	O	689S	C2980S
2	POF	O	866S	C3092S
2	POF	O	869S	C2615S
2	POF	O	687S	C2617S
2	POF	O	1039S	C2104
2	POF	O	1038S	C2104
2	POF	O	689T	C2980T
2	POF	O	866T	C3092T
2	POF	O	869T	C2615T
2	POF	O	687T	C2617T
2	POF	O	1039T	C2104
2	POF	O	1038T	C2104

Click here to print


Connector: C2115

CONNECTOR HOUSING NOT SERVICEABLE

Description: Audio head unit

Location: Behind front touch screen display

Qualifier:

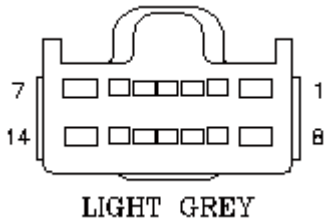


Part No.: YPC910190

Colour: LIGHT GREY

Cavities: 14WY

Harness: FACIA COMPOSITE HARNESS

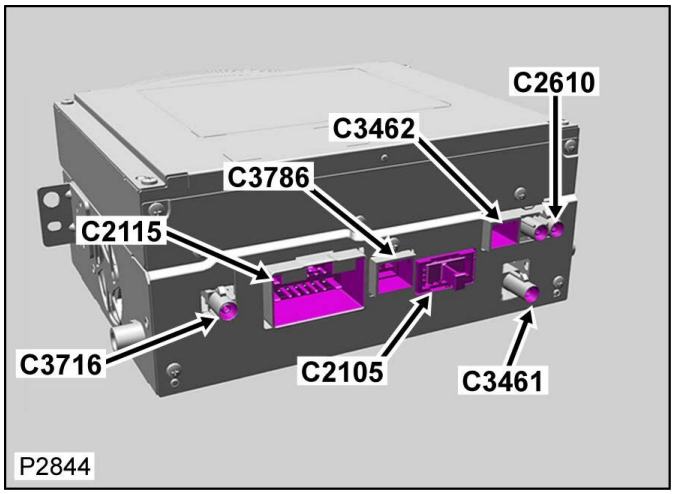

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	PU	124	C0582	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	0.35	U	124L	C2640L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	U	124R	C2640R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	R	124L	C1167L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	R	124R	C1167R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	B	124L	C1167L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	B	124R	C1167R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	R	124SL	C1167L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	R	124TL	C1167L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	R	124SR	C1167R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	R	124TR	C1167R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	U	124SL	C1167L	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	U	124TL	C1167L	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	U	124SR	C1167R	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	U	124TR	C1167R	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
8	2.5	B	124L	S/JOINT SJ590L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
8	2.5	B	124R	S/JOINT SJ590R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
11	0.5	WG	124	S/JOINT SJ1202	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

12	0.5	YO	124	S/JOINT SJ1201	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
13	0.5	WG	124	S/JOINT SJ1202	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	YO	124	S/JOINT SJ1201	418-411-46	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2116T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Rear seat entertainment module

Location: Behind luggage compartment carpet RH side

Qualifier:



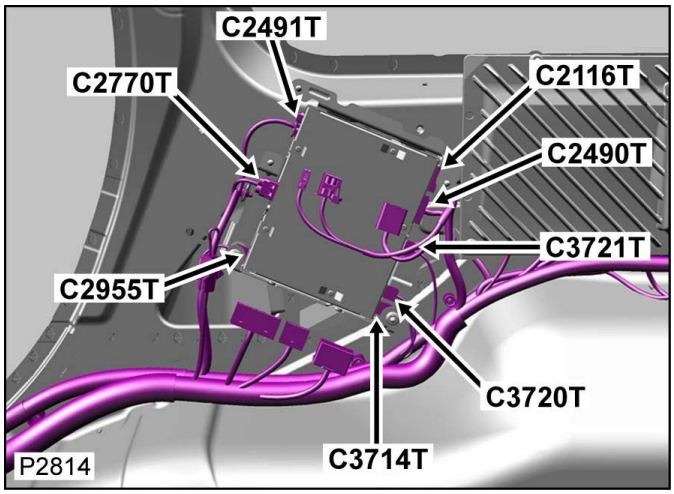

Part No.: YPC913180

Colour: GREY

Cavities: 14WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	WG	514T	S/JOINT SJ11
3	0.5	YO	514T	C3755T
7	0.75	PW	514T	C2639
8	0.35	NU	514T	S/JOINT SJ10
10	0.5	B	514T	C3755T
14	1.0	B	514T	C2648T

Click here to print

Connector: C2117


CONNECTOR HOUSING NOT SERVICEABLE

Description: Receiver-Television

Location: Beneath RH Front seat

Qualifier:



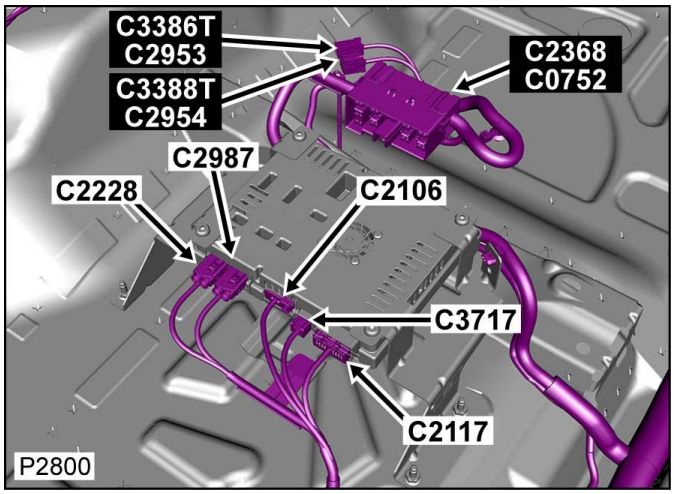

Part No.: YPC900520

Colour: GREY

Cavities: 20WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	R	310	S/JOINT SJ520	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.75	B	310	C2646	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	B	1057	C3275	-	-	-	-	-	-	-
4	0.5	B	1058S	C3275	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	B	1058T	C3275	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	R	1057	S/JOINT SJ690	-	-	-	-	-	-	-
5	0.5	R	1058S	S/JOINT SJ690	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	R	1058T	S/JOINT SJ690	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2126

CONNECTOR HOUSING NOT SERVICEABLE

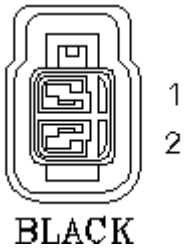

Part No.: YPC500750

Colour: BLACK


Cavities: 2WY

Harness: CABIN HARNESS

Description: Sensor-Side impact-LH side-Front

Location: Base of 'B' post LH side

Qualifier:

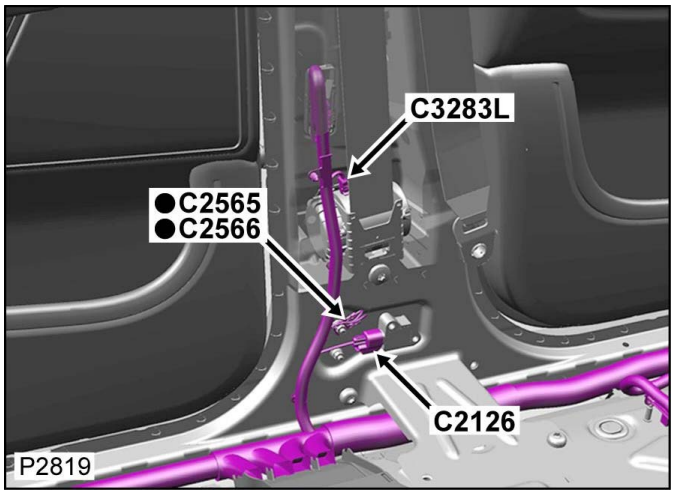


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WR	216	C0256	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	WLG	216	C0256	418-411-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2127

CONNECTOR HOUSING NOT SERVICEABLE

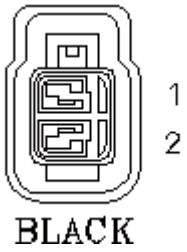

Part No.: YPC500750

Colour: BLACK


Cavities: 2WY

Harness: CABIN HARNESS

Description: Sensor-Side impact-RH side-Front

Location: Base of 'B' post RH side

Qualifier:

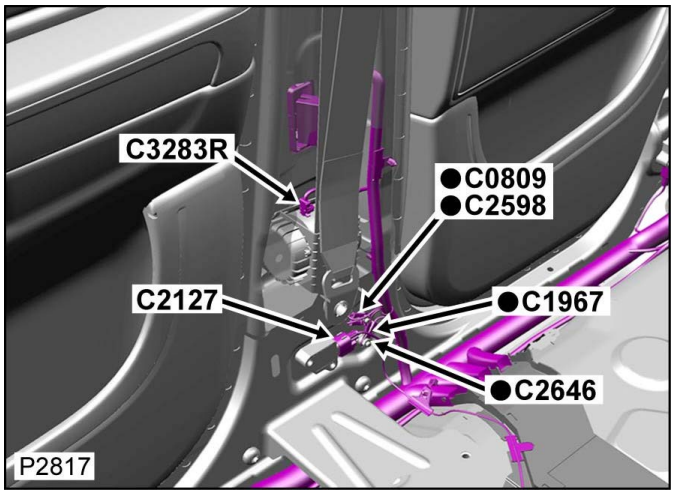

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	RW	216	C0256	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RLG	216	C0256	418-411-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C2128

CONNECTOR HOUSING NOT SERVICEABLE

Description: Sensor-Safety belt tension

Location: Outer edge of seat

Qualifier:

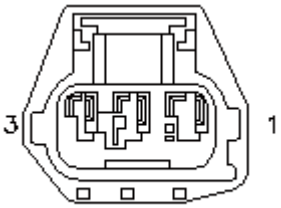


BLACK

Part No.: YPC500530

Colour: BLACK

Cavities: 3WY

Harness: SEAT FRONT HARNESS

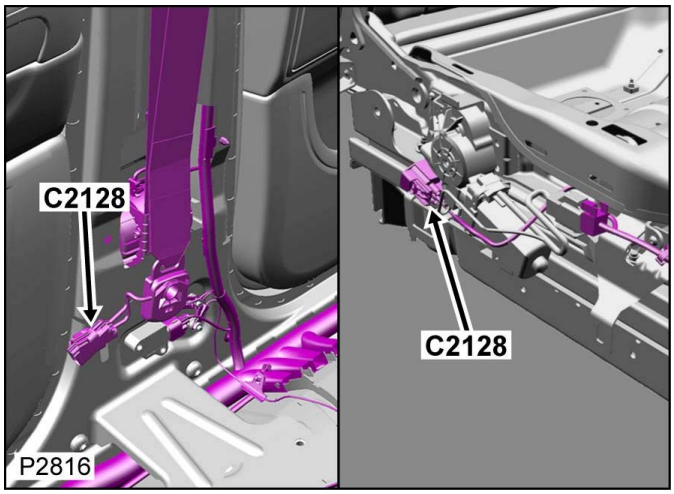


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	G	459	C0962	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	KO	459	C0962	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	BK	459	C0962	418-411-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2130

CONNECTOR HOUSING NOT SERVICEABLE

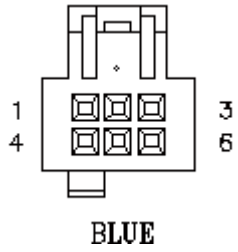

BLUE

Part No.: YPH900970

Colour: BLUE


Cavities: 6WY

Harness: ATC RHD HARNESS

Description: LH air temperature door motor

Location: Behind LH side of Instrument panel

Qualifier:

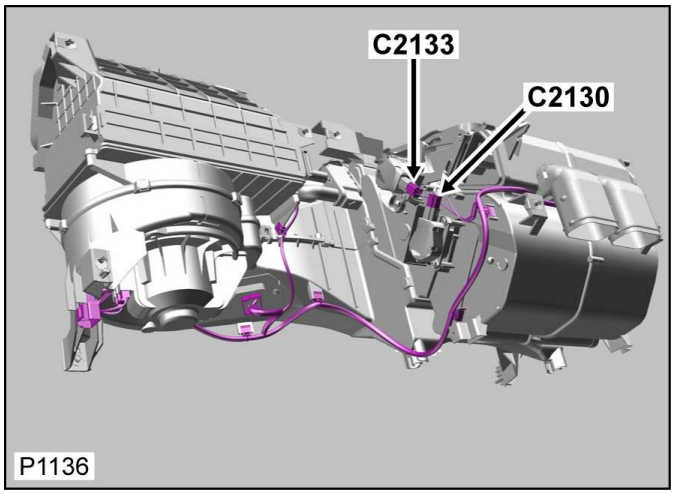


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	0.5	Y	499	C2131	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.5	GY	499	S/JOINT SJ1	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
5	0.5	U	499	C2133	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
6	0.5	O	499	S/JOINT SJ2	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2131

CONNECTOR HOUSING NOT SERVICEABLE

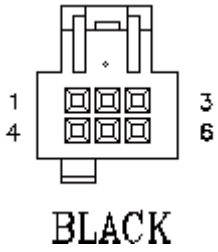

BLACK

Part No.: YPH900960

Colour: BLACK


Cavities: 6WY

Harness: ATC RHD HARNESS

Description: RH air temperature door motor

Location: Climate control assembly-Driver side

Qualifier:

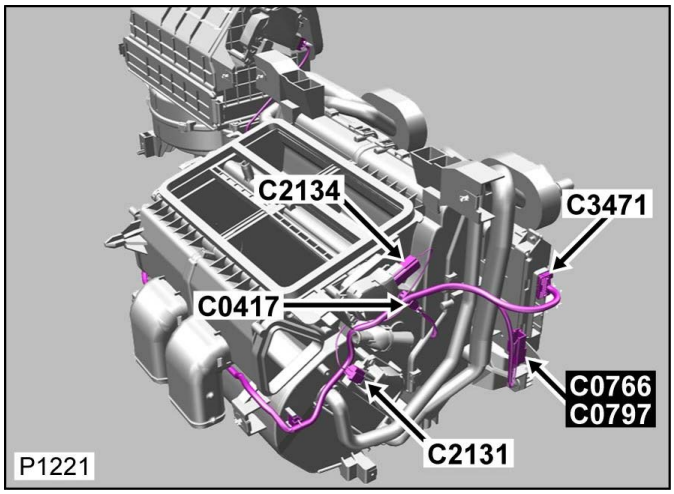

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	0.5	RG	499	C2134	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.5	GY	499	S/JOINT SJ1	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
5	0.5	Y	499	C2130	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
6	0.5	O	499	S/JOINT SJ2	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2133

CONNECTOR HOUSING NOT SERVICEABLE


Description: Motor-air distribution-Feet / face

Location: Behind LH side of Instrument panel

Qualifier:

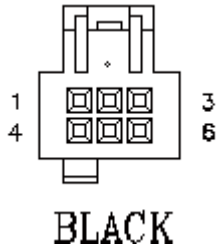

BLACK

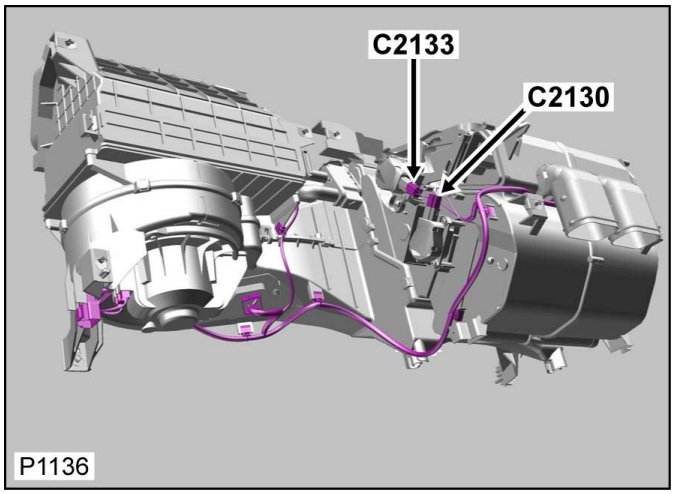

Part No.: YPH900960

Colour: BLACK

Cavities: 6WY

Harness: ATC RHD HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	0.5	U	499	C2130	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.5	GY	499	S/JOINT SJ1	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
6	0.5	O	499	S/JOINT SJ2	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2134

CONNECTOR HOUSING NOT SERVICEABLE

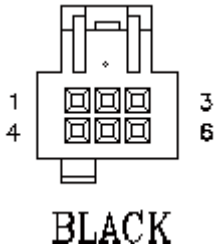

BLACK

Part No.: YPH900960

Colour: BLACK


Cavities: 6WY

Harness: ATC RHD HARNESS

Description: Screen air distribution door motor

Location: Climate control assembly-Driver side

Qualifier:

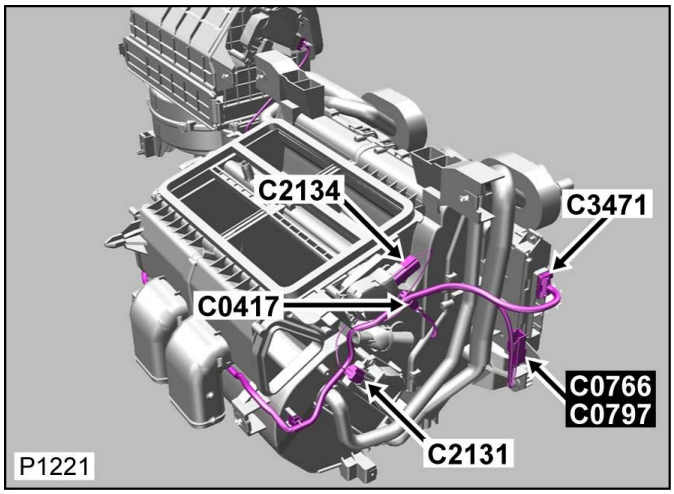


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	0.5	RY	499	S/JOINT SJ4	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.5	GY	499	S/JOINT SJ1	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
5	0.5	RG	499	C2131	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
6	0.5	O	499	S/JOINT SJ2	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: **C2138L**

CONNECTOR HOUSING SERVICEABLE

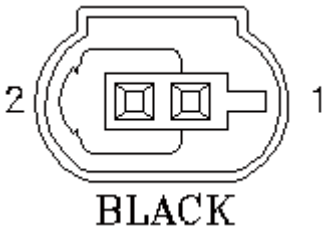

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Fan-E-box

Location: Passenger side of engine compartment

Qualifier:

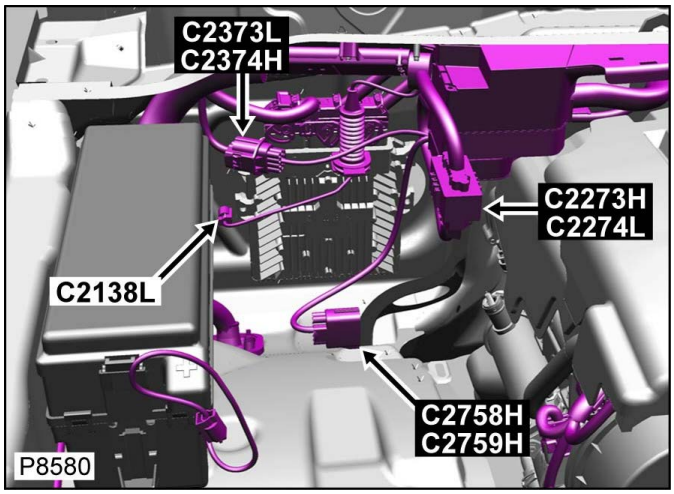


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	R	797L	C0872L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	RU	797L	S/JOINT SJ559	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C2138R**

CONNECTOR HOUSING SERVICEABLE

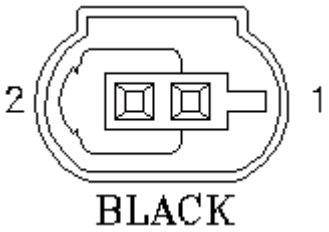

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Fan-E-box

Location: Passenger side of engine compartment

Qualifier:

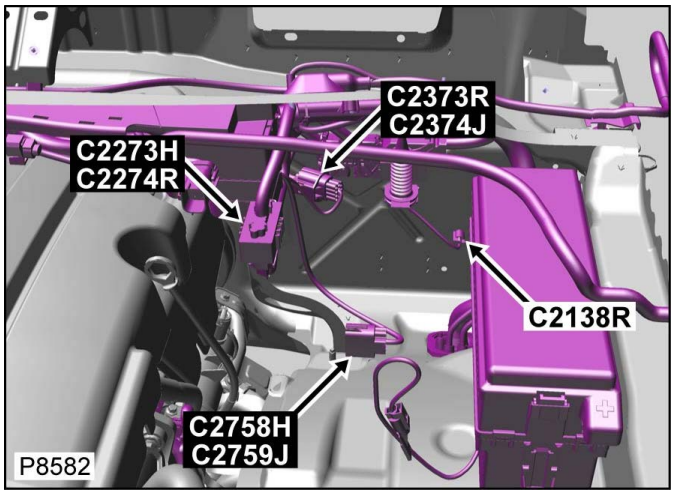

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	R	797R	C0872R	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	RU	797R	S/JOINT SJ1559	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2147


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Steering-wheel-RH

Location: In center of steering wheel

Qualifier:



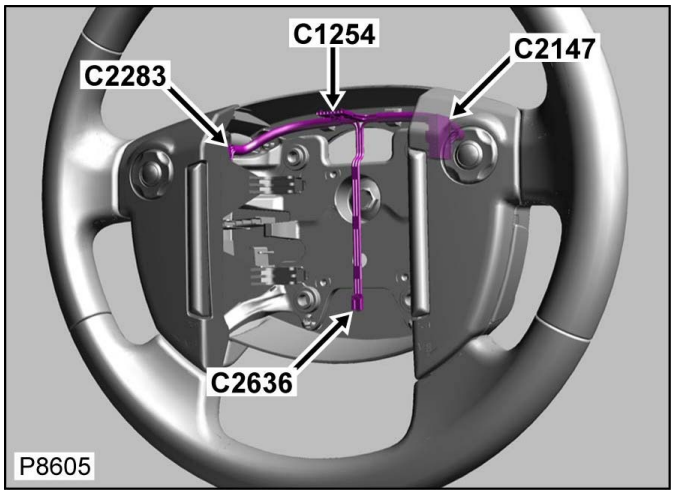

Part No.: CHCT-14489-AKA

Colour: NATURAL

Cavities: 10WY

Harness: STEERING WHEEL HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
3	0.35	K	499	C2283
4	0.35	N	499	C2283
5	0.35	Y	499	C1254
6	0.35	S	499	C2283
7	0.35	P	499	C2283
8	0.35	B	499	C2636
9	0.35	R	499	C2283
10	0.35	U	499	C1254

Click here to print

Connector: **C2149A**

CONNECTOR HOUSING SERVICEABLE

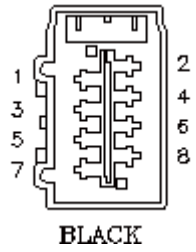

BLACK

Part No.: YPC901230

Colour: BLACK


Cavities: 8WY

Harness: SEAT REAR HARNESS

Description: Rear seat harness to main harness

Location: Beneath rear seat

Qualifier:

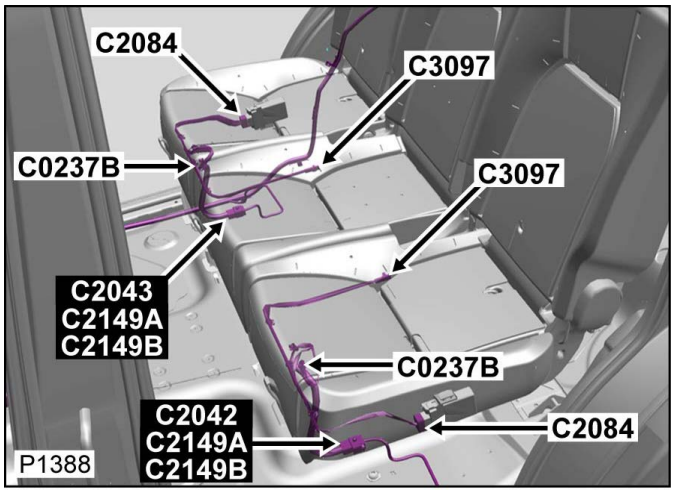


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	UK	592	C2084	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	G	592	C2084	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	U	592	C2084	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
4	1.5	B	592	C2084	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
5	2.5	LGW	592	S/JOINT SJ112	418-411-16	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: **C2149B**

CONNECTOR HOUSING SERVICEABLE

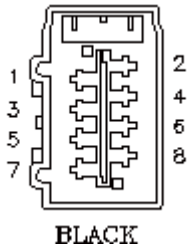

BLACK

Part No.: YPC901230

Colour: BLACK


Cavities: 8WY

Harness: SEAT REAR HARNESS

Description: Rear seat harness to main harness

Location: Beneath rear seat

Qualifier:

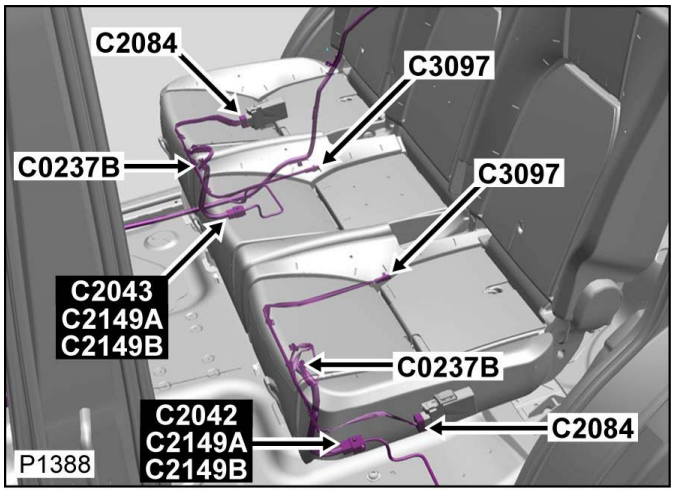

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	UK	572	C2084	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	G	572	C2084	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	U	572	C2084	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
4	1.5	B	572	C2084	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
5	2.5	LGW	572	S/JOINT SJ111	418-411-16	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C2153L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Integrated control panel-Lower

Location: Behind center of Instrument panel

Qualifier: LHD condition illustrated

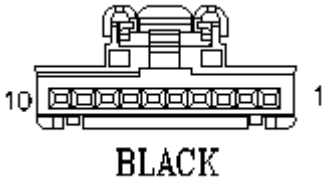

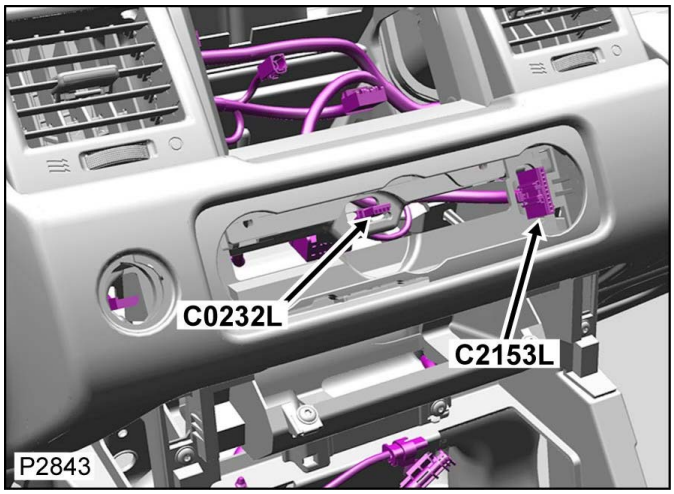

Part No.: YPC908690

Colour: BLACK

Cavities: 10WY

Harness: FACIA COMPOSITE HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	139L	S/JOINT SJ661	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.35	YW	139L	S/JOINT SJ966	-	-	-	-	-	-	-
4	0.35	YU	139L	S/JOINT SJ976	-	-	-	-	-	-	-
10	0.5	GK	139L	S/JOINT SJ552	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2153R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Integrated control panel-Lower

Location: Behind center of Instrument panel

Qualifier: RHD condition illustrated

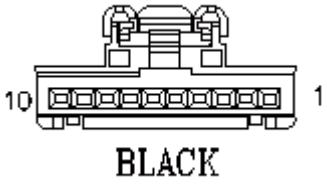

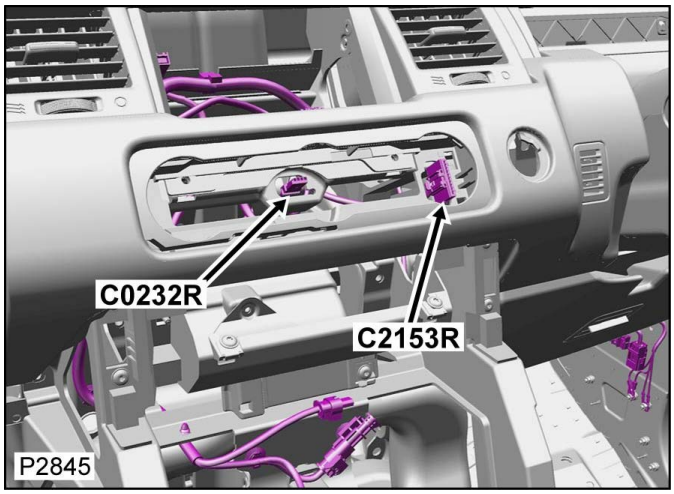

Part No.: YPC908690

Colour: BLACK

Cavities: 10WY

Harness: FACIA COMPOSITE HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	200R	S/JOINT SJ661	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.35	YW	200R	S/JOINT SJ966	-	-	-	-	-	-	-
4	0.35	YU	200R	S/JOINT SJ976	-	-	-	-	-	-	-
10	0.5	GK	200R	S/JOINT SJ552	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: **C2158T**

CONNECTOR HOUSING SERVICEABLE

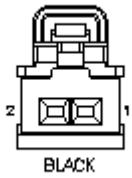

Part No.: YPC908890

Colour: BLACK


Cavities: 2WY

Harness: ICE/NAVIGATION HARNESS

Description: Module-Tuner-DAB

Location: Behind luggage compartment carpet RH side

Qualifier:

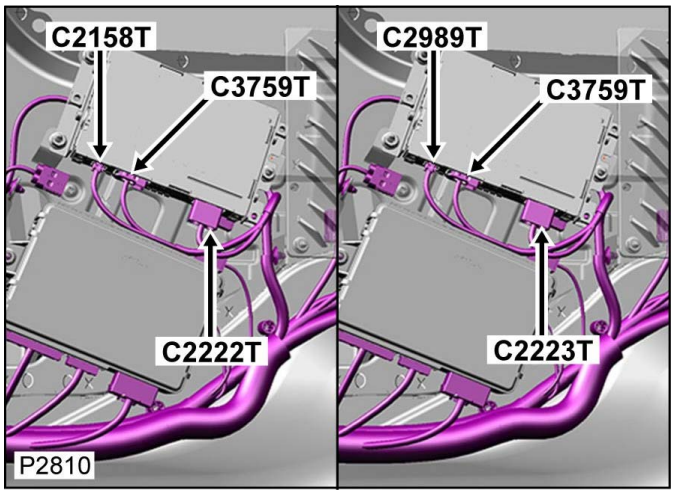

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	R	449T	S/JOINT SJ520	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.75	B	449T	C2647T	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2160T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Keyless vehicle module

Location: Behind luggage compartment carpet RH side

Qualifier:

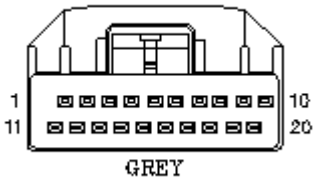

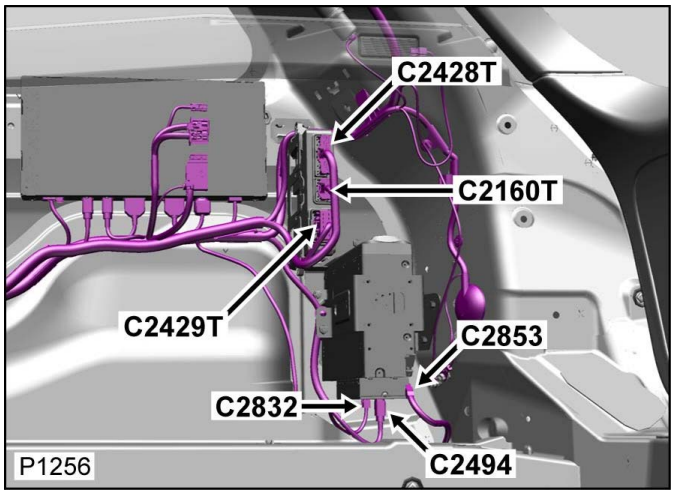

Part No.: YPC803030

Colour: GREY

Cavities: 20WY

Harness: CABIN HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	BW	810T	C3016T
2	0.35	BO	810T	C3016T
3	0.35	GB	410T	C0396
4	0.35	GR	410T	C0396
5	0.35	NP	410T	C0435
6	0.35	NU	410T	C0435
7	0.35	OR	810T	C3017T
8	0.35	OS	810T	C3017T
9	0.35	PN	410T	C0398
10	0.35	PO	410T	C0398
11	0.35	RG	810T	C1165
12	0.35	RU	810T	C1165
13	0.35	SP	810T	C3018T
14	0.35	SY	810T	C3018T
15	0.35	UW	810T	C1165
16	0.35	UK	810T	C1165
17	0.35	WK	410T	C2433T
18	0.35	WG	410T	C2433T
19	0.35	YS	410T	C0436
20	0.35	YO	410T	C0436

Click here to print

Connector: **C2162T**

CONNECTOR HOUSING SERVICEABLE

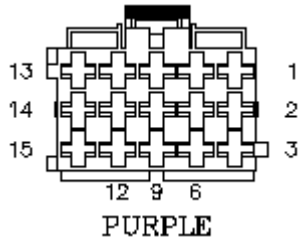

Part No.: YPC114190

Colour: PURPLE


Cavities: 15WY

Harness: CABIN HARNESS

Description: Rear differential control module

Location: Behind luggage compartment carpet LH side

Qualifier:

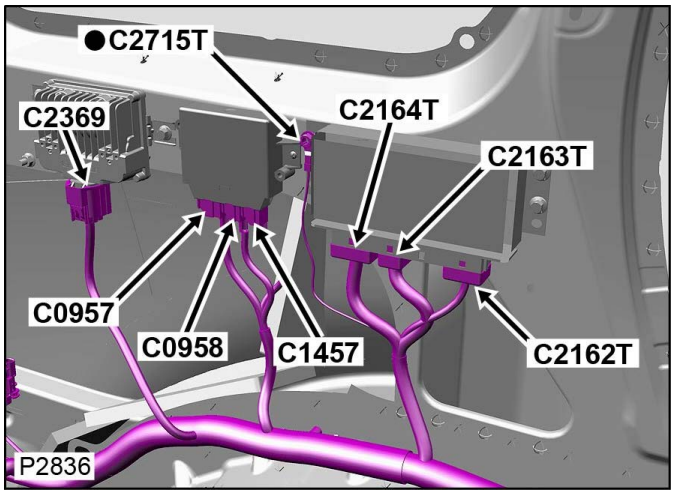


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	0.5	YB	401T	S/JOINT SJ1010	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	YN	401T	S/JOINT SJ1009	418-549-55	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C2163T**

CONNECTOR HOUSING SERVICEABLE

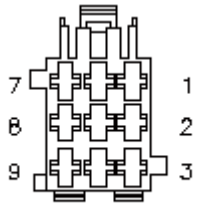

YELLOW

Part No.: YPC114170

Colour: YELLOW


Cavities: 9WY

Harness: CABIN HARNESS

Description: Rear differential control module

Location: Behind luggage compartment carpet LH side

Qualifier:

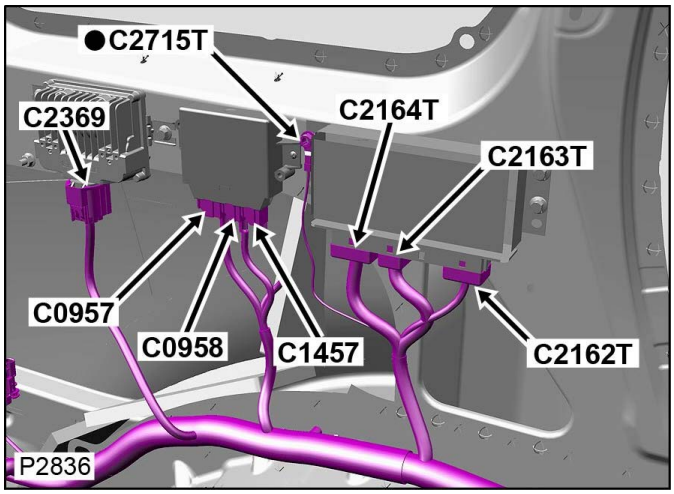


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
3	2.5	B	401T	C2715T	418-549-57	-	418-116A	418-117	418-104	418-113	418-108
4	1.0	R	401T	S/JOINT SJ971	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
6	2.5	B	401T	C2715T	418-549-57	-	418-116A	418-117	418-104	418-113	418-108
7	2.5	PU	401T	S/JOINT SJ542T	418-549-57	-	418-116A	418-117	418-104	418-113	418-108
8	2.5	PU	401T	S/JOINT SJ542T	418-549-57	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C2164T

CONNECTOR HOUSING NOT SERVICEABLE

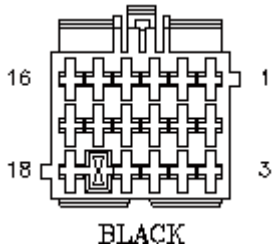

Part No.: YPC800350

Colour: BLACK


Cavities: 17WY

Harness: CABIN HARNESS

Description: Rear differential control module

Location: Behind luggage compartment carpet LH side

Qualifier:

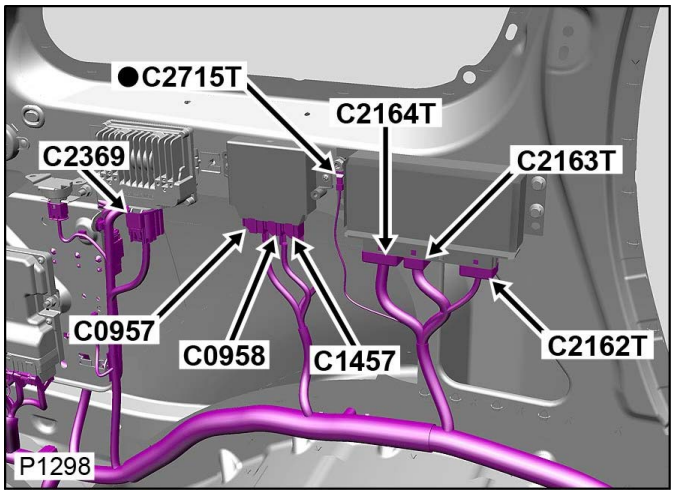


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	G	401T	C0376	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
3	2.5	R	401T	C0376	418-549-57	-	418-116A	418-117	418-104	418-113	418-108
4	0.5	S	401T	C0376	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	O	401T	C0376	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	R	401T	C0376	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	N	401T	C0376	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	Y	401T	C0376	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
12	2.5	U	401T	C0376	418-549-57	-	418-116A	418-117	418-104	418-113	418-108
13	0.5	U	401T	C0376	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
16	0.5	W	401T	C0376	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
17	1.0	G	401T	C0376	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
18	1.0	R	401T	C0376	418-549-55	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2165

CONNECTOR HOUSING NOT SERVICEABLE

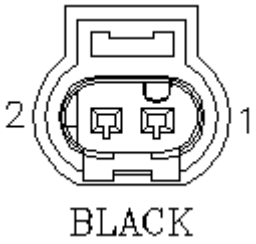

Part No.: YPC801710

Colour: BLACK


Cavities: 2WY

Harness: TRANSMISSION AUTO-PETROL HARNESS

Description: Solenoid-Mode-selector

Location: LH side of transfer box

Qualifier:

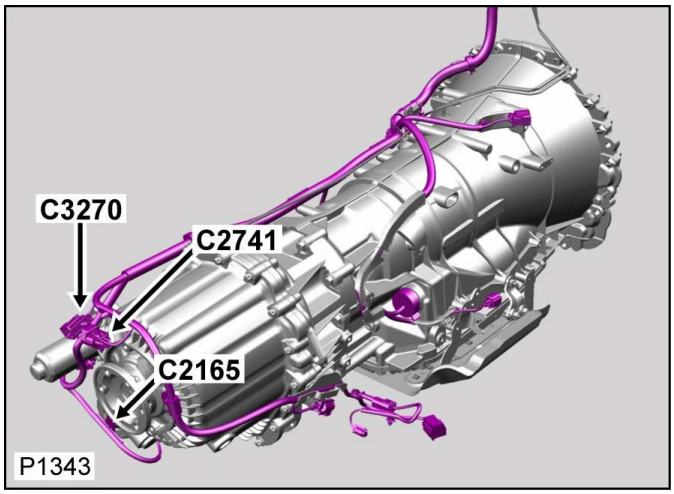


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	G	282L	C1855L
1	1.0	G	281L	C1855A
1	1.0	G	282R	C1855R
1	1.0	G	281R	C1855B
2	1.0	S	282L	C1855L
2	1.0	S	281L	C1855A
2	1.0	S	282R	C1855R
2	1.0	S	281R	C1855B

Click here to print

Connector: C2165

CONNECTOR HOUSING NOT SERVICEABLE

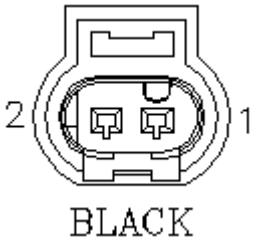

Part No.: YPC801710

Colour: BLACK


Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Solenoid-Mode-selector

Location: LH side of transfer box

Qualifier:

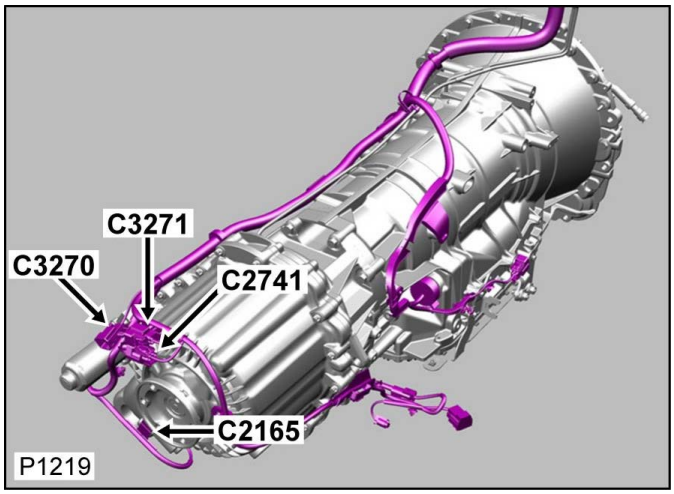


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	G	729L	C1855H
1	1.0	G	729R	C1855J
1	1.0	G	993L	C1855M
1	1.0	G	993R	C1855N
2	1.0	S	729L	C1855H
2	1.0	S	729R	C1855J
2	1.0	S	993L	C1855M
2	1.0	S	993R	C1855N

Click here to print

Connector: C2165A

CONNECTOR HOUSING NOT SERVICEABLE

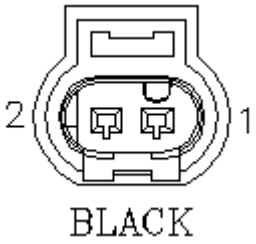

Part No.: YPC801710

Colour: BLACK


Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Solenoid-Mode-selector

Location: Rear of transfer box

Qualifier:

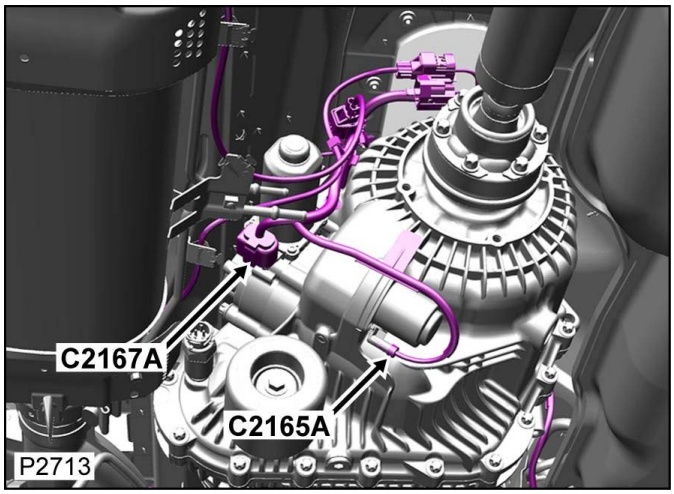

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	G	982L	C1855P
1	1.0	G	982R	C1855Q
2	1.0	S	982L	C1855P
2	1.0	S	982R	C1855Q

Click here to print


Connector: C2167


CONNECTOR HOUSING NOT SERVICEABLE

Description: Motor-Transfer box

Location: LH side of transfer box

Qualifier:

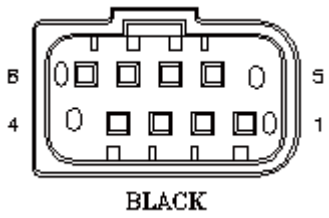

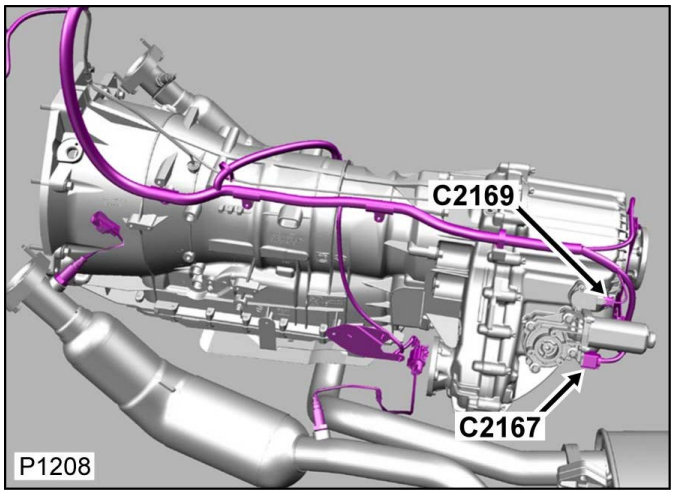

Part No.: YPC801730

Colour: BLACK

Cavities: 8WY

Harness: TRANSMISSION AUTO-PETROL HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	N	282L	C1855L	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108
1	2.5	N	281L	C1855A	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108
1	2.5	N	282R	C1855R	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108
1	2.5	N	281R	C1855B	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108
2	0.5	GY	282L	C1855L	-	-	-	-	-	-	-
2	0.5	GY	281L	C1855A	-	-	-	-	-	-	-
2	0.5	GY	282R	C1855R	-	-	-	-	-	-	-
2	0.5	GY	281R	C1855B	-	-	-	-	-	-	-
3	0.5	UR	282L	C1855L	-	-	-	-	-	-	-
3	0.5	UR	281L	C1855A	-	-	-	-	-	-	-
3	0.5	UR	282R	C1855R	-	-	-	-	-	-	-
3	0.5	UR	281R	C1855B	-	-	-	-	-	-	-
4	0.5	WR	282L	C1855L	-	-	-	-	-	-	-
4	0.5	WR	281L	C1855A	-	-	-	-	-	-	-
4	0.5	WR	282R	C1855R	-	-	-	-	-	-	-
4	0.5	WR	281R	C1855B	-	-	-	-	-	-	-
6	0.5	GR	282L	C1855L	-	-	-	-	-	-	-
6	0.5	GR	281L	C1855A	-	-	-	-	-	-	-
6	0.5	GR	282R	C1855R	-	-	-	-	-	-	-
6	0.5	GR	281R	C1855B	-	-	-	-	-	-	-
7	0.5	RY	282L	C1855L	-	-	-	-	-	-	-
7	0.5	RY	281L	C1855A	-	-	-	-	-	-	-
7	0.5	RY	282R	C1855R	-	-	-	-	-	-	-
7	0.5	RY	281R	C1855B	-	-	-	-	-	-	-
8	2.5	R	282L	C1855L	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108
8	2.5	N	281L	C1855A	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108
											418-

8	2.5	R	282R	C1855R	418-549-35	418-612	418-116A	418-117	418-104	418-113	108
8	2.5	R	281R	C1855B	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C2167


CONNECTOR HOUSING NOT SERVICEABLE

Description: Motor-Transfer box

Location: LH side of transfer box

Qualifier:

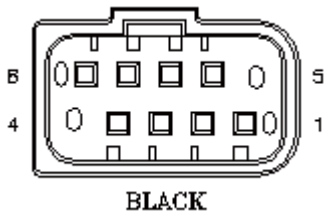

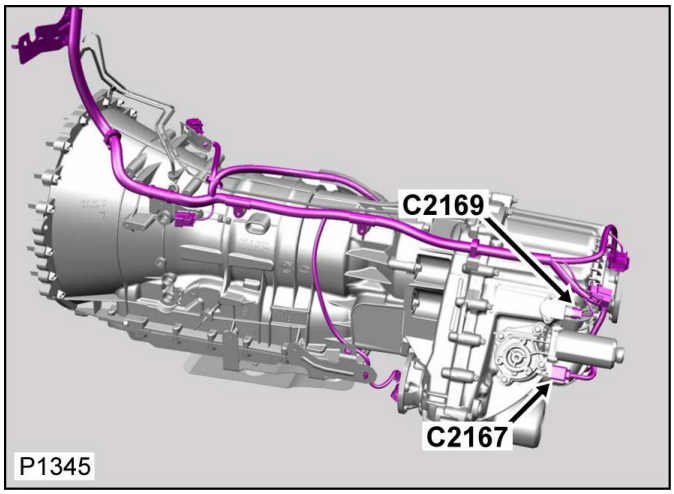

Part No.: YPC801730

Colour: BLACK

Cavities: 8WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	N	729L	C1855H	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108
1	2.5	N	729R	C1855J	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108
1	2.5	N	993L	C1855M	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108
1	2.5	N	993R	C1855N	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108
2	0.5	GY	729L	C1855H	-	-	-	-	-	-	-
2	0.5	GY	729R	C1855J	-	-	-	-	-	-	-
2	0.5	GY	993L	C1855M	-	-	-	-	-	-	-
2	0.5	GY	993R	C1855N	-	-	-	-	-	-	-
3	0.5	UR	729L	C1855H	-	-	-	-	-	-	-
3	0.5	UR	729R	C1855J	-	-	-	-	-	-	-
3	0.5	UR	993L	C1855M	-	-	-	-	-	-	-
3	0.5	UR	993R	C1855N	-	-	-	-	-	-	-
4	0.5	WR	729L	C1855H	-	-	-	-	-	-	-
4	0.5	WR	729R	C1855J	-	-	-	-	-	-	-
4	0.5	WR	993L	C1855M	-	-	-	-	-	-	-
4	0.5	WR	993R	C1855N	-	-	-	-	-	-	-
6	0.5	GR	729L	C1855H	-	-	-	-	-	-	-
6	0.5	GR	729R	C1855J	-	-	-	-	-	-	-
6	0.5	GR	993L	C1855M	-	-	-	-	-	-	-
6	0.5	GR	993R	C1855N	-	-	-	-	-	-	-
7	0.5	RY	729L	C1855H	-	-	-	-	-	-	-
7	0.5	RY	729R	C1855J	-	-	-	-	-	-	-
7	0.5	RY	993L	C1855M	-	-	-	-	-	-	-
7	0.5	RY	993R	C1855N	-	-	-	-	-	-	-
8	2.5	R	729L	C1855H	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108
8	2.5	R	729R	C1855J	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108
											418-

8	2.5	R	993L	C1855M	418-549-35	418-612	418-116A	418-117	418-104	418-113	108
8	2.5	R	993R	C1855N	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C2167A


CONNECTOR HOUSING NOT SERVICEABLE

Description: Motor-Transfer box

Location: Rear of transfer box

Qualifier:

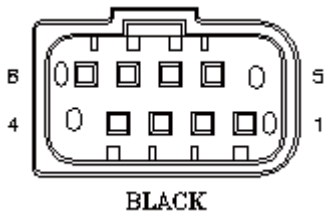

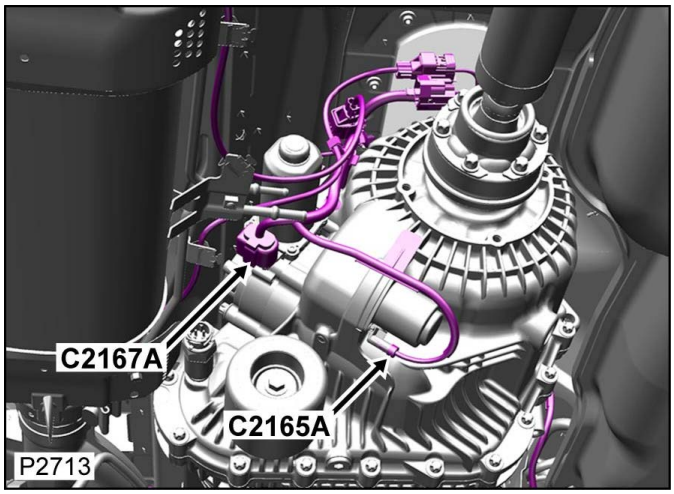

Part No.: YPC801730

Colour: BLACK

Cavities: 8WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	N	982L	C1855P	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108
1	2.5	N	982R	C1855Q	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108
2	0.5	GY	982L	C1855P	-	-	-	-	-	-	-
2	0.5	GY	982R	C1855Q	-	-	-	-	-	-	-
3	0.5	UR	982L	C1855P	-	-	-	-	-	-	-
3	0.5	UR	982R	C1855Q	-	-	-	-	-	-	-
4	0.5	WR	982L	C1855P	-	-	-	-	-	-	-
4	0.5	WR	982R	C1855Q	-	-	-	-	-	-	-
6	0.5	GR	982L	C1855P	-	-	-	-	-	-	-
6	0.5	GR	982R	C1855Q	-	-	-	-	-	-	-
7	0.5	RY	982L	C1855P	-	-	-	-	-	-	-
7	0.5	RY	982R	C1855Q	-	-	-	-	-	-	-
8	2.5	R	982L	C1855P	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108
8	2.5	R	982R	C1855Q	418-549-35	418-612	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C2168

CONNECTOR HOUSING NOT SERVICEABLE

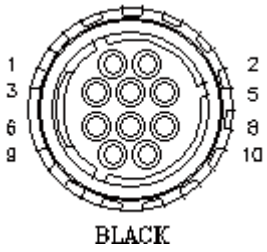

Part No.: YPC114480

Colour: BLACK


Cavities: 10WY

Harness: CHASSIS HARNESS

Description: Actuator-Rear differential

Location: Beneath rear of vehicle - Center

Qualifier:

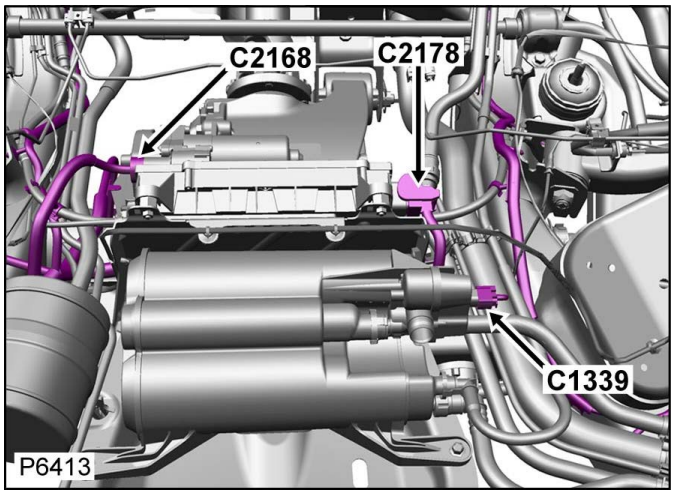


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	R	401	C0390
2	1.0	R	401	C0390
3	0.5	G	401	C0390
4	0.5	N	401	C0390
5	0.5	S	401	C0390
6	0.5	O	401	C0390
7	0.5	U	401	C0390
8	0.5	W	401	C0390
9	1.0	G	401	C0390
10	2.5	U	401	C0390

Click here to print

Connector: C2169

CONNECTOR HOUSING NOT SERVICEABLE

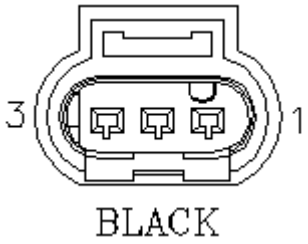

Part No.: YPC801720

Colour: BLACK


Cavities: 3WY

Harness: TRANSMISSION AUTO-PETROL HARNESS

Description: Sensor-Selector-position

Location: LH side of transfer box

Qualifier:

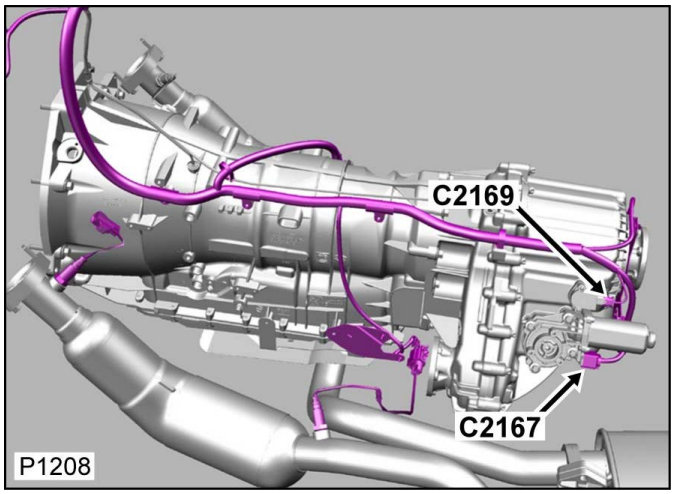


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	UR	282L	C1855L
1	0.5	UR	281L	C1855A
1	0.5	UR	282R	C1855R
1	0.5	UR	281R	C1855B
2	0.5	R	282L	C1855L
2	0.5	R	281L	C1855A
2	0.5	R	282R	C1855R
2	0.5	R	281R	C1855B
3	0.5	RY	282L	C1855L
3	0.5	RY	281L	C1855A
3	0.5	RY	282R	C1855R
3	0.5	RY	281R	C1855B

Click here to print

Connector: C2169

CONNECTOR HOUSING NOT SERVICEABLE

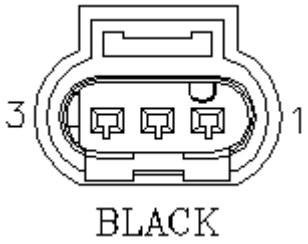

Part No.: YPC801720

Colour: BLACK


Cavities: 3WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Selector-position

Location: LH side of transfer box

Qualifier:

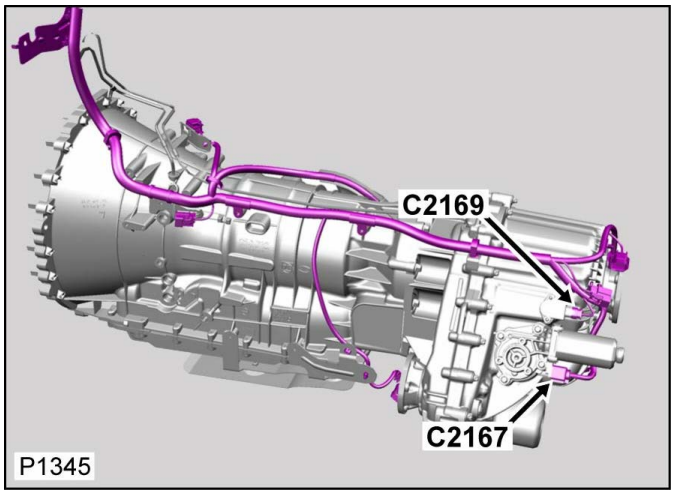


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	UR	729L	C1855H
1	0.5	UR	729R	C1855J
1	0.5	UR	993L	C1855M
1	0.5	UR	993R	C1855N
2	0.5	R	729L	C1855H
2	0.5	R	729R	C1855J
2	0.5	R	993L	C1855M
2	0.5	R	993R	C1855N
3	0.5	RY	729L	C1855H
3	0.5	RY	729R	C1855J
3	0.5	RY	993L	C1855M
3	0.5	RY	993R	C1855N

Click here to print

Connector: **C2169A**

CONNECTOR HOUSING NOT SERVICEABLE

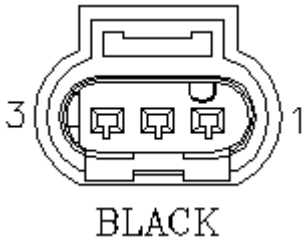

Part No.: YPC801720

Colour: BLACK


Cavities: 3WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Selector-position

Location: Top of transfer box

Qualifier:

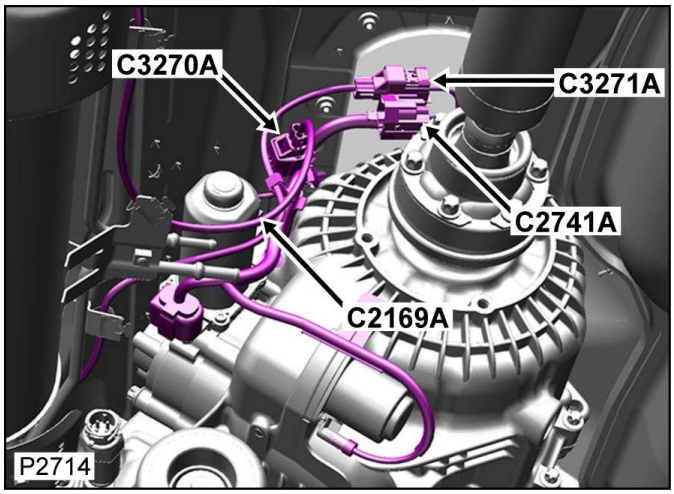


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	UR	982L	C1855P
1	0.5	UR	982R	C1855Q
2	0.5	R	982L	C1855P
2	0.5	R	982R	C1855Q
3	0.5	RY	982L	C1855P
3	0.5	RY	982R	C1855Q

Click here to print

Connector: C2178

CONNECTOR HOUSING NOT SERVICEABLE

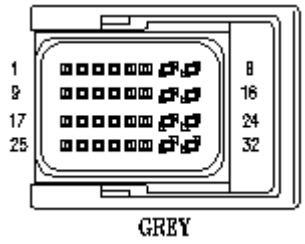

Part No.: YPC803410

Colour: GREY


Cavities: 32WY

Harness: CHASSIS HARNESS

Description: Module-Parking brake

Location: Beneath rear of vehicle - Center

Qualifier:

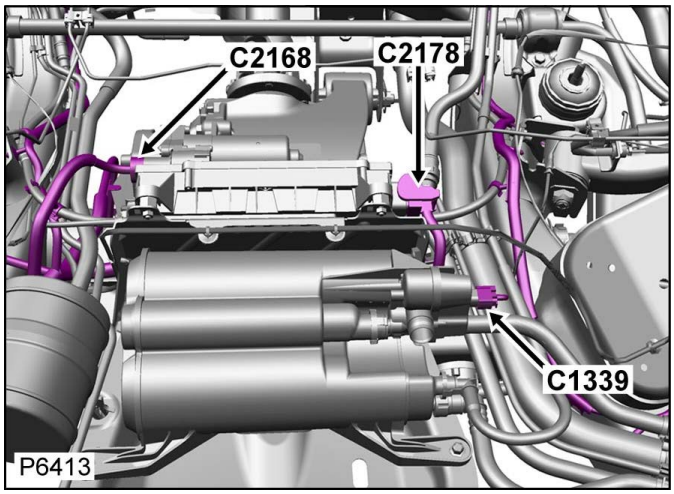


Wire Chart

CAV	CSA	COL	CCT	DESTN
9	0.5	YB	395	C0390
10	0.5	YN	395	C0390
15	1.5	B	395	C0390
16	1.5	B	395	C0390
18	0.5	YU	395	C0390
19	0.5	R	395	C0390
22	0.5	R	395	C0390
26	0.5	Y	395	C0390
27	0.5	YG	395	C0390
30	0.5	G	395	C0390
31	1.5	GY	395	S/JOINT SJ5
32	1.5	GY	395	S/JOINT SJ5

Click here to print

Connector: C2180A

CONNECTOR HOUSING NOT SERVICEABLE

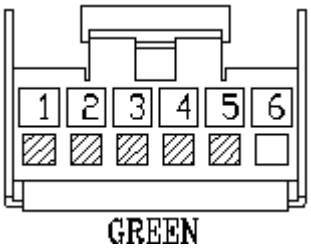

Part No.: YPC106440

Colour: GREEN


Cavities: 6WY

Harness: CONSOLE FRONT HARNESS

Description: Switch-Electric-park brake

Location: Beneath center console LH side

Qualifier: LHD condition illustrated

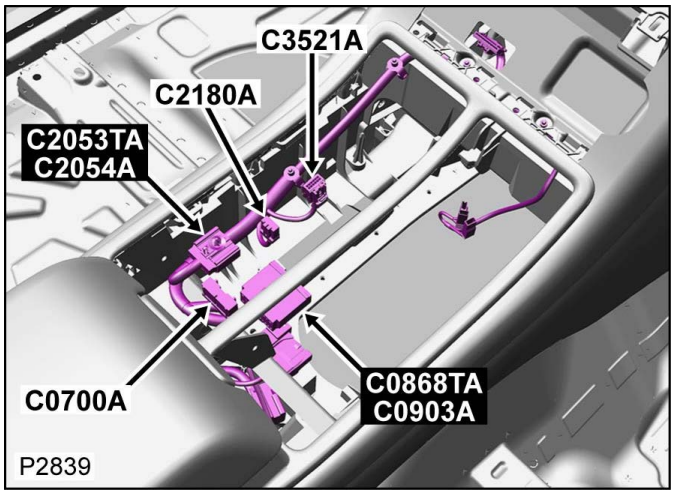


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	R	982L	C2054A	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.5	Y	982L	C2054A	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	YU	982L	C0903A	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	YG	982L	C0903A	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	RN	982L	S/JOINT SJ322	418-587-02	-	418-116A	418-117	-	418-112	418-107
6	0.5	B	982L	S/JOINT SJ323	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2180B

CONNECTOR HOUSING NOT SERVICEABLE

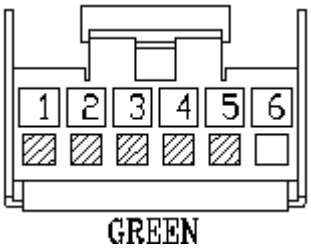

Part No.: YPC106440

Colour: GREEN


Cavities: 6WY

Harness: CONSOLE FRONT HARNESS

Description: Switch-Electric-park brake

Location: Beneath center console RH side

Qualifier: RHD condition illustrated

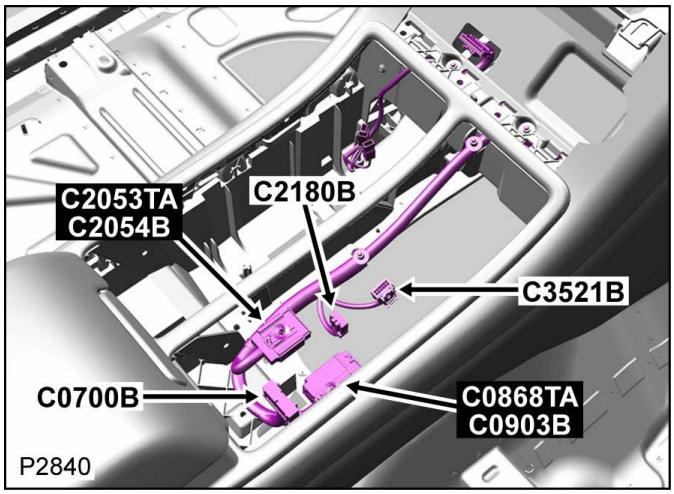


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	R	982R	C2054B	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.5	Y	982R	C2054B	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	YU	982R	C0903B	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	YG	982R	C0903B	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	RN	982R	S/JOINT SJ322	418-587-02	-	418-116A	418-117	-	418-112	418-107
6	0.5	B	982R	S/JOINT SJ323	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2180L

CONNECTOR HOUSING NOT SERVICEABLE

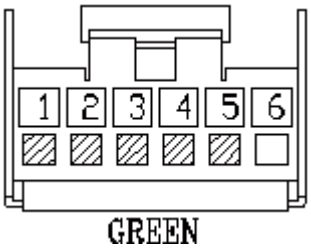

Part No.: YPC106440

Colour: GREEN


Cavities: 6WY

Harness: CONSOLE FRONT HARNESS

Description: Switch-Electric-park brake

Location: Beneath center console LH side

Qualifier:

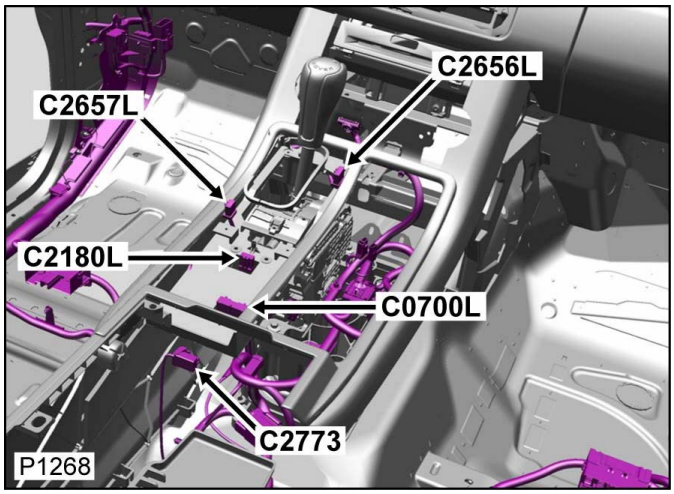


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	R	986L	C2054L	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.5	Y	986L	C2054L	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	YU	986L	C0903L	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	YG	986L	C0903L	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	RN	986L	S/JOINT SJ322	418-587-02	-	418-116A	418-117	-	418-112	418-107
6	0.5	B	986L	S/JOINT SJ323	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2180R

CONNECTOR HOUSING NOT SERVICEABLE

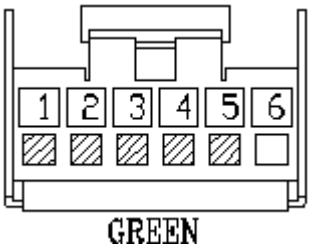

Part No.: YPC106440

Colour: GREEN


Cavities: 6WY

Harness: CONSOLE FRONT HARNESS

Description: Switch-Electric-park brake

Location: Beneath center console RH side

Qualifier:

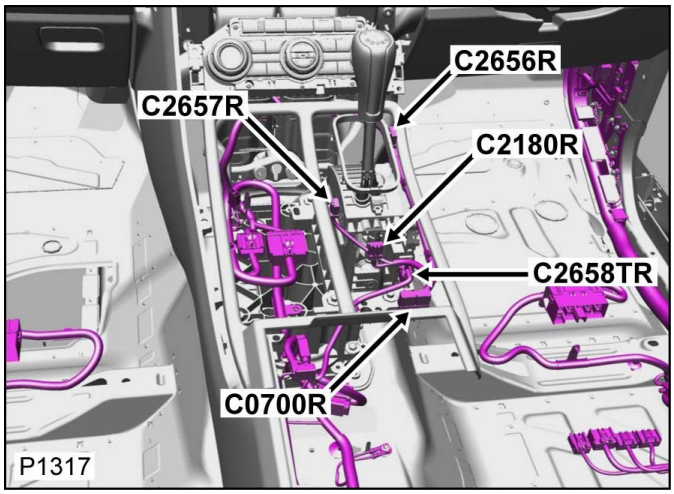


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	R	986R	C2054R	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.5	Y	986R	C2054R	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	YU	986R	C0903R	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	YG	986R	C0903R	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	RN	986R	S/JOINT SJ322	418-587-02	-	418-116A	418-117	-	418-112	418-107
6	0.5	B	986R	S/JOINT SJ323	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2184L

CONNECTOR HOUSING NOT SERVICEABLE

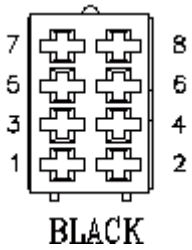

Part No.: ADU9122

Colour: BLACK


Cavities: 8WY

Harness: FACIA COMPOSITE HARNESS

Description: Switch pack-Steering-column motor

Location: Behind steering column cowl

Qualifier:

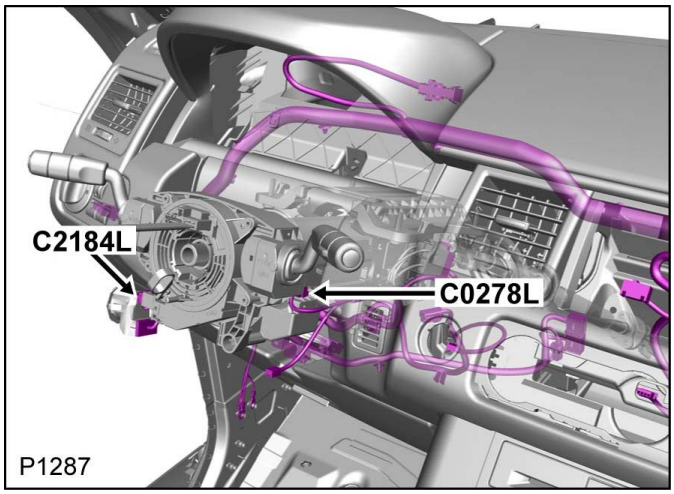


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	NW	406L	C0580	418-587-01	-	418-116A	418-117	-	418-112	418-107
3	0.35	NR	406L	S/JOINT SJ870L	418-587-01	-	418-116A	418-117	-	418-112	418-107
5	0.35	NR	406L	C2443	418-587-01	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2184R

CONNECTOR HOUSING NOT SERVICEABLE

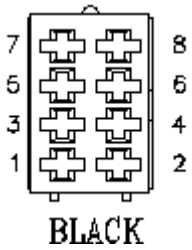

Part No.: ADU9122

Colour: BLACK


Cavities: 8WY

Harness: FACIA COMPOSITE HARNESS

Description: Switch pack-Steering-column motor

Location: Behind steering column cowl

Qualifier:

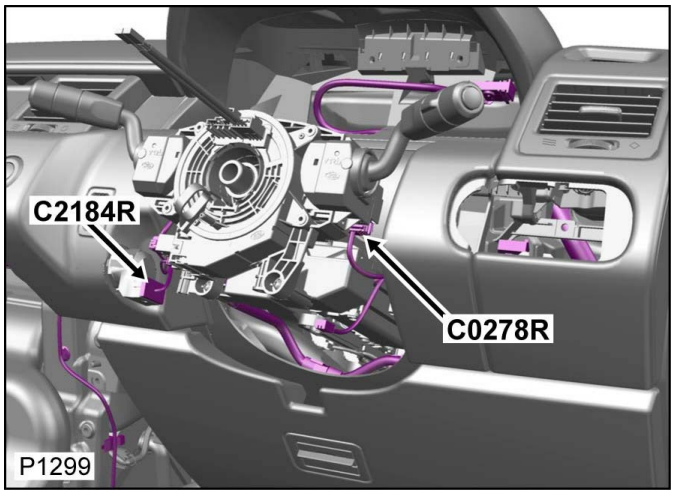


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	NW	406R	C0580	418-587-01	-	418-116A	418-117	-	418-112	418-107
3	0.35	NR	406R	S/JOINT SJ870R	418-587-01	-	418-116A	418-117	-	418-112	418-107
5	0.35	NR	406R	C2238R	418-587-01	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2188L

CONNECTOR HOUSING NOT SERVICEABLE

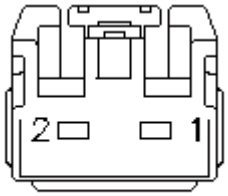

GREY

Part No.: YPC909710

Colour: GREY


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Dynamic response module

Location: Driver 'A' post

Qualifier:

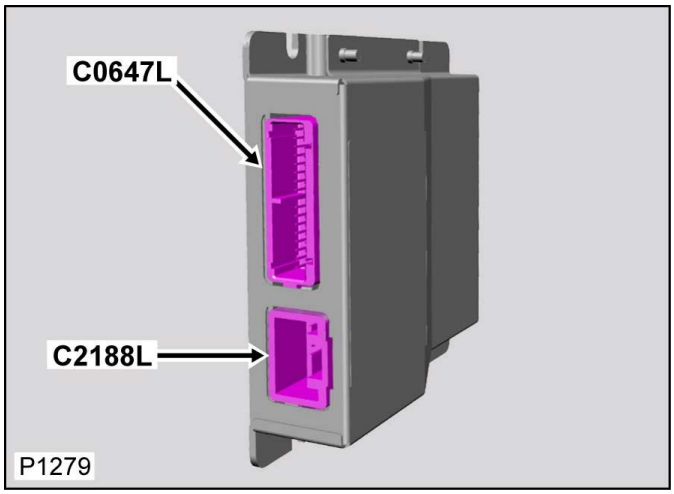

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	PO	407L	C0570L	418-411-53	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	B	407L	C2602L	418-411-53	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C2188R

CONNECTOR HOUSING NOT SERVICEABLE

Description: Dynamic response module

Location: Driver 'A' post

Qualifier:




Part No.: YPC500610

Colour: GREY

Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

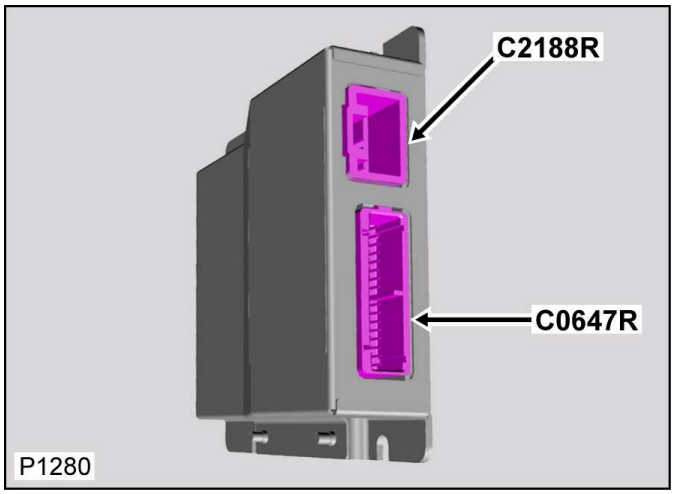


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	PO	407R	C0570R	418-411-53	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	B	953R	C0559R	418-411-53	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C2193L

CONNECTOR HOUSING NOT SERVICEABLE

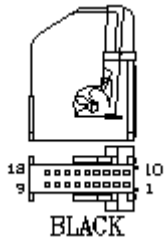

Part No.: YPH900990

Colour: BLACK


Cavities: 18WY

Harness: ENGINE COMPARTMENT HARNESS

Description: AFS control module

Location: Passenger 'A' post

Qualifier:

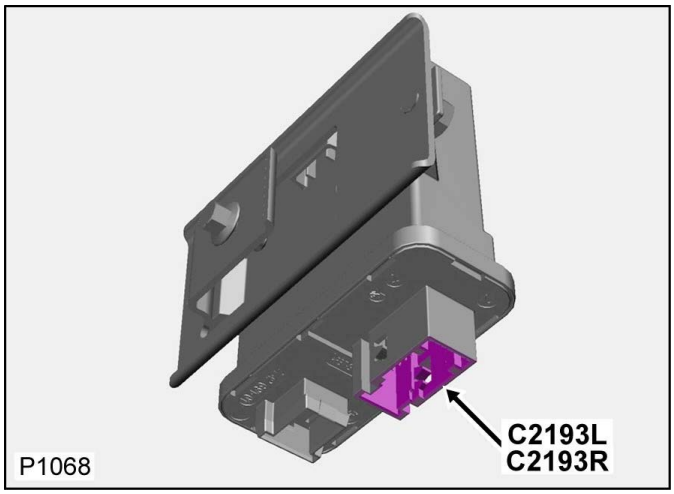

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	404L	S/JOINT SJ173	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
7	0.35	R	404L	S/JOINT SJ444	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
10	0.75	P	404L	S/JOINT SJ443	-	-	-	-	-	-	-
13	0.35	YB	404L	S/JOINT SJ1005	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
14	0.35	YN	404L	S/JOINT SJ1024	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
17	0.35	R	404L	S/JOINT SJ442	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2193R

CONNECTOR HOUSING NOT SERVICEABLE

Description: AFS control module

Location: Passenger 'A' post

Qualifier:

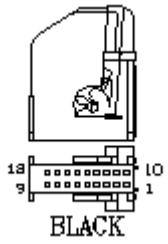


Part No.: YPH900990

Colour: BLACK

Cavities: 18WY

Harness: ENGINE COMPARTMENT HARNESS

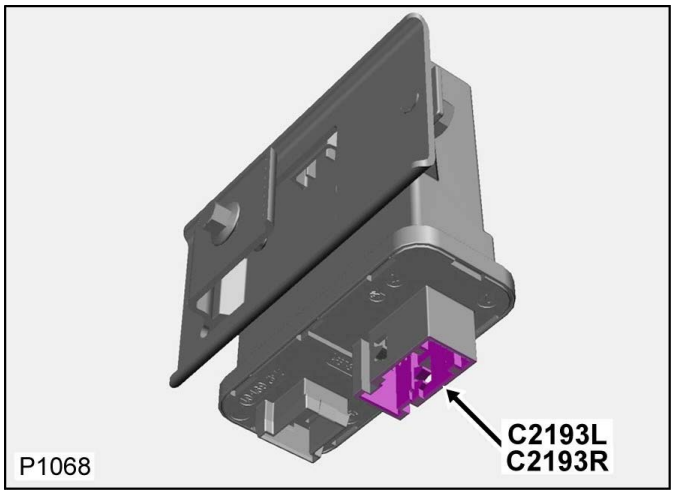


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	404R	S/JOINT SJ171	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
7	0.35	R	404R	S/JOINT SJ444	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
10	0.5	P	404R	S/JOINT SJ443	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
13	0.35	YB	404R	S/JOINT SJ2005	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
14	0.35	YN	404R	S/JOINT SJ2024	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
17	0.35	R	404R	S/JOINT SJ1142	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2198

CONNECTOR HOUSING NOT SERVICEABLE

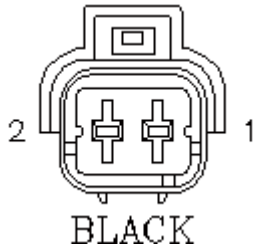

Part No.: YPC910290

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Initiator-Front-LH

Location: Behind LH front fender splash shield

Qualifier:

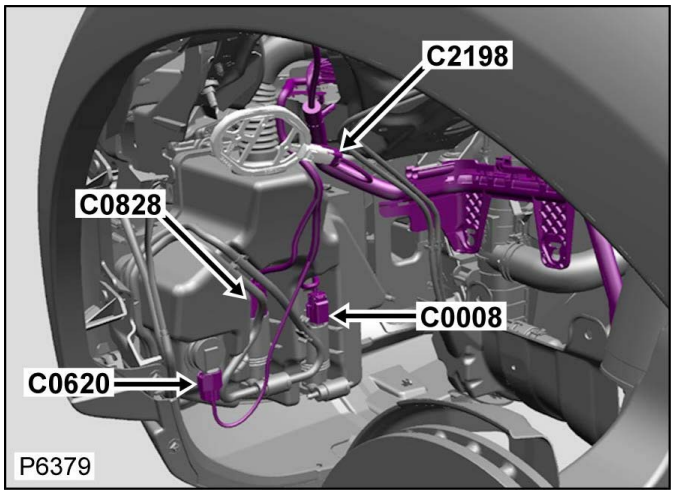


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	PN	591L	C0584L
1	0.75	PN	591R	C0584R
2	0.75	Y	591L	C0584L
2	0.75	Y	591R	C0584R

Click here to print

Connector: C2199

CONNECTOR HOUSING NOT SERVICEABLE

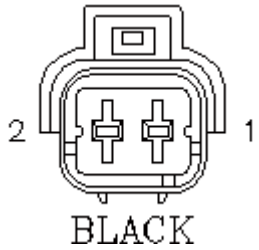

Part No.: YPC910290

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Initiator-Front-RH

Location: Behind RH front fender splash shield

Qualifier:

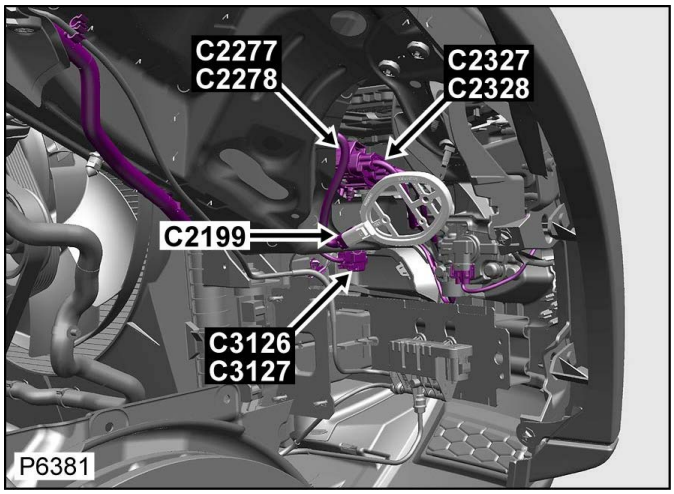


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	UN	591L	C0584L
1	0.75	UN	591R	C0584R
2	0.75	NW	591L	C0584L
2	0.75	NW	591R	C0584R

Click here to print

Connector: C2200

CONNECTOR HOUSING NOT SERVICEABLE

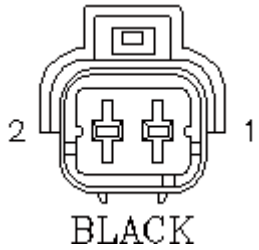

Part No.: YPC910290

Colour: BLACK


Cavities: 2WY

Harness: CABIN HARNESS

Description: Initiator-Rear-LH

Location: Behind LH rear fender splash shield

Qualifier:

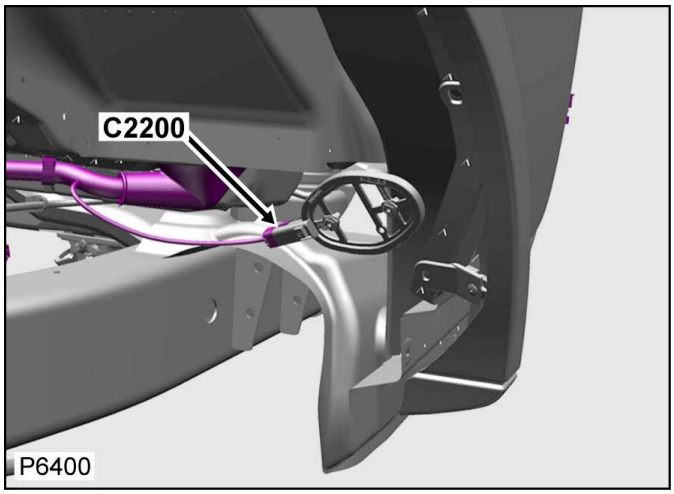


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	NY	591L	C0586L
1	0.75	NY	591R	C0586R
2	0.75	UO	591L	C0586L
2	0.75	UO	591R	C0586R

Click here to print

Connector: C2201T

CONNECTOR HOUSING NOT SERVICEABLE

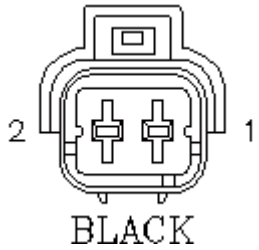

Part No.: YPC910290

Colour: BLACK


Cavities: 2WY

Harness: CABIN HARNESS

Description: Initiator-Rear-RH

Location: Below RH rear wheelarch

Qualifier:

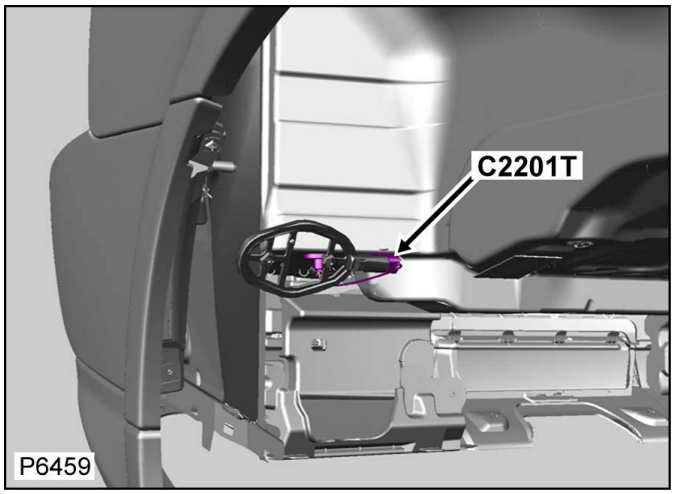

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	NG	591TL	C0586L
1	0.75	NG	591TR	C0586R
2	0.75	SP	591TL	C0586L
2	0.75	SP	591TR	C0586R

Click here to print

Connector: C2206


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Heated steering wheel

Location: In center of steering wheel

Qualifier:

ASSEMBLY

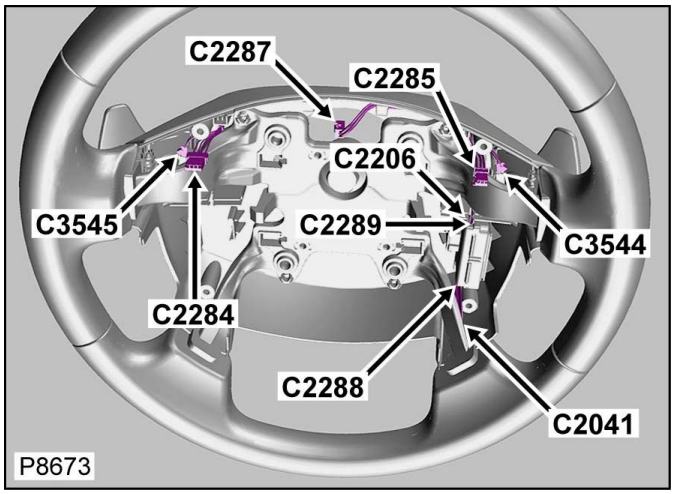

Part No.: CASSY

Colour: NO COLOUR

Cavities: 1WY

Harness: STEERING WHEEL HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	Y	-	C2287
2	0.75	B	-	C2287

Click here to print

Connector: **C2209L**

CONNECTOR HOUSING SERVICEABLE

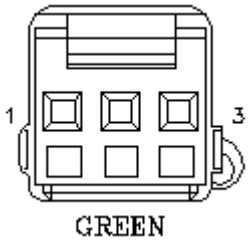

Part No.: YPC909420

Colour: GREEN


Cavities: 3WY

Harness: FACIA COMPOSITE HARNESS

Description: Module-Immobiliser antenna

Location: Underside of steering column

Qualifier:

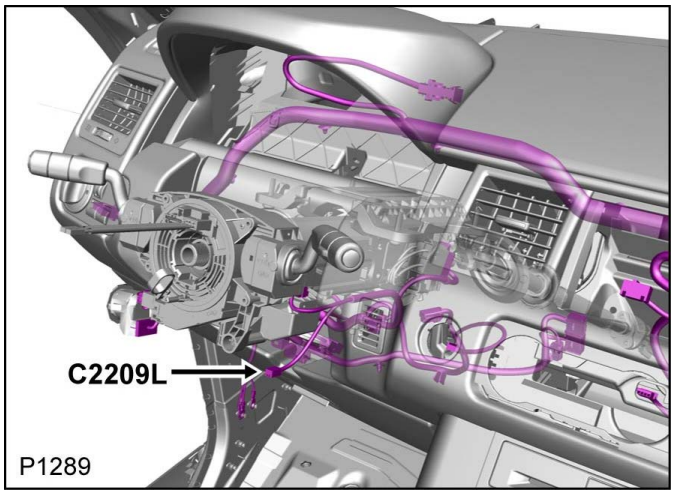


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	RU	139L	S/JOINT SJ134	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.35	UR	139L	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	139L	S/JOINT SJ661	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: **C2209R**

CONNECTOR HOUSING SERVICEABLE

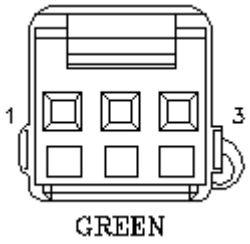

Part No.: YPC909420

Colour: GREEN


Cavities: 3WY

Harness: FACIA COMPOSITE HARNESS

Description: Module-Immobiliser antenna

Location: Underside of steering column

Qualifier:

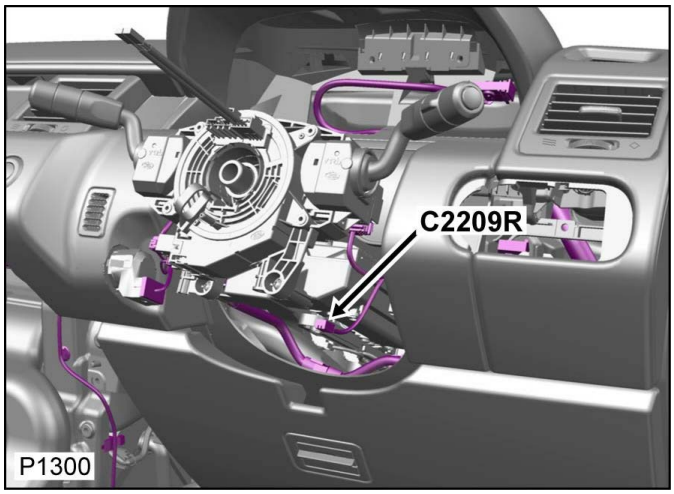

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	RU	200R	S/JOINT SJ134	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.35	UR	200R	C0581	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	200R	S/JOINT SJ661	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2218


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Navigation system-Japan

Location: Beneath LH Front seat

Qualifier:

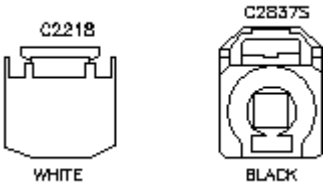

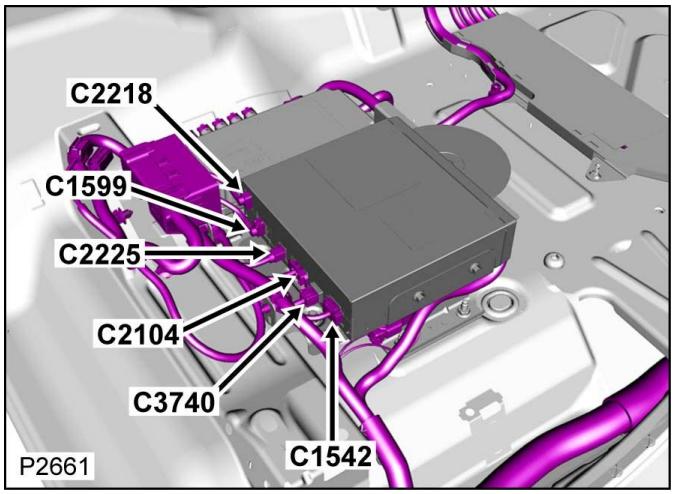

Part No.: XUD815620

Colour: BLACK

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	568S	C2837S
1S	SCR	SCR	568S	C2837S
1	0.5	B	568T	C2837T
1S	SCR	SCR	568T	C2837T

Click here to print


Connector: C2219T

CONNECTOR HOUSING NOT SERVICEABLE

Description: AM/FM diversity antenna amplifier

Location: Rear of headlining - RH side

Qualifier:

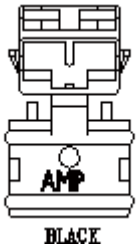


Part No.: YPC901750

Colour: BLACK

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

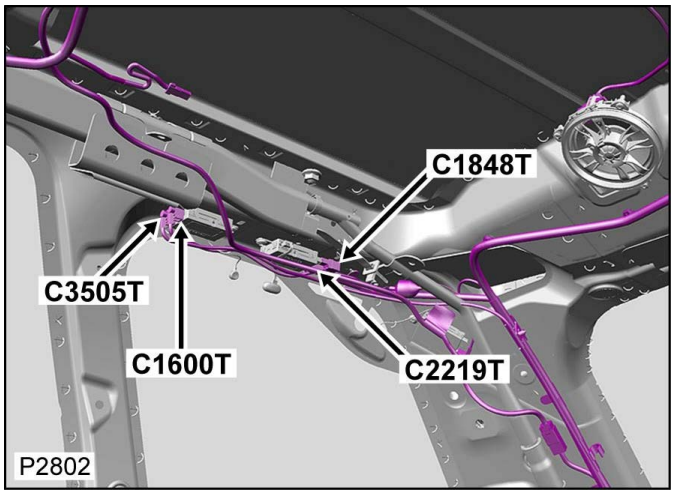

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	1031T	C2639

Click here to print


Connector: C2221


CONNECTOR HOUSING NOT SERVICEABLE

Description: Instrument panel harness to ICE harness

Location: Beneath center console LH side

Qualifier:

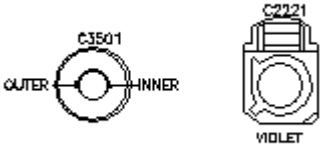

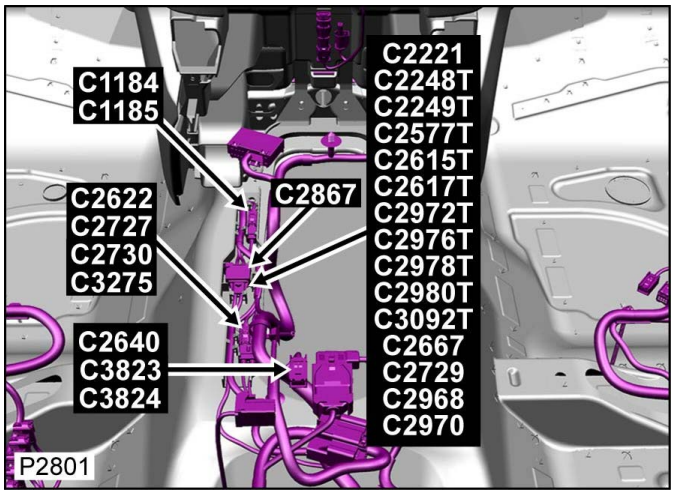

Part No.: XUD815580

Colour: NO COLOUR

Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	568	C3501
1S	0.5	SCR	568	C3501

Click here to print


Connector: C2222T

CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Tuner-DAB/SDARS

Location: Behind luggage compartment carpet RH side

Qualifier:

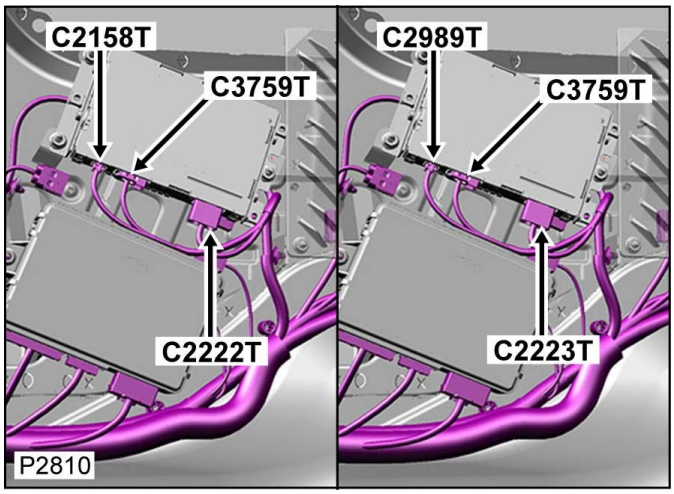

ASSEMBLY

Part No.: XUD812370

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	449T	C3383T
1S	SCR	SCR	449T	C3383T
2	0.5	B	449T	C3381T
2S	SCR	SCR	449T	C3381T

Click here to print


Connector: C2223T

CONNECTOR HOUSING NOT SERVICEABLE

Description: SDARS antenna

Location: Behind luggage compartment carpet RH side

Qualifier:

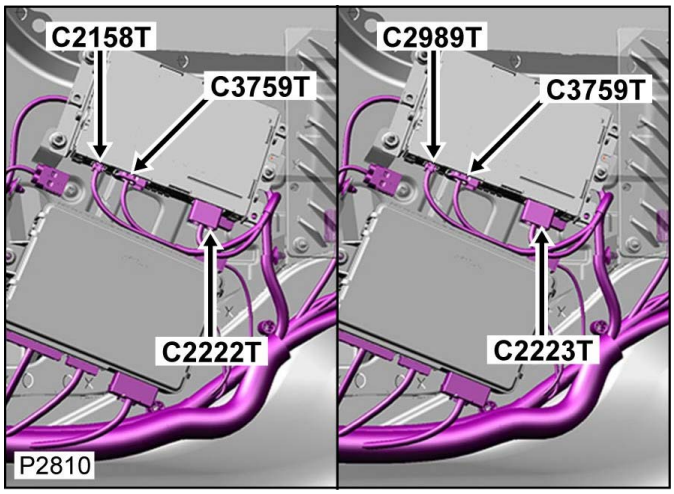

ASSEMBLY

Part No.: XUD812380

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	512T	C2789T
1S	SCR	SCR	512T	C2789T

Click here to print


Connector: C2225

CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Navigation system-Japan

Location: Beneath LH Front seat

Qualifier:

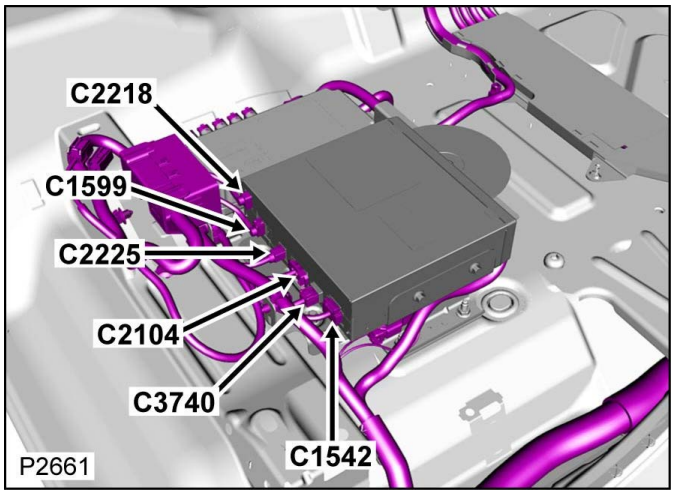

ASSEMBLY

Part No.: XUD815570

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	568	C2968
1S	SCR	SCR	568	C2968

Click here to print

Connector: C2226


CONNECTOR HOUSING NOT SERVICEABLE

Description: AV input panel

Location: In rear of center console

Qualifier:

ASSEMBLY

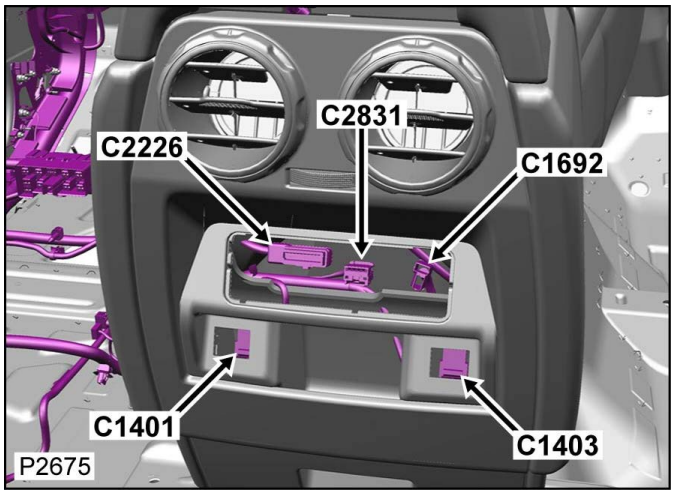

Part No.: XUD815530

Colour: NO COLOUR

Cavities: 1WY

Harness: CONSOLE REAR HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
2	0.5	N	425	C2315
4	0.5	G	425	C2315
6	0.5	W	425	C2315
8	0.5	Y	425	C2315
10	SCR	SCR	425	C2315
16	0.5	G	425	C2315
17	SCR	SCR	425	C2315
18	SCR	SCR	425	C2315
19	0.5	R	425	C2315
20	0.5	U	425	C2315

Click here to print

Connector: C2228


CONNECTOR HOUSING NOT SERVICEABLE

Description: Receiver-Television

Location: Beneath RH Front seat

Qualifier:

ASSEMBLY

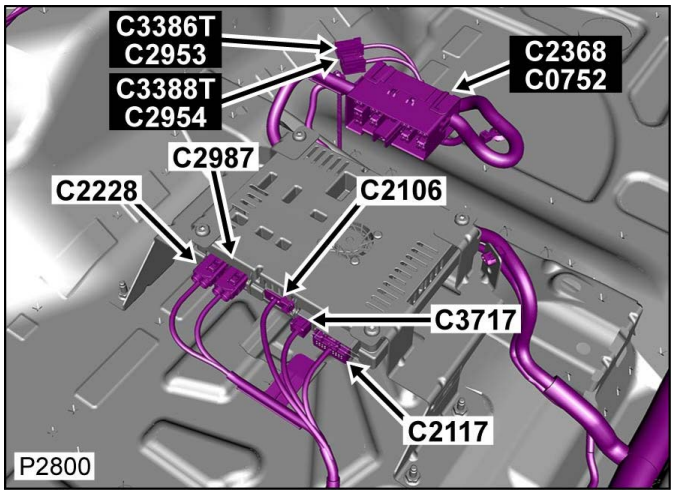

Part No.: XUD812280

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	310S	C1602S
1S	SCR	SCR	310S	C1602S
1	0.5	B	310T	C1602T
1S	SCR	SCR	310T	C1602T
2	0.5	B	310S	C1603S
2S	SCR	SCR	310S	C1603S
2	0.5	B	310T	C1603T
2S	SCR	SCR	310T	C1603T

Click here to print


Connector: C2229

CONNECTOR HOUSING NOT SERVICEABLE

Description: Fuel fired booster heater receiver

Location: Behind luggage compartment carpet RH side

Qualifier:

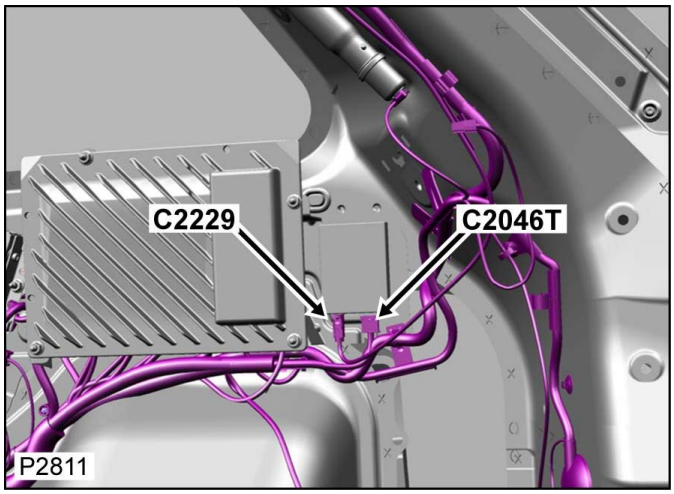

ASSEMBLY

Part No.: XUD815200

Colour: NO COLOUR

Cavities: 2WY

Harness: REMOTE PARK HEAT HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	PN	692T	C3505T
1S	SCR	SCR	692T	C3505T
1	0.5	PN	692S	C3505S
1S	SCR	SCR	692S	C3505S
1	0.5	PN	1012S	C3506S
1S	SCR	SCR	1012S	C3506S

Click here to print

Connector: C2238L

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC900470

Colour: DARK GREY


Cavities: 22WY

Harness: FACIA COMPOSITE HARNESS

Description: Instrument panel harness to engine compartment harness

Location: Base of RH 'A' post

Qualifier: LHD condition illustrated

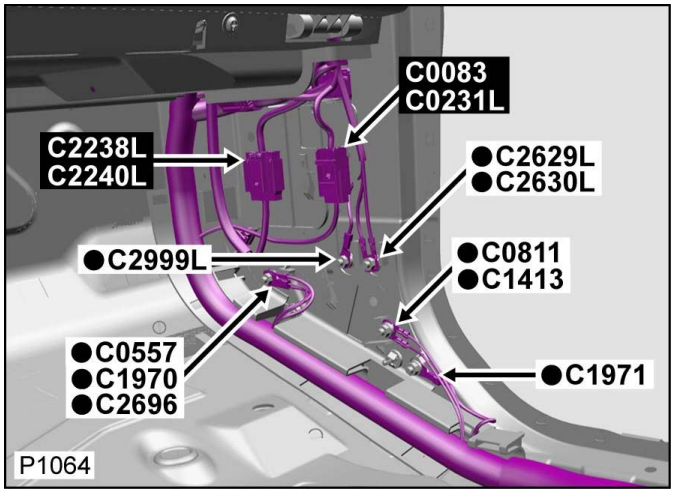

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	N	139L	C3510	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.35	LGW	139L	C3470	-	-	-	-	-	-	-
7	0.5	RU	139L	C3470	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.5	N	252L	C0040	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.5	G	252L	C0040	418-411-45	-	418-116A	418-117	-	418-112	418-107
11	0.5	BU	139L	C3470	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.5	LG	409L	C0862L	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.5	LGR	139L	C0040	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.35	NG	139L	C0082L	-	-	-	-	-	-	-

Click here to print

Connector: C2238R

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC900470

Colour: DARK GREY


Cavities: 22WY

Harness: FACIA COMPOSITE HARNESS

Description: Instrument panel harness to engine compartment harness

Location: Base of RH 'A' post

Qualifier: RHD condition illustrated

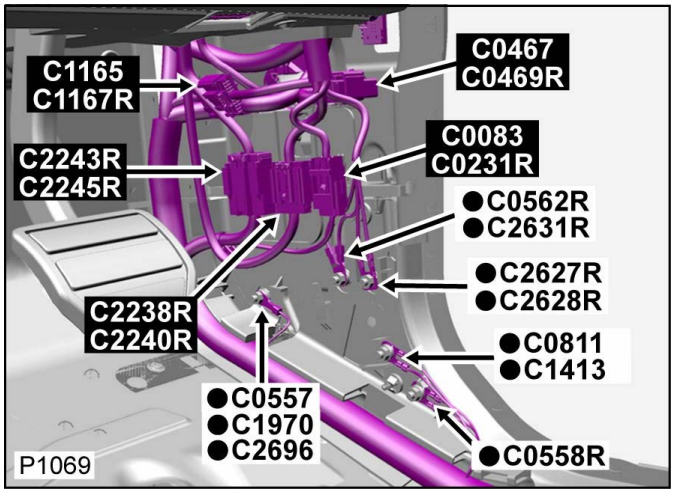

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	YN	430R	C0041	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.35	NR	406R	C2184R	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	O	19R	C3470	-	-	-	-	-	-	-
4	0.5	BG	19R	C3470	-	-	-	-	-	-	-
5	0.5	BG	19R	S/JOINT SJ550	-	-	-	-	-	-	-
6	0.75	GB	19R	S/JOINT SJ199	-	-	-	-	-	-	-
7	0.5	RU	200R	C3470	-	-	-	-	-	-	-
8	0.5	B	200R	C2631R	-	-	-	-	-	-	-
9	0.5	R	413SR	C1629SR	-	-	-	-	-	-	-
10	0.35	R	200R	C0040	418-411-45	-	418-116A	418-117	-	418-112	418-107
11	0.5	BU	200R	C3470	-	-	-	-	-	-	-
12	0.35	YN	200R	S/JOINT SJ851	418-411-45	-	418-116A	418-117	-	418-112	418-107
13	0.35	YB	200R	S/JOINT SJ861	418-411-45	-	418-116A	418-117	-	418-112	418-107
14	0.35	YW	200R	S/JOINT SJ730	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.35	YU	200R	S/JOINT SJ731	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.5	RB	254R	C3470	-	-	-	-	-	-	-
18	0.5	LG	409R	C0862R	-	-	-	-	-	-	-
19	0.35	G	200R	S/JOINT SJ223R	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.35	NG	200R	C0082R	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2239R

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC910190

Colour: LIGHT GREY


Cavities: 14WY

Harness: FACIA COMPOSITE HARNESS

Description: Instrument panel harness to engine compartment harness

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

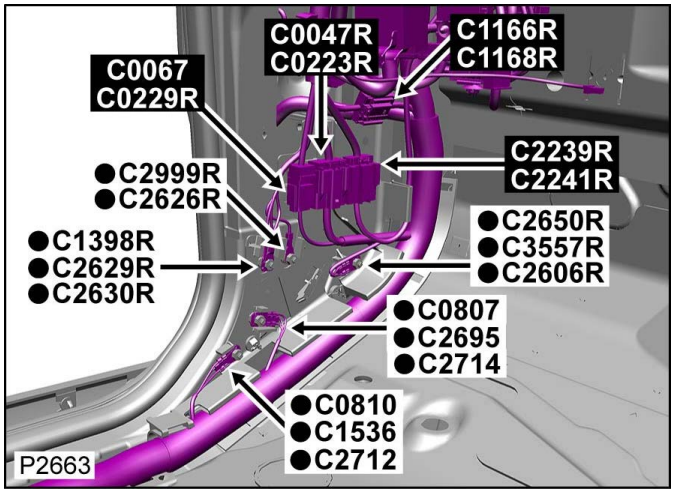


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	PY	200R	C1168R	418-587-10	-	418-116A	418-117	-	418-112	418-107
2	0.35	LGW	200R	C3470	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	N	252R	C0040	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	G	252R	C0040	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	LGR	200R	C0040	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	BY	200TR	C1168R	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
8	0.35	BU	200TR	C1168R	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	BR	200TR	C0223R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	UN	200R	C3470	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	BG	200R	S/JOINT SJ550	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	RG	19R	S/JOINT SJ880	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
13	0.5	N	200R	C3510	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
14	2.5	NR	200TR	C0223R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C2240L

CONNECTOR HOUSING NOT SERVICEABLE

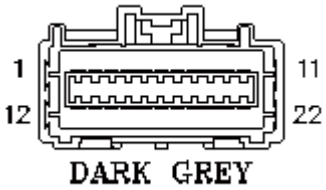

Part No.: YPC901410

Colour: DARK GREY


Cavities: 22WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to instrument panel harness

Location: Base of RH 'A' post

Qualifier: LHD condition illustrated

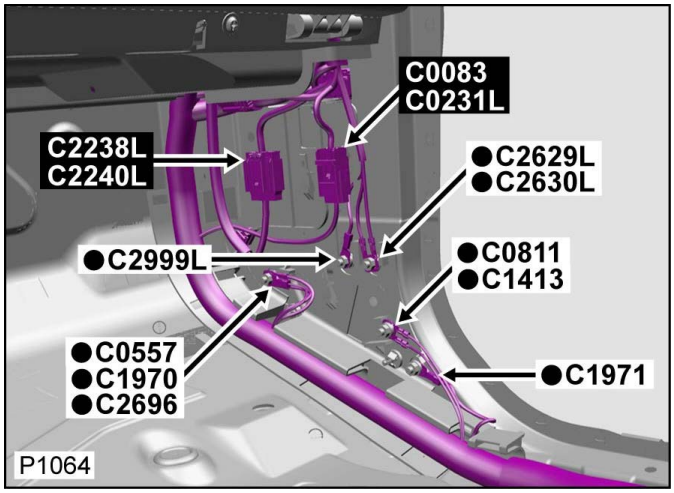


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	N	798L	C0570L	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.5	LGW	139L	C0570L	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.5	W	797L	C2274L	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.5	W	798L	C3070L	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.5	BG	282L	C2725L	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.35	GW	797L	C3424L	-	-	-	-	-	-	-
9	0.5	N	282L	C0635L	418-411-47	-	418-116A	418-117	-	418-112	418-107
10	0.5	G	282L	C0635L	418-411-47	-	418-116A	418-117	-	418-112	418-107
11	0.5	S	798L	C3070L	418-411-47	-	418-116A	418-117	-	418-112	418-107
11	0.5	S	797L	C2274L	418-411-47	-	418-116A	418-117	-	418-112	418-107
11	0.5	RG	282L	C2725L	418-411-47	-	418-116A	418-117	-	418-112	418-107
14	0.5	YG	377L	S/JOINT SJ12	418-411-47	-	418-116A	418-117	-	418-112	418-107
18	0.75	LG	413L	S/JOINT SJ109	418-411-47	-	418-116A	418-117	-	418-112	418-107
19	0.5	LGR	139L	S/JOINT SJ3	418-411-47	-	418-116A	418-117	-	418-112	418-107
20	0.35	NG	139L	S/JOINT SJ945	-	-	-	-	-	-	-

Click here to print

Connector: C2240R

CONNECTOR HOUSING NOT SERVICEABLE

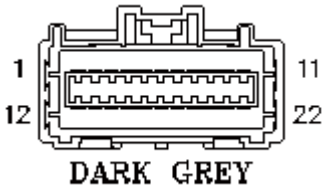

Part No.: YPC901410

Colour: DARK GREY


Cavities: 22WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to instrument panel harness

Location: Base of RH 'A' post

Qualifier: RHD condition illustrated

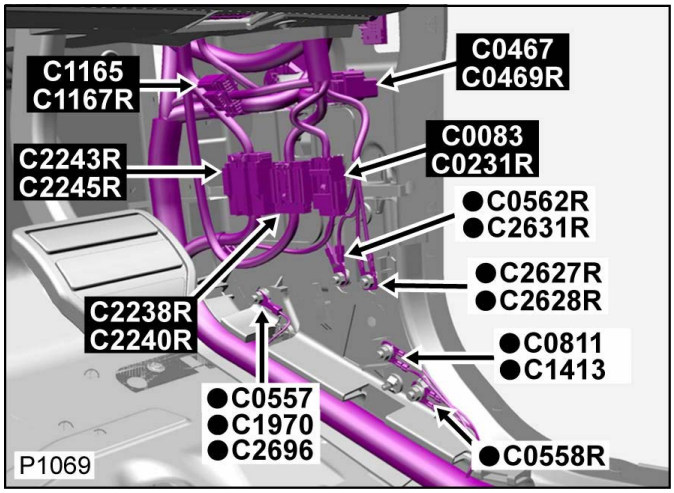

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	YN	107R	S/JOINT SJ1180	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.5	NR	200R	C0584R	-	-	-	-	-	-	-
3	0.5	B	200R	C2683	-	-	-	-	-	-	-
4	0.5	B	200R	C2683	-	-	-	-	-	-	-
5	0.5	B	200R	C2683	-	-	-	-	-	-	-
6	0.75	B	200R	C2683	-	-	-	-	-	-	-
7	0.5	W	797R	C2274R	-	-	-	-	-	-	-
7	0.5	W	798R	C3070R	-	-	-	-	-	-	-
7	0.5	BG	282R	C2725R	-	-	-	-	-	-	-
9	0.5	R	920R	C0506R	-	-	-	-	-	-	-
10	0.5	WP	413R	C0506R	-	-	-	-	-	-	-
11	0.5	S	798R	C3070R	-	-	-	-	-	-	-
11	0.5	S	797R	C2274R	-	-	-	-	-	-	-
11	0.5	RG	282R	C2725R	-	-	-	-	-	-	-
12	0.5	YN	1005R	C1857R	-	-	-	-	-	-	-
12	0.35	YN	407R	S/JOINT SJ1274	418-411-47	-	418-116A	418-117	-	418-112	418-107
12	0.35	YN	831R	S/JOINT SJ176	418-411-47	-	418-116A	418-117	-	418-112	418-107
13	0.5	YB	1005R	C1857R	-	-	-	-	-	-	-
13	0.35	YB	407R	S/JOINT SJ1276	418-411-47	-	418-116A	418-117	-	418-112	418-107
13	0.35	YB	831R	S/JOINT SJ177	418-411-47	-	418-116A	418-117	-	418-112	418-107
14	0.35	YW	252R	C2244R	418-411-47	-	418-116A	418-117	-	418-112	418-107
14	0.35	YW	254R	S/JOINT SJ422	418-411-47	-	418-116A	418-117	-	418-112	418-107
15	0.35	YU	252R	C2244R	418-411-47	-	418-116A	418-117	-	418-112	418-107
15	0.35	YU	254R	S/JOINT SJ423	418-411-47	-	418-116A	418-117	-	418-112	418-107

16	0.75	RB	798R	C2034	-	-	-	-	-	-	-
18	0.75	LG	413R	S/JOINT SJ1109	-	-	-	-	-	-	-
19	0.5	B	200R	C0666R	-	-	-	-	-	-	-
20	0.35	NG	200R	S/JOINT SJ1945	418-411-47	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2241R

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC910210

Colour: LIGHT GREY


Cavities: 14WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to instrument panel harness

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

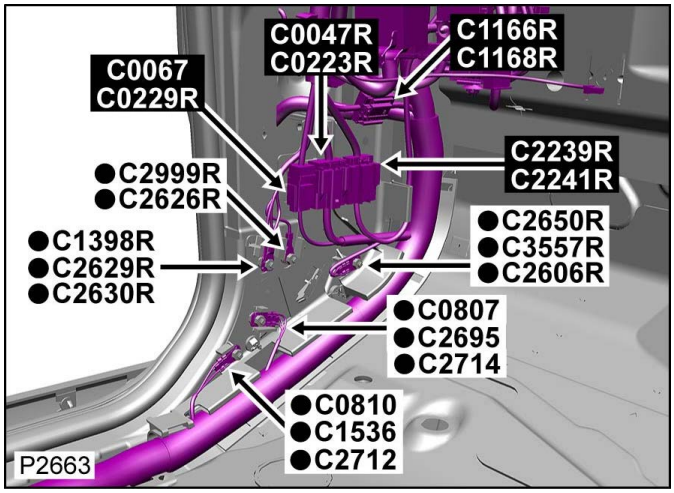

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	PY	798R	S/JOINT SJ1062	-	-	-	-	-	-	-
2	0.5	LGW	200R	C0570R	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	YG	377R	S/JOINT SJ1012	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	N	282R	C0635R	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	G	282R	C0635R	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	LGR	200R	S/JOINT SJ1003	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	BY	245R	C3428	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
8	0.35	BU	245R	C3428	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	GW	797R	C3424R	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	BR	245R	C3428	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	UN	805R	C1465	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	UN	282R	C3398	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	WU	805R	C1465	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	WU	282R	C3398	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	R	805R	C1465	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	R	282R	C3398	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
13	0.5	N	798R	C0570R	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
14	2.5	R	200TR	C0570R	418-411-16	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C2242L

CONNECTOR HOUSING NOT SERVICEABLE


Description: Main harness to engine compartment harness

Location: Behind passenger side of Instrument panel

Qualifier: LHD condition illustrated

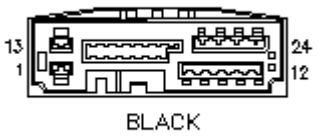

BLACK

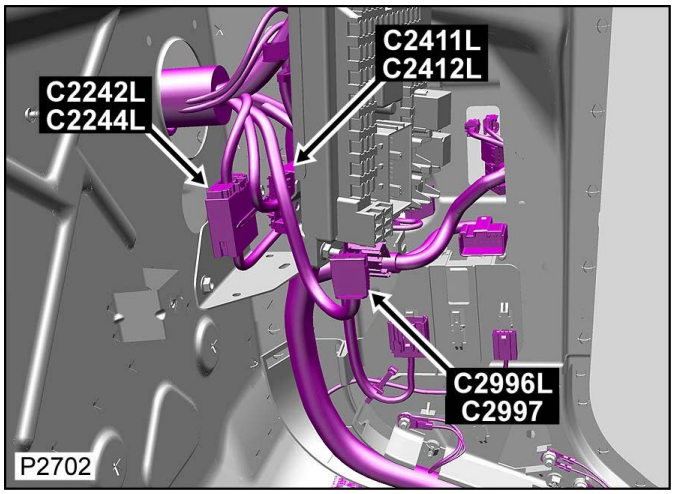

Part No.: YPC803290

Colour: BLACK

Cavities: 24WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	4.0	PS	109SL	C1623SL	418-587-05	-	418-116A	418-117	-	418-114	418-109
1	4.0	PS	109TL	C1623TL	418-587-05	-	418-116A	418-117	-	418-114	418-109
2	0.35	UW	171L	C0958	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.35	GW	171L	C0958	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.35	YB	171L	C0958	418-411-47	-	418-116A	418-117	-	418-112	418-107
5	0.35	YG	171L	C0958	418-411-47	-	418-116A	418-117	-	418-112	418-107
6	0.35	YS	171L	C0958	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.35	YO	171L	C0958	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.5	Y	986SL	C2658S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	Y	986TL	C2658TL	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	R	986SL	C2658S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	R	986TL	C2658TL	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
10	1.5	PO	245TL	C3088T	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
11	0.75	R	139L	S/JOINT SJ971	-	-	-	-	-	-	-
12	0.5	PW	139SL	C0698S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	PW	139TL	C0698T	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
13	4.0	PU	401SL	S/JOINT SJ542S	418-587-05	-	418-116A	418-117	-	418-114	418-109
13	4.0	PU	401TL	S/JOINT SJ542T	418-587-05	-	418-116A	418-117	-	418-114	418-109

14	0.5	LG	139L	C0586L	-	-	-	-	-	-	-
15	0.35	BR	245TL	C3087T	418-411-47	-	418-116A	418-117	-	418-112	418-107
16	0.5	P	139L	S/JOINT SJ227	-	-	-	-	-	-	-
17	0.5	KO	216L	C1649	-	-	-	-	-	-	-
18	0.5	PLG	216L	C1649	-	-	-	-	-	-	-
19	0.5	W	216L	C1649	-	-	-	-	-	-	-
20	0.5	N	216L	C1649	-	-	-	-	-	-	-
21	0.5	YG	216L	S/JOINT SJ225	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
22	0.5	WU	252L	C2369	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
23	1.0	SK	193SL	S/JOINT SJ28S	-	-	-	-	-	-	-
23	1.0	SK	193TL	S/JOINT SJ28T	-	-	-	-	-	-	-
24	4.0	NU	21SL	C0839S	418-587-05	-	418-116A	418-117	-	418-114	418-109

Click here to print


Connector: C2242R

CONNECTOR HOUSING NOT SERVICEABLE


Description: Main harness to engine compartment harness

Location: Behind passenger side of Instrument panel

Qualifier: RHD condition illustrated

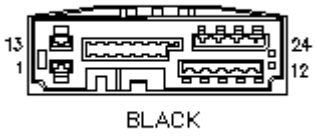

BLACK

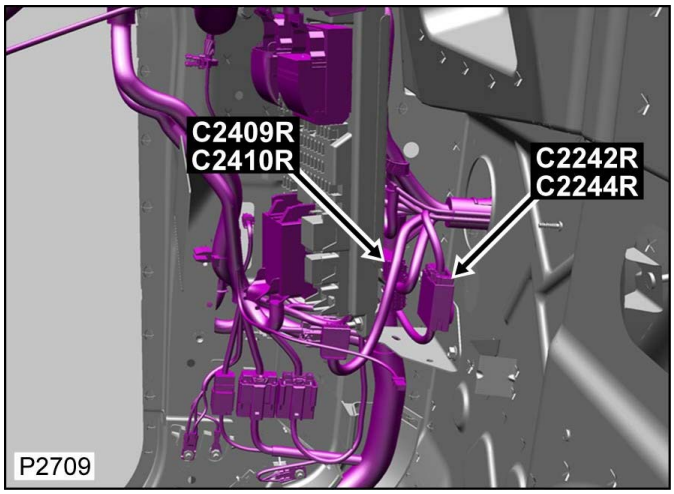

Part No.: YPC803290

Colour: BLACK

Cavities: 24WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	WP	254R	C0376	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
1	4.0	WP	252R	C2369	418-587-05	-	418-116A	418-117	-	418-114	418-109
2	0.35	UW	171R	C0958	-	-	-	-	-	-	-
3	0.35	YG	171R	C0958	-	-	-	-	-	-	-
4	0.35	GW	171R	C0958	-	-	-	-	-	-	-
5	0.35	YB	171R	C0958	-	-	-	-	-	-	-
6	0.35	YS	171R	C0958	-	-	-	-	-	-	-
7	0.35	YO	171R	C0958	-	-	-	-	-	-	-
8	1.5	R	204R	C2378	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	GR	169SR	C0868S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	GR	986TR	C0868TR	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	GR	982TR	C0868TA	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	OR	169SR	C0868S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	OR	986TR	C0868TR	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	OR	982TR	C0868TA	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
11	0.35	O	169SR	C0868S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	OR	986TR	C0868TR	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	OR	982TR	C0868TA	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
12	0.75	RB	200R	S/JOINT SJ971	-	-	-	-	-	-	-
13	1.5	PO	245TR	C3088T	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
14	0.35	UR	21SR	C0349S	-	-	-	-	-	-	-

14	0.5	R	986TR	C2053TR	418-411-47	-	418-116A	418-117	-	418-112	418-107
14	0.5	R	982TR	C2053TA	418-411-47	-	418-116A	418-117	-	418-112	418-107
15	0.5	WY	200R	C0585R	418-411-47	-	418-116A	418-117	-	418-112	418-107
16	0.5	P	200R	S/JOINT SJ227	418-411-47	-	418-116A	418-117	-	418-112	418-107
17	0.5	GO	28R	C0586R	418-411-47	-	418-116A	418-117	-	418-112	418-107
18	0.35	YW	200R	S/JOINT SJ2010	-	-	-	-	-	-	-
19	0.35	YU	200R	S/JOINT SJ2011	-	-	-	-	-	-	-
20	0.5	LG	200R	C0586R	418-411-47	-	418-116A	418-117	-	418-112	418-107
21	0.75	LGW	200SR	C2754S	-	-	-	-	-	-	-
21	0.75	LGW	200TR	C2754T	-	-	-	-	-	-	-
22	1.0	SK	193SR	S/JOINT SJ28S	-	-	-	-	-	-	-
22	1.0	SK	193TR	S/JOINT SJ28T	-	-	-	-	-	-	-
23	1.0	RB	200SR	S/JOINT SJ22S	-	-	-	-	-	-	-
23	1.0	RB	200TR	S/JOINT SJ22T	-	-	-	-	-	-	-
24	4.0	PK	109SR	C1624S	418-587-05	-	418-116A	418-117	-	418-114	418-109
24	4.0	PK	109TR	C1624T	418-587-05	-	418-116A	418-117	-	418-114	418-109

Click here to print


Connector: C2243L

CONNECTOR HOUSING NOT SERVICEABLE


Description: Main harness to engine compartment harness

Location: LH 'A' post

Qualifier:

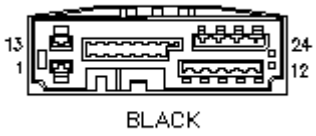

BLACK

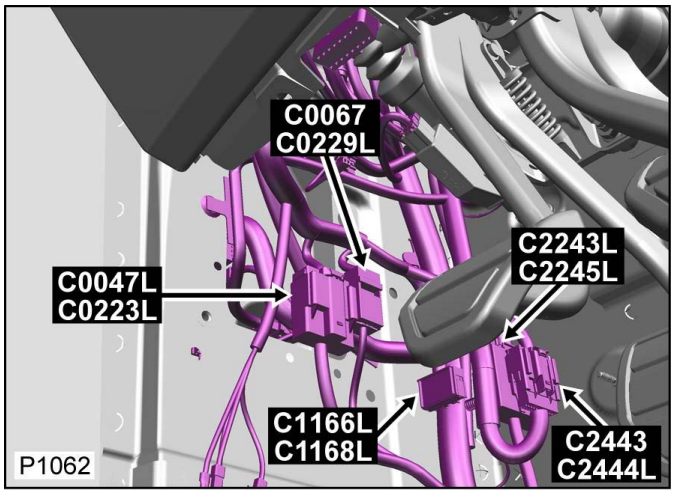

Part No.: YPC803290

Colour: BLACK

Cavities: 24WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	4.0	WP	254L	C0376	418-587-05	-	418-116A	418-117	-	418-114	418-109
1	4.0	WP	252L	C2369	418-587-05	-	418-116A	418-117	-	418-114	418-109
2	0.35	G	169SL	C0868S	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.35	G	986TL	C0868TL	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.35	G	982TL	C0868TA	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.35	GR	169SL	C0868S	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.35	GR	986TL	C0868TL	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.35	GR	982TL	C0868TA	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.35	OR	169SL	C0868S	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.35	OR	986TL	C0868TL	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.35	OR	982TL	C0868TA	418-411-47	-	418-116A	418-117	-	418-112	418-107
5	0.35	O	169SL	C0868S	418-411-47	-	418-116A	418-117	-	418-112	418-107
5	0.35	O	986TL	C0868TL	418-411-47	-	418-116A	418-117	-	418-112	418-107
5	0.35	O	982TL	C0868TA	418-411-47	-	418-116A	418-117	-	418-112	418-107
6	0.35	YB	407TL	C0657T	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.35	OS	407TL	C0657T	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.35	YK	407TL	C0657T	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
9	1.5	R	204L	C2378	418-411-65	-	418-116A	418-117	418-104	418-112	418-107

10	0.35	BR	245TL	C3087T	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
11	0.35	BW	245TL	S/JOINT SJ251T	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
12	0.35	BG	245TL	S/JOINT SJ250T	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
13	4.0	PK	109SL	C1624S	418-587-05	-	418-116A	418-117	-	418-114	418-109
13	4.0	PK	109TL	C1624T	418-587-05	-	418-116A	418-117	-	418-114	418-109
14	0.5	R	97SL	C2046S	-	-	-	-	-	-	-
14	0.5	R	97TL	C2046T	-	-	-	-	-	-	-
15	0.5	BG	413SL	C0868S	-	-	-	-	-	-	-
15	0.5	BG	986TL	C0868TL	-	-	-	-	-	-	-
15	0.5	BG	982TL	C0868TA	-	-	-	-	-	-	-
16	0.35	R	986TL	C2053TL	418-411-47	-	418-116A	418-117	-	418-112	418-107
16	0.35	R	982TL	C2053TA	418-411-47	-	418-116A	418-117	-	418-112	418-107
19	0.5	S	982SL	C0868S	-	-	-	-	-	-	-
19	0.5	S	982TL	C0868TA	-	-	-	-	-	-	-
20	0.5	GW	982SL	C0868S	-	-	-	-	-	-	-
20	0.5	GW	982TL	C0868TA	-	-	-	-	-	-	-
21	0.5	GO	982SL	C0868S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
21	0.5	GO	982TL	C0868TA	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
22	1.0	RB	139SL	S/JOINT SJ22S	-	-	-	-	-	-	-
22	1.0	RB	139TL	S/JOINT SJ22T	-	-	-	-	-	-	-
23	1.5	N	319L	S/JOINT SJ318	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
24	2.5	U	319SL	C1642S	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
24	2.5	U	415T	C1390T	418-411-16	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C2243R

CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to engine compartment harness

Location: Base of RH 'A' post

Qualifier: RHD condition illustrated




Part No.: YPC910210

Colour: LIGHT GREY

Cavities: 14WY

Harness: CABIN HARNESS

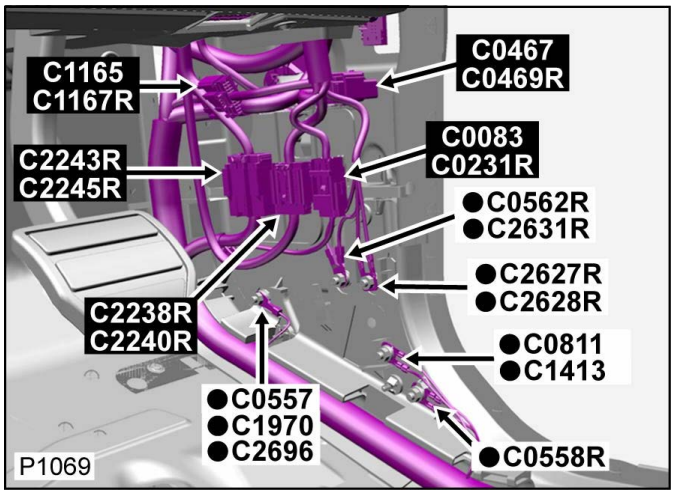

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	4.0	PS	109SR	C1623SR	418-587-05	-	418-116A	418-117	-	418-114	418-109
1	4.0	PS	109TR	C1623TR	418-587-05	-	418-116A	418-117	-	418-114	418-109
2	0.35	G	169SR	C0868S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	G	986TR	C0868TR	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	G	982TR	C0868TA	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	Y	986SR	C2658S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	Y	986TR	C2658TR	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	R	986SR	C2658S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	R	986TR	C2658TR	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	BG	413SR	C0868S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	BG	986TR	C0868TR	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	BG	982TR	C0868TA	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	W	216R	C1649	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	N	216R	C1649	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	GP	200R	C0586R	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	BG	986SR	C2658S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	BG	986TR	C2658TR	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	Y	986SR	C2658S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107

10	0.35	Y	986TR	C2658TR	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
11	0.35	N	986SR	C2658S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
11	0.35	N	986TR	C2658TR	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
12	0.35	G	986SR	C2658S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
12	0.35	G	986TR	C2658TR	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
13	1.0	RO	200SR	C0125S	-	-	-	-	-	-	-
13	1.0	RO	200TR	C0125T	-	-	-	-	-	-	-
14	4.0	R	478SR	C2414S	418-587-05	-	418-116A	418-117	-	418-114	418-109
14	4.0	R	478TR	C2414T	418-587-05	-	418-116A	418-117	-	418-114	418-109

Click here to print


Connector: C2244L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine compartment harness to main harness

Location: Behind passenger side of Instrument panel

Qualifier: LHD condition illustrated

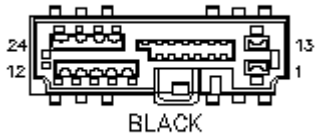

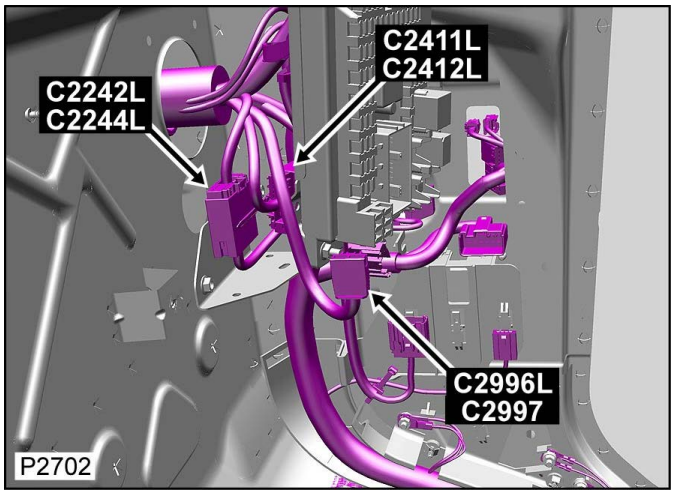

Part No.: YPC803270

Colour: BLACK

Cavities: 24WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	4.0	PS	109L	C0570L	418-100	-	418-116A	418-117	-	418-114	418-109
2	0.35	UW	309L	C2277	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.35	GW	309L	C2277	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.35	YB	309L	C2277	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.35	YG	309L	C2277	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.35	YS	309L	C2277	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.35	YO	309L	C2277	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.5	Y	797L	C3424L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	Y	807L	C3424L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	R	797L	C3424L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	R	807L	C3424L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	1.5	PO	245L	S/JOINT SJ8	-	-	-	-	-	-	-
11	0.75	R	139L	S/JOINT SJ242	-	-	-	-	-	-	-
12	0.5	PW	139L	C0570L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
13	4.0	PU	139L	C0570L	418-100	-	418-116A	418-117	-	418-114	418-109
14	0.5	LG	139L	S/JOINT SJ947	-	-	-	-	-	-	-
15	0.35	BR	245L	C3428	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.5	P	139L	S/JOINT SJ443	-	-	-	-	-	-	-
17	0.5	KO	139L	C1652	-	-	-	-	-	-	-

18	0.5	PLG	139L	C1652	-	-	-	-	-	-	-
19	0.5	W	139L	C1653	-	-	-	-	-	-	-
20	0.5	N	139L	C1653	-	-	-	-	-	-	-
21	0.5	YG	797L	C0872L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
21	0.5	NY	798L	C0658L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
21	0.5	YG	282L	C0635L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
22	0.5	WU	282L	C0635L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
23	1.0	SK	139L	C0570L	-	-	-	-	-	-	-
24	4.0	NU	21L	C0570L	418-100	-	418-116A	418-117	-	418-114	418-109

Click here to print


Connector: C2244R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine compartment harness to main harness

Location: Behind passenger side of Instrument panel

Qualifier: RHD condition illustrated

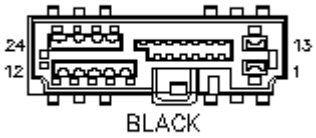

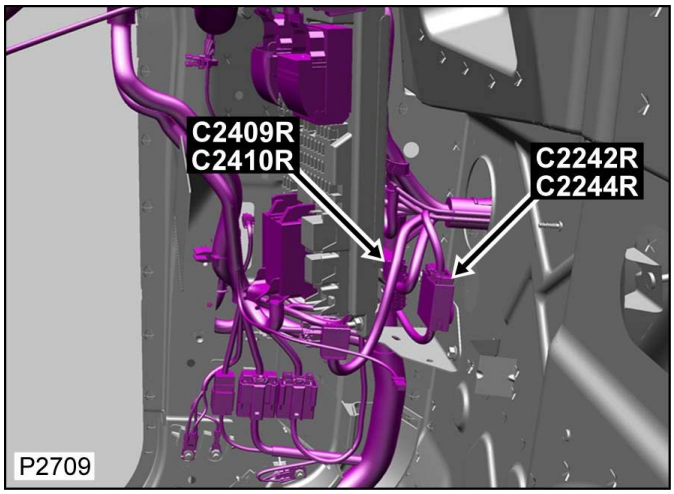

Part No.: YPC803270

Colour: BLACK

Cavities: 24WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	WP	254R	S/JOINT SJ1489	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
1	4.0	WP	282R	C0570R	418-100	-	418-116A	418-117	-	418-114	418-109
2	0.35	UW	309R	C2277	-	-	-	-	-	-	-
3	0.35	YG	309R	C2277	-	-	-	-	-	-	-
4	0.35	GW	309R	C2277	-	-	-	-	-	-	-
5	0.35	YB	309R	C2277	-	-	-	-	-	-	-
6	0.35	YS	309R	C2277	-	-	-	-	-	-	-
7	0.35	YO	309R	C2277	-	-	-	-	-	-	-
8	1.5	R	885R	S/JOINT SJ1014	-	-	-	-	-	-	-
9	0.5	GR	200R	C1857R	-	-	-	-	-	-	-
10	0.5	OR	200R	C1857R	-	-	-	-	-	-	-
11	0.5	O	200R	C1857R	-	-	-	-	-	-	-
12	0.75	R	200R	S/JOINT SJ1242	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
13	1.5	PO	245R	S/JOINT SJ1008	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
14	0.5	UR	21R	C0570R	418-411-45	-	418-116A	418-117	-	418-112	418-107
14	0.5	R	921R	C0506R	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.5	WY	798R	C0658R	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.5	WY	282R	C0635R	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.75	WY	797R	C0872R	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.5	P	200R	S/JOINT SJ443	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.5	GO	28R	S/JOINT SJ1905	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.35	YW	252R	C2240R	-	-	-	-	-	-	-
				S/JOINT							

18	0.35	YW	254R	SJ422	-	-	-	-	-	-	-
19	0.35	YU	252R	C2240R	-	-	-	-	-	-	-
19	0.35	YU	254R	S/JOINT SJ423	-	-	-	-	-	-	-
20	0.5	LG	200R	S/JOINT SJ1947	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	0.75	LGW	200R	C0583R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
22	1.0	SK	200R	C0570R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
23	1.0	RB	200R	S/JOINT SJ943	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
24	4.0	PK	109R	C0570R	418-100	-	418-116A	418-117	-	418-114	418-109

Click here to print


Connector: C2245L

CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine compartment harness to main harness

Location: LH 'A' post

Qualifier:

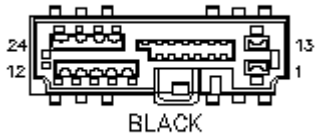


Part No.: YPC803270

Colour: BLACK

Cavities: 24WY

Harness: ENGINE COMPARTMENT HARNESS

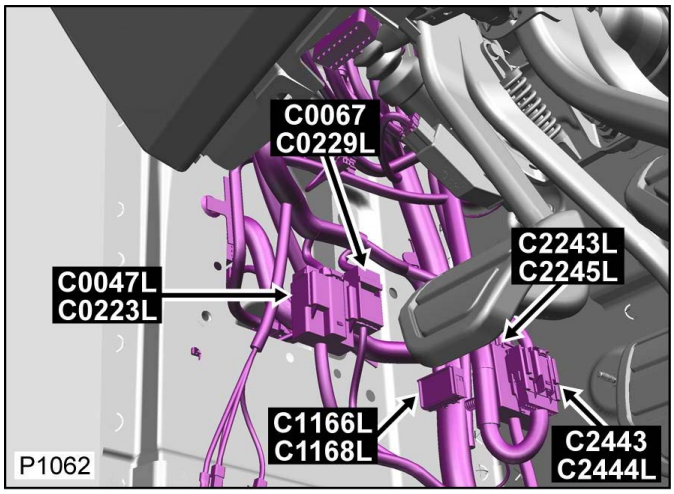

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	WP	254L	S/JOINT SJ489	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
1	4.0	WP	282L	C0570L	418-100	-	418-116A	418-117	-	418-114	418-109
2	0.5	G	139L	C1857L	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	GR	139L	C1857L	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	OR	139L	C1857L	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	O	139L	C1857L	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.35	YB	407L	C0647L	-	-	-	-	-	-	-
7	0.35	OS	407L	C0647L	-	-	-	-	-	-	-
8	0.35	YK	407L	C0647L	-	-	-	-	-	-	-
9	1.5	R	885L	S/JOINT SJ14	-	-	-	-	-	-	-
10	0.5	BR	245L	C3434L	-	-	-	-	-	-	-
11	0.5	BW	245L	C3434L	-	-	-	-	-	-	-
12	0.5	BG	245L	C3434L	-	-	-	-	-	-	-
13	4.0	PK	109L	C0570L	418-100	-	418-116A	418-117	-	418-114	418-109
14	0.5	R	97L	C0925	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.5	BG	413L	C0506L	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.5	R	921L	C0506L	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.5	S	798L	C3424L	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.5	GW	798L	C3424L	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	0.5	GO	798L	S/JOINT SJ905	-	-	-	-	-	-	-
22	1.0	RB	139L	S/JOINT SJ943	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

23	1.5	N	319L	C2590	-	-	-	-	-	-	-
24	2.5	U	319L	C2590	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C2245R

CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine compartment harness to main harness

Location: Base of RH 'A' post

Qualifier: RHD condition illustrated




Part No.: YPC910190

Colour: LIGHT GREY

Cavities: 14WY

Harness: ENGINE COMPARTMENT HARNESS

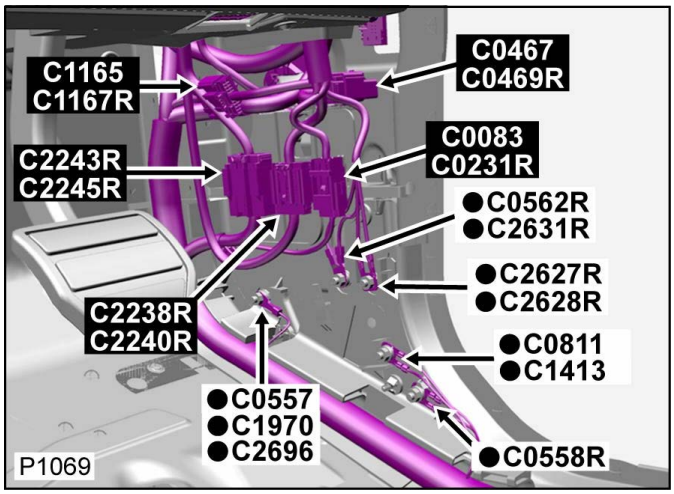

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	4.0	PS	109R	C0570R	418-100	-	418-116A	418-117	-	418-114	418-109
2	0.5	G	200R	C1857R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	Y	797R	C3424R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	Y	807R	C3424R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	R	797R	C3424R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	R	807R	C3424R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	BG	413R	C0506R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	W	200R	C1653	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	N	200R	C1653	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	GP	200R	S/JOINT SJ1814	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	BG	797R	C3424R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	BG	807R	C3424R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	Y	797R	C3424R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	Y	807R	C3424R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	N	797R	C3424R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
11	0.35	N	807R	C3424R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	G	797R	C3424R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
12	0.35	G	807R	C3424R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

13	1.0	RO	200R	S/JOINT SJ942	-	-	-	-	-	-	-
14	4.0	NP	200R	C0570R	418-100	-	418-116A	418-117	-	418-114	418-109

Click here to print

Connector: C2248T


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to instrument panel harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

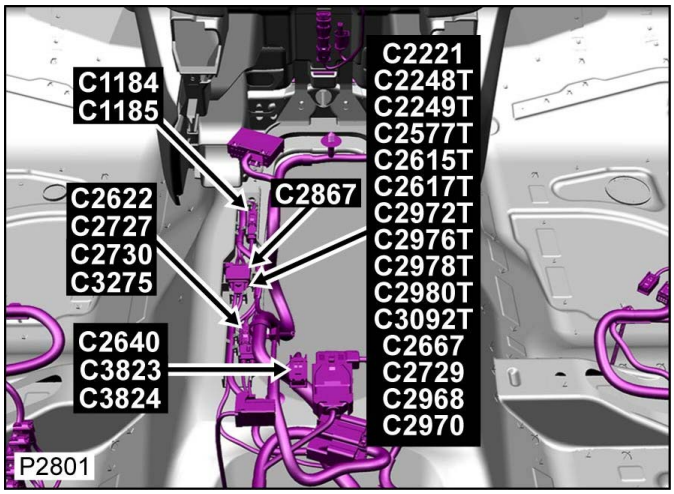

Part No.: XUD812780

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	662T	C2102T
2	POF	O	662T	C2491T

Click here to print

Connector: C2249T


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to instrument panel harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

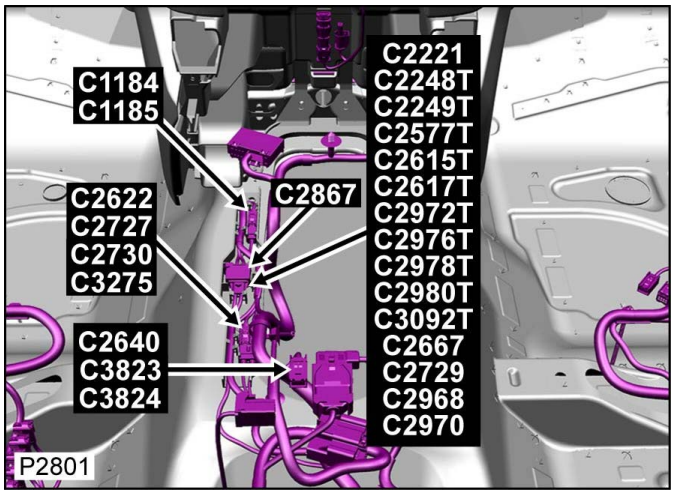

Part No.: XUD815240

Colour: BLACK

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	656T	C2102T
2	POF	O	656T	C2102T

Click here to print

Connector: C2251M

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC913010

Colour: BLACK


Cavities: 3WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Sensor-Pressure-Fuel rail - DV6

Location: RH side of engine

Qualifier:

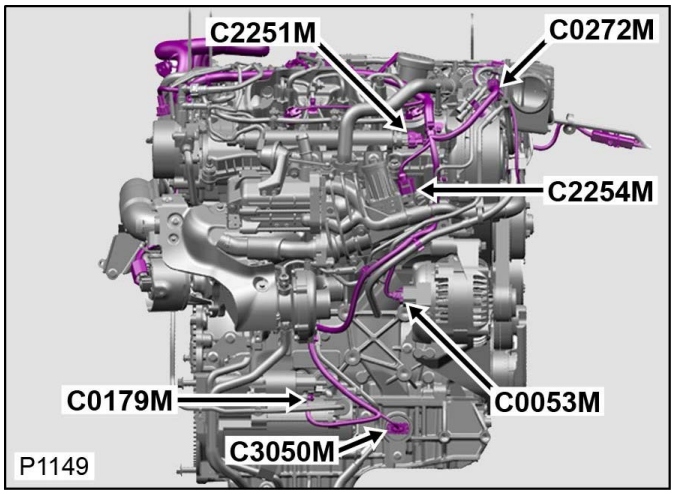


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	UN	798	C0659M
2	0.5	UN	798	C0659M
3	0.5	S	798	C0659M

Click here to print

Connector: C2254M

CONNECTOR HOUSING NOT SERVICEABLE

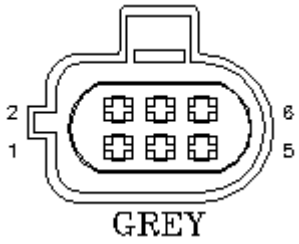

Part No.: YPC911180

Colour: GREY


Cavities: 6WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Actuator-EGR-Electric - DV6

Location: RH side of engine

Qualifier:

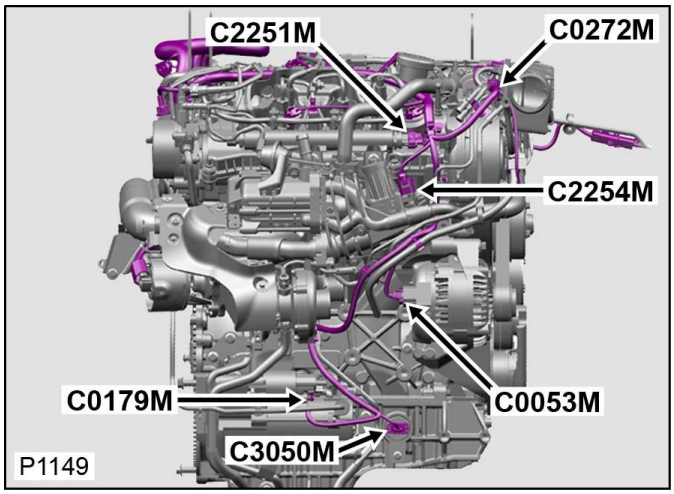


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	UG	798	C0659M
2	0.5	YP	798	C0659M
4	0.5	UO	798	S/JOINT SJ2
5	0.75	GU	798	C0659M
6	0.5	NW	798	S/JOINT SJ3

Click here to print

Connector: C2255M

CONNECTOR HOUSING NOT SERVICEABLE

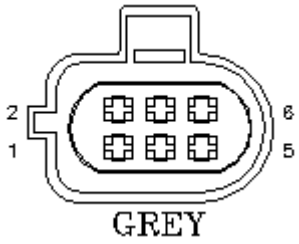

Part No.: YPC911180

Colour: GREY


Cavities: 6WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Actuator-EGR-Electric - DV6

Location: LH side of engine

Qualifier:

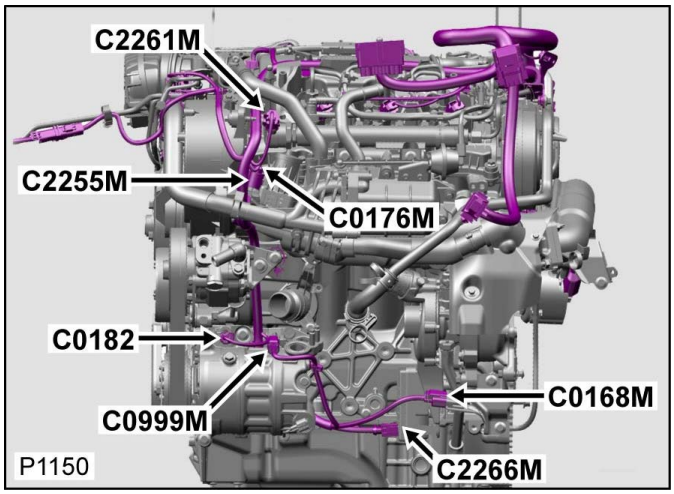


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	GU	798	C0659M
2	0.75	YP	798	C0659M
4	0.5	UO	798	S/JOINT SJ2
5	0.75	UG	798	C0659M
6	0.5	NW	798	S/JOINT SJ3

Click here to print

Connector: C2258

CONNECTOR HOUSING NOT SERVICEABLE

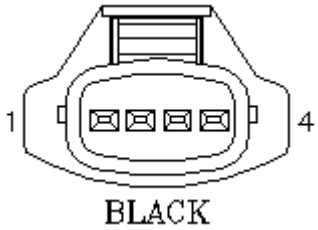

Part No.: YPC912800

Colour: BLACK


Cavities: 4WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Sensor-Temperature and Manifold-Absolute Pressure (TMAP)

Location: Rear of engine - Center

Qualifier:

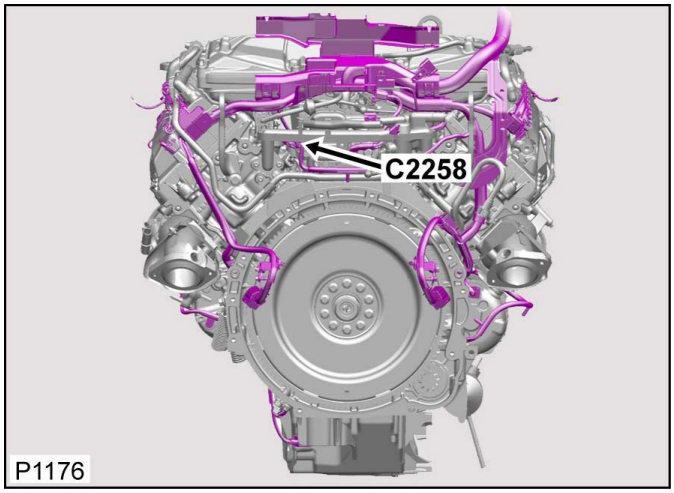


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	WN	(EN_RY)	S/JOINT PIS29
2	0.5	SO	(EN_RY)	C0634
3	0.5	GN	(EN_RY)	S/JOINT PIS30
4	0.5	US	(EN_RY)	C0634

Click here to print

Connector: **C2260M**

CONNECTOR HOUSING NOT SERVICEABLE

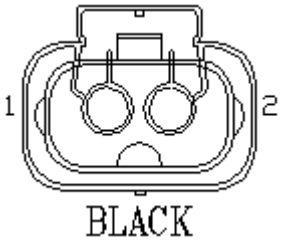

Part No.: YPC913430

Colour: BLACK


Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Valve-Control-Fuel volume - DV6

Location: Top of engine

Qualifier:

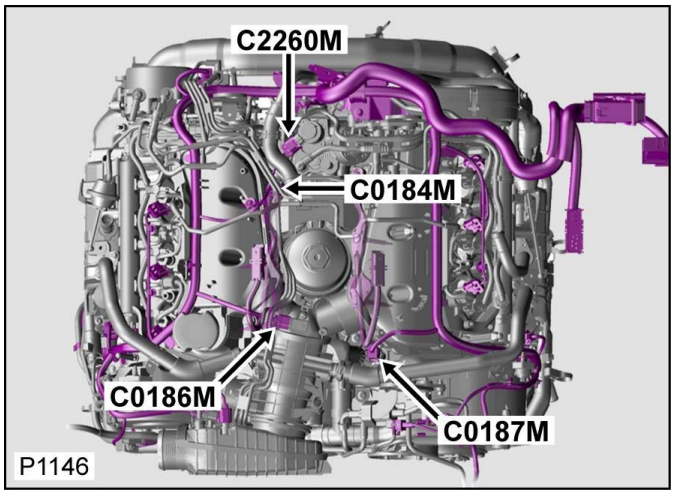


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	OW	798	S/JOINT SJ11
2	0.75	NY	798	C0659M

Click here to print

Connector: C2261M

CONNECTOR HOUSING NOT SERVICEABLE

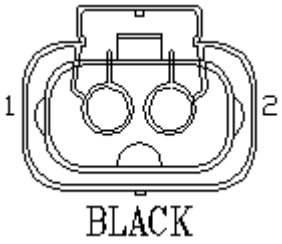

Part No.: YPC913430

Colour: BLACK


Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Valve-Control-Fuel pressure - DV6

Location: LH side of engine

Qualifier:

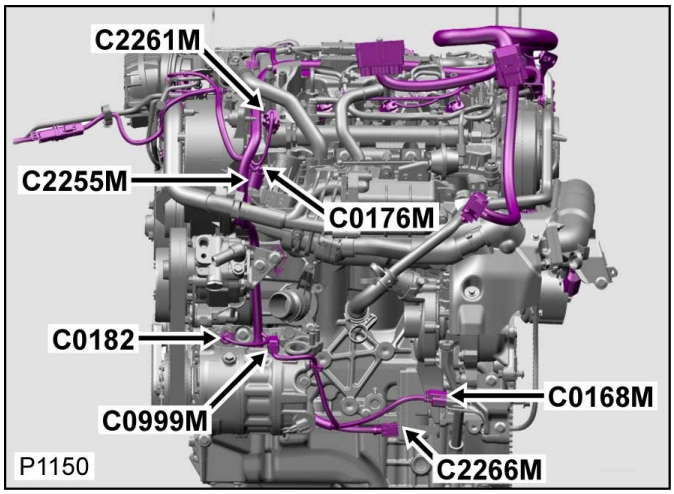


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	US	798	C0659M
2	0.75	OW	798	S/JOINT SJ11

Click here to print

Connector: C2262

CONNECTOR HOUSING NOT SERVICEABLE

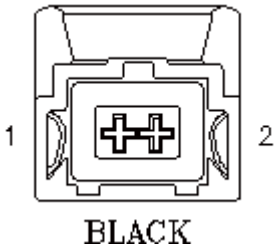

Part No.: YPC909150

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Active engine mounting solenoid

Location: Rear RH side of engine compartment

Qualifier:

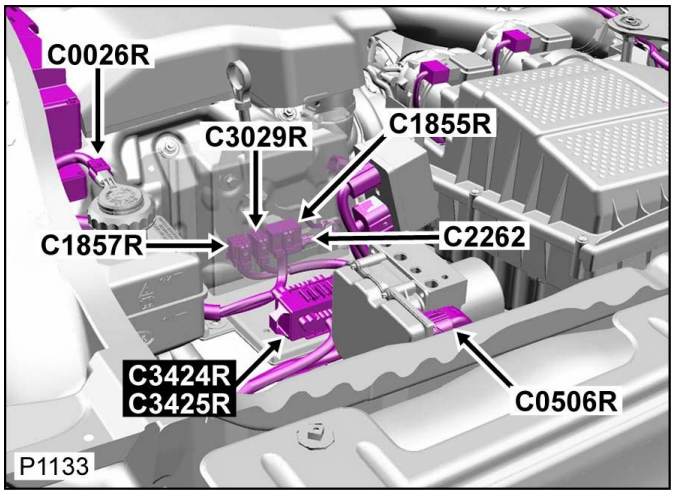

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	P	798L	S/JOINT SJ866
1	0.75	BN	798R	S/JOINT SJ1866
2	0.75	UO	798L	C0658L
2	0.75	UO	798R	C0658R

Click here to print


Connector: C2266M

CONNECTOR HOUSING NOT SERVICEABLE


Description: Actuator-Vane VGT - DV6

Location: LH side of engine

Qualifier:

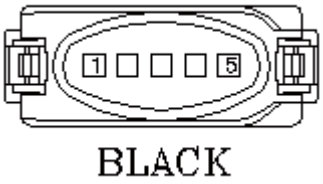

BLACK

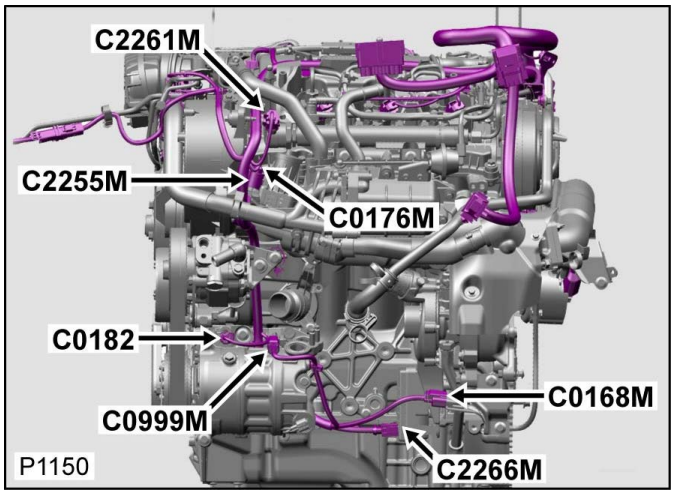

Part No.: YPC909760

Colour: BLACK

Cavities: 5WY

Harness: ENGINE DIESEL 3.0L HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	W	798	C0659M
2	1.0	U	798	C0659M
3	0.75	S	798	C0659M
4	0.75	WO	798	C0659M
5	0.75	UW	798	C0659M

Click here to print


Connector: C2270


CONNECTOR HOUSING NOT SERVICEABLE

Description: Viscous fan - DV6

Location: Front LH side of engine compartment

Qualifier:

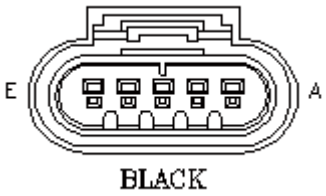

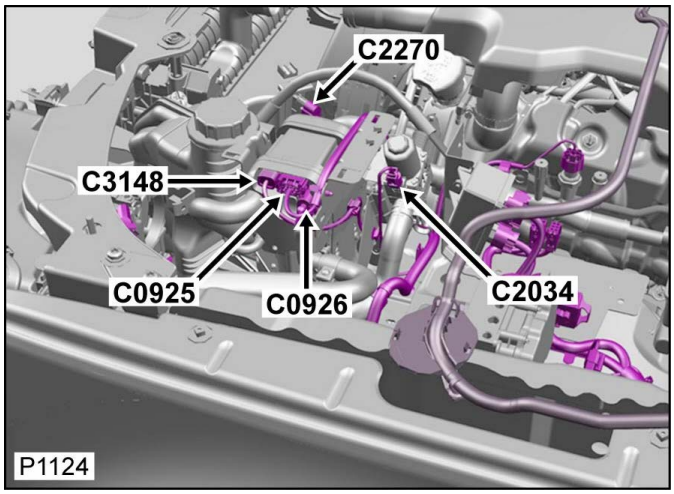

Part No.: YPC800240

Colour: BLACK

Cavities: 5WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
D	0.75	BO	797L	C2274L
C	0.75	KB	797L	C2274L
D	0.75	O	798L	C0658L
C	0.75	NB	798L	C0658L
A	1.0	BN	805	S/JOINT SJ630
B	1.0	B	805	C3001
E	1.0	BN	805	S/JOINT SJ630
D	0.75	BO	797R	C2274R
C	0.75	KB	797R	C2274R
D	0.75	O	798R	C0658R
C	0.75	NB	798R	C0658R

Click here to print


Connector: C2271


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Driver door

Location: Behind driver door trim panel

Qualifier: RHD condition illustrated



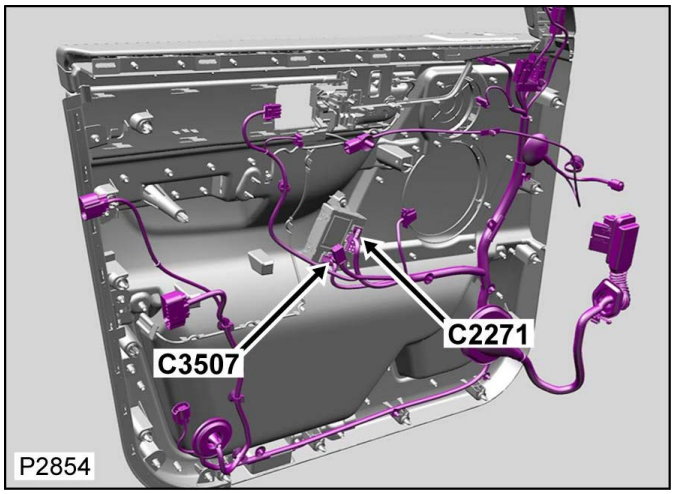

Part No.: YPC908660

Colour: BLACK

Cavities: 22WY

Harness: DOORS FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	G	674	C0740	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	B	674	C3646	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
3	0.35	US	674	C0978	-	-	-	-	-	-	-
4	0.5	B	674	C3560	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	UW	674	C0740	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.5	YU	674	C0740	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.75	B	674	C0441	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.75	B	674	C0441	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.75	B	674	C0441	418-411-45	-	418-116A	418-117	-	418-112	418-107
12	2.5	U	674	C0740	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
13	2.5	B	674	S/JOINT SJ840	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
15	0.5	B	674	C0441	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.5	PG	674	C0740	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.5	WN	674	C0740	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.5	B	674	S/JOINT SJ19	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	0.5	B	674	C0441	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2272


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Passenger door

Location: Behind passenger door trim panel

Qualifier: RHD condition illustrated



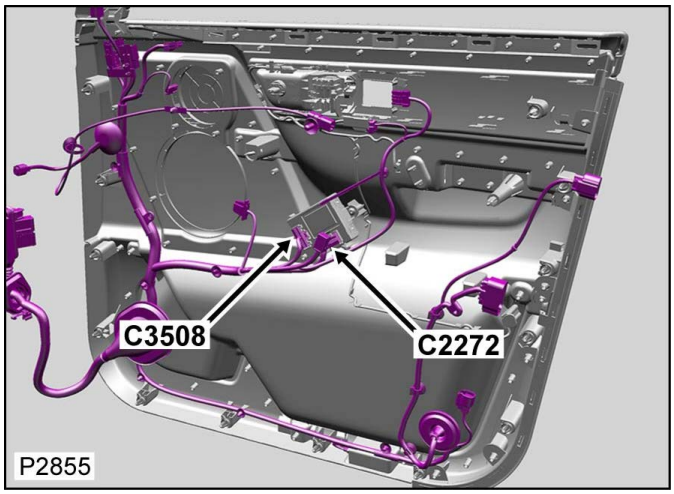

Part No.: YPC908680

Colour: GREY

Cavities: 22WY

Harness: DOORS FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	G	675	C0740	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	B	675	C0439	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
3	0.35	US	675	C0978	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	RN	675	S/JOINT SJ841	-	-	-	-	-	-	-
5	0.5	YU	675	C0740	-	-	-	-	-	-	-
6	0.5	UW	675	C0740	-	-	-	-	-	-	-
7	0.75	B	675	C0441	-	-	-	-	-	-	-
9	0.75	B	675	C0441	-	-	-	-	-	-	-
10	0.75	B	675	C0441	-	-	-	-	-	-	-
11	0.35	GO	675	C0087	418-411-45	-	418-116A	418-117	-	418-112	418-107
12	2.5	U	675	C0740	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
13	2.5	B	675	S/JOINT SJ840	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
15	0.5	B	675	C0441	-	-	-	-	-	-	-
16	0.5	PG	675	C0740	-	-	-	-	-	-	-
17	0.5	WN	675	C0740	-	-	-	-	-	-	-
18	0.5	G	675	C0087	-	-	-	-	-	-	-
20	0.5	B	675	S/JOINT SJ19	-	-	-	-	-	-	-
21	0.5	B	675	C0441	-	-	-	-	-	-	-
22	0.35	NY	675	C0087	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2274L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine compartment harness to engine harness

Location: Passenger side of engine compartment

Qualifier:

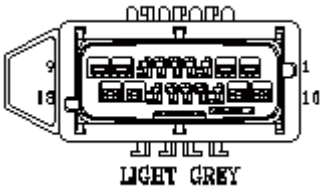

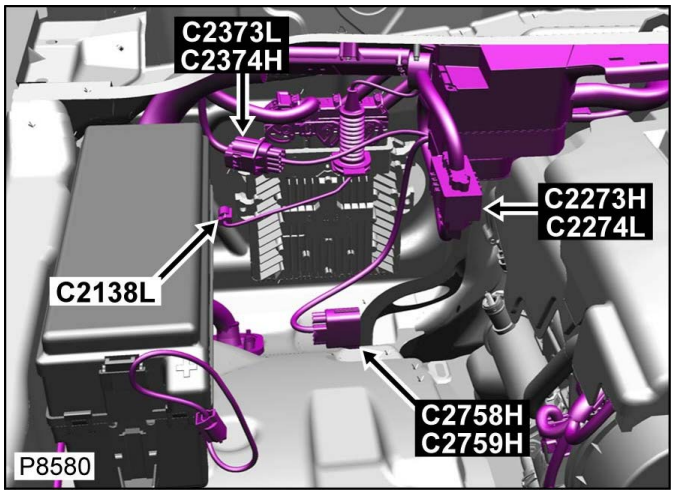

Part No.: YPC909610

Colour: LIGHT GREY

Cavities: 18WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	RB	797L	C0570L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
2	0.75	BN	797L	C0169	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	R	797L	C0570L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.75	RB	797L	S/JOINT SJ995	-	-	-	-	-	-	-
7	0.5	W	797L	C2240L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
8	0.75	KB	797L	C2270	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	S	797L	C2240L	-	-	-	-	-	-	-
12	0.75	BO	797L	C2270	-	-	-	-	-	-	-
13	0.75	W	797L	C0169	-	-	-	-	-	-	-
14	0.75	BG	797L	C0584L	-	-	-	-	-	-	-
15	0.35	YB	1006L	S/JOINT SJ1005	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
15	0.35	YB	1007L	S/JOINT SJ775	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
16	0.35	YN	1006L	S/JOINT SJ1024	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
16	0.35	YN	1007L	S/JOINT SJ785	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
18	1.5	RU	797L	C0570L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C2274R

CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine compartment harness to engine harness

Location: Passenger side of engine compartment

Qualifier:

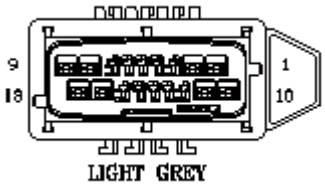


Part No.: YPC909640

Colour: LIGHT GREY

Cavities: 18WY

Harness: ENGINE COMPARTMENT HARNESS

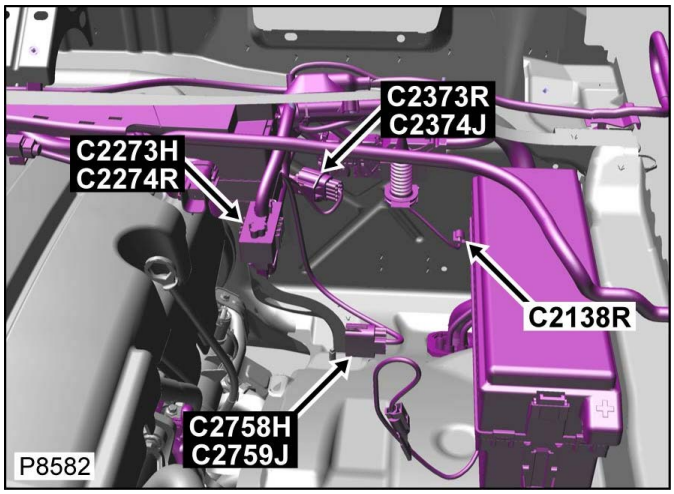

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	RB	797R	C0570R	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
2	0.75	BN	797R	C0169	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	R	797R	C0570R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.75	RB	797R	S/JOINT SJ1995	-	-	-	-	-	-	-
7	0.5	W	797R	C2240R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
8	0.75	KB	797R	C2270	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	S	797R	C2240R	-	-	-	-	-	-	-
12	0.75	BO	797R	C2270	-	-	-	-	-	-	-
13	0.75	W	797R	C0169	-	-	-	-	-	-	-
14	0.75	BG	797R	C0584R	-	-	-	-	-	-	-
15	0.35	YB	1006R	S/JOINT SJ2005	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
15	0.35	YB	1007R	S/JOINT SJ1775	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
16	0.35	YN	1006R	S/JOINT SJ2024	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
16	0.35	YN	1007R	S/JOINT SJ1785	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
18	1.5	RU	797R	C0570R	418-411-19	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C2277

CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine compartment harness to bumper harness

Location: Behind RH front fender splash shield

Qualifier:




Part No.: YPC904240

Colour: DARK GREY

Cavities: 8WY

Harness: ENGINE COMPARTMENT HARNESS

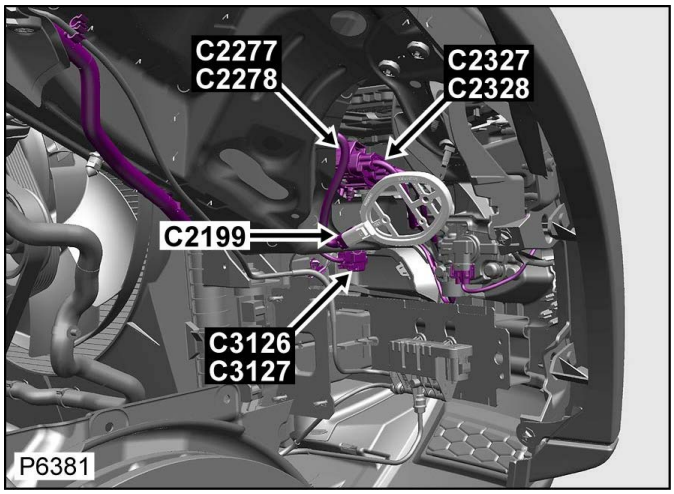

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	UW	309L	C2244L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
1	0.35	UW	309R	C2244R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
2	1.5	UP	93L	C0583L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	UP	93R	C0583R	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
3	0.35	GW	309L	C2244L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	GW	309R	C2244R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
4	1.5	B	93	S/JOINT SJ877	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
5	0.35	YG	309L	C2244L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	YG	309R	C2244R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
6	0.35	YS	309L	C2244L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
6	0.35	YS	309R	C2244R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	YB	309L	C2244L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	YB	309R	C2244R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
8	0.35	YO	309L	C2244L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
8	0.35	YO	309R	C2244R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2278

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC904290

Colour: DARK GREY


Cavities: 8WY

Harness: FRONT BUMPER HARNESS

Description: Bumper harness to engine compartment harness

Location: Behind RH front fender splash shield

Qualifier:

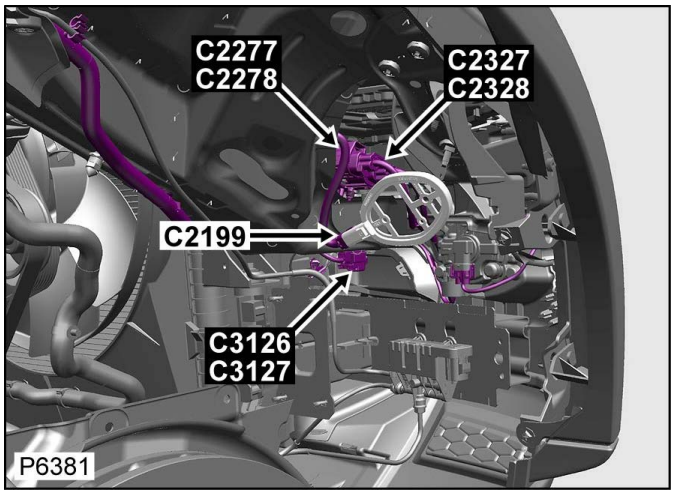


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	N	309	S/JOINT SJ402	-	-	-	-	-	-	-
2	1.5	UP	93	S/JOINT SJ191	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
3	0.35	B	309	S/JOINT SJ403	-	-	-	-	-	-	-
4	1.5	B	93	S/JOINT SJ404	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
5	0.35	YG	309	C0403	-	-	-	-	-	-	-
6	0.35	YS	309	C0400	-	-	-	-	-	-	-
7	0.35	YB	309	C0401	-	-	-	-	-	-	-
8	0.35	YO	309	C0402	-	-	-	-	-	-	-

Click here to print

Connector: C2281

CONNECTOR HOUSING NOT SERVICEABLE

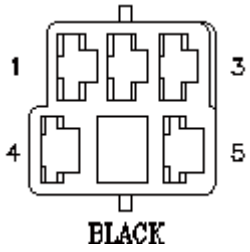

Part No.: YPC119190

Colour: BLACK


Cavities: 5WY

Harness: ATC RHD HARNESS

Description: Module-Blower-motor control-Front

Location: Climate control assembly-Passenger side

Qualifier:

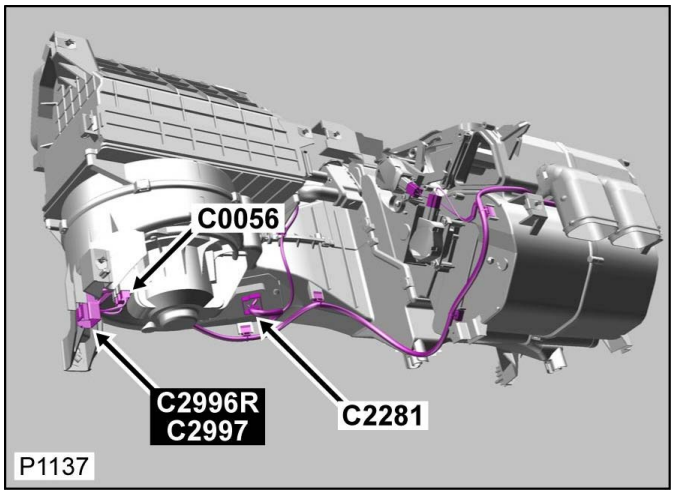

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	LGB	499	C3471	418-549-51	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	G	499	C3471	418-549-51	-	418-116A	418-117	418-104	418-112	418-107
4	4.0	R	499	C2997	-	-	-	-	-	-	-
5	4.0	B	499	C0056	-	-	-	-	-	-	-

Click here to print


Connector: C2283


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Steering-wheel-LH

Location: In center of steering wheel

Qualifier:

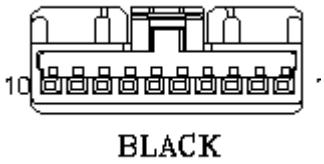

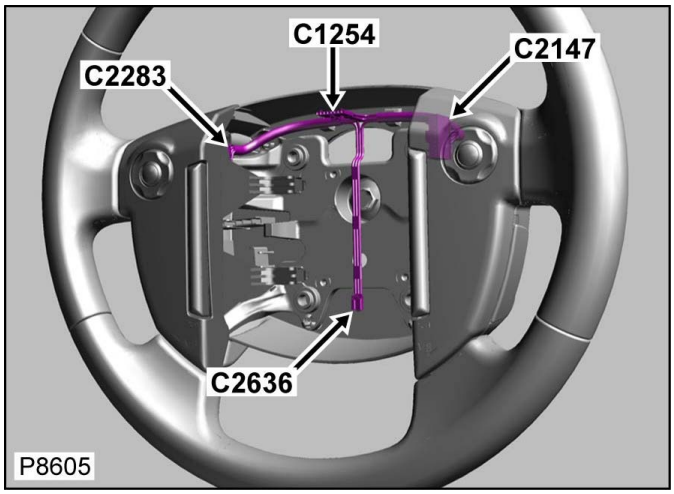

Part No.: CHCT-14489-AJA

Colour: BLACK

Cavities: 10WY

Harness: STEERING WHEEL HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	G	499	C1254
2	0.35	LU	499	C1254
3	0.35	W	499	C1254
4	0.35	K	499	C2147
5	0.35	N	499	C2147
6	0.35	S	499	C2147
7	0.35	O	499	C1254
8	0.35	P	499	C2147
9	0.35	B	499	C2636
10	0.35	R	499	C2147

Click here to print

Connector: C2284

CONNECTOR HOUSING NOT SERVICEABLE

No connector face
Geen connector-vooraanzicht
Pas de face de connecteur
Kein diagramm
Senza faccia connettore
Sem imagen dos pinos da ficha
No hay cara de conector

Part No.: F6VB-14489-BA

Colour:


Cavities:

Harness: STEERING WHEEL HARNESS

Description: Module-Steering-wheel-LH

Location: In center of steering wheel

Qualifier:

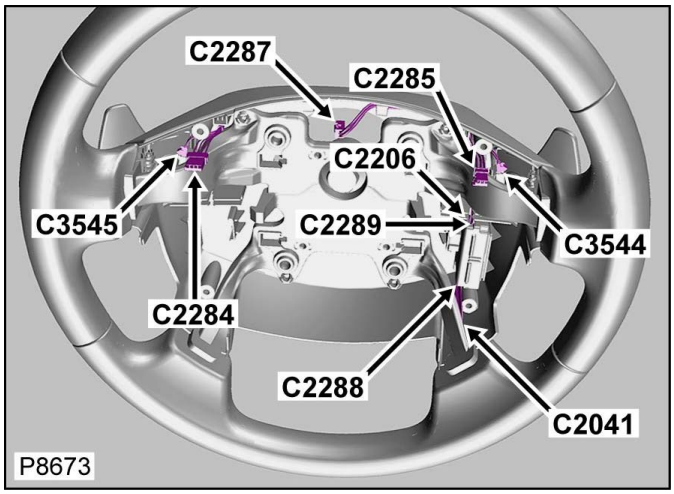

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	B	499	S/JOINT SJ7
2	0.35	S	499	C3544
3	0.35	S	499	C3545
4	0.35	R	499	S/JOINT SJ8

Click here to print

Connector: C2285


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Steering-wheel-RH

Location: In center of steering wheel

Qualifier:

ASSEMBLY

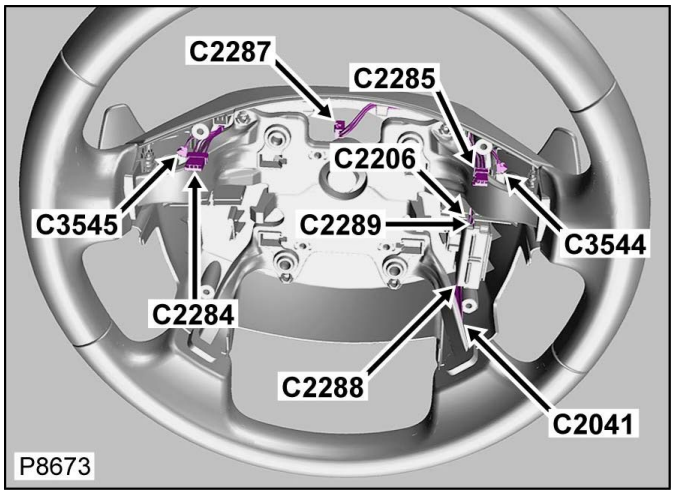

Part No.: CASSY

Colour: NO COLOUR

Cavities: 1WY

Harness: STEERING WHEEL HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	R	-	C2289
2	0.35	R	-	C2289
3	0.35	R	-	C2289

Click here to print

Connector: C2287


CONNECTOR HOUSING NOT SERVICEABLE

Description: Clock spring

Location: In center of steering wheel

Qualifier:

ASSEMBLY

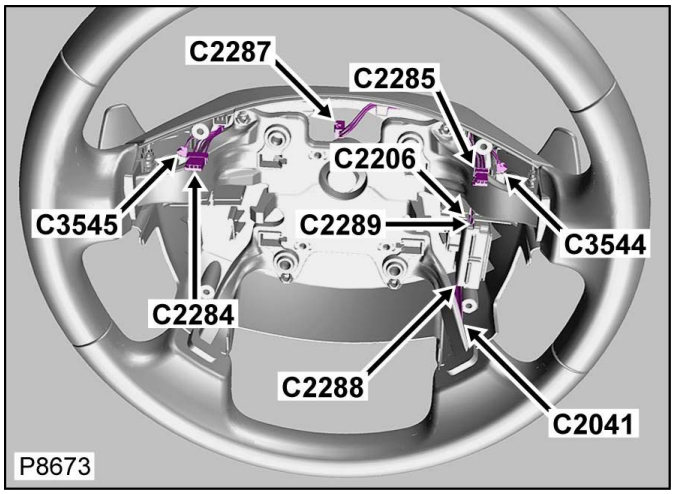

Part No.: CASSY

Colour: NO COLOUR

Cavities: 1WY

Harness: STEERING WHEEL HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	Y	-	C2206
2	0.75	B	-	C2206

Click here to print

Connector: C2288


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Heated steering wheel

Location: In center of steering wheel

Qualifier:

ASSEMBLY

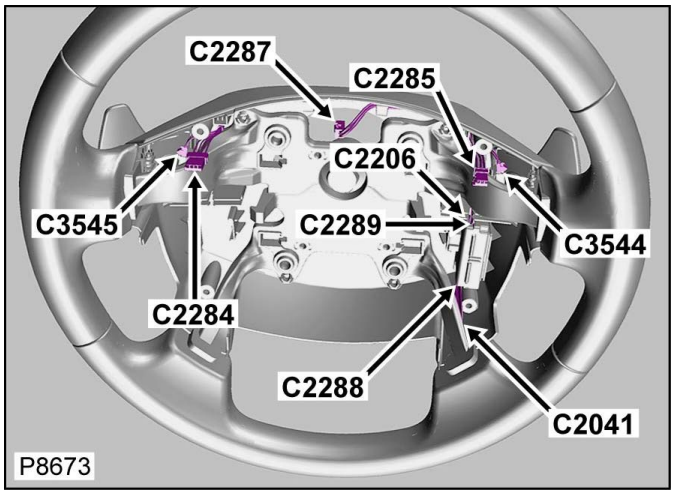

Part No.: CASSY

Colour: NO COLOUR

Cavities: 1WY

Harness: STEERING WHEEL HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	W	-	C2041
2	0.35	S	-	C2041
3	0.35	R	-	C2041
4	0.35	R	-	C2041

Click here to print


Connector: C2289

CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Heated steering wheel

Location: In center of steering wheel

Qualifier:

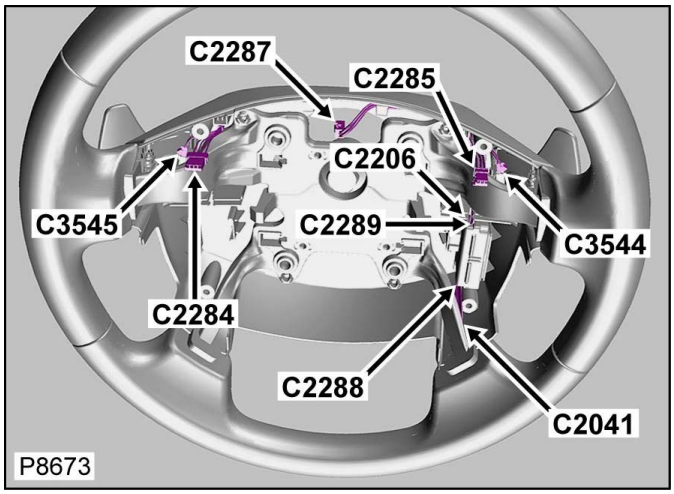

ASSEMBLY

Part No.: CASSY

Colour: NO COLOUR

Cavities: 1WY

Harness: STEERING WHEEL HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	R	-	C2285
2	0.35	R	-	C2285
3	0.35	R	-	C2285

Click here to print


Connector: C2293


CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine compartment harness to chassis harness

Location: Front LH side of engine compartment

Qualifier:

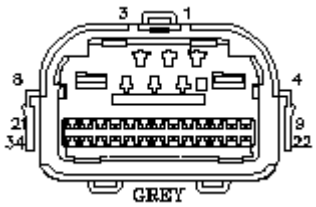

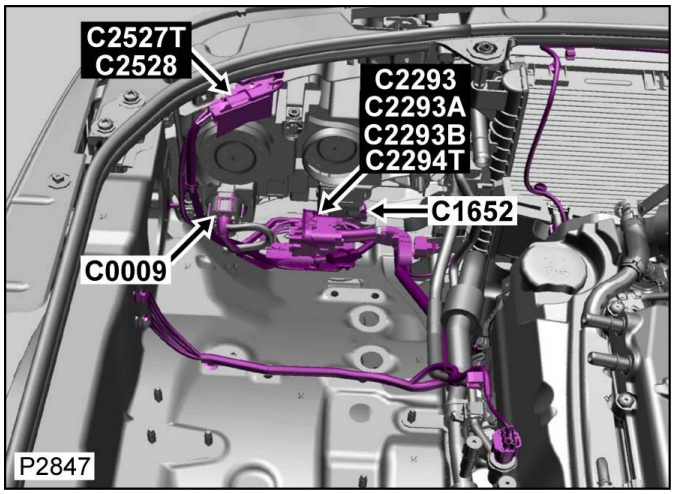

Part No.: YPC803930

Colour: GREY

Cavities: 34WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart


CAV	CSA	COL	CCT	DESTN
1	0.75	NK	319L	S/JOINT SJ941
2	0.5	R	319L	C0635L
3	0.5	G	319L	C0635L
5	0.5	Y	319L	C0635L
6	0.5	UG	413L	C0506L
6	0.5	UG	413R	C0506R
8	6.0	GY	139L	C0570L
8	6.0	GY	200R	C0570R
10	0.75	BW	419L	C2320L
10	0.75	BW	419R	C2320R
11	0.75	BU	419L	C2320L
11	0.75	BU	419R	C2320R
12	0.35	BY	419L	C2321L
12	0.35	BY	419R	C2321R
13	0.35	BG	419L	C2321L
13	0.35	BG	419R	C2321R
14	0.35	YB	419L	C2320L
14	0.35	YB	419R	C2320R
15	0.35	OS	419L	C2320L
15	0.35	OS	419R	C2320R
16	0.35	YK	419L	C2320L
16	0.35	YK	419R	C2320R
17	1.0	BW	419L	C2321L
17	1.0	BW	419R	C2321R
18	1.0	B	419L	C2321L
18	1.0	B	419R	C2321R
19	0.35	SG	419L	C2321L
19	0.35	SG	419R	C2321R
20	0.35	SO	419L	C2321L
20	0.35	SO	419R	C2321R
21	0.35	SB	419L	C2321L
21	0.35	SB	419R	C2321R

23	0.5	W	413L	C0506L
23	0.5	W	413R	C0506R
25	0.5	G	413L	C0506L
25	0.5	G	413R	C0506R
27	0.5	UW	413L	C0506L
27	0.5	UW	413R	C0506R
29	0.35	R	499	C0050
30	0.75	R	825L	C0584L
31	0.75	BR	825L	C0584L

Click here to print

Connector: C2293A

CONNECTOR HOUSING NOT SERVICEABLE

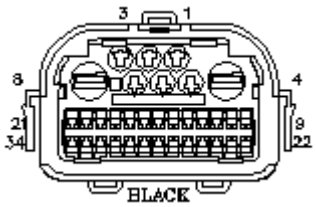

Part No.: YPC803910

Colour: BLACK


Cavities: 24WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to chassis harness

Location: Front LH side of engine compartment


Qualifier:

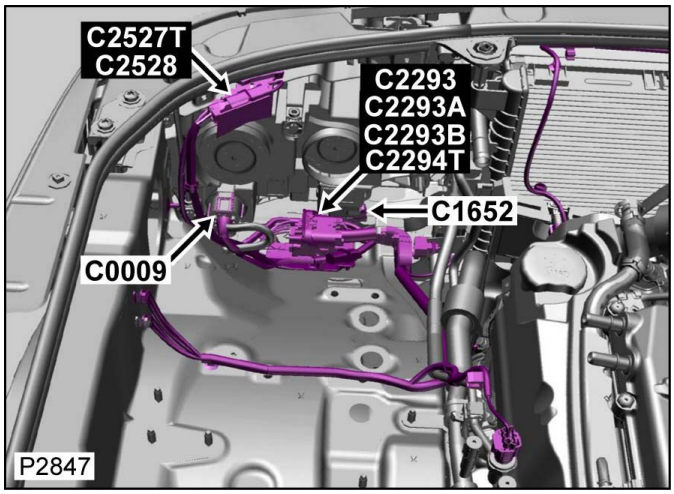

Click here to print

Connector: **C2293B**

CONNECTOR HOUSING NOT SERVICEABLE

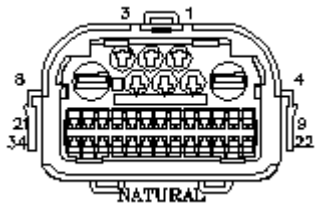

Part No.: YPC803950

Colour: NATURAL


Cavities: 34WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to chassis harness

Location: Front LH side of engine compartment

Qualifier:

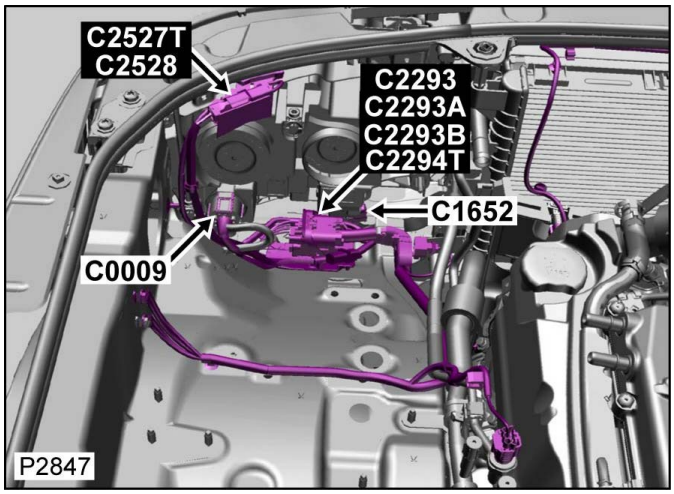

Click here to print

Connector: C2294T

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC803940

Colour: GREY


Cavities: 34WY

Harness: CHASSIS HARNESS

Description: Chassis harness to engine compartment harness

Location: Front LH side of engine compartment

Qualifier:

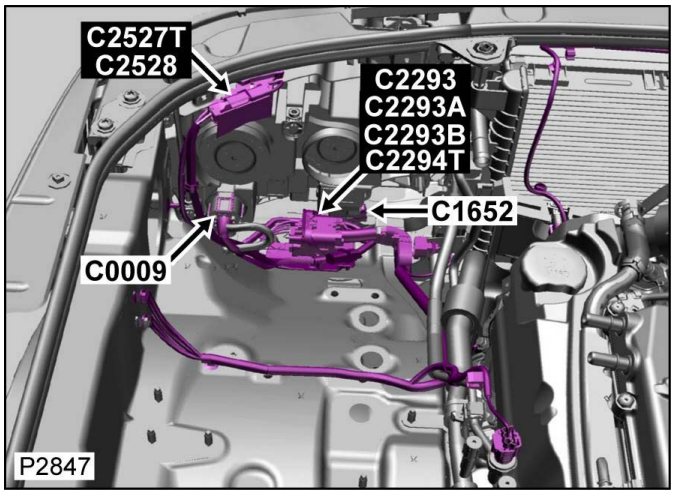


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	NK	382T	C1339
2	0.5	R	382T	C1339
3	0.5	G	382T	C1339
5	0.5	Y	382T	C1339
6	0.5	W	413T	C0503
8	6.0	GY	395T	S/JOINT SJ5
10	0.75	BW	419T	C0781
11	0.75	BU	419T	C0781
12	0.5	BY	419T	C0781
13	0.5	BG	419T	C0781
14	0.5	YB	419T	C1684T
15	0.5	OS	419T	C1684T
16	0.5	YK	419T	C1684T
17	1.0	BW	419T	C1689
18	1.0	B	419T	C1689
19	0.35	SG	245	C3095
19	0.35	SG	826T	C1696T
20	0.35	SO	245	C3095
20	0.35	SO	826T	C1696T
21	0.35	SB	245	C3095
21	0.35	SB	826T	C1696T
23	0.5	WY	413T	C0502
25	0.5	WG	413T	C0503
27	0.5	W	413T	C0502
29	0.5	B	131T	C0968
30	0.75	R	825	C2038B
31	0.75	BR	825	C2038B

Click here to print

Connector: C2299

CONNECTOR HOUSING NOT SERVICEABLE

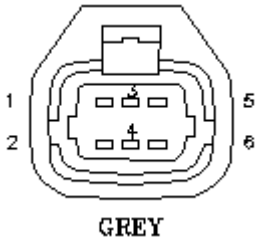

Part No.: YPC803590

Colour: GREY


Cavities: 6WY

Harness: DOORS FRONT HARNESS

Description: Module-Door handle

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated

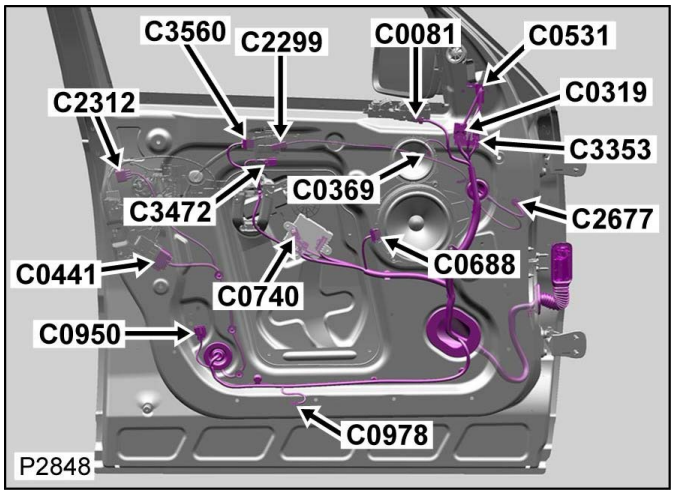


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	B	410	S/JOINT SJ840
2	0.35	RU	811	C0439
2	0.35	RU	812	C3646
3	0.35	RG	811	C0439
3	0.35	RG	812	C3646
4	0.35	W	811	C0439
4	0.35	W	812	C3646
5	0.35	G	811	C0439
5	0.35	G	812	C3646
6	0.35	R	811	C0439
6	0.35	R	812	C3646

Click here to print

Connector: C2301

CONNECTOR HOUSING NOT SERVICEABLE

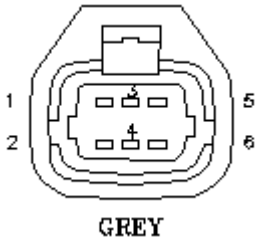

Part No.: YPC803590

Colour: GREY


Cavities: 6WY

Harness: REAR DOOR HARNESS

Description: Module-Rear door handle

Location: Behind rear door trim panel

Qualifier: LH side illustrated RH side similar

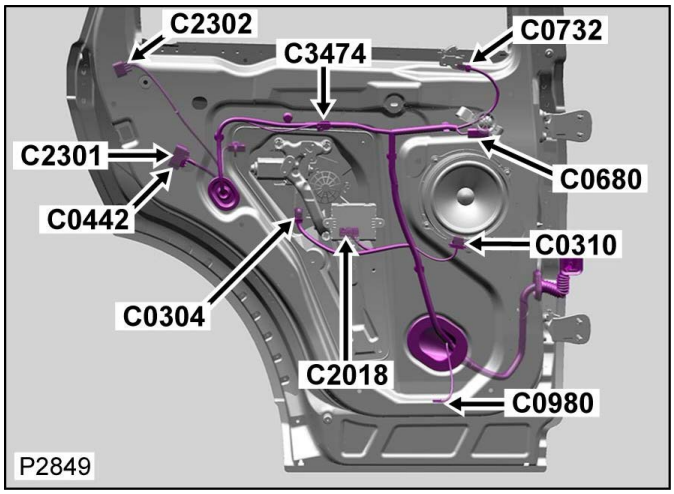


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	B	410	S/JOINT SJ200
2	0.35	RW	811	C0803
2	0.35	RW	812	C0804
3	0.35	RW	811	C0803
3	0.35	RW	812	C0804
4	0.35	WR	811	C0803
4	0.35	WR	812	C0804
5	0.35	GR	811	C0803
5	0.35	GR	812	C0804
6	0.35	R	811	C0803
6	0.35	R	812	C0804

Click here to print

Connector: C2302

CONNECTOR HOUSING NOT SERVICEABLE

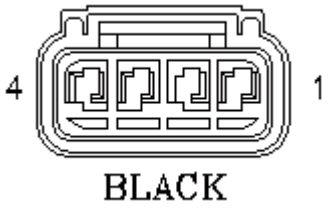

Part No.: YPC500740

Colour: BLACK


Cavities: 4WY

Harness: REAR DOOR HARNESS

Description: Module-Rear door latch

Location: Behind rear door trim panel

Qualifier: LH side illustrated RH side similar

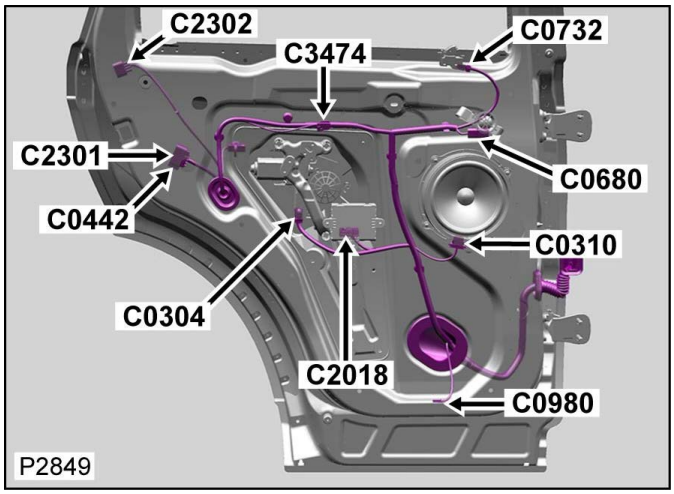

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	B	811	C0803	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
1	0.5	B	812	S/JOINT SJ200	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	1.5	B	811	C0803	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
2	0.5	B	812	C0804	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	1.5	B	812	C0804	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
3	0.5	B	811	C0803	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	1.5	B	812	C0804	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
4	0.5	B	811	S/JOINT SJ200	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2312


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Door latch

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated



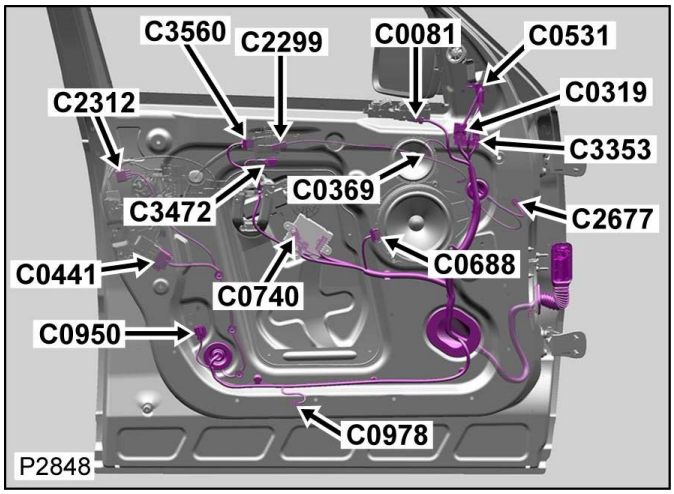

Part No.: YPC500740

Colour: BLACK

Cavities: 4WY

Harness: DOORS FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	B	811	C0439	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
1	0.5	B	812	S/JOINT SJ840	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	1.5	B	811	C0439	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
2	0.5	B	812	C3646	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	B	811	C0439	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	1.5	B	812	C3646	418-587-09	-	418-116A	418-117	418-104	418-113	418-108
4	0.5	B	811	S/JOINT SJ840	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	1.5	B	812	C3646	418-587-09	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C2314

CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to console harness

Location: Beneath center console RH side

Qualifier: LHD condition illustrated

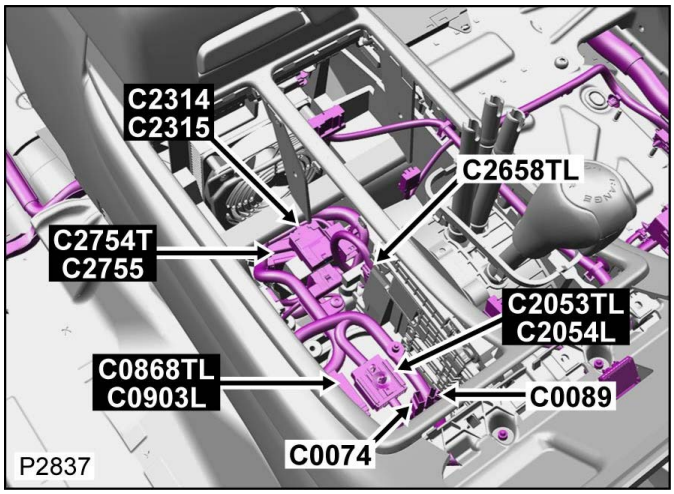

ASSEMBLY

Part No.: XUD815540

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
2	0.5	B	514S	C3721S
2	0.5	B	514T	C3721T
4	0.5	N	514S	C3721S
4	0.5	N	514T	C3721T
6	0.5	P	514S	C3721S
6	0.5	P	514T	C3721T
8	0.5	R	514S	C3721S
8	0.5	R	514T	C3721T
10	SCR	SCR	514S	C3721S
10	SCR	SCR	514T	C3721T
16	0.5	UG	514S	C2490S
16	0.5	W	514T	C2490T
17	SCR	SCR	514S	C2490S
17	SCR	SCR	514T	C2490T
18	SCR	SCR	514S	C2490S
18	SCR	SCR	514T	C2490T
19	0.5	R	514S	C2490S
19	0.5	R	514T	C2490T
20	0.5	UY	514S	C2490S
20	0.5	U	514T	C2490T

Click here to print


Connector: C2315

CONNECTOR HOUSING NOT SERVICEABLE

Description: Console harness to ICE harness

Location: Beneath center console RH side

Qualifier: LHD condition illustrated

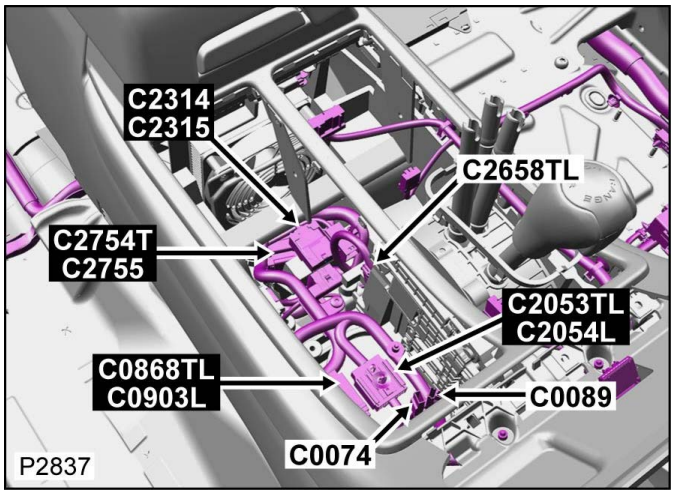

ASSEMBLY

Part No.: XUD815530

Colour: NO COLOUR

Cavities: 1WY

Harness: CONSOLE REAR HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
2	0.5	N	425	C2226
4	0.5	G	425	C2226
6	0.5	W	425	C2226
8	0.5	Y	425	C2226
10	SCR	SCR	425	C2226
16	0.5	G	425	C2226
17	SCR	SCR	425	C2226
18	SCR	SCR	425	C2226
19	0.5	R	425	C2226
20	0.5	U	425	C2226

Click here to print

Connector: C2320L

CONNECTOR HOUSING NOT SERVICEABLE

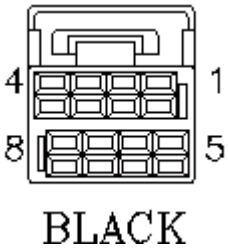

BLACK

Part No.: YPC500670

Colour: BLACK


Cavities: 8WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Module-Air suspension

Location: LH 'A' post

Qualifier:

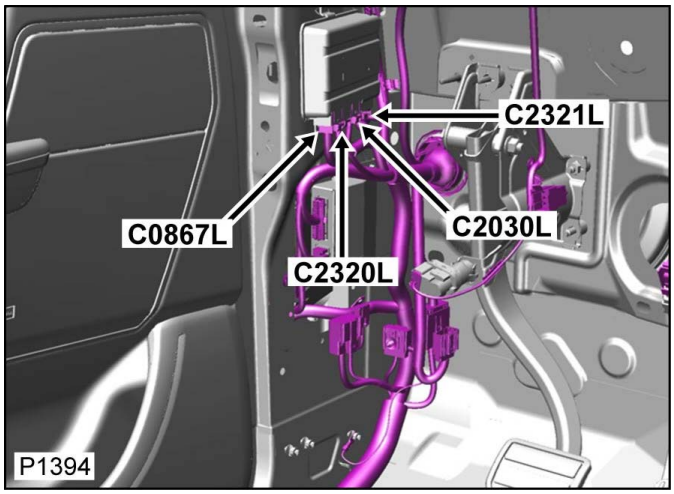


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	NR	419L	C0570L	-	-	-	-	-	-	-
2	0.35	YB	419L	C2293	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	OS	419L	C2293	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	YK	419L	C2293	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
5	0.75	BU	419L	C2293	-	-	-	-	-	-	-
6	0.75	BW	419L	C2293	-	-	-	-	-	-	-

Click here to print

Connector: C2320R

CONNECTOR HOUSING NOT SERVICEABLE

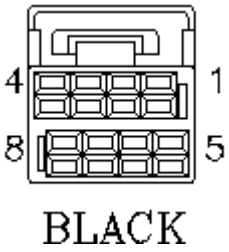

BLACK

Part No.: YPC500670

Colour: BLACK


Cavities: 8WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Module-Air suspension

Location: RH 'A' post

Qualifier:

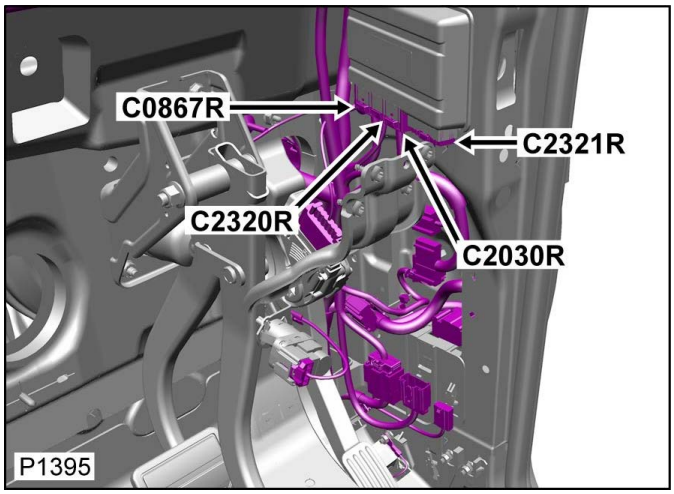

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	NR	419R	C0570R	-	-	-	-	-	-	-
2	0.35	YB	419R	C2293	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	OS	419R	C2293	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	YK	419R	C2293	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
5	0.75	BU	419R	C2293	-	-	-	-	-	-	-
6	0.75	BW	419R	C2293	-	-	-	-	-	-	-

Click here to print


Connector: C2321L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Air suspension

Location: LH 'A' post

Qualifier:

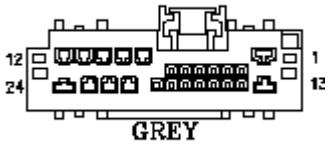

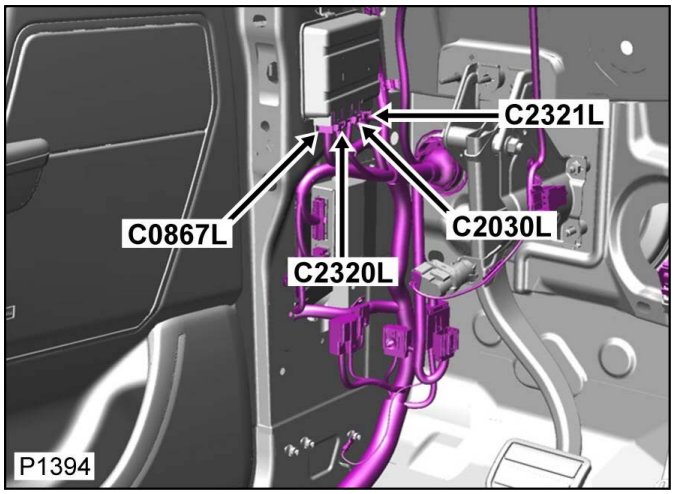

Part No.: YPC500400

Colour: GREY

Cavities: 24WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	PU	419L	C0570L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	0.35	BY	419L	C2293	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.35	SG	419L	C2293	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.35	SO	419L	C2293	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.35	SB	419L	C2293	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.5	R	419L	C0570L	-	-	-	-	-	-	-
7	0.5	BY	419L	C0570L	-	-	-	-	-	-	-
8	1.0	BW	419L	C2293	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	1.0	BO	419L	C3009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	1.0	BP	419L	C3009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
11	1.0	BG	419L	C3009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
12	1.0	BY	419L	C3009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
14	0.35	SY	419L	C3009	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.35	SU	419L	C3009	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.35	SR	419L	C3009	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.35	BG	419L	C2293	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	1.0	B	419L	C2293	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
22	1.0	BW	419L	C3009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
23	1.0	BU	419L	C3009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

24	2.5	B	808L	C0559L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
24	2.5	B	809L	C2602L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
24	2.5	B	245L	C2602L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C2321R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Air suspension

Location: RH 'A' post

Qualifier:

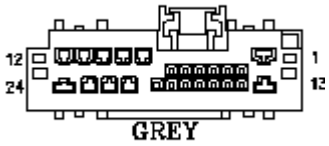

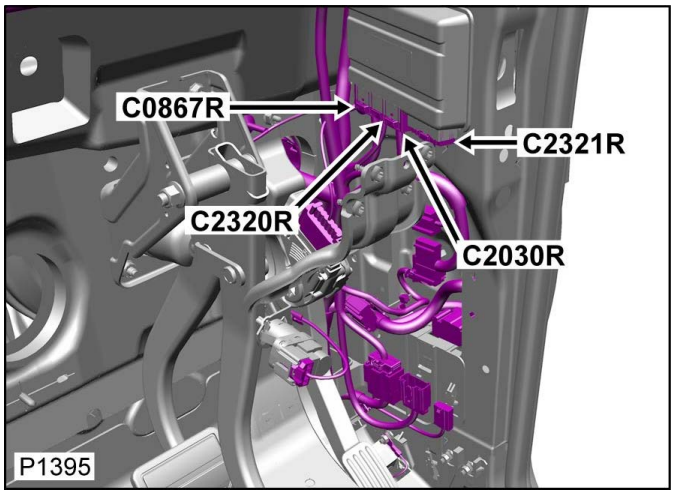

Part No.: YPC500400

Colour: GREY

Cavities: 24WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	PU	419R	C0570R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	0.35	BY	419R	C2293	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.35	SG	419R	C2293	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.35	SO	419R	C2293	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.35	SB	419R	C2293	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.5	R	419R	C0570R	-	-	-	-	-	-	-
7	0.5	BY	419R	C0570R	-	-	-	-	-	-	-
8	1.0	BW	419R	C2293	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	1.0	BO	419R	C3009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	1.0	BP	419R	C3009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
11	1.0	BG	419R	C3009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
12	1.0	BY	419R	C3009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
14	0.35	SY	419R	C3009	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.35	SU	419R	C3009	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.35	SR	419R	C3009	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.35	BG	419R	C2293	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	1.0	B	419R	C2293	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
22	1.0	BW	419R	C3009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
23	1.0	BU	419R	C3009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

24	2.5	B	953R	C0559R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
24	2.5	B	951R	C3310R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C2363

CONNECTOR HOUSING NOT SERVICEABLE

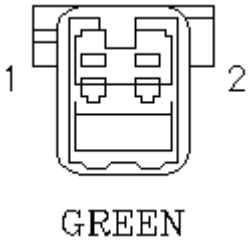

GREEN

Part No.: YPC800270

Colour: GREEN


Cavities: 2WY

Harness: SEAT FRONT HARNESS

Description: Seat harness to main harness

Location: Beneath front seat

Qualifier:

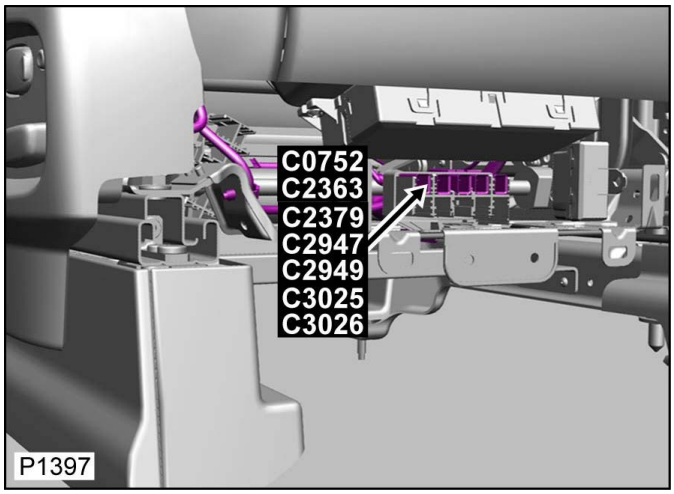


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	SP	207	C0773	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	B	459	C0962	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	Y	207	C0773	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RW	459	C0962	418-411-12	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2366H

CONNECTOR HOUSING NOT SERVICEABLE

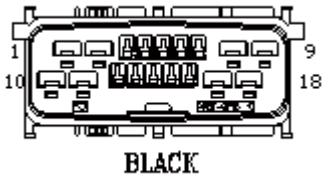

Part No.: YPC909660

Colour: BLACK


Cavities: 18WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Transmission harness to engine compartment harness

Location: Driver side of engine compartment

Qualifier:

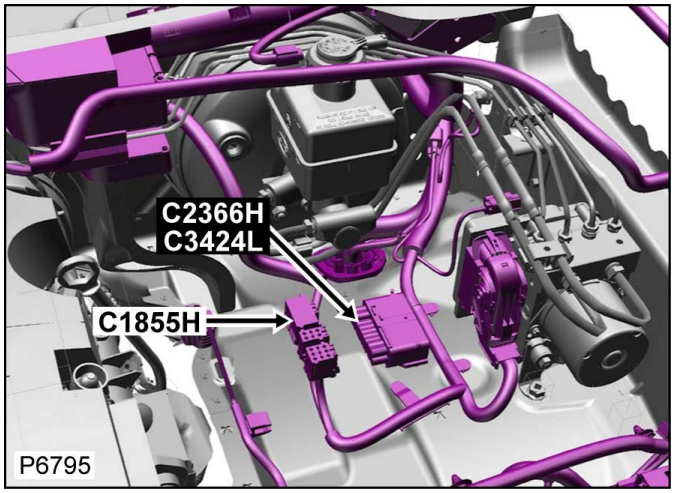

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	PY	729L	S/JOINT SJ4410	-	-	-	-	-	-	-
2	0.5	YN	729L	S/JOINT SJ720	-	-	-	-	-	-	-
3	0.5	YB	729L	S/JOINT SJ721	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	YN	729L	S/JOINT SJ720	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	YB	729L	S/JOINT SJ721	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	1.0	GW	729L	C3432	-	-	-	-	-	-	-
7	0.5	BG	729L	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	GO	729L	C3432	-	-	-	-	-	-	-
9	0.5	N	729L	C3432	-	-	-	-	-	-	-
10	1.0	B	729L	S/JOINT SJ4409	-	-	-	-	-	-	-
11	0.5	Y	729L	C3432	-	-	-	-	-	-	-
13	0.5	YW	729L	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	R	729L	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
15	0.5	G	729L	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
16	0.5	GW	729L	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C2368

CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to seat harness

Location: Beneath RH Front seat

Qualifier:

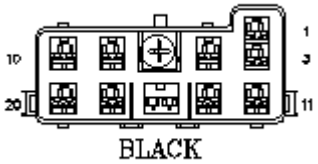


Part No.: YPC801440

Colour: BLACK

Cavities: 20WY

Harness: CABIN HARNESS

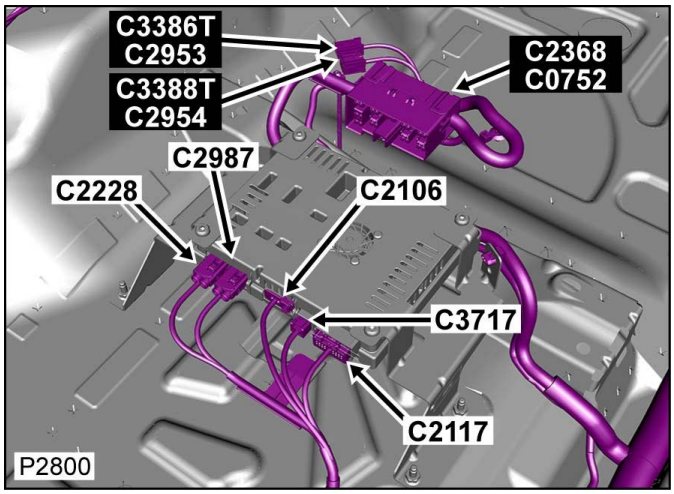

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	R	204L	C2411L	-	-	-	-	-	-	-
1	1.5	R	204R	C2409R	-	-	-	-	-	-	-
2	0.35	NP	204L	C1165	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	WG	204R	C1166R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
4	1.5	B	204	C2696	-	-	-	-	-	-	-
5	0.5	WY	216	C0256	-	-	-	-	-	-	-
6	0.5	NY	216	C0256	-	-	-	-	-	-	-
7	0.5	YR	216L	C0256	-	-	-	-	-	-	-
7	0.5	LGR	216R	C0256	-	-	-	-	-	-	-
8	0.5	UB	216L	C0256	-	-	-	-	-	-	-
8	0.5	LGB	216R	C0256	-	-	-	-	-	-	-
9	0.35	G	216L	C0256	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	G	216R	C0256	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	B	216	C2561	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	GK	499	S/JOINT SJ14	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
12	1.5	B	499	S/JOINT SJ2024	-	-	-	-	-	-	-
13	0.35	YW	207R	S/JOINT SJ2000	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
14	0.35	YU	207R	S/JOINT SJ2001	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
15	2.5	NP	139L	C0585L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
15	2.5	NP	200R	S/JOINT SJ3004	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
16	2.5	B	499	S/JOINT SJ2024	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
17	0.5	B	139L	C2561	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

17	0.35	SP	207R	C0398	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
18	0.5	RW	319L	S/JOINT SJ17	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
18	0.35	O	162L	C0586L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
19	0.35	YN	319L	S/JOINT SJ1003	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
19	0.5	B	216R	C2561	-	-	-	-	-	-	-
20	0.35	YB	319L	S/JOINT SJ1004	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
20	0.5	LG	216R	C0256	-	-	-	-	-	-	-

Click here to print

Connector: C2369

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC800060

Colour: DARK GREY


Cavities: 6WY

Harness: CABIN HARNESS

Description: Module-Fuel-pump driver

Location: Behind luggage compartment carpet LH side

Qualifier:

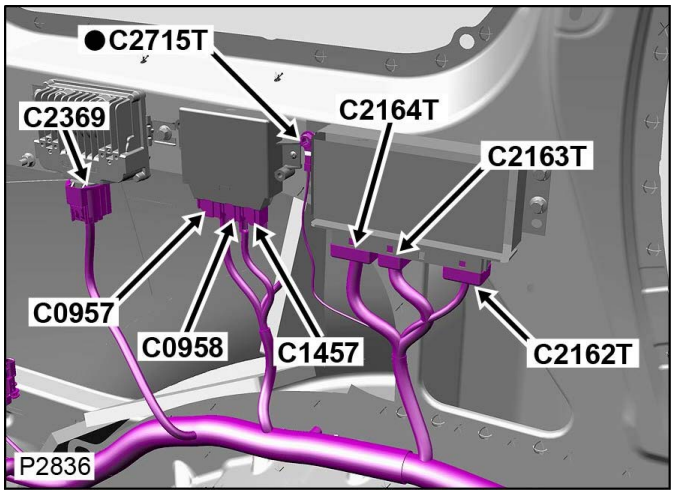


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	4.0	B	252	S/JOINT SJ873	418-100	-	418-116A	418-117	-	418-114	418-109
2	0.5	UR	252L	C2411L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	UR	252R	C2409R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
3	2.5	B	252	C0376	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
4	4.0	WP	252L	C2243L	418-100	-	418-116A	418-117	-	418-114	418-109
4	4.0	WP	252R	C2242R	418-100	-	418-116A	418-117	-	418-114	418-109
5	0.5	WU	252L	C2242L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	WU	252R	C2409R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
6	2.5	WP	252	C0376	418-411-19	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C2373L

CONNECTOR HOUSING NOT SERVICEABLE

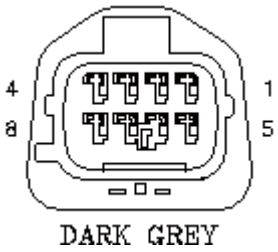

Part No.: YPC500640

Colour: DARK GREY


Cavities: 8WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to transmission harness

Location: Passenger side of engine compartment

Qualifier:

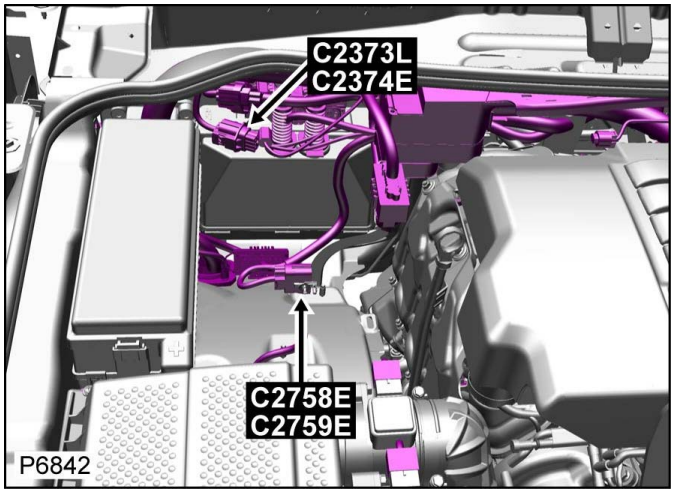


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	816L	S/JOINT SJ9	-	-	-	-	-	-	-
2	0.75	WU	816L	C0925	-	-	-	-	-	-	-
3	1.0	RU	797L	S/JOINT SJ560	-	-	-	-	-	-	-
4	0.5	RB	797L	C0872L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	NR	797L	C0872L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2373R

CONNECTOR HOUSING NOT SERVICEABLE

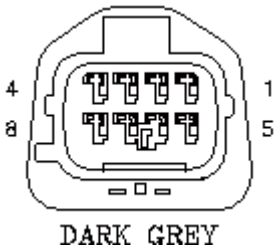

Part No.: YPC500640

Colour: DARK GREY


Cavities: 8WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to transmission harness

Location: Rear LH side of engine compartment

Qualifier:

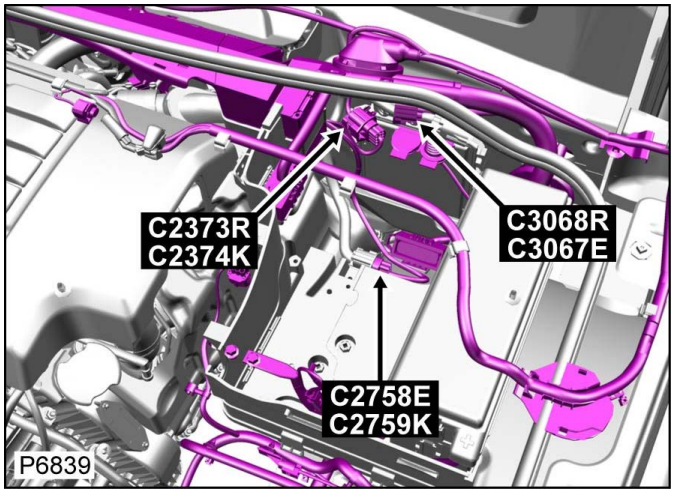

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	816R	S/JOINT SJ9	-	-	-	-	-	-	-
2	0.75	WU	816R	C0925	-	-	-	-	-	-	-
3	1.0	RU	797R	S/JOINT SJ1560	-	-	-	-	-	-	-
4	0.5	RB	797R	C0872R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	NR	797R	C0872R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2374A

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC501000

Colour: DARK GREY


Cavities: 8WY

Harness: TRANSMISSION AUTO-PETROL HARNESS

Description: Transmission harness to engine compartment harness

Location: Passenger side of engine compartment

Qualifier:

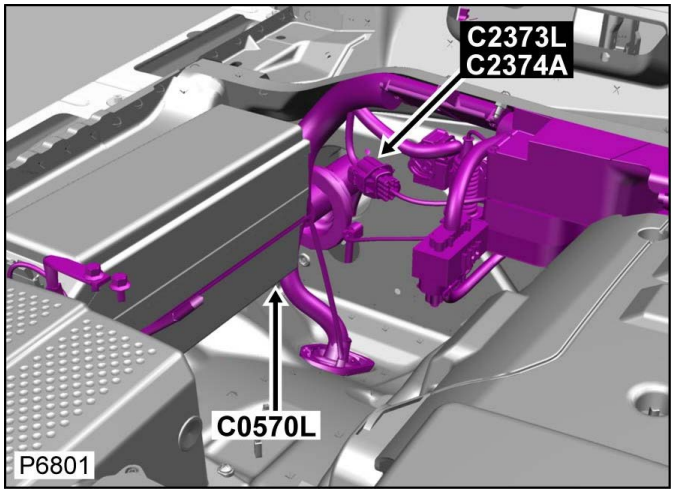

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WU	281L	C0643	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	G	281L	C0643	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	RB	281L	C0164	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	U	281L	C0164	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
5	1.0	WO	281L	C0164	-	-	-	-	-	-	-
7	0.5	RB	281L	C0643	418-411-08	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2374H

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC501000

Colour: DARK GREY


Cavities: 8WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Transmission harness to engine compartment harness

Location: Passenger side of engine compartment

Qualifier:

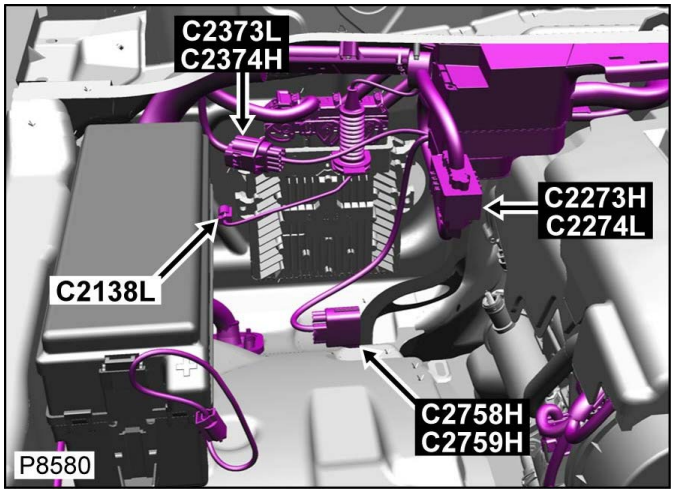

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	816L	C0920	-	-	-	-	-	-	-
2	0.75	WU	816L	C0920	-	-	-	-	-	-	-
3	1.0	RU	729L	C0735	-	-	-	-	-	-	-
4	0.5	RB	729L	C0735	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	NR	729L	C0735	418-411-08	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2374J

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC501000

Colour: DARK GREY


Cavities: 8WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Transmission harness to engine compartment harness

Location: Passenger side of engine compartment

Qualifier:

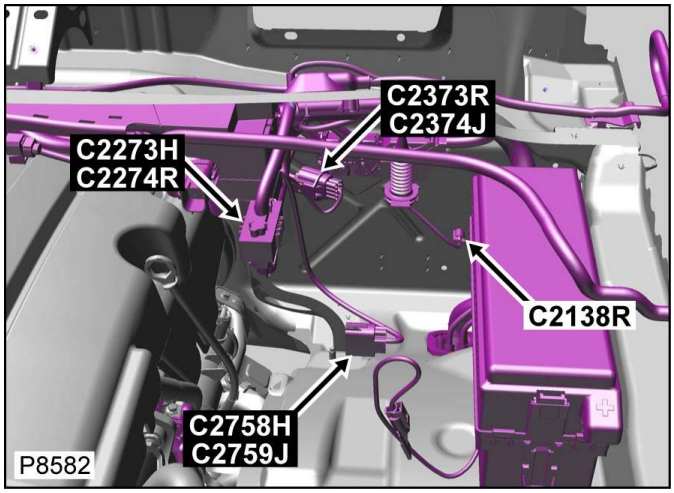

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	816R	C0920	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	WU	816R	C0920	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
3	1.0	RU	729R	C0735	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	RB	729R	C0735	-	-	-	-	-	-	-
5	0.5	NR	729R	C0735	-	-	-	-	-	-	-

Click here to print


Connector: C2378

CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to seat harness

Location: Beneath LH Front seat

Qualifier:

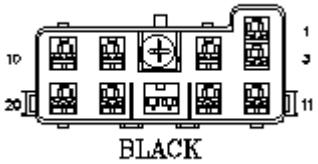


Part No.: YPC801440

Colour: BLACK

Cavities: 20WY

Harness: CABIN HARNESS

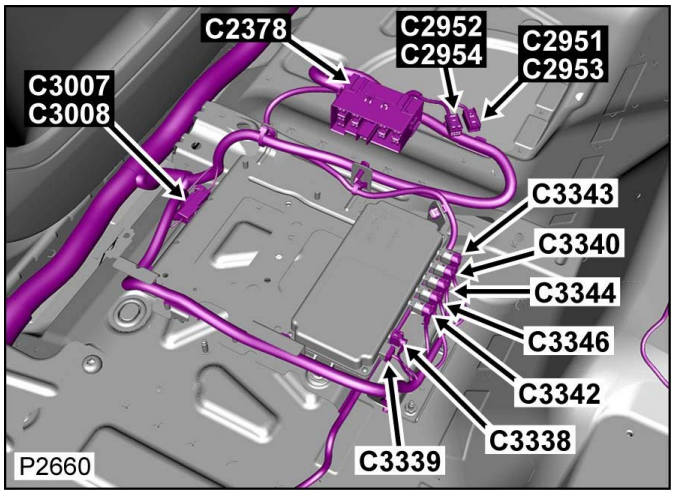

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	R	204L	C2243L	-	-	-	-	-	-	-
1	1.5	R	204R	C2242R	-	-	-	-	-	-	-
2	0.35	WG	204L	C1166L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	NP	204R	C1165	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
4	1.5	B	204	C0810	-	-	-	-	-	-	-
5	0.5	WU	216	C0256	-	-	-	-	-	-	-
6	0.5	R	216	C0256	-	-	-	-	-	-	-
7	0.5	LGR	216L	C0256	-	-	-	-	-	-	-
7	0.5	YR	216R	C0256	-	-	-	-	-	-	-
8	0.5	LGB	216L	C0256	-	-	-	-	-	-	-
8	0.5	UB	216R	C0256	-	-	-	-	-	-	-
9	0.35	G	216L	C0256	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	G	216R	C0256	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	B	216	C3196	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	GK	499	S/JOINT SJ14	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
12	1.5	B	499	S/JOINT SJ53	-	-	-	-	-	-	-
13	0.35	YW	207L	S/JOINT SJ2008	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
14	0.35	YU	207L	S/JOINT SJ2009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
15	2.5	NP	139L	S/JOINT SJ3002	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
15	2.5	NP	200R	C0585R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
16	2.5	B	499	S/JOINT SJ53	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
17	0.35	SP	207L	C0396	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

17	0.5	B	200R	C3196	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
18	0.35	O	200R	C0586R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
19	0.5	B	216L	C3196	-	-	-	-	-	-	-
20	0.5	LG	216L	C0256	-	-	-	-	-	-	-

Click here to print

Connector: C2379

CONNECTOR HOUSING NOT SERVICEABLE

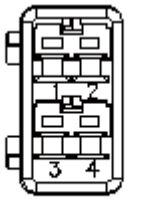

BLACK

Part No.: YPC905870

Colour: BLACK


Cavities: 4WY

Harness: SEAT ASSEMBLIES HARNESS

Description: Seat harness to main harness

Location: Beneath front seat

Qualifier:

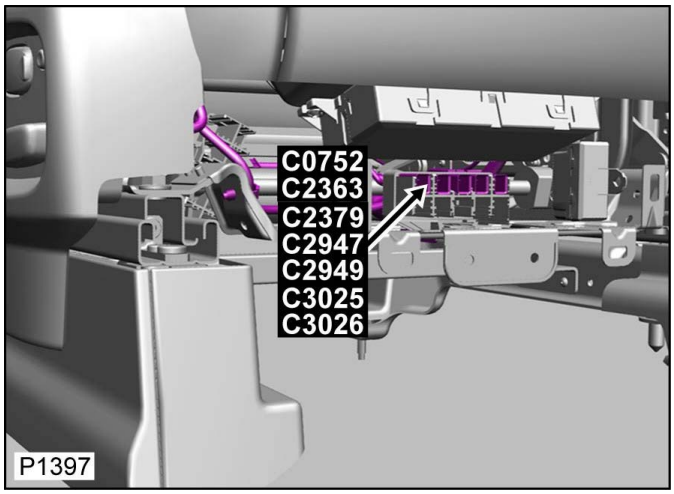

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	R	204	C0755
2	0.5	Y	204	C0755
4	1.5	B	204	C0755

Click here to print


Connector: C2381


CONNECTOR HOUSING NOT SERVICEABLE

Description: Memory control module

Location: Beneath driver seat

Qualifier:

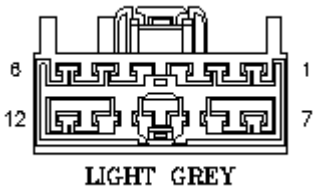

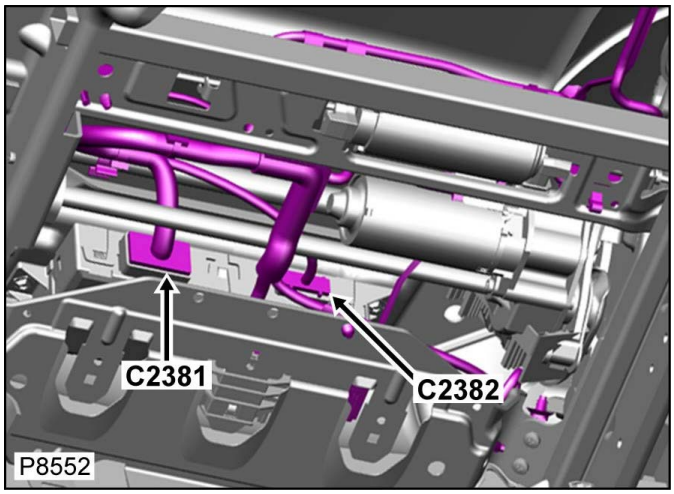

Part No.: YPC500580

Colour: LIGHT GREY

Cavities: 12WY

Harness: SEAT FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	R	207	C2930	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	N	207	C2993	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	K	207	C2993	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
4	1.5	G	207	C0097	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
5	1.5	Y	207	C0097	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
7	2.5	B	207	S/JOINT SJ151	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
8	1.5	R	207	C2930	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
9	2.5	NP	207	C3025	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
10	1.5	P	207	C0721	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
11	1.5	U	207	C0721	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C2382


CONNECTOR HOUSING NOT SERVICEABLE

Description: Memory control module

Location: Beneath driver seat

Qualifier:

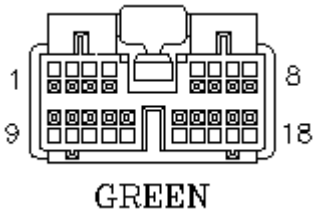

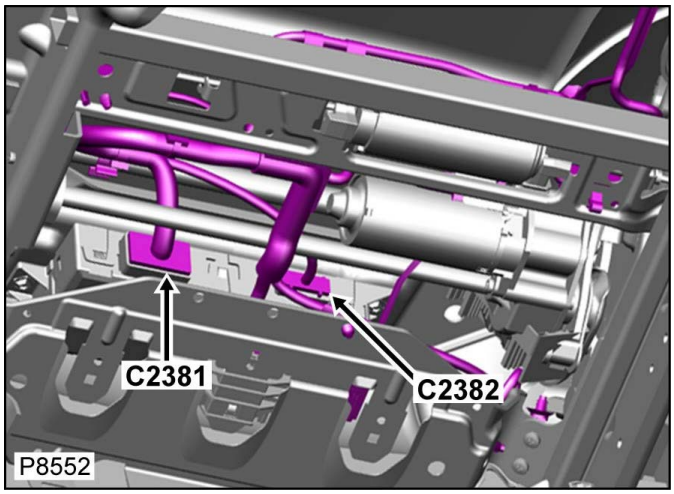

Part No.: YPH900070

Colour: GREEN

Cavities: 18WY

Harness: SEAT FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	YP	207	C2931	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.35	K	207	C0097	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.35	K	207	C0721	418-587-02	-	418-116A	418-117	-	418-112	418-107
6	0.35	S	207	C0773	418-587-02	-	418-116A	418-117	-	418-112	418-107
7	0.35	RS	207	C0721	418-587-02	-	418-116A	418-117	-	418-112	418-107
8	0.35	RU	207	C0097	418-587-02	-	418-116A	418-117	-	418-112	418-107
9	0.5	B	207	C3026	418-587-02	-	418-116A	418-117	-	418-112	418-107
11	0.5	GK	207	S/JOINT SJ998	418-587-02	-	418-116A	418-117	-	418-112	418-107
13	0.35	YP	207	C2993	418-587-02	-	418-116A	418-117	-	418-112	418-107
14	0.35	YW	207	C0751	418-587-02	-	418-116A	418-117	-	418-112	418-107
15	0.35	YU	207	C0751	418-587-02	-	418-116A	418-117	-	418-112	418-107
16	0.35	RG	207	C2931	418-587-02	-	418-116A	418-117	-	418-112	418-107
17	0.35	R	207	C2993	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2394

CONNECTOR HOUSING NOT SERVICEABLE

Description: Chassis harness to engine compartment harness

Location: Behind RH front fender splash shield

Qualifier:




Part No.: YPC501050

Colour: DARK GREY

Cavities: 12WY

Harness: ARC LINK HARNESS

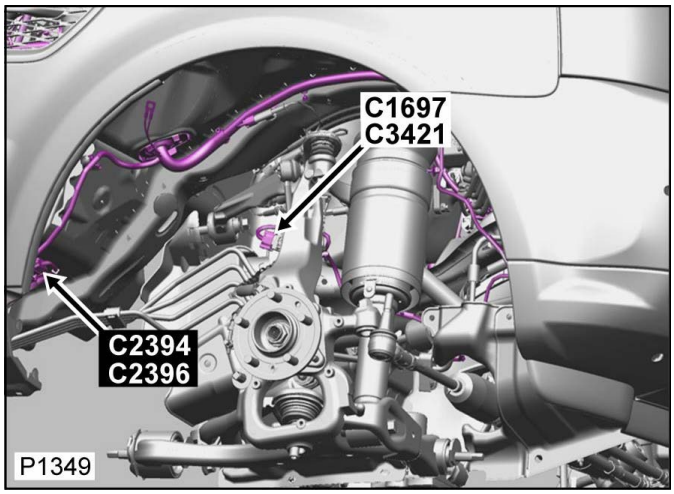

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	YB	407	C0656	-	-	-	-	-	-	-
2	0.5	OS	407	C0656	-	-	-	-	-	-	-
3	0.5	YK	407	C0656	-	-	-	-	-	-	-
4	0.5	Y	407	C1610	-	-	-	-	-	-	-
5	0.5	YS	407	C1610	-	-	-	-	-	-	-
6	0.75	BG	407	C0771	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	YG	407	C1610	-	-	-	-	-	-	-
8	0.75	GR	407	C1690	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
9	0.75	OG	407	C1690	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
10	0.75	GR	407	C0770	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
11	0.75	YB	407	C0770	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
12	0.75	P	407	C0771	418-411-08	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2396

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC903680

Colour: DARK GREY


Cavities: 12WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to chassis harness

Location: Behind RH front fender splash shield

Qualifier:

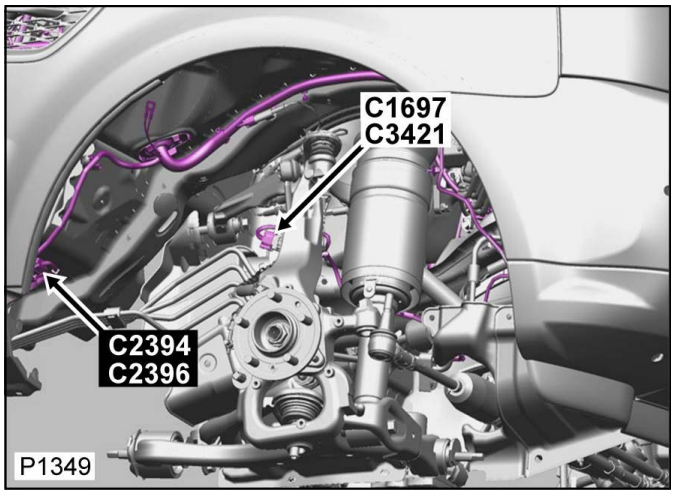

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	YB	407L	C0647L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.35	YB	407R	C0647R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	OS	407L	C0647L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	OS	407R	C0647R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	YK	407L	C0647L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	YK	407R	C0647R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	Y	407L	C0647L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	Y	407R	C0647R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	YS	407L	C0647L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	YS	407R	C0647R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.75	BG	407L	C0647L	-	-	-	-	-	-	-
6	0.75	BG	407R	C0647R	-	-	-	-	-	-	-
7	0.35	YG	407L	C0647L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	YG	407R	C0647R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
8	0.75	GR	407L	C0647L	-	-	-	-	-	-	-
8	0.75	GR	407R	C0647R	-	-	-	-	-	-	-
9	0.75	OG	407L	C0647L	-	-	-	-	-	-	-
9	0.75	OG	407R	C0647R	-	-	-	-	-	-	-
10	0.75	GR	407L	C0647L	-	-	-	-	-	-	-
10	0.75	GR	407R	C0647R	-	-	-	-	-	-	-
11	0.75	YB	407L	C0647L	-	-	-	-	-	-	-
11	0.75	YB	407R	C0647R	-	-	-	-	-	-	-
12	0.75	P	407L	C0647L	-	-	-	-	-	-	-

12	0.75	P	407R	C0647R	-	-	-	-	-	-	-

Click here to print


Connector: C2409R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to engine compartment harness

Location: Behind passenger side of Instrument panel

Qualifier: RHD condition illustrated

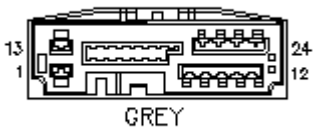

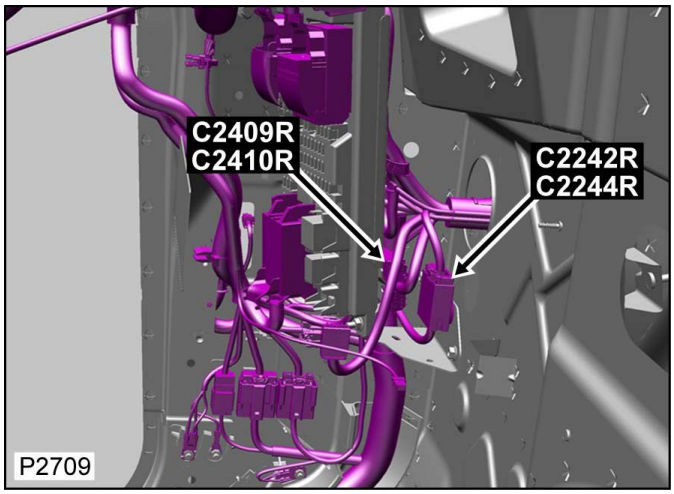

Part No.: YPC803300

Colour: GREY

Cavities: 24WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	4.0	NU	21SR	C0839S	418-587-05	-	418-116A	418-117	-	418-114	418-109
2	0.5	PW	200SR	C0698S	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.5	PW	200TR	C0698T	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.35	YB	407TR	C0657T	-	-	-	-	-	-	-
4	0.35	OS	407TR	C0657T	-	-	-	-	-	-	-
5	0.35	YK	407TR	C0657T	-	-	-	-	-	-	-
6	0.35	BG	245TR	S/JOINT SJ250T	-	-	-	-	-	-	-
7	0.35	BR	245TR	C3087T	-	-	-	-	-	-	-
8	0.35	BW	245TR	S/JOINT SJ251T	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
9	0.75	RW	245TR	C3087T	-	-	-	-	-	-	-
10	0.5	S	982SR	C0868S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	S	982TR	C0868TA	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	GW	982SR	C0868S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	GW	982TR	C0868TA	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	GO	982SR	C0868S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	GO	982TR	C0868TA	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
13	4.0	PU	401SR	S/JOINT SJ542S	418-587-05	-	418-116A	418-117	-	418-114	418-109
13	4.0	PU	401TR	S/JOINT SJ542T	418-587-05	-	418-116A	418-117	-	418-114	418-109
14	0.75	WR	245TR	C3087T	418-411-47	-	418-116A	418-117	-	418-112	418-107
15	0.5	WU	252R	C2369	418-411-47	-	418-116A	418-117	-	418-112	418-107
											418-

16	0.5	UR	252R	C2369	418-411-47	-	418-116A	418-117	-	418-112	107
17	0.5	YG	216R	S/JOINT SJ225	418-411-47	-	418-116A	418-117	-	418-112	418-107
18	0.5	KO	216R	C1649	418-411-47	-	418-116A	418-117	-	418-112	418-107
19	0.5	PLG	216R	C1649	418-411-47	-	418-116A	418-117	-	418-112	418-107
20	0.5	PN	97SR	C2046S	418-411-47	-	418-116A	418-117	-	418-112	418-107
20	0.5	PN	97TR	C2046T	418-411-47	-	418-116A	418-117	-	418-112	418-107
21	0.5	R	97SR	C2046S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
21	0.5	R	97TR	C2046T	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
22	0.5	PY	200R	C0585R	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
23	1.5	R	204R	C2368	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
24	2.5	LGW	572R	S/JOINT SJ23	418-411-16	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C2410R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine compartment harness to main harness

Location: Behind passenger side of Instrument panel

Qualifier: RHD condition illustrated



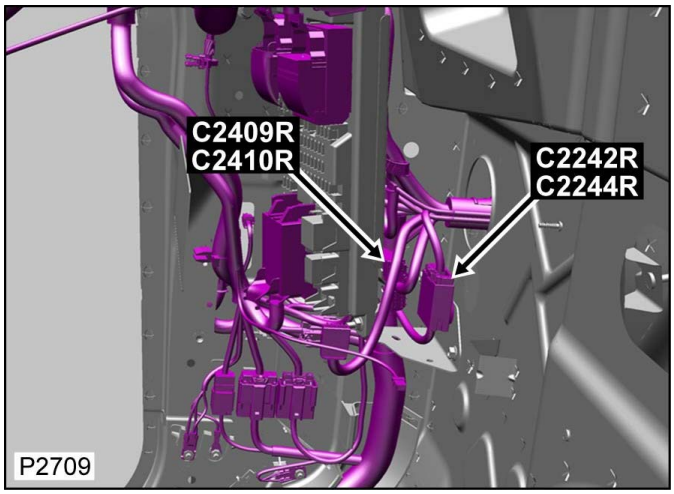

Part No.: YPC803280

Colour: GREY

Cavities: 24WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	4.0	NU	21R	C0570R	418-100	-	418-116A	418-117	-	418-114	418-109
2	0.5	PW	200R	C0570R	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.35	YB	407R	C0647R	-	-	-	-	-	-	-
4	0.35	OS	407R	C0647R	-	-	-	-	-	-	-
5	0.35	YK	407R	C0647R	-	-	-	-	-	-	-
6	0.5	BG	245R	C3434R	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.5	BR	245R	C3434R	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.5	BW	245R	C3434R	-	-	-	-	-	-	-
9	0.75	RW	245R	C3428	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	S	798R	C3424R	-	-	-	-	-	-	-
11	0.5	GW	798R	C3424R	-	-	-	-	-	-	-
12	0.5	GO	798R	S/JOINT SJ1905	-	-	-	-	-	-	-
13	4.0	PU	200R	C0570R	418-100	-	418-116A	418-117	-	418-114	418-109
14	0.75	WR	245R	C3009	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.5	WU	282R	C0635R	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.5	UR	282R	C0635R	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.5	YG	797R	C0872R	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.5	NY	798R	C0658R	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.5	YG	282R	C0635R	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.5	KO	200R	C1652	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.5	PLG	200R	C1652	418-411-45	-	418-116A	418-117	-	418-112	418-107

20	0.5	PN	97R	C0570R	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	0.5	R	97R	C0925	-	-	-	-	-	-	-
22	0.5	PY	200R	C0075R	-	-	-	-	-	-	-
23	1.5	R	885R	S/JOINT SJ1014	-	-	-	-	-	-	-
24	2.5	LGW	572R	C0570R	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C2411L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to engine compartment harness

Location: Behind passenger side of Instrument panel

Qualifier: LHD condition illustrated



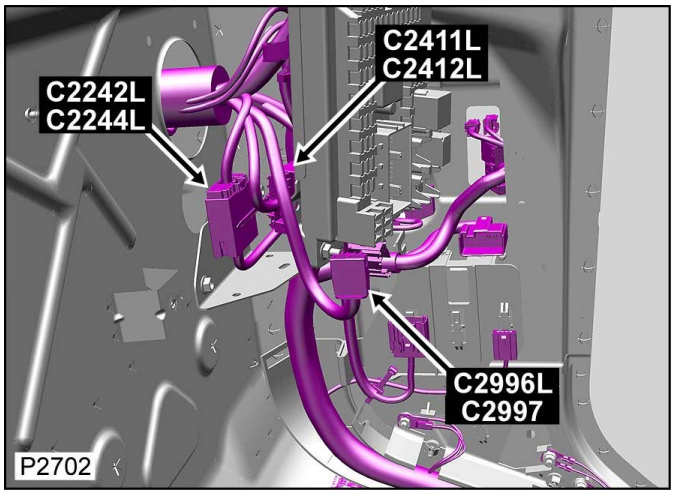

Part No.: YPC803300

Colour: GREY

Cavities: 24WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	NR	139TL	C2959T	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
2	0.5	UR	252L	C2369	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.35	G	986SL	C2658S	-	-	-	-	-	-	-
3	0.35	G	986TL	C2658TL	-	-	-	-	-	-	-
4	0.35	BG	986SL	C2658S	-	-	-	-	-	-	-
4	0.35	BG	986TL	C2658TL	-	-	-	-	-	-	-
5	0.35	Y	986SL	C2658S	-	-	-	-	-	-	-
5	0.35	Y	986TL	C2658TL	-	-	-	-	-	-	-
6	0.35	N	986SL	C2658S	-	-	-	-	-	-	-
6	0.35	N	986TL	C2658TL	-	-	-	-	-	-	-
7	0.5	GP	139L	C0586L	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.75	RW	245TL	C3087T	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
9	0.75	WR	245TL	C3087T	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
10	0.75	PY	982SL	C0868S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
10	0.75	PY	982TL	C0868TA	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
11	0.35	BU	245TL	S/JOINT SJ248T	-	-	-	-	-	-	-
12	0.35	BY	245TL	S/JOINT SJ249T	-	-	-	-	-	-	-
13	2.5	LGW	572L	S/JOINT SJ23	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
14	0.5	PN	97SL	C2046S	418-411-47	-	418-116A	418-117	-	418-112	418-107
14	0.5	PN	97TL	C2046T	418-411-47	-	418-116A	418-117	-	418-112	418-107
15	0.35	UR	21SL	C0349S	-	-	-	-	-	-	-
16	0.5	PY	139L	C0585L	418-411-47	-	418-116A	418-117	-	418-112	418-107

17	0.5	WY	139L	C0585L	418-411-47	-	418-116A	418-117	-	418-112	418-107
18	0.5	GO	28L	C0586L	418-411-47	-	418-116A	418-117	-	418-112	418-107
19	0.35	YW	139L	S/JOINT SJ2000	-	-	-	-	-	-	-
20	0.35	YU	139L	S/JOINT SJ2001	-	-	-	-	-	-	-
21	1.5	R	204L	C2368	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
22	1.0	RO	139SL	C0125S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
22	1.0	RO	139TL	C0125T	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
23	0.75	LGW	139SL	C2754S	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
23	0.75	LGW	139TL	C2754T	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
24	4.0	R	478SL	C2414S	418-587-05	-	418-116A	418-117	-	418-114	418-109
24	4.0	R	478TL	C2414T	418-587-05	-	418-116A	418-117	-	418-114	418-109

Click here to print

Connector: C2412L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine compartment harness to main harness

Location: Behind passenger side of Instrument panel

Qualifier: LHD condition illustrated



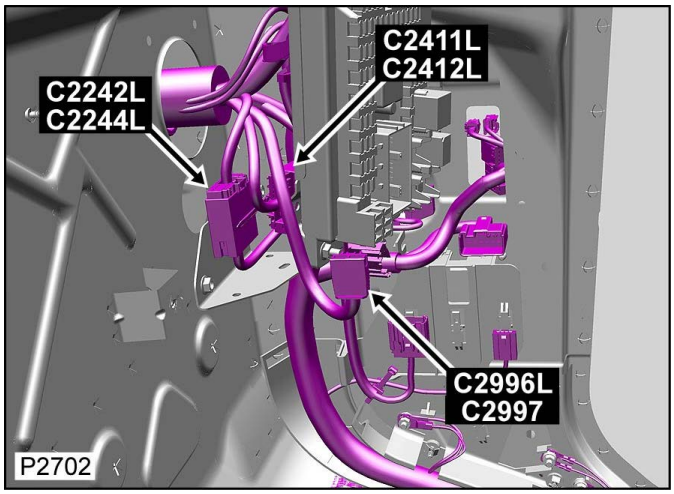

Part No.: YPC803280

Colour: GREY

Cavities: 24WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	R	139TL	C0570L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	0.5	UR	282L	C0635L	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.35	G	797L	C3424L	-	-	-	-	-	-	-
3	0.35	G	807L	C3424L	-	-	-	-	-	-	-
4	0.35	BG	797L	C3424L	-	-	-	-	-	-	-
4	0.35	BG	807L	C3424L	-	-	-	-	-	-	-
5	0.35	Y	797L	C3424L	-	-	-	-	-	-	-
5	0.35	Y	807L	C3424L	-	-	-	-	-	-	-
6	0.35	N	797L	C3424L	-	-	-	-	-	-	-
6	0.35	N	807L	C3424L	-	-	-	-	-	-	-
7	0.5	GP	139L	S/JOINT SJ814	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.75	RW	245L	C3428	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
9	0.75	WR	245L	C3009	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
10	1.0	PY	798L	S/JOINT SJ1061	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
11	0.35	BU	245L	C3428	-	-	-	-	-	-	-
12	0.35	BY	245L	C3428	-	-	-	-	-	-	-
13	2.5	LGW	572L	C0570L	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
14	0.5	PN	97L	C0570L	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.5	UR	21L	C0570L	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.5	PY	139L	C0075L	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.5	WY	798L	C0658L	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.5	WY	282L	C0635L	418-411-45	-	418-116A	418-117	-	418-112	418-107
											418-

17	0.75	WY	797L	C0872L	418-411-45	-	418-116A	418-117	-	418-112	107
18	0.5	GO	28L	S/JOINT SJ905	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.35	YW	252L	C2444L	-	-	-	-	-	-	-
19	0.35	YW	254L	S/JOINT SJ422	-	-	-	-	-	-	-
20	0.35	YU	252L	C2444L	-	-	-	-	-	-	-
20	0.35	YU	254L	S/JOINT SJ423	-	-	-	-	-	-	-
21	1.5	R	885L	S/JOINT SJ14	-	-	-	-	-	-	-
22	1.0	RO	139L	S/JOINT SJ942	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
23	0.75	LGW	139L	C0583L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
24	4.0	NP	139L	C0570L	418-100	-	418-116A	418-117	-	418-114	418-109

Click here to print

Connector: C2414T

CONNECTOR HOUSING NOT SERVICEABLE

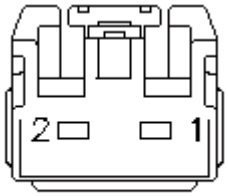

GREY

Part No.: YPC909710

Colour: GREY


Cavities: 2WY

Harness: CABIN HARNESS

Description: Amplifier-Audio

Location: Behind luggage compartment carpet RH side

Qualifier:

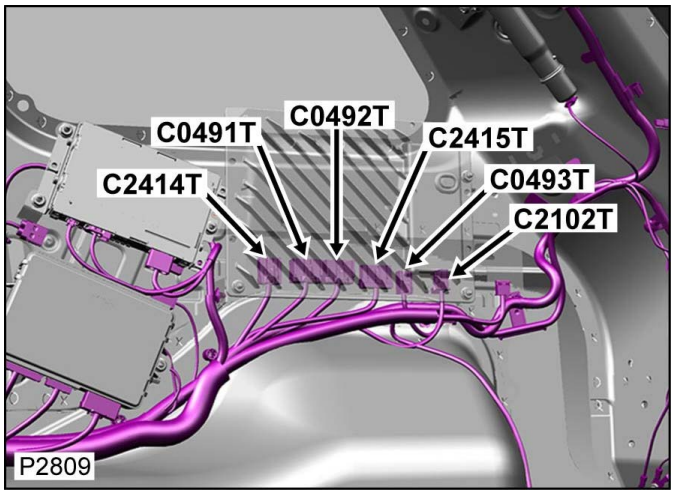


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	4.0	R	478TL	C2411L	418-411-60	-	418-116A	418-117	418-105	418-114	418-109
1	4.0	R	478TR	C2243R	418-411-60	-	418-116A	418-117	418-105	418-114	418-109
2	4.0	B	478T	C0557	418-411-60	-	418-116A	418-117	418-105	418-114	418-109

Click here to print

Connector: C2415T

CONNECTOR HOUSING NOT SERVICEABLE

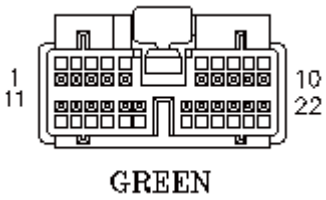

Part No.: YPC106490

Colour: GREEN


Cavities: 22WY

Harness: CABIN HARNESS

Description: Amplifier-power

Location: Behind luggage compartment carpet RH side

Qualifier:

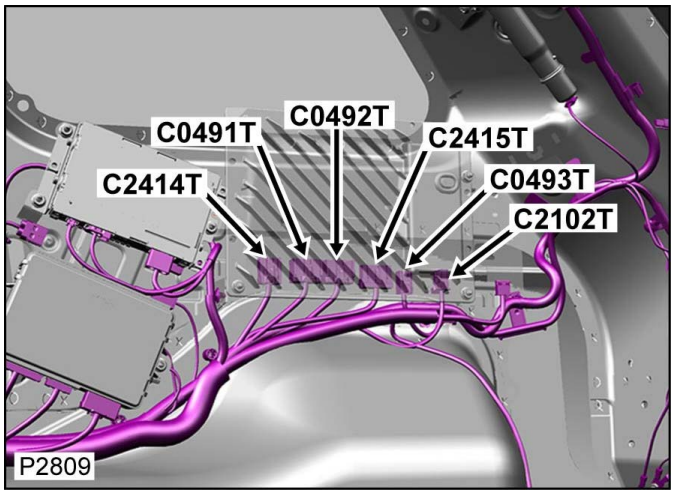

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	YR	478T	C0467	418-587-02	-	418-116A	418-117	-	418-112	418-107
11	0.5	B	478T	C1355T	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2428T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Keyless vehicle module

Location: Behind luggage compartment carpet RH side

Qualifier:



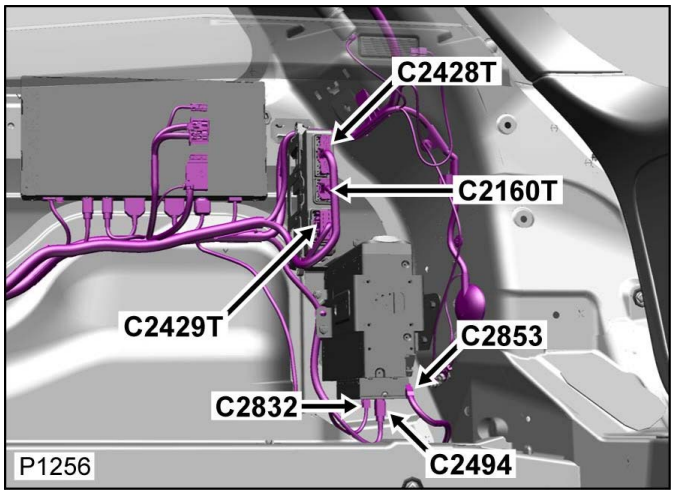

Part No.: YPC803040

Colour: GREY

Cavities: 40WY

Harness: CABIN HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	410TL	C1166L
1	0.5	R	410TR	C1165
3	0.35	UW	410T	C0436
4	0.5	R	410T	C1165
6	0.35	OY	410T	C0398
7	0.35	RW	410T	C0435
10	0.35	RG	410T	C0396
13	0.35	YU	810T	S/JOINT SJ2003
14	0.35	YW	810T	S/JOINT SJ2002
16	0.35	SN	810T	C0674T
17	0.5	B	810T	C1967
20	0.5	NR	810TL	C0585L
20	0.5	NR	810TR	C0585R
21	0.35	GW	410T	C0396
22	0.35	PO	410T	C0435
23	0.35	SN	410T	C0398
24	0.35	NU	410T	C0436
25	0.35	RW	410T	C0435
26	0.35	RU	410T	C0398
27	0.35	RU	410T	C0396
28	0.35	RW	410T	C0436
40	0.5	R	410T	S/JOINT SJ21

Click here to print


Connector: C2429T

CONNECTOR HOUSING NOT SERVICEABLE

Description: Keyless vehicle module

Location: Behind luggage compartment carpet RH side

Qualifier:

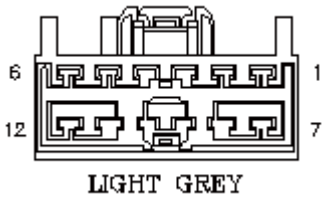


Part No.: YPC910640

Colour: LIGHT GREY

Cavities: 12WY

Harness: CABIN HARNESS

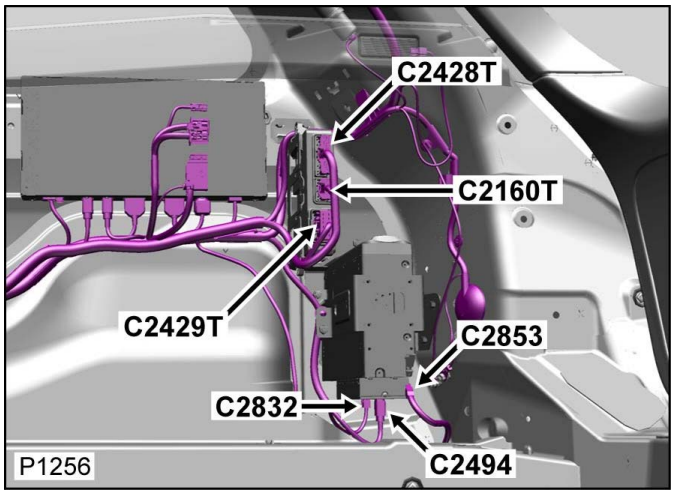


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	B	410T	C2598	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	WP	410T	C0398	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	NP	410T	C0396	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
4	1.5	WN	410T	C0435	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
5	1.5	WN	410T	C0436	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
7	1.5	SN	410T	C0398	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
8	1.5	N	410T	C0396	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
9	1.5	YU	410T	C0435	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
10	1.5	G	410T	C0436	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
12	2.5	R	410T	C0467	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C2433T

CONNECTOR HOUSING NOT SERVICEABLE

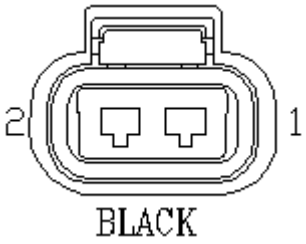

Part No.: YPC911650

Colour: BLACK


Cavities: 2WY

Harness: CABIN HARNESS

Description: Tailgate handle antenna

Location: Behind Center of rear bumper

Qualifier:

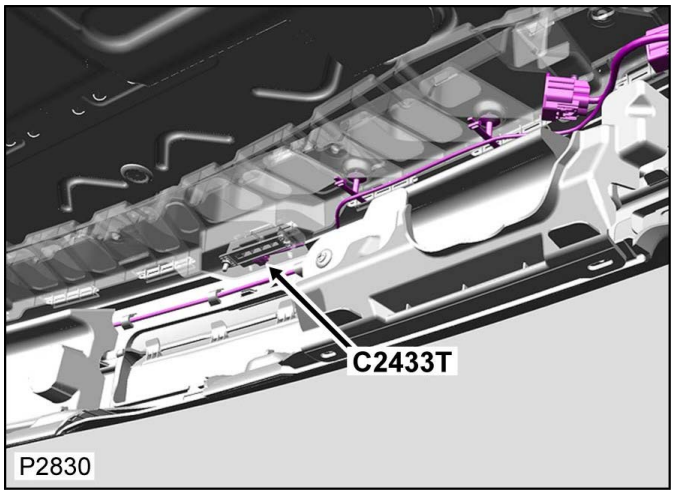

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	WK	410T	C2160T
2	0.35	WG	410T	C2160T

Click here to print

Connector: C2443


CONNECTOR HOUSING NOT SERVICEABLE

Description: Instrument panel harness to engine compartment harness

Location: LH 'A' post

Qualifier:



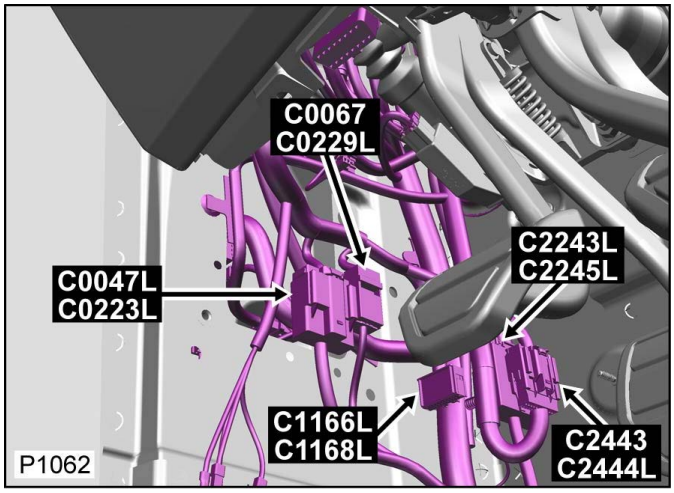

Part No.: YPC900470

Colour: DARK GREY

Cavities: 22WY

Harness: FACIA COMPOSITE HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	R	413SL	C1629SL	-	-	-	-	-	-	-
2	0.35	R	139L	C0040	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.35	YW	139SL	S/JOINT SJ964	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.35	YW	139TL	S/JOINT SJ966	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.35	YU	139SL	S/JOINT SJ974	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.35	YU	139TL	S/JOINT SJ976	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.5	UN	139L	C3470	-	-	-	-	-	-	-
8	0.5	BG	139L	S/JOINT SJ550	-	-	-	-	-	-	-
9	0.5	RG	139L	C3470	-	-	-	-	-	-	-
11	0.35	YN	139L	S/JOINT SJ851	418-411-45	-	418-116A	418-117	-	418-112	418-107
12	0.35	YB	139L	S/JOINT SJ861	418-411-45	-	418-116A	418-117	-	418-112	418-107
13	0.5	RB	254L	C3470	-	-	-	-	-	-	-
14	0.35	YN	430L	C0041	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.35	G	139L	S/JOINT SJ223L	418-411-45	-	418-116A	418-117	-	418-112	418-107
16	0.35	NR	406L	C2184L	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2444L

CONNECTOR HOUSING NOT SERVICEABLE

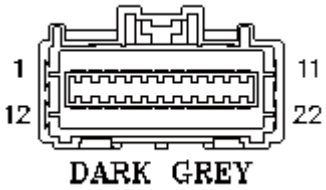

Part No.: YPC901410

Colour: DARK GREY


Cavities: 22WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to instrument panel harness

Location: LH 'A' post

Qualifier:

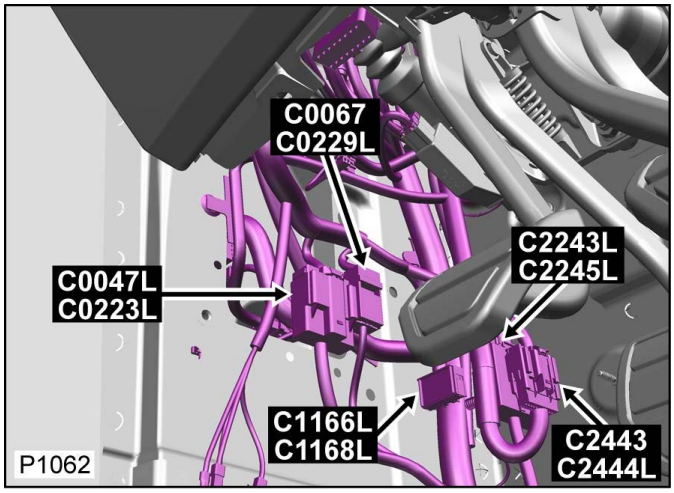

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	R	920L	C0506L	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.5	WP	413L	C0506L	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.35	YW	252L	C2412L	-	-	-	-	-	-	-
4	0.35	YW	254L	S/JOINT SJ422	-	-	-	-	-	-	-
5	0.35	YU	252L	C2412L	-	-	-	-	-	-	-
5	0.35	YU	254L	S/JOINT SJ423	-	-	-	-	-	-	-
7	0.5	UN	805L	C1465	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.5	UN	282L	C3398	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.5	WU	805L	C1465	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.5	WU	282L	C3398	418-411-47	-	418-116A	418-117	-	418-112	418-107
9	0.5	R	805L	C1465	418-411-47	-	418-116A	418-117	-	418-112	418-107
9	0.5	R	282L	C3398	418-411-47	-	418-116A	418-117	-	418-112	418-107
11	0.5	YN	1004L	C1857L	418-411-47	-	418-116A	418-117	-	418-112	418-107
11	0.35	YN	407L	S/JOINT SJ274	-	-	-	-	-	-	-
12	0.5	YB	1004L	C1857L	418-411-47	-	418-116A	418-117	-	418-112	418-107
12	0.35	YB	407L	S/JOINT SJ276	-	-	-	-	-	-	-
13	0.75	RB	798L	C2034	418-411-47	-	418-116A	418-117	-	418-112	418-107
14	0.35	YN	107L	S/JOINT SJ180	-	-	-	-	-	-	-
15	0.5	B	139L	C0666L	418-411-47	-	418-116A	418-117	-	418-112	418-107

16	0.5	NR	139L	C0584L	418-411-47	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2453R

CONNECTOR HOUSING NOT SERVICEABLE

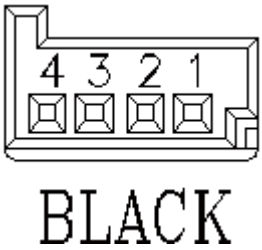

BLACK

Part No.: YPC906620

Colour: BLACK


Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS

Description: Switch-Start-stop

Location: Behind driver side of Instrument panel

Qualifier:

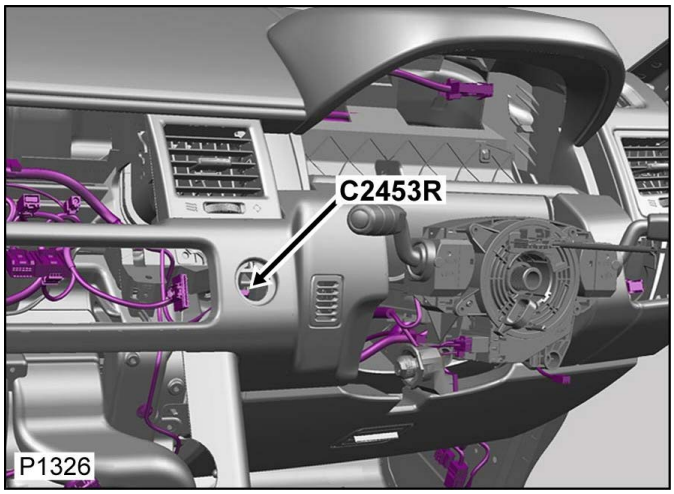

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	RN	200R	S/JOINT SJ117	418-549-10	-	418-116A	418-117	-	418-112	418-107
2	0.35	WU	200R	C0581	418-549-10	-	418-116A	418-117	-	418-112	418-107
3	0.35	UW	200R	C0581	418-549-10	-	418-116A	418-117	-	418-112	418-107
4	0.35	B	200R	C0580	418-549-10	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2453TL

CONNECTOR HOUSING NOT SERVICEABLE


Description: Switch-Start-stop

Location: Behind driver side of Instrument panel

Qualifier: LHD condition illustrated

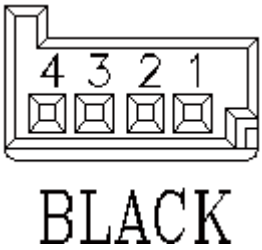

BLACK

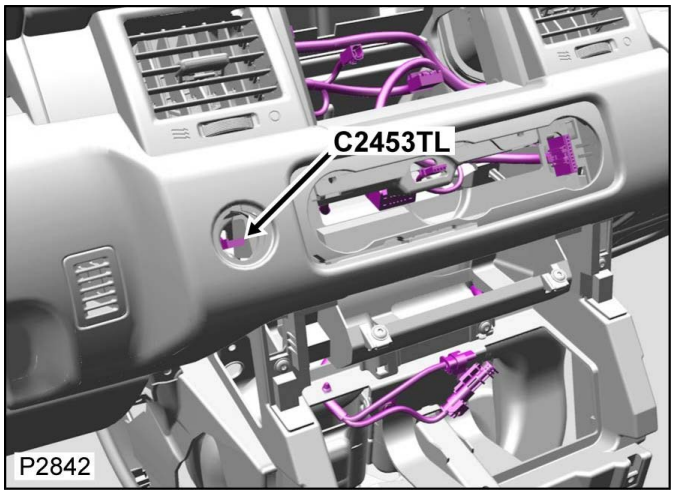

Part No.: YPC906620

Colour: BLACK

Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	RN	139TL	S/JOINT SJ117	418-549-10	-	418-116A	418-117	-	418-112	418-107
2	0.35	WU	139TL	C0581	418-549-10	-	418-116A	418-117	-	418-112	418-107
3	0.35	UW	139TL	C0581	418-549-10	-	418-116A	418-117	-	418-112	418-107
4	0.35	B	139TL	C0580	418-549-10	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2454

CONNECTOR HOUSING NOT SERVICEABLE

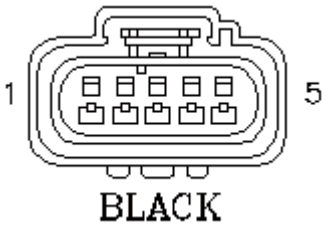

Part No.: YPC801300

Colour: BLACK


Cavities: 5WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Sensor-MAF/IAT-Bank 2

Location: Front LH side of engine compartment

Qualifier:

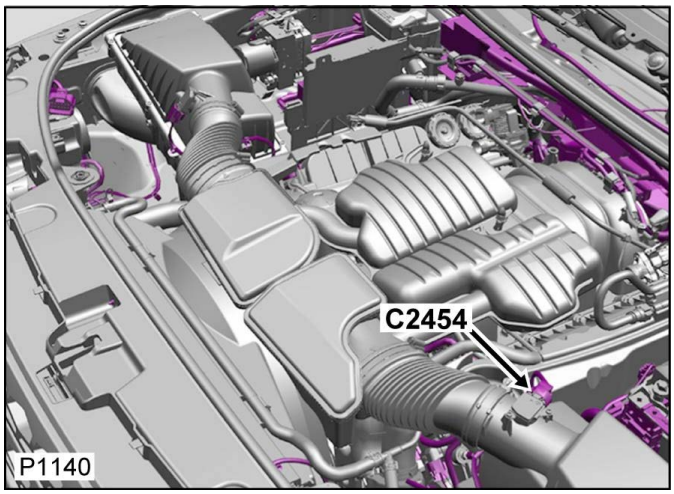


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	BR	ALL	C0634
2	0.5	B	ALL	S/JOINT PIS10
3	0.5	BO	ALL	S/JOINT PIS15
4	0.5	BU	ALL	C0634
5	0.5	BG	ALL	C0634

Click here to print

Connector: C2467

CONNECTOR HOUSING NOT SERVICEABLE

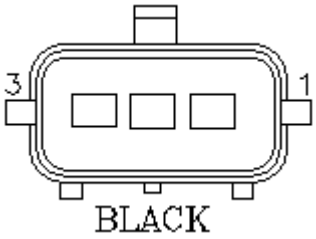

Part No.: YPC912790

Colour: BLACK


Cavities: 3WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Sensor-Fuel rail-pressure

Location: Top of engine - RH side

Qualifier:

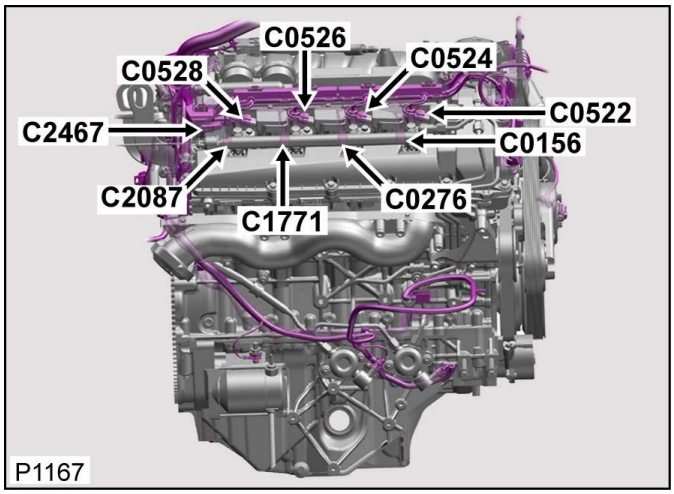

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	UN	ALL	C0634
2	0.5	U	ALL	C0634
3	0.5	GN	ALL	S/JOINT PIS30

Click here to print

Connector: C2490T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Rear seat entertainment module

Location: Behind luggage compartment carpet RH side

Qualifier:



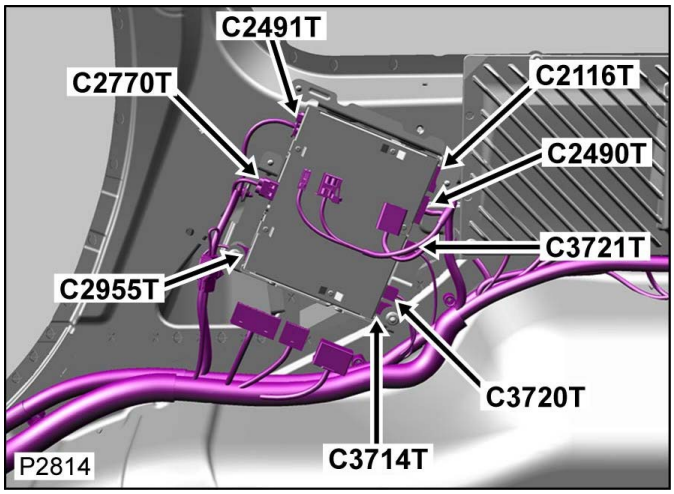

Part No.: YPC913160

Colour: GREY

Cavities: 24WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	W	514T	C2314
2	0.5	U	514T	C2314
3	SCR	SCR	514T	C2314
11	0.35	YS	514T	S/JOINT SJ7
12	0.35	WN	514T	S/JOINT SJ6
13	SCR	SCR	514T	C2314
14	0.5	R	514T	C2314
20	0.35	N	514T	C3755T
21	0.35	G	514T	C3755T

Click here to print

Connector: C2491T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Rear seat entertainment module

Location: Behind luggage compartment carpet RH side

Qualifier:

ASSEMBLY

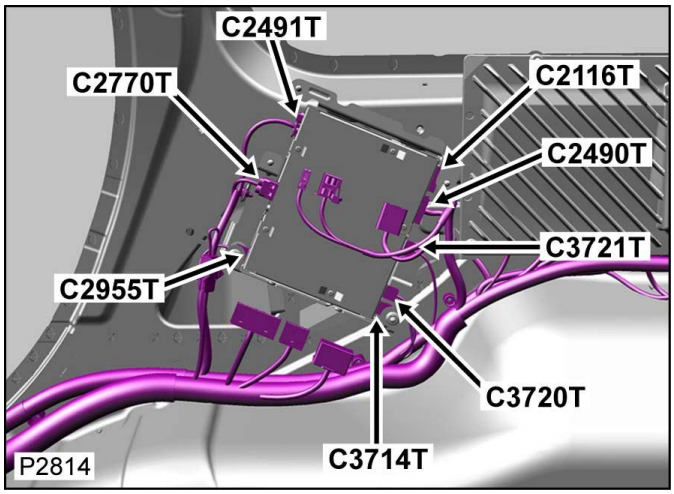

Part No.: XUD812770

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	659T	C2102T
1	POF	O	662T	C3759T
1	POF	O	869T	C3759T
1	POF	O	687T	C2102T
1	POF	O	1039T	C2102T
2	POF	O	659T	C2577T
2	POF	O	662T	C2248T
2	POF	O	869T	C2106
2	POF	O	687T	C2106
2	POF	O	1039T	C2106

Click here to print

Connector: C2527T

CONNECTOR HOUSING NOT SERVICEABLE

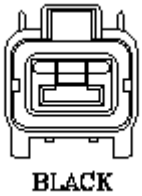

Part No.: YPC905140

Colour: BLACK


Cavities: 1WY

Harness: CHASSIS HARNESS

Description: Chassis harness to engine compartment harness

Location: Behind LH headlamp

Qualifier:

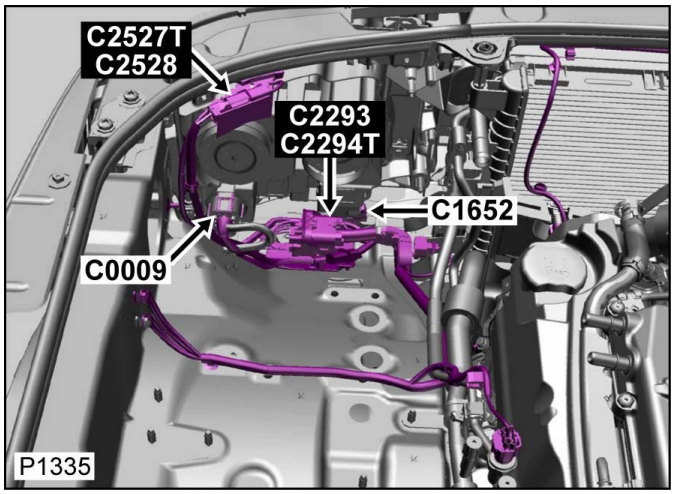


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	6.0	NR	419T	C0780

Click here to print

Connector: C2528

CONNECTOR HOUSING NOT SERVICEABLE

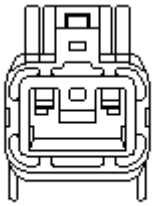

BLACK

Part No.: YPC905130

Colour: BLACK


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to chassis harness

Location: Behind LH headlamp

Qualifier:

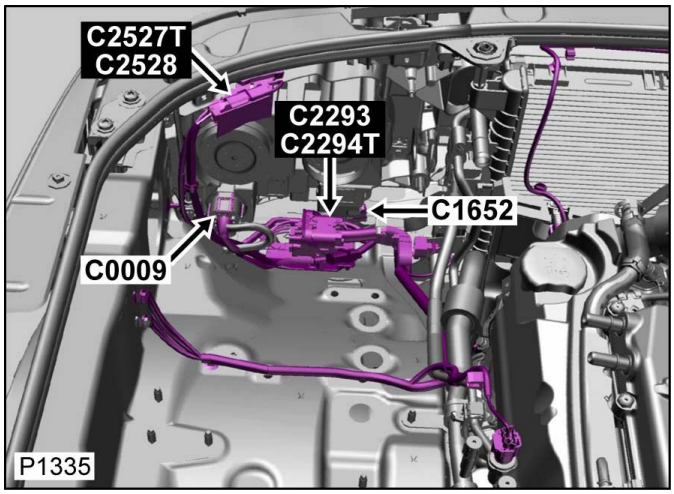

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	6.0	NR	419L	S/JOINT SJ572
1	6.0	NR	419R	S/JOINT SJ1572

Click here to print


Connector: C2554T

CONNECTOR HOUSING NOT SERVICEABLE

Description: FM antenna amplifier

Location: Rear of headlining - LH side

Qualifier:

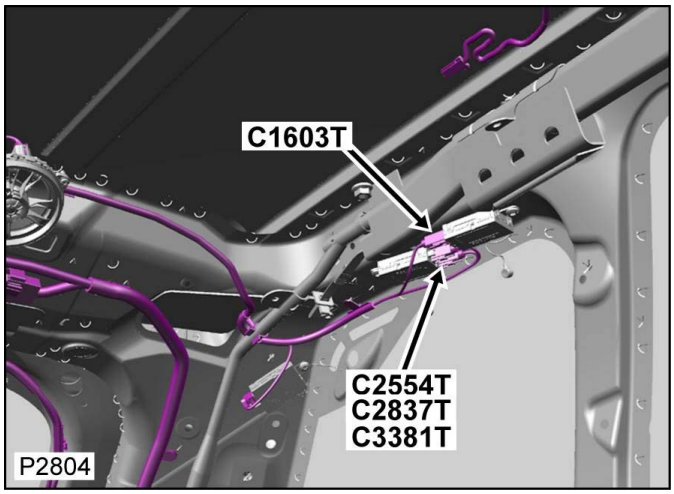

ASSEMBLY

Part No.: XUD812340

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	1031T	C2616
1S	SCR	SCR	1031T	C2616

Click here to print

Connector: C2561

CONNECTOR HOUSING NOT SERVICEABLE

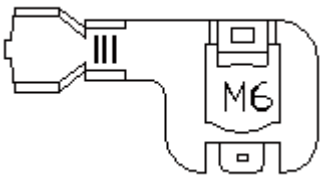

Part No.: YPG900270

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Behind center console

Qualifier:

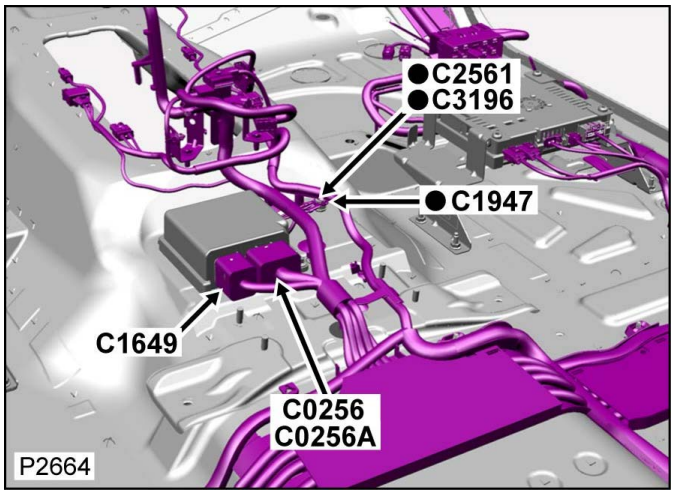


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	B	216	C2368
1	0.5	B	139L	C2368
1	0.5	B	216R	C2368

Click here to print

Connector: C2563

CONNECTOR HOUSING NOT SERVICEABLE

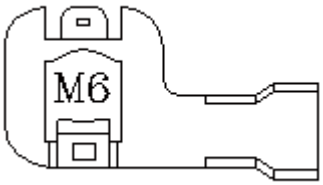

Part No.: YPG900260

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Front LH side of engine compartment

Qualifier:

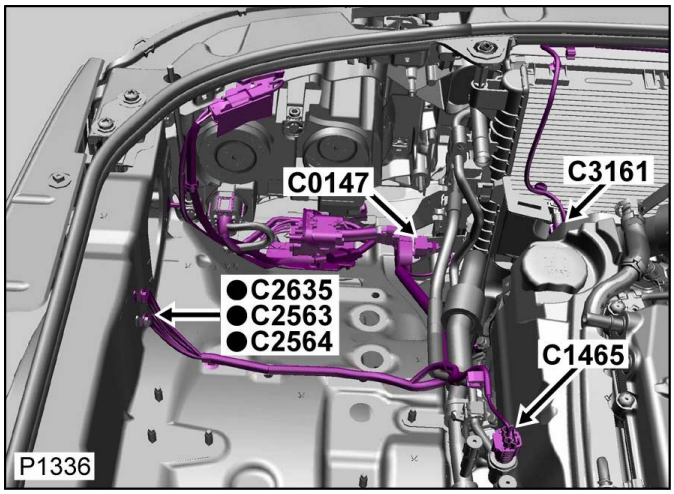


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	252	S/JOINT SJ879

Click here to print

Connector: C2564

CONNECTOR HOUSING NOT SERVICEABLE

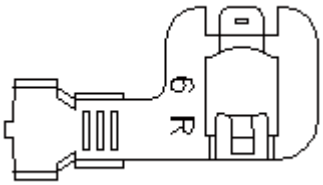

Part No.: YPG800220

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Front LH side of engine compartment

Qualifier:

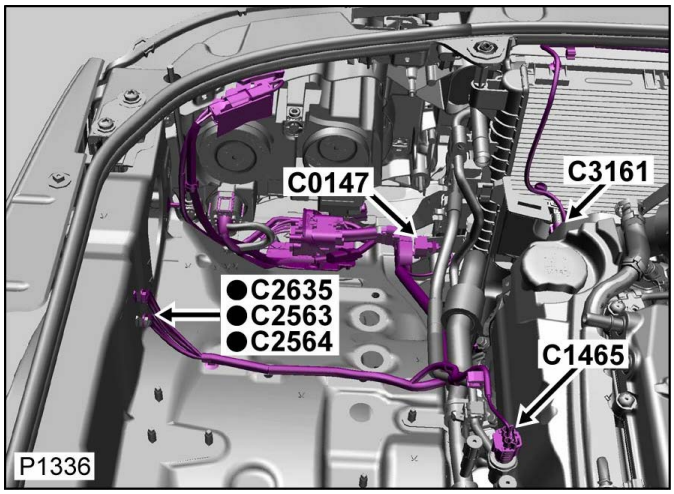

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	252	S/JOINT SJ171

Click here to print


Connector: C2565


CONNECTOR HOUSING NOT SERVICEABLE

Description: Ground point

Location: Base of 'B' post LH side

Qualifier:

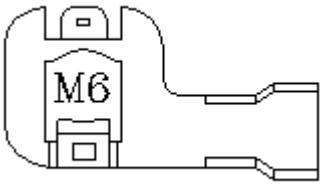

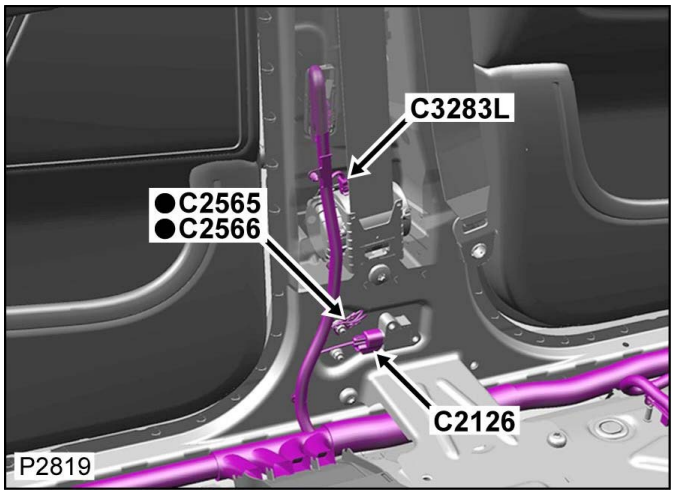

Part No.: YPG900260

Colour: TIN PLATED

Cavities: 1WY

Harness: CABIN HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	499	C0435
1	2.5	B	572	C2042

Click here to print

Connector: C2566

CONNECTOR HOUSING NOT SERVICEABLE

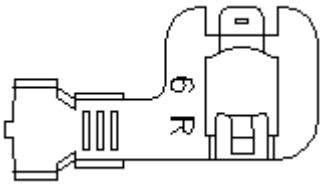

Part No.: YPG800220

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of 'B' post LH side

Qualifier:

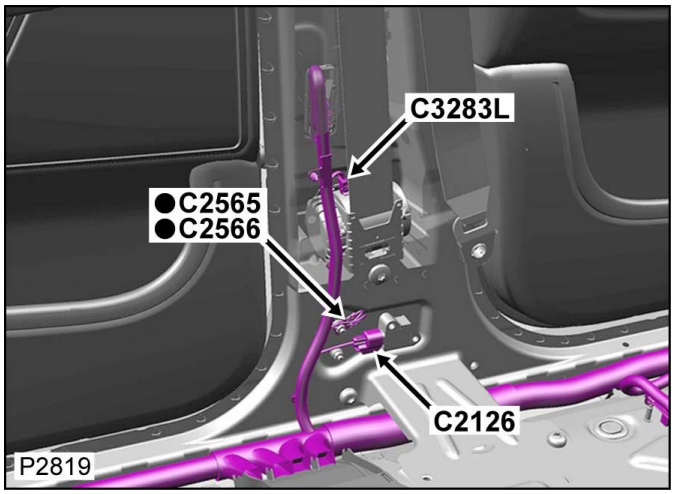


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	13S	C2754S
1	1.5	B	499S	C2754S
1	1.5	B	13T	C2754T
1	1.5	B	499T	C2754T

Click here to print

Connector: C2568T

CONNECTOR HOUSING NOT SERVICEABLE

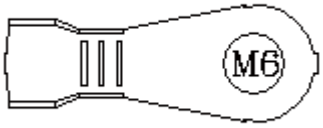

Part No.: YPG801370

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of 'D' post LH side

Qualifier:

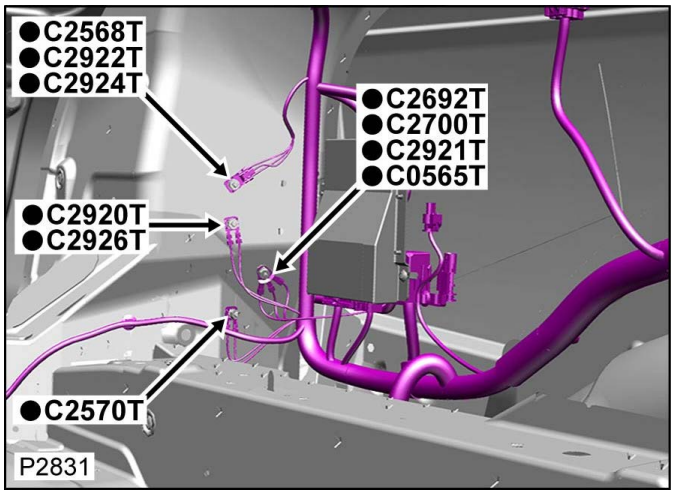


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	B	245T	C3088T

Click here to print

Connector: C2570T

CONNECTOR HOUSING NOT SERVICEABLE

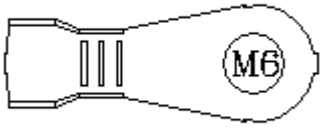

Part No.: YPG801380

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of 'D' post LH side

Qualifier:

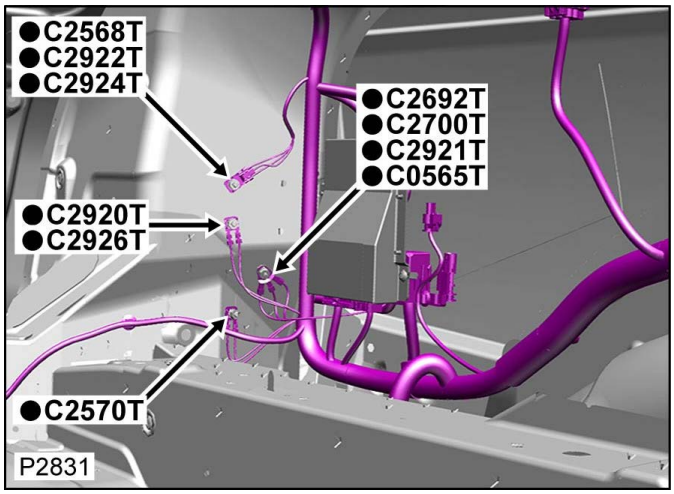

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	499T	S/JOINT SJ405

Click here to print

Connector: C2577T


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to ICE link harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

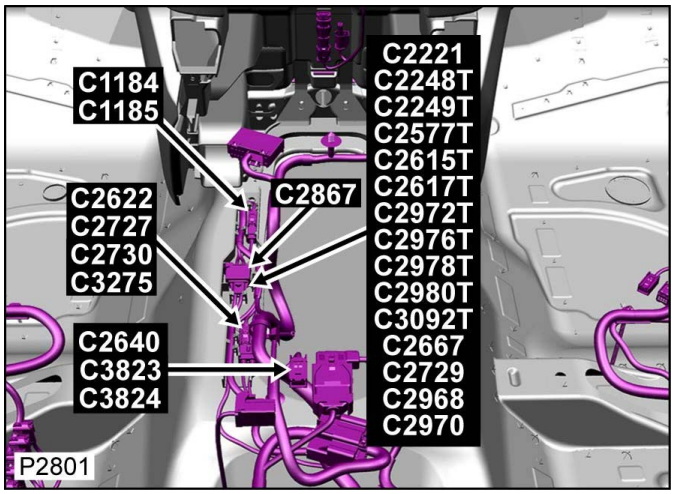

Part No.: XUD812770

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	659T	C2102T
2	POF	O	659T	C2491T

Click here to print

Connector: C2581

CONNECTOR HOUSING NOT SERVICEABLE

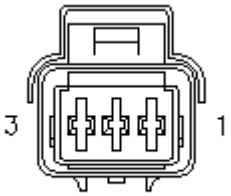

BLACK

Part No.: YPC900490

Colour: BLACK


Cavities: 3WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to glow plug harness

Location: Top of engine - LH side

Qualifier:

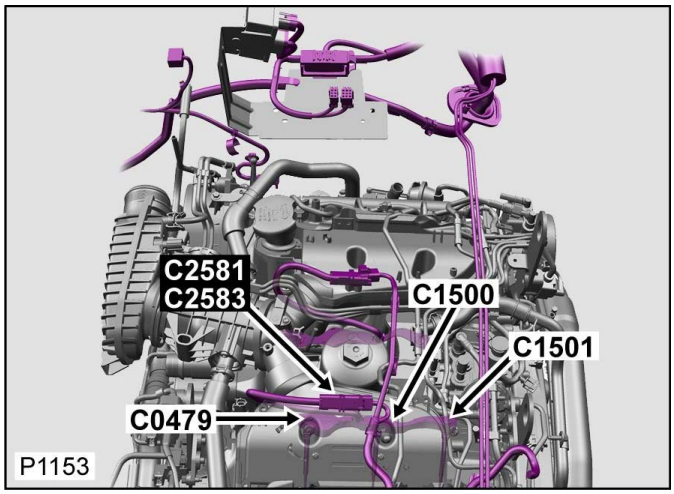


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	YB	797	S/JOINT SJ80
1	1.5	WN	798L	C0189L
1	1.5	WN	798R	C0189R
2	1.5	YB	797	S/JOINT SJ80
2	1.5	GW	798L	C0189L
2	1.5	GW	798R	C0189R
3	1.5	YB	797	S/JOINT SJ902
3	1.5	YU	798L	C0189L
3	1.5	YU	798R	C0189R

Click here to print

Connector: C2583

CONNECTOR HOUSING NOT SERVICEABLE

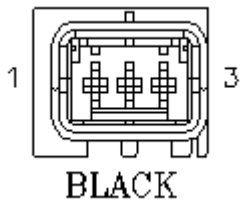

Part No.: YPC801960

Colour: BLACK


Cavities: 3WY

Harness: GLOWPLUG LINK V6 LHS HARNESS

Description: Glow plug harness to engine compartment harness

Location: Top of engine - LH side

Qualifier:

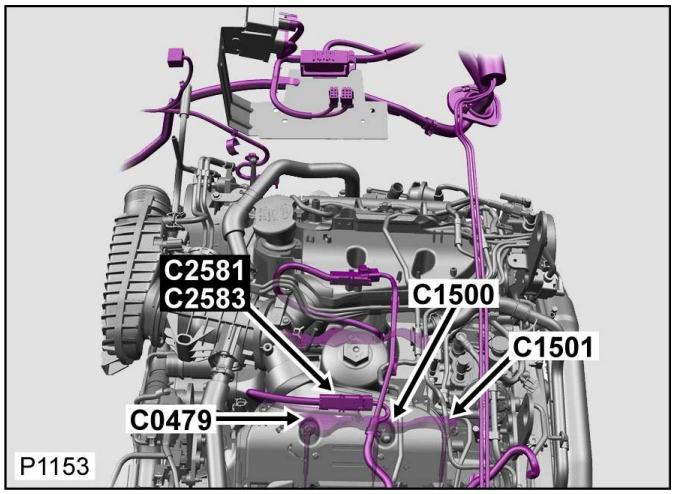


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	GO	695	C0479
2	1.5	GR	695	C1500
3	1.5	GU	695	C1501

Click here to print

Connector: C2584

CONNECTOR HOUSING NOT SERVICEABLE

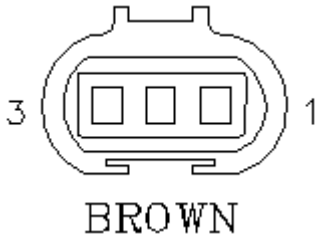

Part No.: YPC911500

Colour: BROWN


Cavities: 3WY

Harness: GLOWPLUG LINK V6 RHS HARNESS

Description: Glow plug harness to engine compartment harness

Location: Top of engine - RH side

Qualifier:

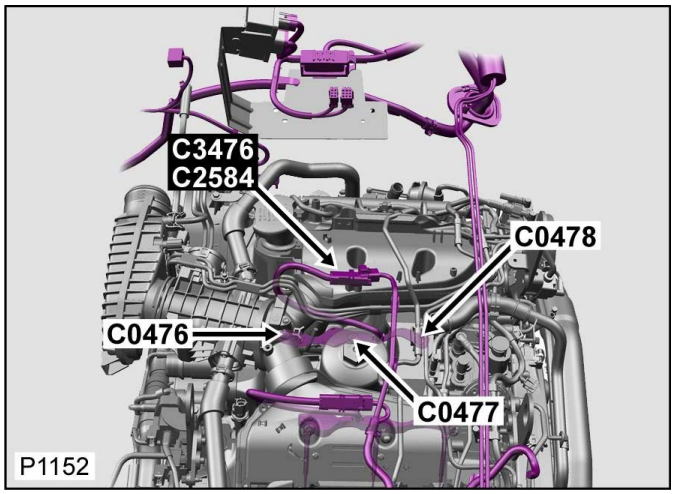


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	GO	695	C0476
2	1.5	GR	695	C0477
3	1.5	GU	695	C0478

Click here to print

Connector: C2590

CONNECTOR HOUSING NOT SERVICEABLE

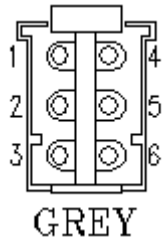

Part No.: YPC906160

Colour: GREY


Cavities: 6WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Module-Trailer-Electric Brake

Location: Driver footwell

Qualifier:

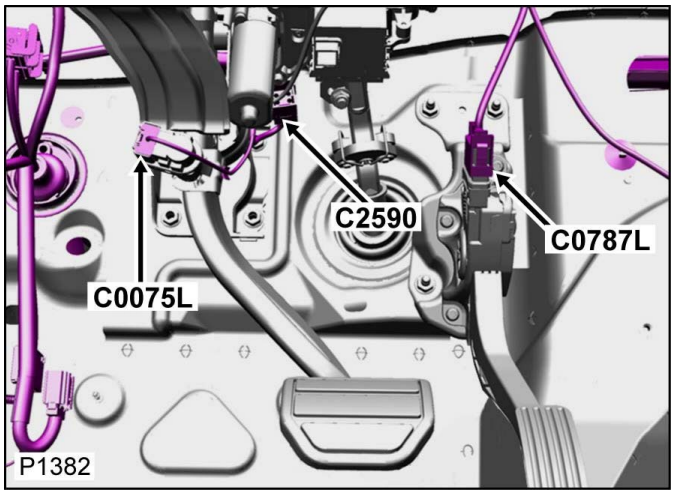

Wire Chart

CAV	CSA	COL	CCT	DESTN
2	1.5	N	319L	C2245L
3	1.5	B	319L	C0563L
4	4.0	KW	319L	C0570L
5	1.5	GP	319L	S/JOINT SJ814
6	2.5	U	319L	C2245L

Click here to print


Connector: C2597T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Ground point

Location: Front of headlining in the center

Qualifier:

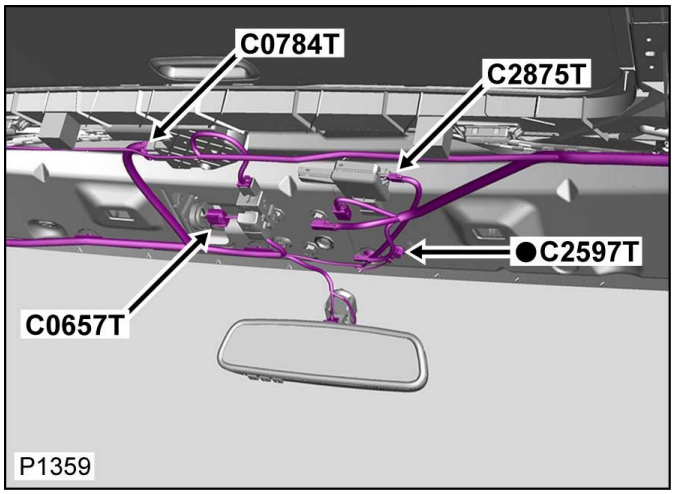



Part No.: YPG10004

Colour: TIN PLATED

Cavities: 1WY

Harness: CABIN HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	591T	C2875T
1	0.5	B	499T	C0674T

Click here to print

Connector: C2598

CONNECTOR HOUSING NOT SERVICEABLE

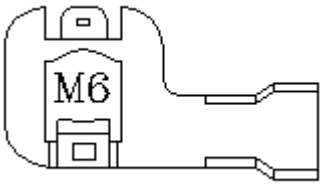

Part No.: YPG900260

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of 'B' post RH side

Qualifier:

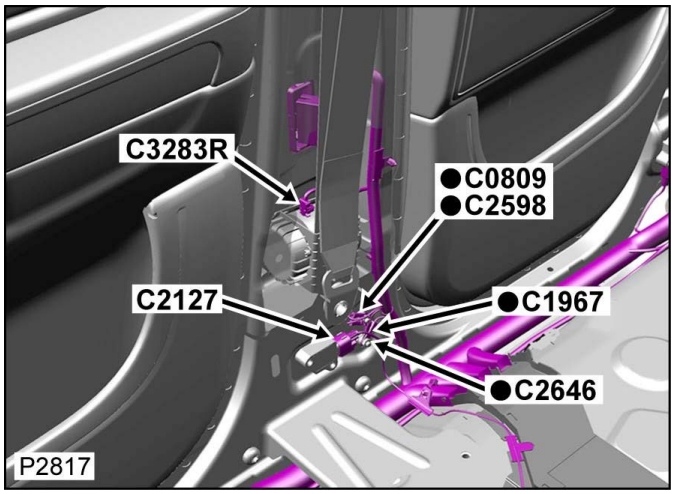


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	410S	C2429S
1	2.5	B	499S	C0868S
1	2.5	B	410T	C2429T
1	2.5	B	986TL	C0868TL
1	2.5	B	982T	C0868TA
1	2.5	B	986TR	C0868TR

Click here to print

Connector: C2601

CONNECTOR HOUSING NOT SERVICEABLE

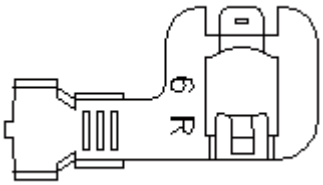

Part No.: YPG800220

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Rear LH side of engine compartment

Qualifier:

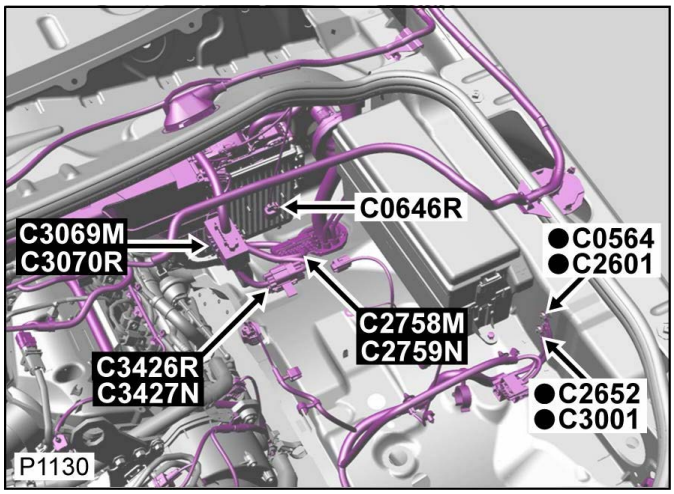


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	254	S/JOINT SJ171

Click here to print

Connector: C2602L

CONNECTOR HOUSING NOT SERVICEABLE

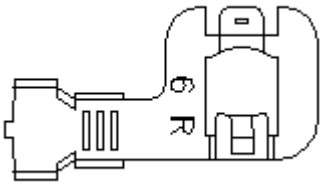

Part No.: YPG800220

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: LHD condition illustrated

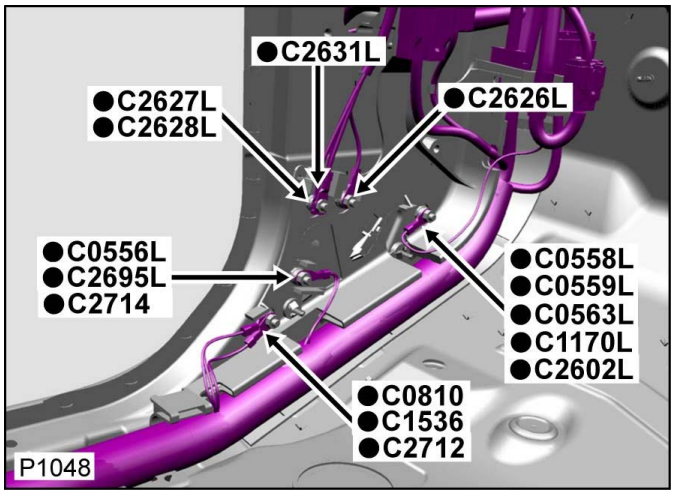


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	407L	C2188L
1	2.5	B	809L	C2321L
1	2.5	B	245L	C2321L

Click here to print

Connector: C2602R

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG10004

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Behind RH front fender splash shield

Qualifier:

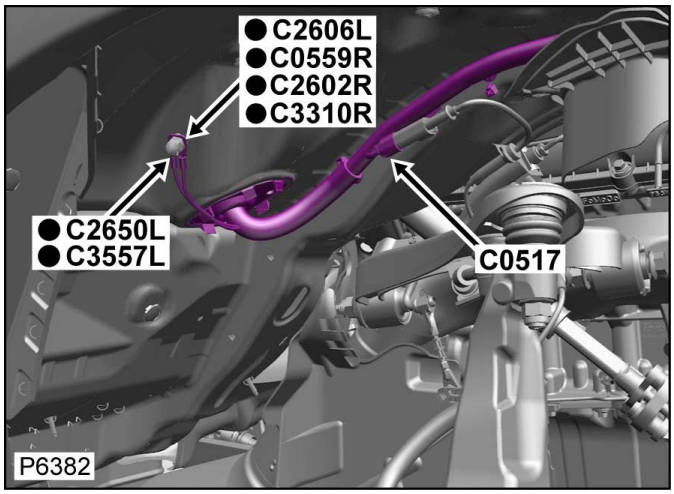


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	413R	C1656R

Click here to print

Connector: C2603L

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG10018

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Rear LH side of engine compartment

Qualifier:

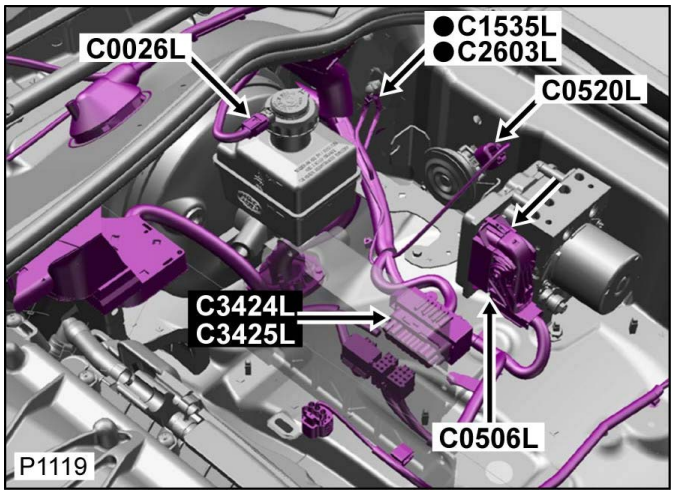


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	413L	C0506L
1	2.5	B	413L	C0506L

Click here to print

Connector: C2603R

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG10018

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Rear RH side of engine compartment

Qualifier:

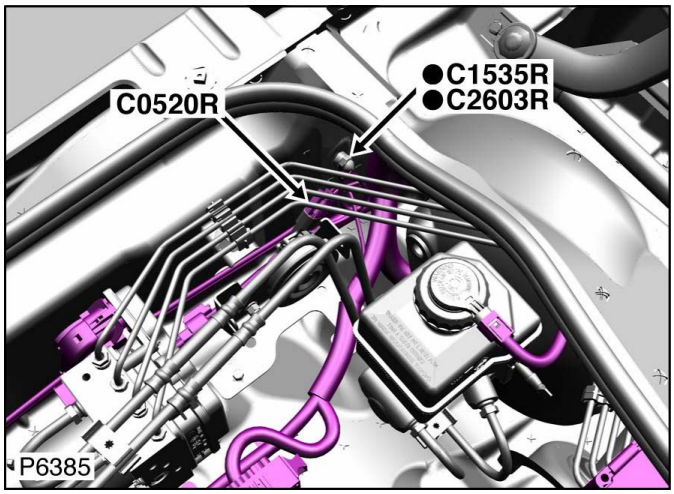


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	413R	C0506R
1	2.5	B	413R	C0506R

Click here to print

Connector: C2606L

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG10018

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Behind RH front fender splash shield

Qualifier:

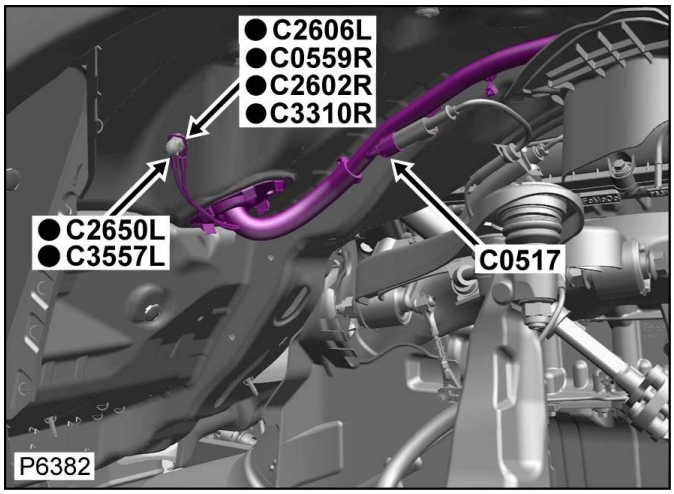


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	139L	C2996L
1	4.0	B	183L	S/JOINT SJ15

Click here to print

Connector: C2606R

CONNECTOR HOUSING NOT SERVICEABLE

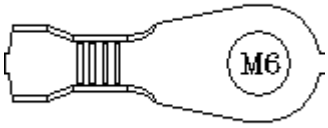

Part No.: YPG800650

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

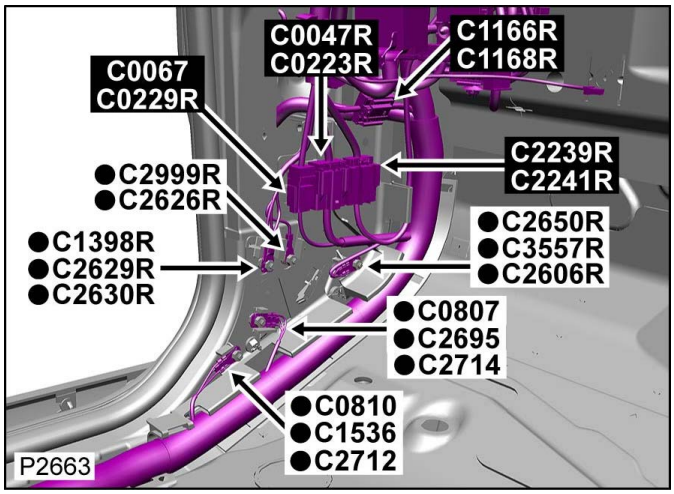

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	200R	C2996R

Click here to print


Connector: C2610

CONNECTOR HOUSING NOT SERVICEABLE

Description: Audio head unit

Location: Behind front touch screen display

Qualifier:

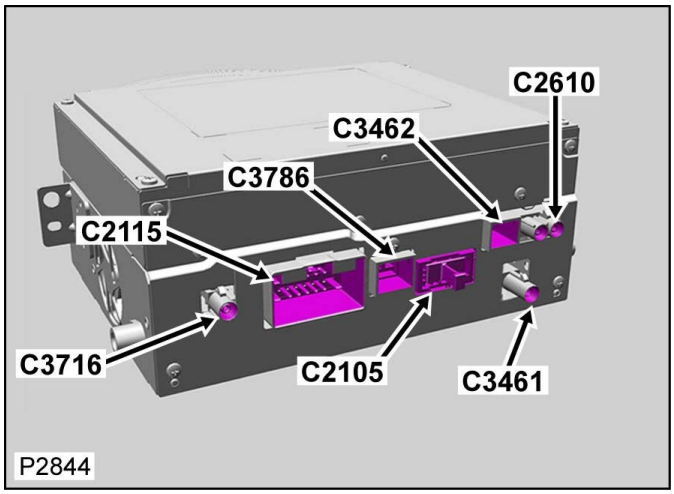

ASSEMBLY

Part No.: XUD815130

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE LINK HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	1031	C2620
1S	0.5	SCR	1031	C2620
2	0.5	B	1031	C2620
2S	0.5	SCR	1031	C2620

Click here to print

Connector: C2615T


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to ICE link harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

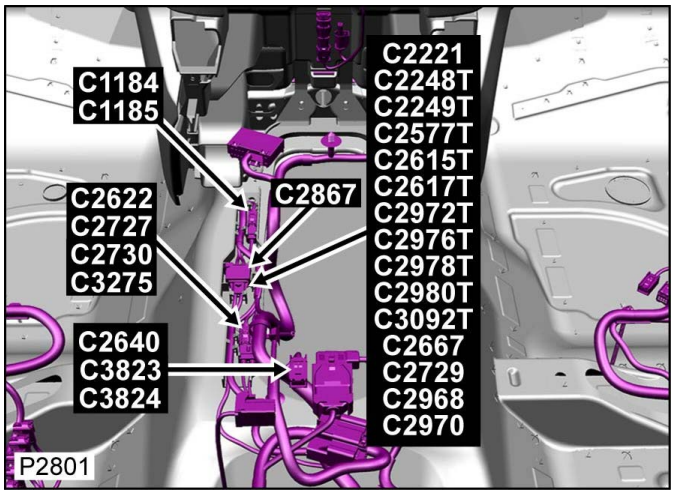

Part No.: XUD812790

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	869T	C2102T
2	POF	O	869T	C2106

Click here to print

Connector: C2616


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to ICE link harness

Location: Beneath center console RH side

Qualifier:

ASSEMBLY

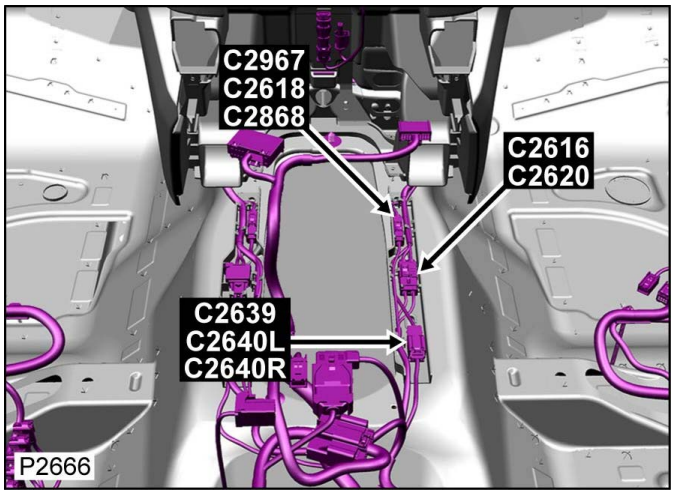

Part No.: XUD812220

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	1031S	C1848S
1S	SCR	SCR	1031S	C1848S
1	0.5	B	1031T	C1848T
1S	SCR	SCR	1031T	C1848T
2	0.5	B	1031S	C2554S
2S	SCR	SCR	1031S	C2554S
2	0.5	B	1031T	C2554T
2S	SCR	SCR	1031T	C2554T

Click here to print

Connector: C2617T


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to instrument panel harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

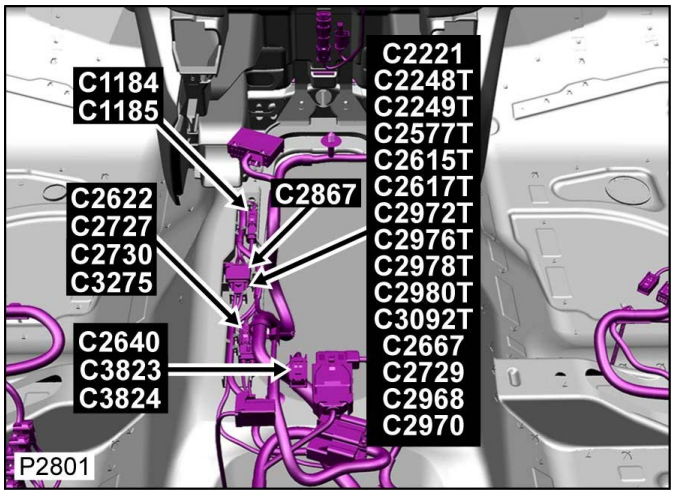

Part No.: XUD812800

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	687T	C2102T
2	POF	O	687T	C2106

Click here to print


Connector: C2618

CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to ICE link harness

Location: Beneath center console RH side

Qualifier:

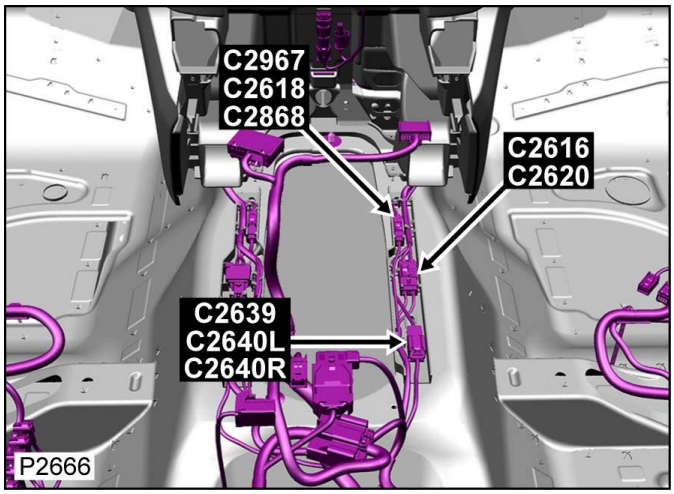

ASSEMBLY

Part No.: XUD812310

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	1030S	C2770S
1S	SCR	SCR	1030S	C2770S
1	0.5	B	1030T	C2770T
1S	SCR	SCR	1030T	C2770T

Click here to print


Connector: C2620

CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE link harness to ICE harness

Location: Beneath center console RH side

Qualifier:

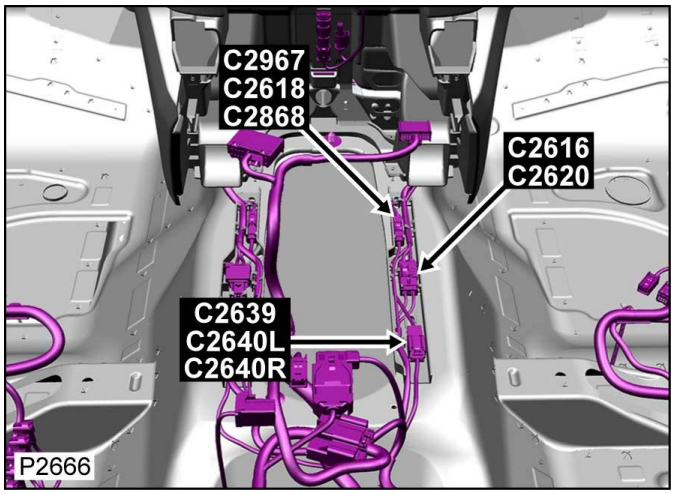

ASSEMBLY

Part No.: XUD815130

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE LINK HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	1031	C2610
1S	0.5	SCR	1031	C2610
2	0.5	B	1031	C2610
2S	0.5	SCR	1031	C2610

Click here to print

Connector: C2622


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to ICE link harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

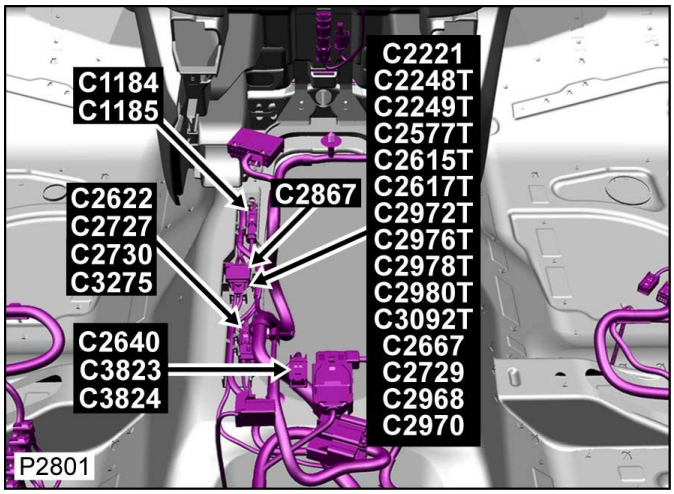

Part No.: XUD812200

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE LINK HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1S	0.5	SCR	1022	C3499
1	0.5	B	1022	C3499
2	0.5	B	1022	C3499
2S	0.5	SCR	1022	C3499

Click here to print

Connector: C2626L

CONNECTOR HOUSING NOT SERVICEABLE

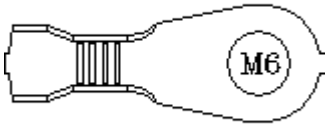

Part No.: YPG800650

Colour: TIN PLATED


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: LHD condition illustrated

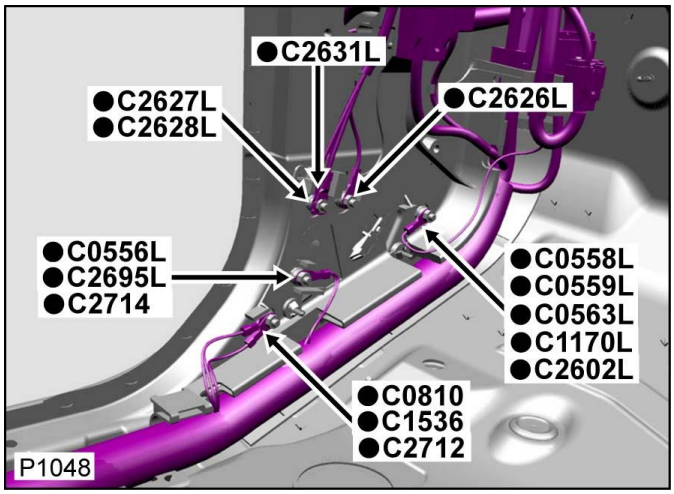


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	139L	C0230
1	2.5	B	125L	C3481
1	2.5	B	124L	S/JOINT SJ590L

Click here to print

Connector: C2626R

CONNECTOR HOUSING NOT SERVICEABLE

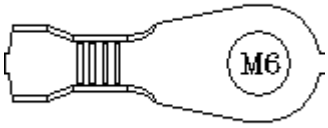

Part No.: YPG800650

Colour: TIN PLATED


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

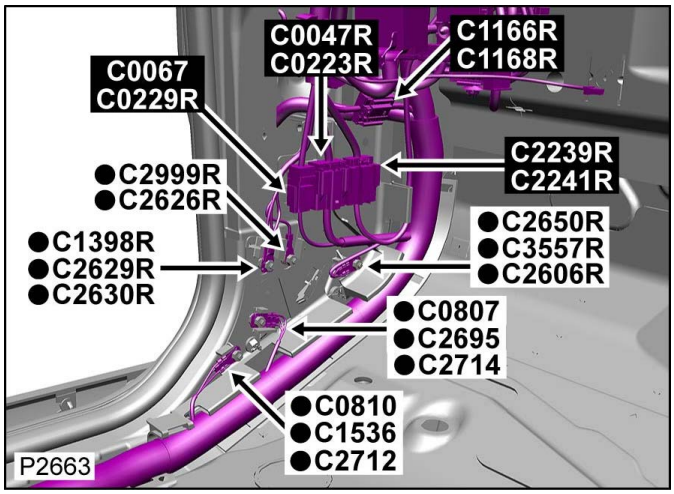


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	124R	S/JOINT SJ590R

Click here to print

Connector: C2627L

CONNECTOR HOUSING NOT SERVICEABLE

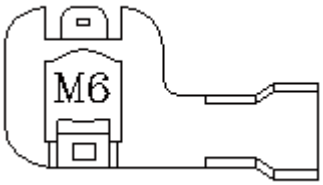

Part No.: YPG900260

Colour: TIN PLATED


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: LHD condition illustrated

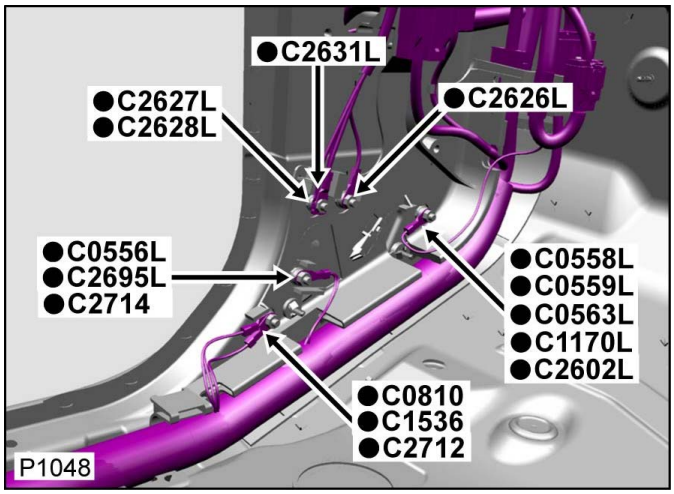


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	139L	S/JOINT SJ660
1	0.5	B	57L	C0040

Click here to print

Connector: C2627R

CONNECTOR HOUSING NOT SERVICEABLE

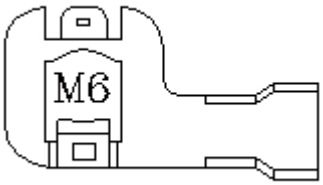

Part No.: YPG900260

Colour: TIN PLATED


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Ground point

Location: Base of RH 'A' post

Qualifier: RHD condition illustrated

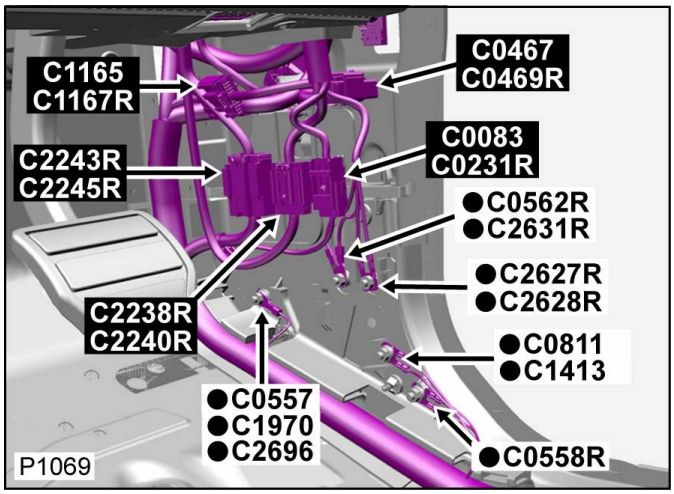


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	200R	S/JOINT SJ660
1	0.5	B	57R	C0040

Click here to print

Connector: C2628L

CONNECTOR HOUSING NOT SERVICEABLE

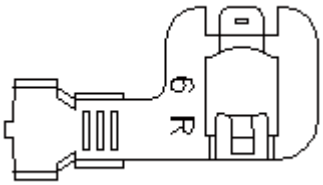

Part No.: YPG800220

Colour: TIN PLATED


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: LHD condition illustrated

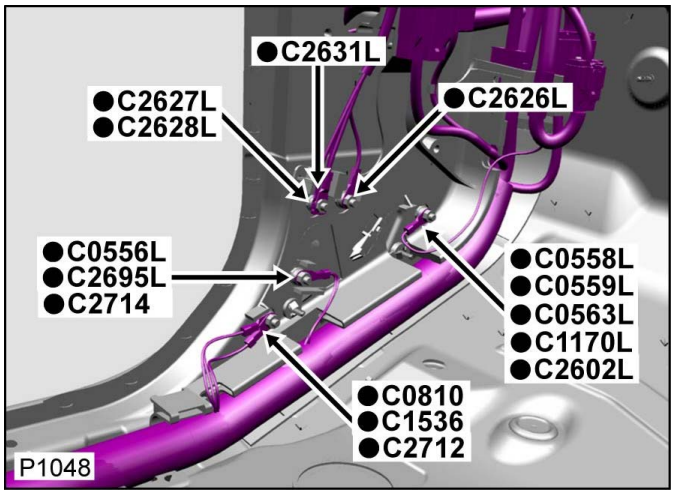


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	139L	S/JOINT SJ661
1	0.5	B	57L	C0040

Click here to print

Connector: C2628R

CONNECTOR HOUSING NOT SERVICEABLE

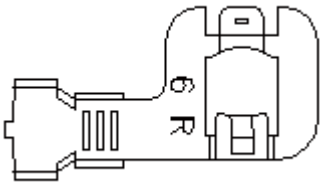

Part No.: YPG800220

Colour: TIN PLATED


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Ground point

Location: Base of RH 'A' post

Qualifier: RHD condition illustrated

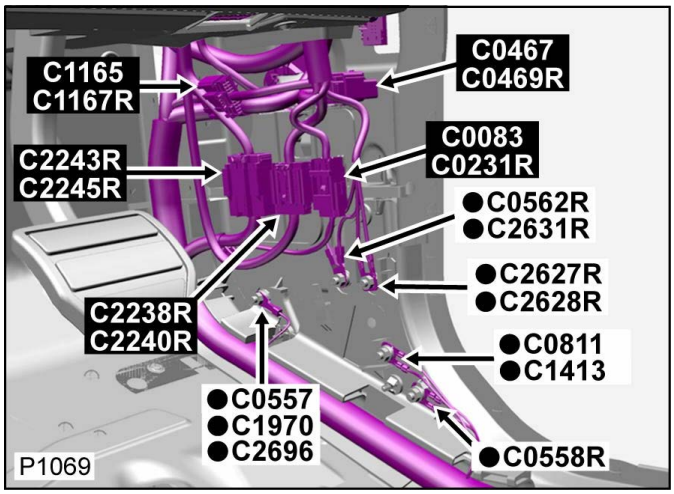


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	200R	S/JOINT SJ661
1	0.5	B	57R	C0040

Click here to print

Connector: C2629L

CONNECTOR HOUSING NOT SERVICEABLE

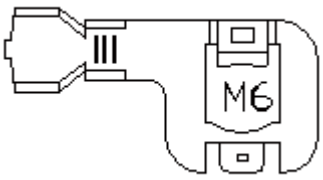

Part No.: YPG900270

Colour: TIN PLATED


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Ground point

Location: Base of RH 'A' post

Qualifier: LHD condition illustrated

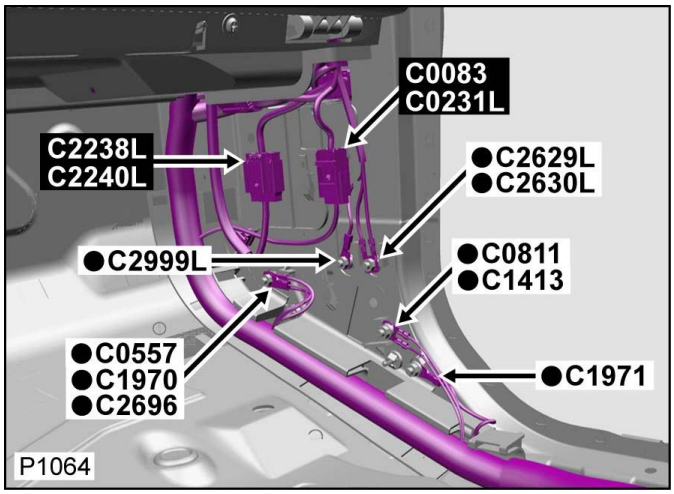


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	B	139L	C3470

Click here to print

Connector: C2629R

CONNECTOR HOUSING NOT SERVICEABLE

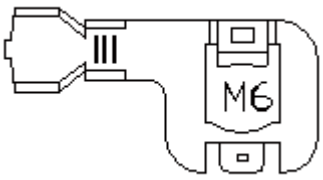

Part No.: YPG900270

Colour: TIN PLATED


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

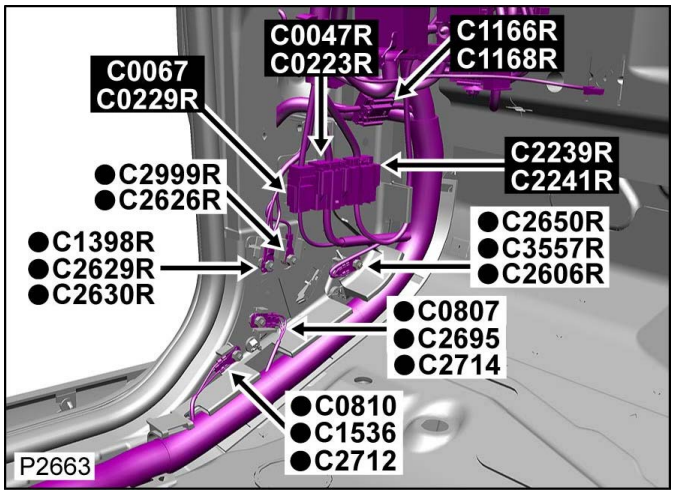


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	B	200R	C3470

Click here to print

Connector: C2630L

CONNECTOR HOUSING NOT SERVICEABLE

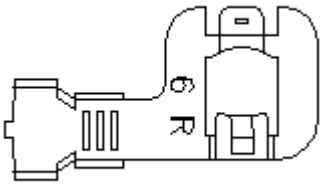

Part No.: YPG800220

Colour: TIN PLATED


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Ground point

Location: Base of RH 'A' post

Qualifier: LHD condition illustrated

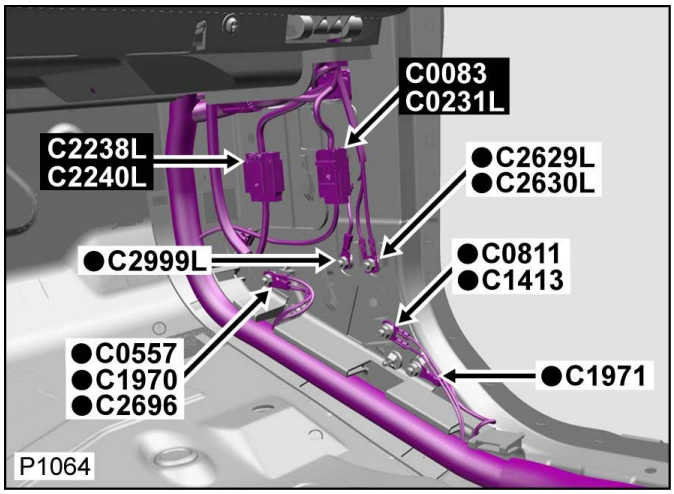


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	139L	S/JOINT SJ662

Click here to print

Connector: C2630R

CONNECTOR HOUSING NOT SERVICEABLE

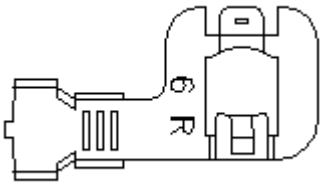

Part No.: YPG800220

Colour: TIN PLATED


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

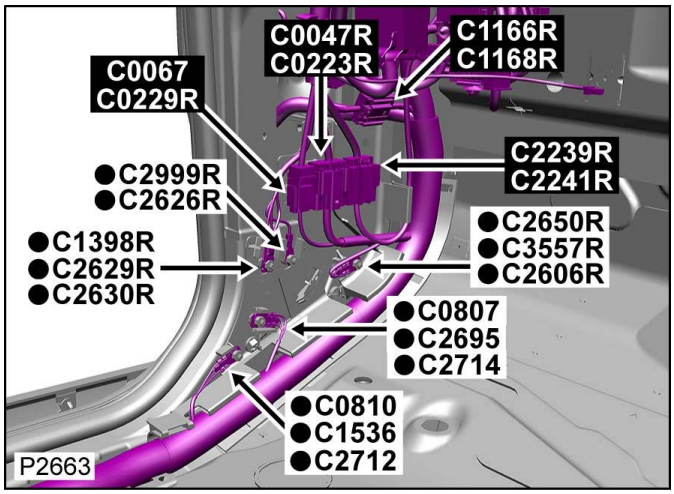


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	200R	S/JOINT SJ662

Click here to print

Connector: C2631L

CONNECTOR HOUSING NOT SERVICEABLE

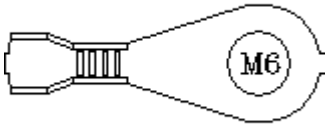

Part No.: YPG800660

Colour: TIN PLATED


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: LHD condition illustrated

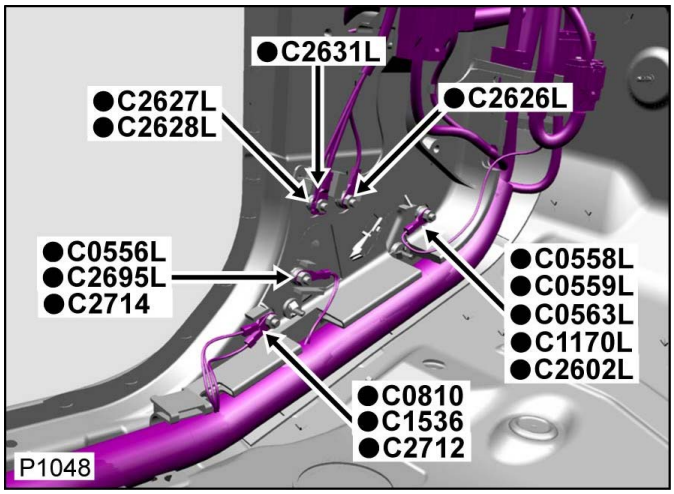


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	139L	C0278L

Click here to print

Connector: C2631R

CONNECTOR HOUSING NOT SERVICEABLE

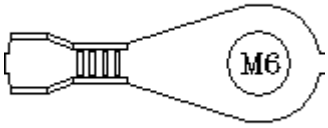

Part No.: YPG800660

Colour: TIN PLATED


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Ground point

Location: Base of RH 'A' post

Qualifier: RHD condition illustrated

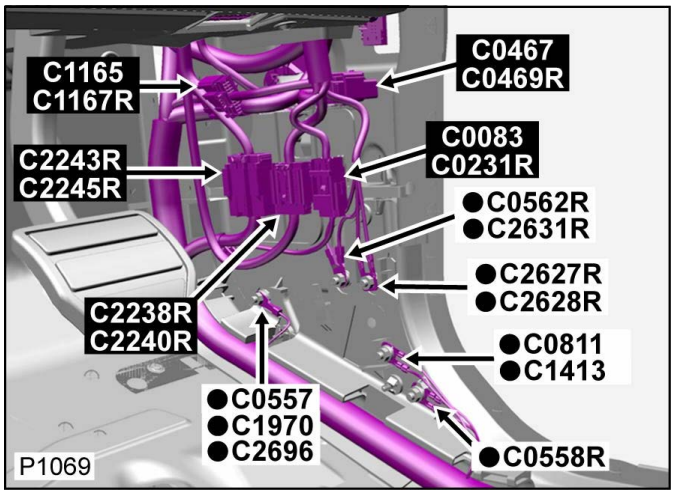


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	200R	C2238R
1	0.5	B	200R	C0278R

Click here to print

Connector: C2635

CONNECTOR HOUSING NOT SERVICEABLE

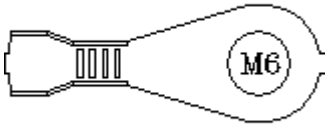

Part No.: YPG800670

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Front LH side of engine compartment

Qualifier:

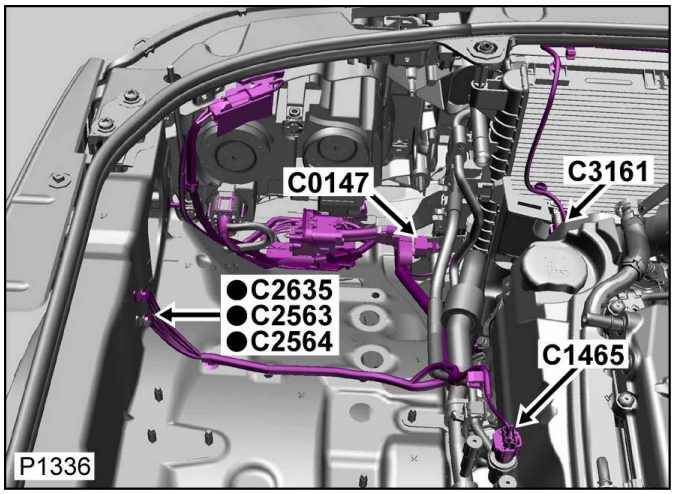


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	374	C3006

Click here to print

Connector: C2636

CONNECTOR HOUSING NOT SERVICEABLE

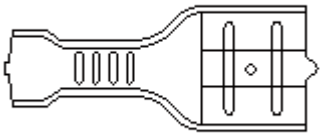

Part No.: AFU3262

Colour: TIN PLATED


Cavities: 1WY

Harness: STEERING WHEEL HARNESS

Description: Module-Air bag-Driver

Location: In center of steering wheel

Qualifier:

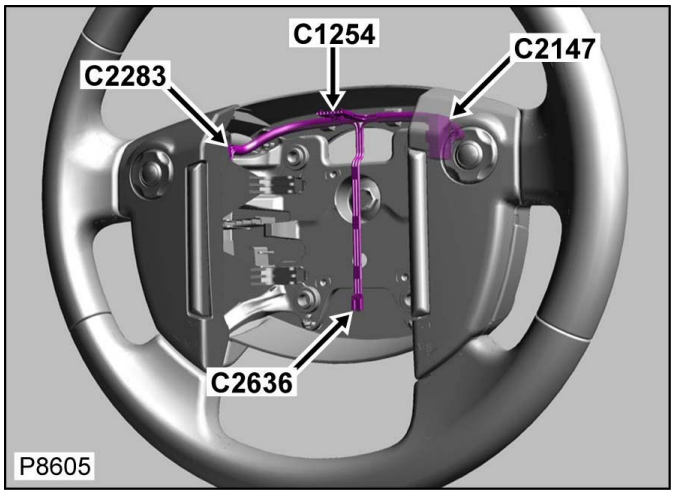


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	B	499	C1254
1	0.35	B	499	C2283
1	0.35	B	499	C2147

Click here to print

Connector: C2637L

CONNECTOR HOUSING NOT SERVICEABLE

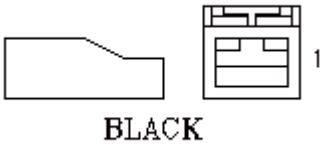

Part No.: ADU9409

Colour: BLACK


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Module-Air bag-Passenger

Location: Behind passenger air bag module

Qualifier:

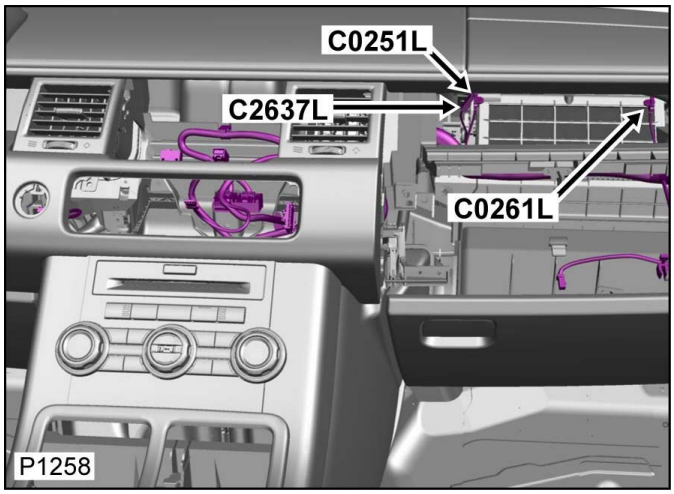


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	216L	C2999L

Click here to print

Connector: C2637R

CONNECTOR HOUSING NOT SERVICEABLE

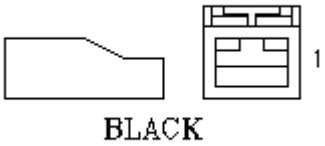

Part No.: ADU9409

Colour: BLACK


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Module-Air bag-Passenger

Location: Behind passenger air bag module

Qualifier:

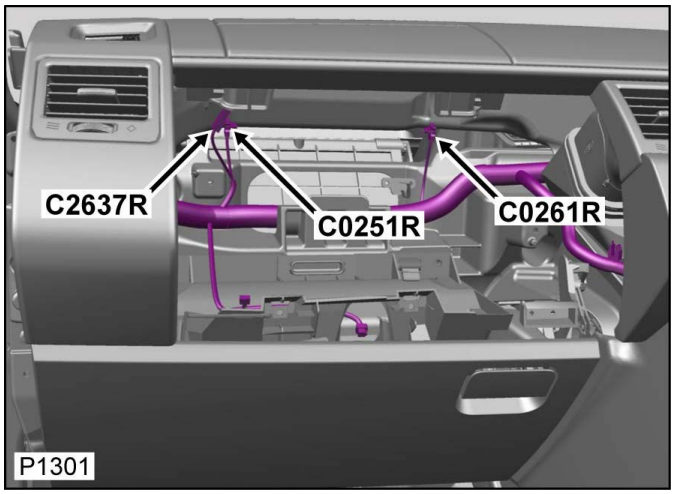


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	216R	C2999R

Click here to print

Connector: C2638

CONNECTOR HOUSING NOT SERVICEABLE

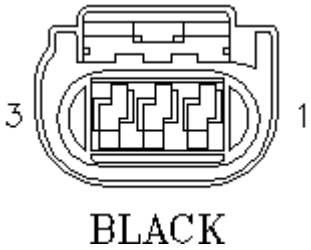

BLACK

Part No.: YPC800510

Colour: BLACK


Cavities: 3WY

Harness: SEAT FRONT HARNESS

Description: Sensor-Pressure-mat

Location: Beneath front passenger seat

Qualifier:

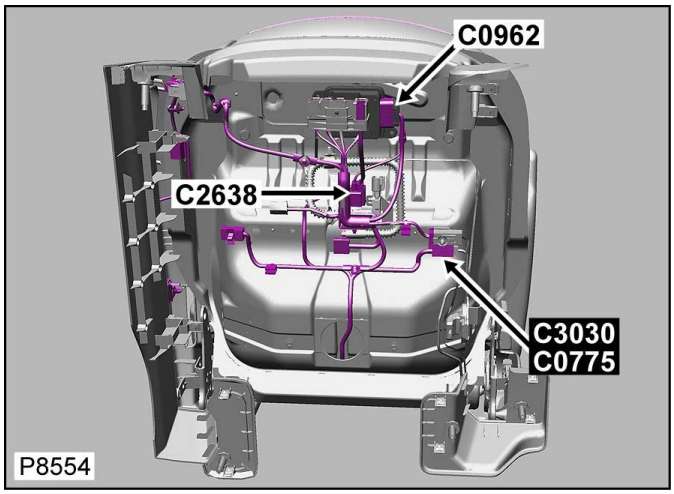

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	KU	459	C0962	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	P	459	C0962	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	G	459	C0962	418-411-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C2639

CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to instrument panel harness

Location: Beneath center console RH side

Qualifier:

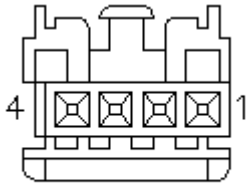


BLACK

Part No.: YPC902310

Colour: BLACK

Cavities: 4WY

Harness: ICE/NAVIGATION HARNESS

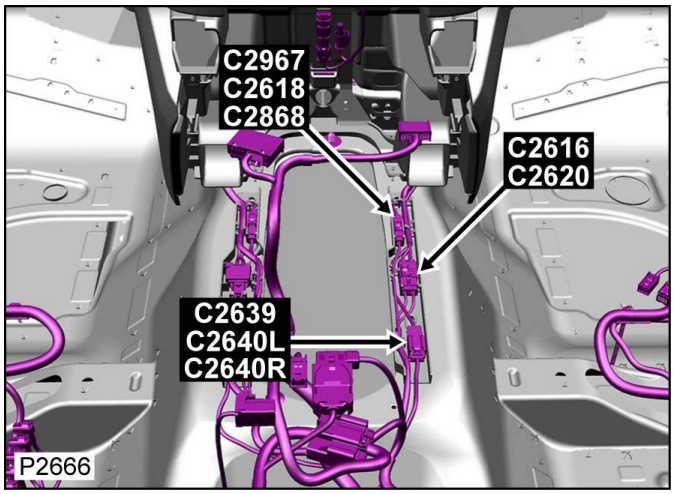


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	U	1031S	C2219S	418-411-45	-	418-116A	418-117	-	418-112	418-107
1	0.5	U	1031T	C2219T	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	UO	568S	C0820S	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.75	W	1054	C2639	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	UO	568T	C0820T	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.75	R	1052	S/JOINT SJ520	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.75	PW	514S	C2116S	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.75	W	1054	C2639	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.75	PW	514T	C2116T	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2640

CONNECTOR HOUSING NOT SERVICEABLE

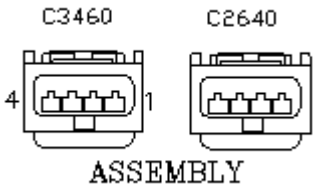

Part No.: XUD815380

Colour: NO COLOUR


Cavities: 4WY

Harness: ICE LINK HARNESS

Description: ICE link harness to USB link harness

Location: Beneath center console LH side

Qualifier:

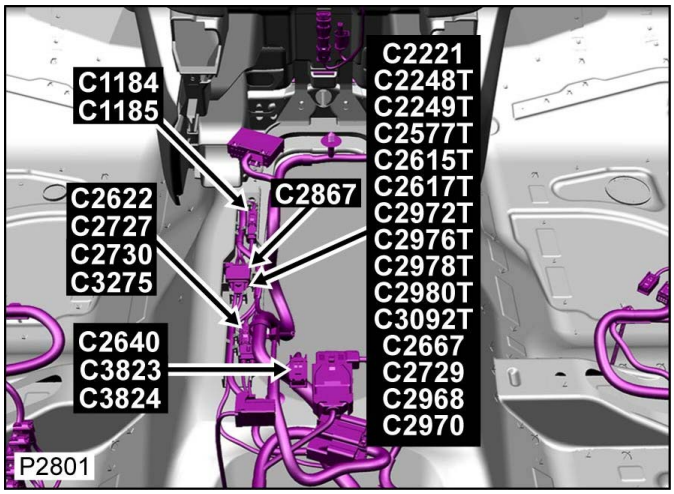


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	1020	C3460
2	0.5	N	1020	C3460
3	0.5	P	1020	C3460
4	0.5	B	1020	C3460
5	0.5	SCR	1020	C3460

Click here to print

Connector: **C2640L**

CONNECTOR HOUSING SERVICEABLE

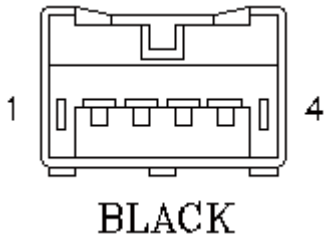

Part No.: YPC906730

Colour: BLACK


Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS

Description: Instrument panel harness to ICE harness

Location: Beneath center console RH side

Qualifier:

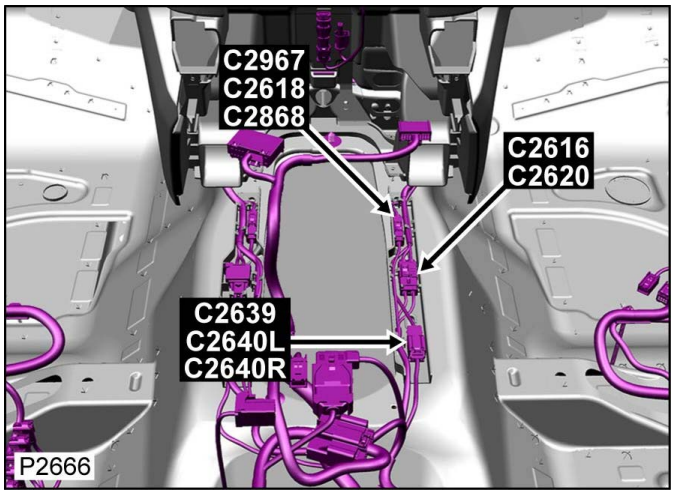


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	U	124L	C2115	-	-	-	-	-	-	-
1	0.5	U	125L	S/JOINT SJ980L	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.75	U	124L	C0582	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.75	PW	124L	C0582	418-411-47	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2640R

CONNECTOR HOUSING SERVICEABLE

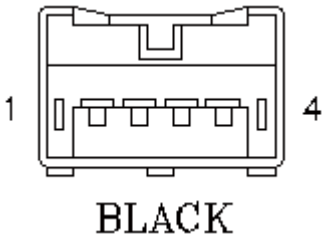

Part No.: YPC906730

Colour: BLACK


Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS

Description: Instrument panel harness to ICE harness

Location: Beneath center console RH side

Qualifier:

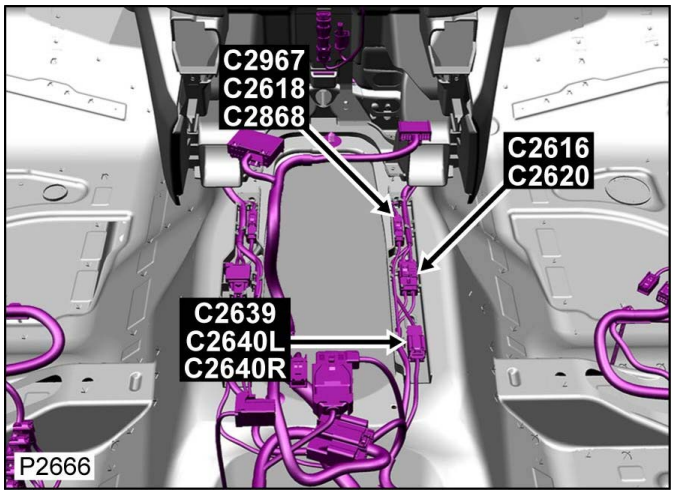


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	U	124R	C2115	-	-	-	-	-	-	-
1	0.5	U	125R	S/JOINT SJ980R	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.5	UO	568	C2819R	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.75	U	124R	C0582	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.75	PW	124R	C0582	418-411-47	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2641L

CONNECTOR HOUSING NOT SERVICEABLE

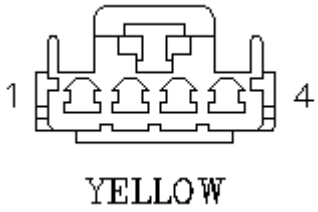

Part No.: YPC800250

Colour: YELLOW


Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS

Description: Clock spring

Location: Behind steering column cowl LH side

Qualifier:

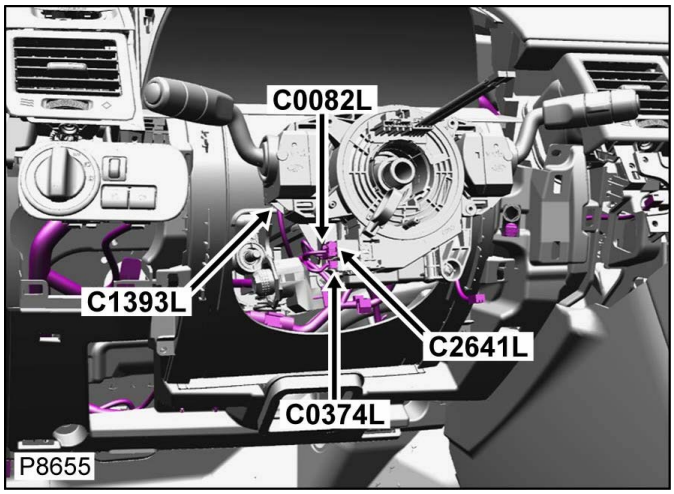


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	RY	216L	C0229L
2	0.5	R	216L	C0229L
3	0.5	RG	216L	C0229L
4	0.5	RB	216L	C0229L

Click here to print

Connector: C2641R

CONNECTOR HOUSING NOT SERVICEABLE

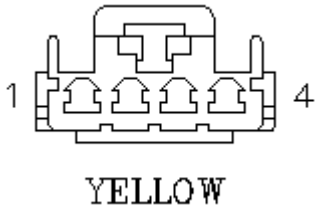

Part No.: YPC800250

Colour: YELLOW


Cavities: 4WY

Harness: FACIA COMPOSITE HARNESS

Description: Clock spring

Location: Behind steering column cowl LH side

Qualifier:

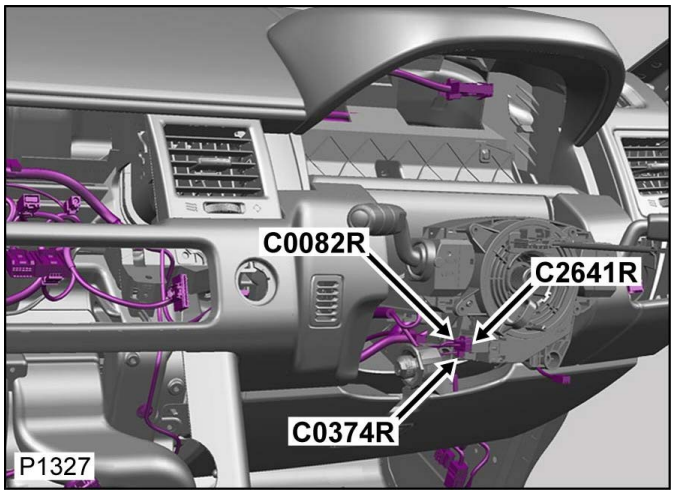

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	RY	216R	C0231R
2	0.5	R	216R	C0231R
3	0.5	RG	216R	C0231R
4	0.5	RB	216R	C0231R

Click here to print


Connector: C2646


CONNECTOR HOUSING NOT SERVICEABLE

Description: Ground point

Location: Base of 'B' post RH side

Qualifier:

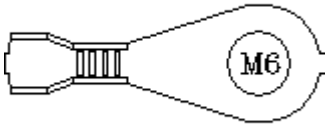

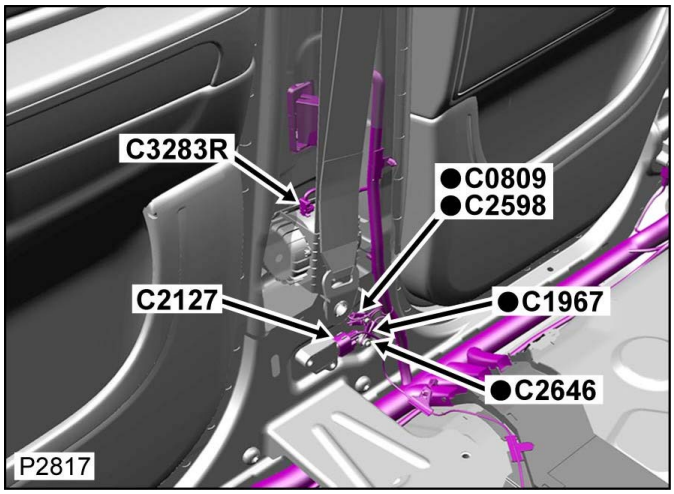

Part No.: YPG800660

Colour: TIN PLATED

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	B	310	C2117

Click here to print

Connector: C2647T

CONNECTOR HOUSING NOT SERVICEABLE

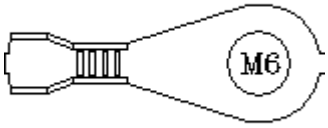

Part No.: YPG800660

Colour: TIN PLATED


Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Description: Ground point

Location: Base of 'D' post RH side

Qualifier:

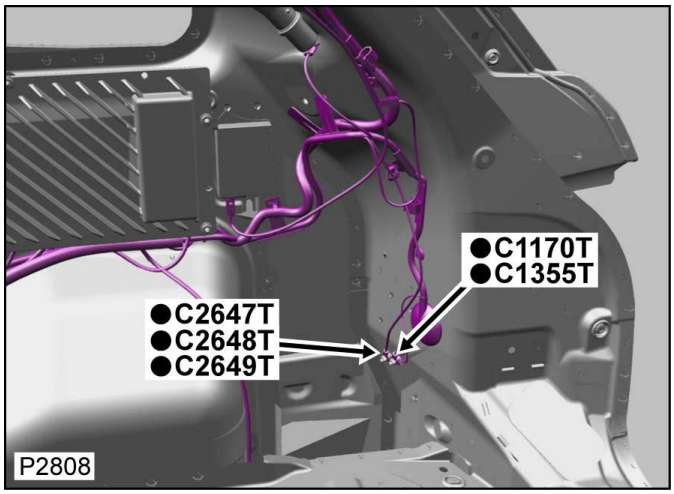


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	B	512T	C2989T
1	0.75	B	449T	C2158T

Click here to print

Connector: C2648T

CONNECTOR HOUSING NOT SERVICEABLE

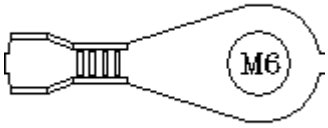

Part No.: YPG800660

Colour: TIN PLATED


Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Description: Ground point

Location: Base of 'D' post RH side

Qualifier:

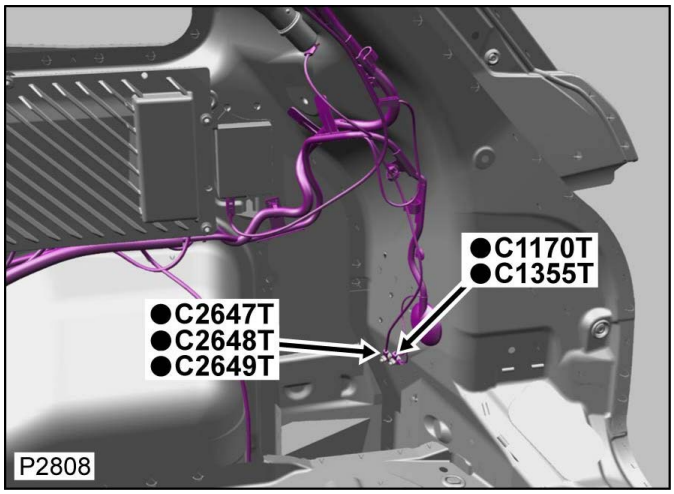


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	B	514T	C2116T

Click here to print

Connector: C2649T

CONNECTOR HOUSING NOT SERVICEABLE

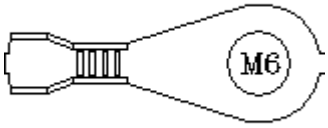

Part No.: YPG800660

Colour: TIN PLATED


Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Description: Ground point

Location: Base of 'D' post RH side

Qualifier:

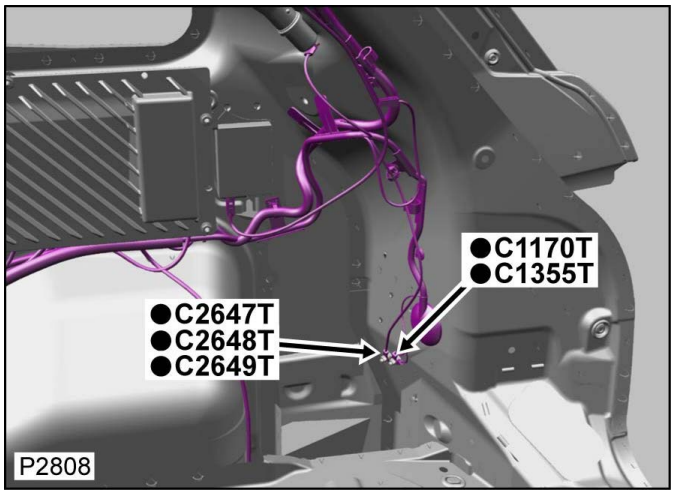


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	568T	S/JOINT SJ1
1	0.5	B	1011T	C0897

Click here to print

Connector: C2650L

CONNECTOR HOUSING NOT SERVICEABLE

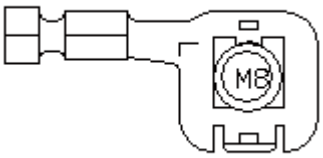

Part No.: YPG900110

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Behind RH front fender splash shield

Qualifier:

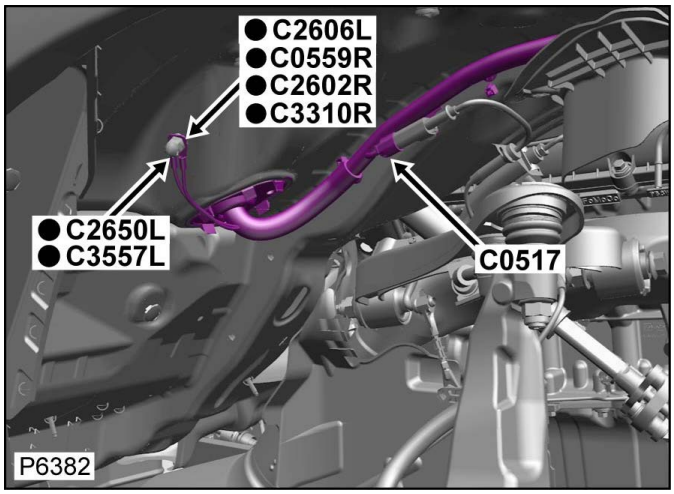


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	798L	C0658L
1	2.5	B	252L	C0635L
1	2.5	B	798L	C0658L
1	1.5	B	797L	C0872L
1	1.5	B	797L	C0872L

Click here to print

Connector: C2650R

CONNECTOR HOUSING NOT SERVICEABLE

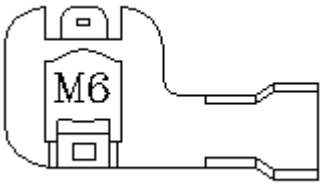

Part No.: YPG900260

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

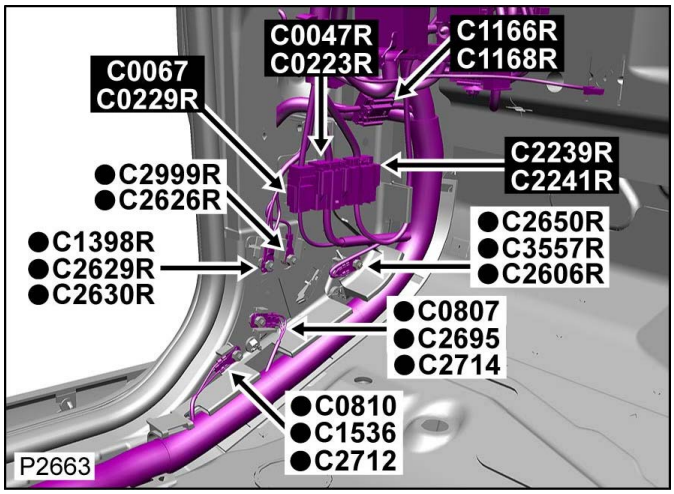


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	798R	C0658R
1	2.5	B	252R	C0635R
1	2.5	B	798R	C0658R
1	1.5	B	797R	C0872R
1	1.5	B	797R	C0872R

Click here to print

Connector: C2652

CONNECTOR HOUSING NOT SERVICEABLE

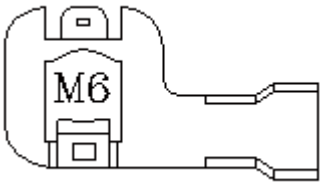

Part No.: YPG900260

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Rear LH side of engine compartment

Qualifier:

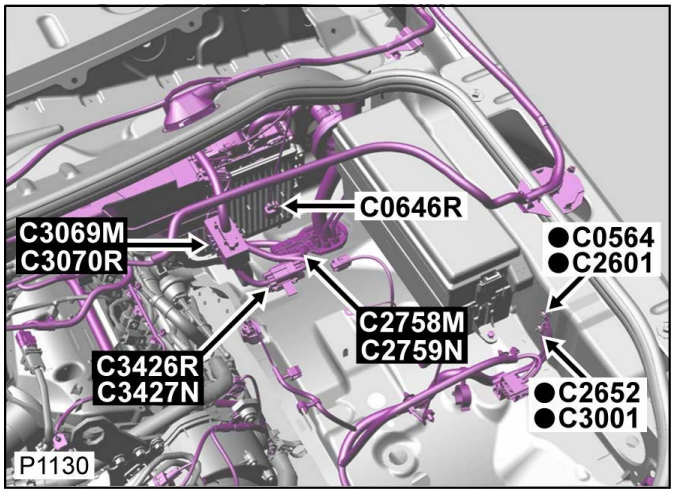


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	97	S/JOINT SJ9

Click here to print

Connector: C2656L

CONNECTOR HOUSING NOT SERVICEABLE

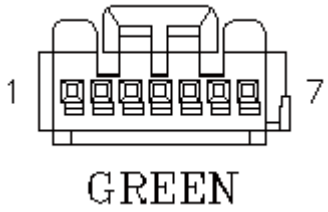

Part No.: 6901816

Colour: GREEN


Cavities: 7WY

Harness: CONSOLE FRONT HARNESS

Description: Lamp-Automatic gearbox-selector indicator

Location: Beneath center console LH side

Qualifier:

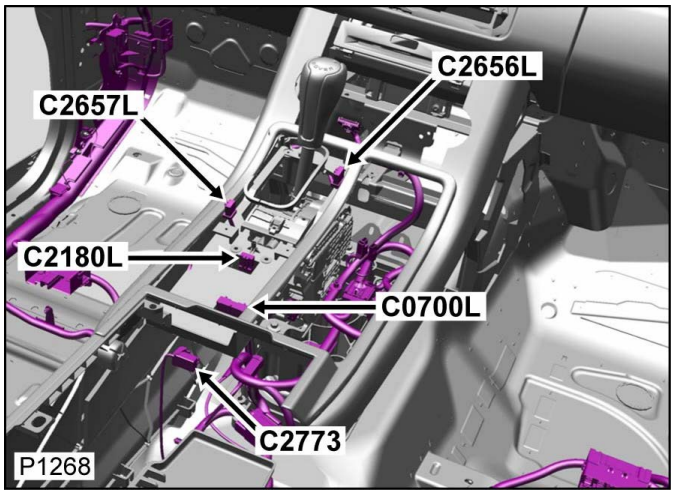

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	R	986L	C0903L
2	0.35	RG	986L	C0903L
3	0.35	RW	986L	C0903L
4	0.35	RU	986L	C0903L
5	0.5	RB	986L	S/JOINT SJ998
6	0.5	B	986L	S/JOINT SJ323
7	0.5	RN	986L	S/JOINT SJ322

Click here to print


Connector: C2656R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Lamp-Automatic gearbox-selector indicator

Location: Beneath center console RH side

Qualifier:

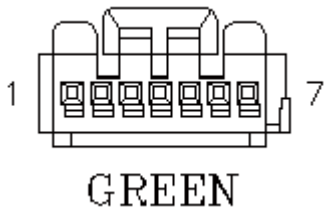

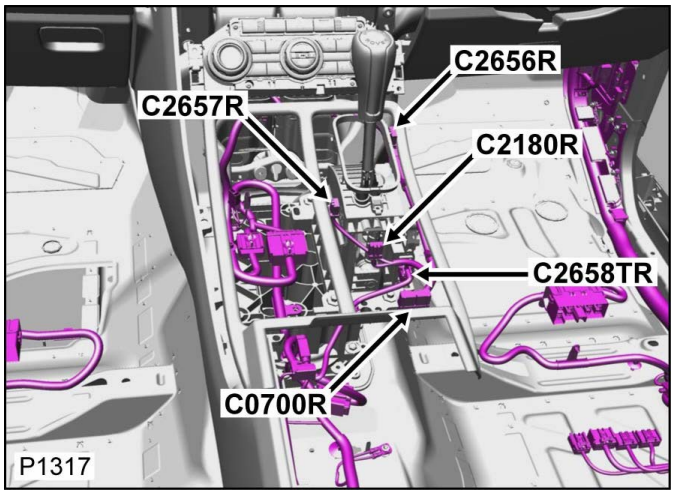

Part No.: 6901816

Colour: GREEN

Cavities: 7WY

Harness: CONSOLE FRONT HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	986R	C0903R
2	0.5	RG	986R	C0903R
3	0.5	RW	986R	C0903R
4	0.5	RU	986R	C0903R
5	0.5	RB	986R	S/JOINT SJ304
6	0.5	B	986R	S/JOINT SJ323
7	0.5	RN	986R	S/JOINT SJ322

Click here to print


Connector: C2657L

CONNECTOR HOUSING NOT SERVICEABLE

Description: Lamp-Automatic gearbox-selector indicator

Location: Beneath center console LH side

Qualifier:

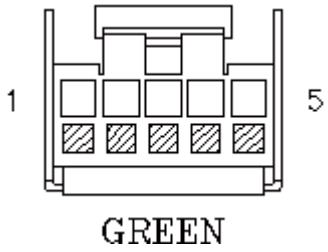


Part No.: YPC10182

Colour: GREEN

Cavities: 5WY

Harness: CONSOLE FRONT HARNESS

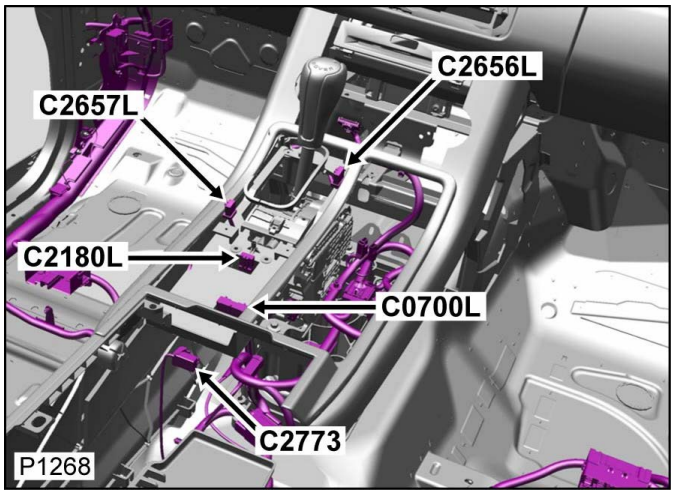

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	RB	986L	S/JOINT SJ998	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.5	RY	986L	C0903L	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	986L	S/JOINT SJ323	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	RN	986L	S/JOINT SJ322	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2657R

CONNECTOR HOUSING NOT SERVICEABLE

Description: Lamp-Automatic gearbox-selector indicator

Location: Beneath center console RH side

Qualifier:

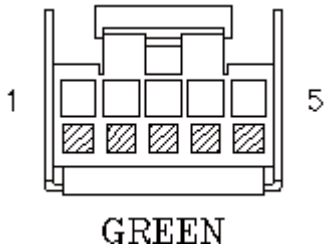


Part No.: YPC10182

Colour: GREEN

Cavities: 5WY

Harness: CONSOLE FRONT HARNESS

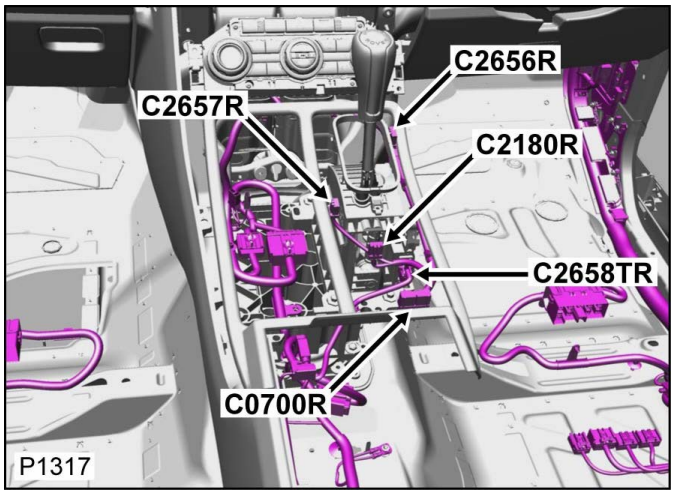

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	RB	986R	S/JOINT SJ304	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.5	RY	986R	C0903R	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	986R	S/JOINT SJ323	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	RN	986R	S/JOINT SJ322	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2658TL

CONNECTOR HOUSING NOT SERVICEABLE

Description: Gearshift mechanism

Location: Beneath center console RH side

Qualifier: LHD condition illustrated

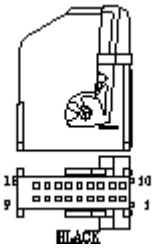


Part No.: YPC902000

Colour: BLACK

Cavities: 18WY

Harness: CABIN HARNESS

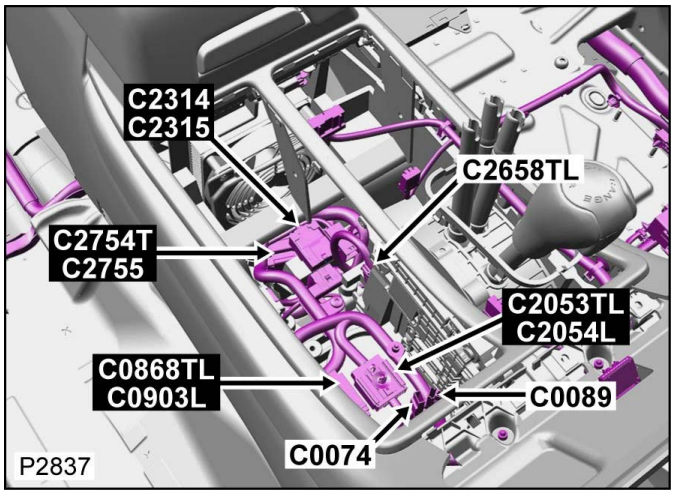


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	986TL	C1967	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.35	G	986TL	C2411L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
3	0.5	RN	986TL	S/JOINT SJ2022	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.35	BG	986TL	C2411L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
5	0.35	Y	986TL	C2411L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
6	0.35	N	986TL	C2411L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
7	0.5	R	986TL	S/JOINT SJ971	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
8	0.5	PU	986TL	C1165	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
9	0.5	R	986TL	C2242L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
10	0.5	Y	986TL	C2242L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
11	0.5	R	986TL	C0868TL	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
12	0.5	RG	986TL	C0868TL	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
13	0.5	RW	986TL	C0868TL	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
14	0.5	RU	986TL	C0868TL	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
15	0.5	RY	986TL	C0868TL	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
16	0.5	RB	986TL	C0868TL	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2658TR

CONNECTOR HOUSING NOT SERVICEABLE

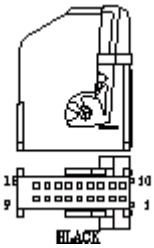

Part No.: YPC902000

Colour: BLACK


Cavities: 18WY

Harness: CABIN HARNESS

Description: Gearshift mechanism

Location: Beneath center console RH side

Qualifier:

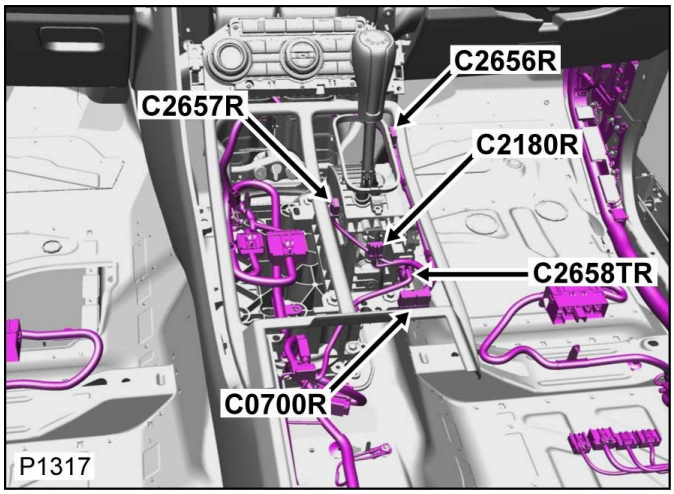

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	986TR	C1967	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.35	G	986TR	C2243R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
3	0.5	RN	986TR	S/JOINT SJ2022	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.35	BG	986TR	C2243R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
5	0.35	Y	986TR	C2243R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
6	0.35	N	986TR	C2243R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
7	0.5	R	986TR	S/JOINT SJ971	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
8	0.5	PU	986TR	C1166R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
9	0.5	R	986TR	C2243R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
10	0.5	Y	986TR	C2243R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
11	0.5	R	986TR	C0868TR	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
12	0.5	RG	986TR	C0868TR	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
13	0.5	RW	986TR	C0868TR	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
14	0.5	RU	986TR	C0868TR	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
15	0.5	RY	986TR	C0868TR	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
16	0.5	RB	986TR	C0868TR	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2667


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to instrument panel harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

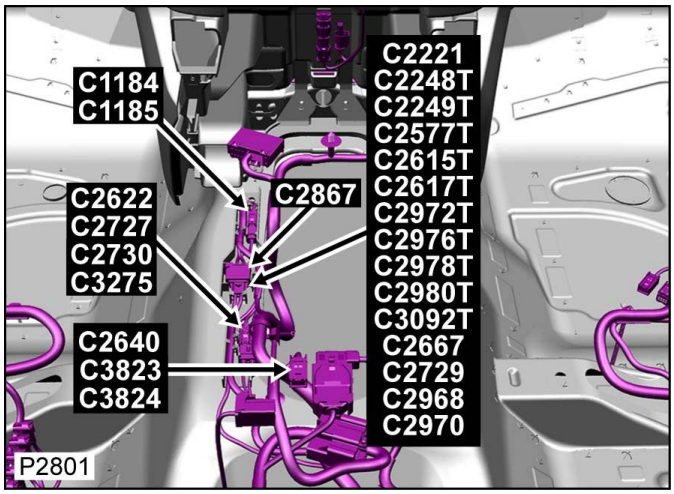

Part No.: XUD812320

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	1018	C3383S
1S	SCR	SCR	1018	C3383S
1	0.5	B	1019	C3561S
1S	SCR	SCR	1019	C3561S
2	0.5	B	1018	C3381S
2S	SCR	SCR	1018	C3381S
2	0.5	B	1019	C3381S
2S	SCR	SCR	1019	C3381S

Click here to print

Connector: C2674L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to engine compartment harness

Location: RH 'A' post

Qualifier: LHD condition illustrated

No connector face
Geen connector-vooraanzicht
Pas de face de connecteur
Kein diagramm
Senza faccia connettore
Sem imagen dos pinos da ficha
No hay cara de conector

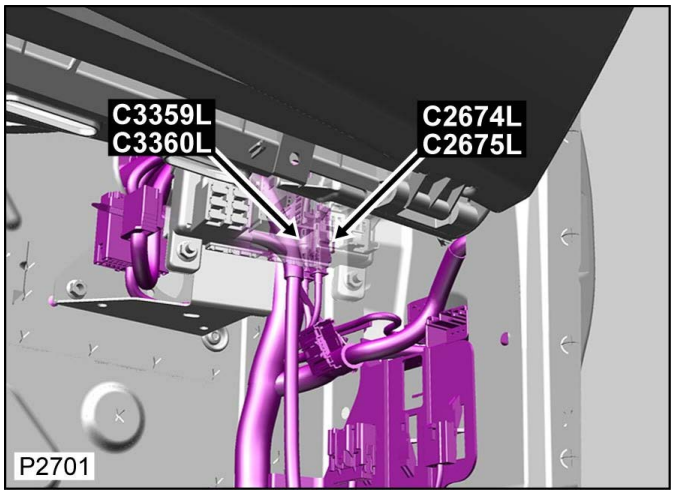

Part No.: XUD815650

Colour: NO COLOUR

Cavities: 4WY

Harness: CABIN HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784L	C3340
2	0.5	O	784L	C3340
3	0.5	G	784L	C3340
4	0.5	N	784L	C3340

Click here to print

Connector: C2674R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to engine compartment harness

Location: Behind passenger side of Instrument panel

Qualifier: RHD condition illustrated

No connector face
Geen connector-vooraanzicht
Pas de face de connecteur
Kein diagramm
Senza faccia connettore
Sem imagen dos pinos da ficha
No hay cara de conector

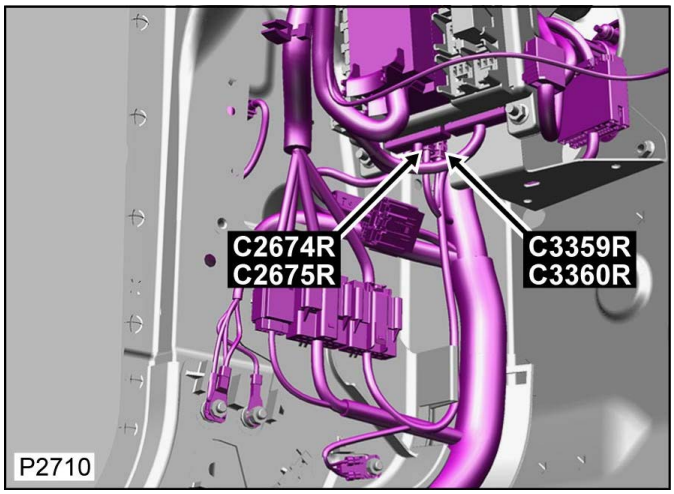

Part No.: XUD815660

Colour: NO COLOUR

Cavities: 4WY

Harness: CABIN HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784R	C3340
2	0.5	O	784R	C3340
3	0.5	G	784R	C3340
4	0.5	N	784R	C3340

Click here to print

Connector: C2675L

CONNECTOR HOUSING NOT SERVICEABLE

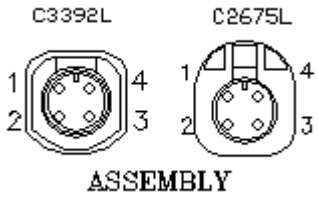

Part No.: XUD814090

Colour: NO COLOUR


Cavities: 4WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to main harness

Location: RH 'A' post

Qualifier: LHD condition illustrated

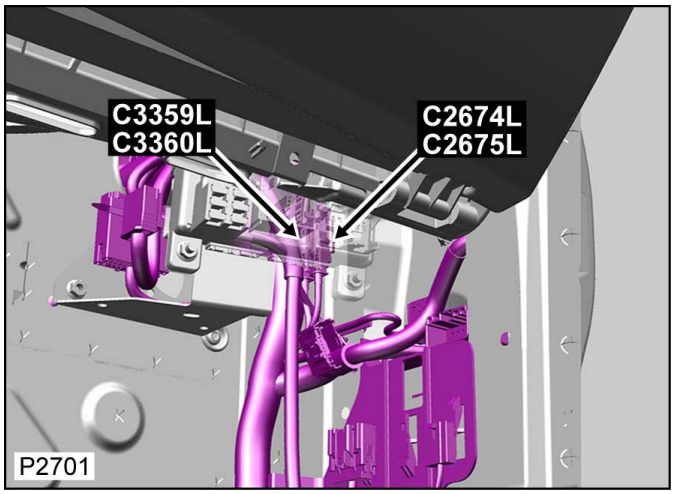


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784L	C3392L
2	0.5	O	784L	C3392L
3	0.5	G	784L	C3392L
4	0.5	N	784L	C3392L

Click here to print

Connector: C2675R

CONNECTOR HOUSING NOT SERVICEABLE

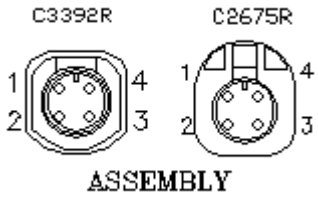

Part No.: XUD814100

Colour: NO COLOUR


Cavities: 4WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to main harness

Location: Behind passenger side of Instrument panel

Qualifier: RHD condition illustrated

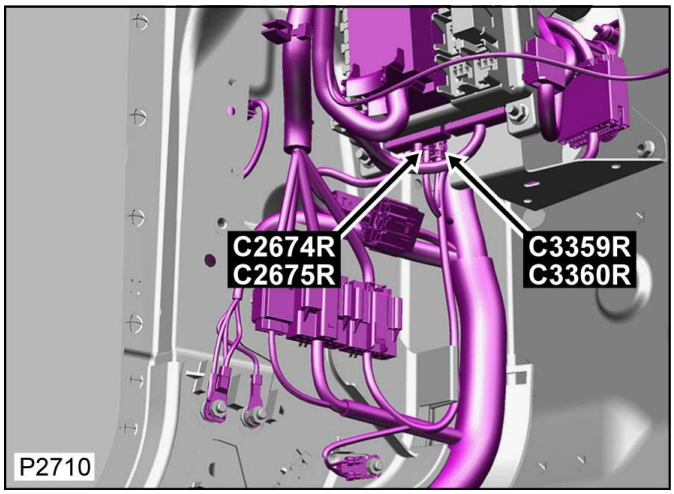


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784R	C3392R
2	0.5	O	784R	C3392R
3	0.5	G	784R	C3392R
4	0.5	N	784R	C3392R

Click here to print

Connector: **C2677**

CONNECTOR HOUSING SERVICEABLE

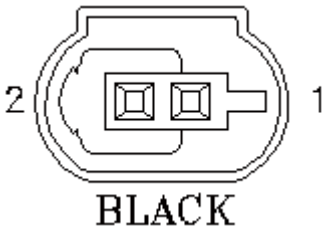

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: DOORS FRONT HARNESS

Description: Lamp-Side repeater-Front

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated

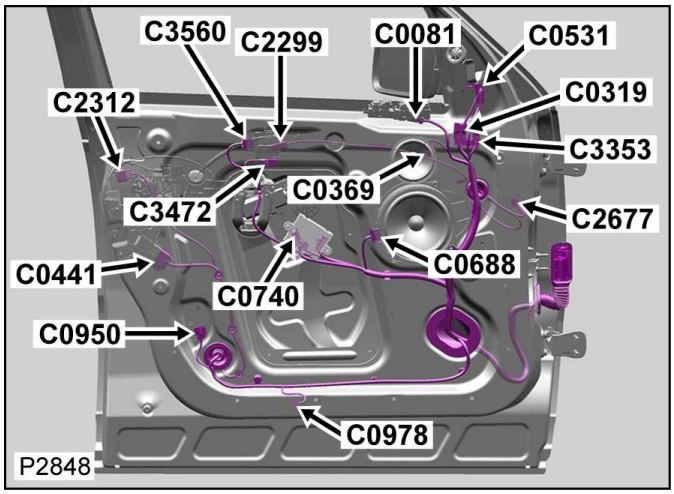

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	B	499	S/JOINT SJ840	-	-	-	-	-	-	-
2	0.5	GW	672	C2058	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	GW	673	C2057	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	GW	674	C3507	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	GW	675	C3508	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2683

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC906860

Colour: BLACK


Cavities: 6WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Pollution sensor

Location: In front of radiator

Qualifier:

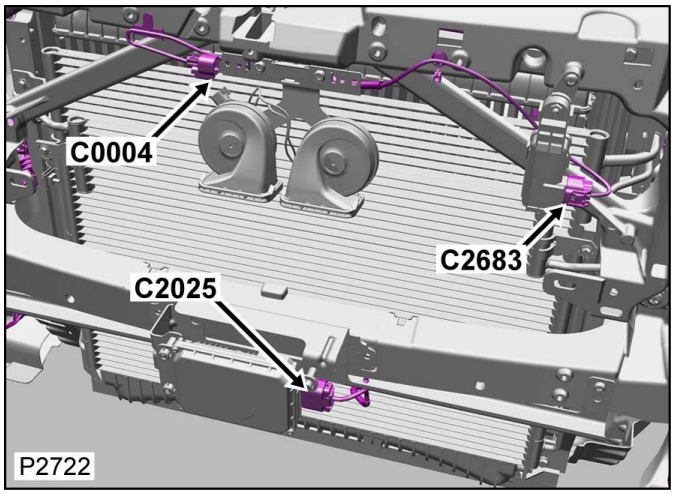


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	200R	C2240R
2	0.5	B	200R	C2240R
3	0.75	B	200R	C2240R
4	0.5	B	200R	C2240R
6	1.5	B	200R	S/JOINT SJ173

Click here to print

Connector: C2692T

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG10014

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of 'D' post LH side

Qualifier:

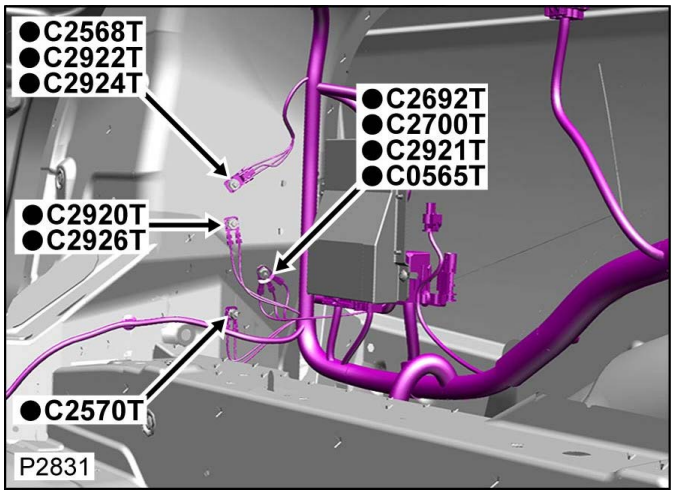


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	W	162T	C1390T

Click here to print

Connector: C2695

CONNECTOR HOUSING NOT SERVICEABLE

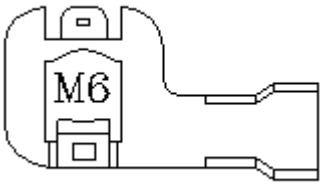

Part No.: YPG900260

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

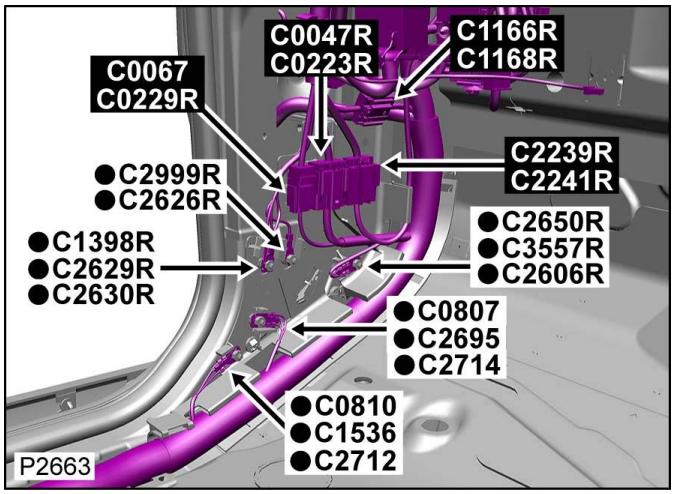


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	109S	C0247S
1	4.0	B	109T	C0247T

Click here to print

Connector: C2696

CONNECTOR HOUSING NOT SERVICEABLE

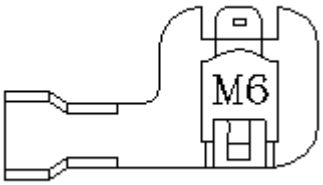

Part No.: YPG900310

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of RH 'A' post

Qualifier: LHD condition illustrated

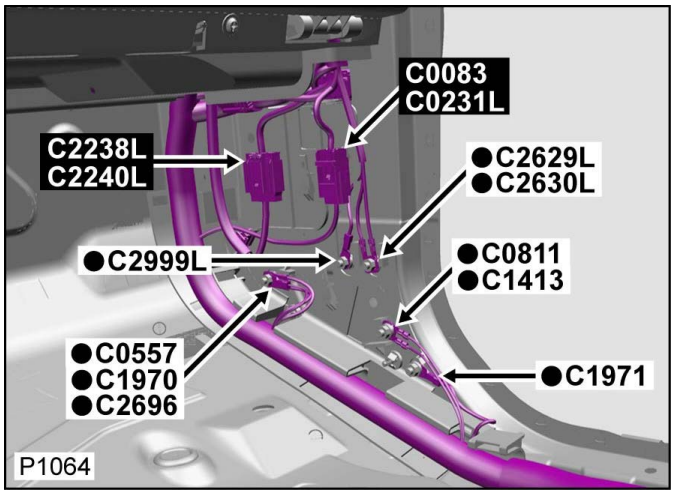


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	B	204	C2368
1	0.5	B	784	C3339

Click here to print

Connector: C2700T

CONNECTOR HOUSING NOT SERVICEABLE

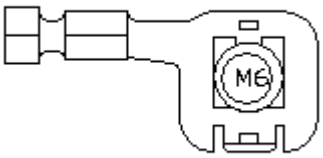

Part No.: YPG10050

Colour: UN-PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of 'D' post LH side

Qualifier:

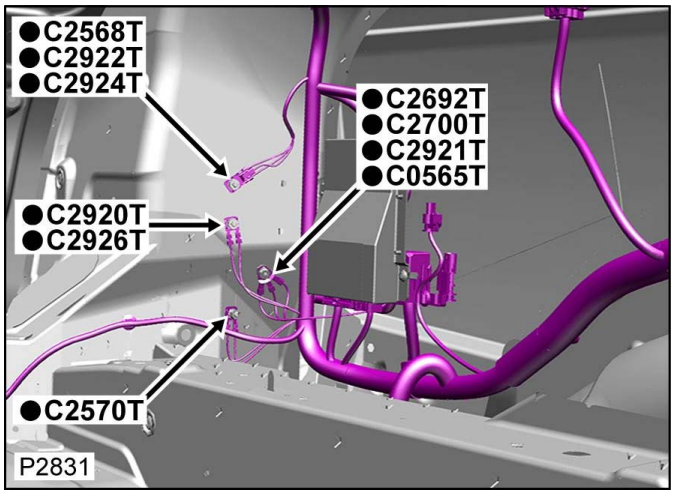


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	W	162T	C1388T

Click here to print

Connector: C2702

CONNECTOR HOUSING NOT SERVICEABLE

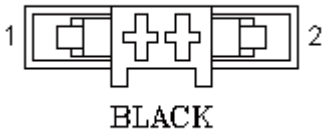

Part No.: YPC113640

Colour: BLACK


Cavities: 2WY

Harness: TAILGATE HARNESS

Description: Sub-woofer

Location: RH side of taildoor, behind trim panel

Qualifier:

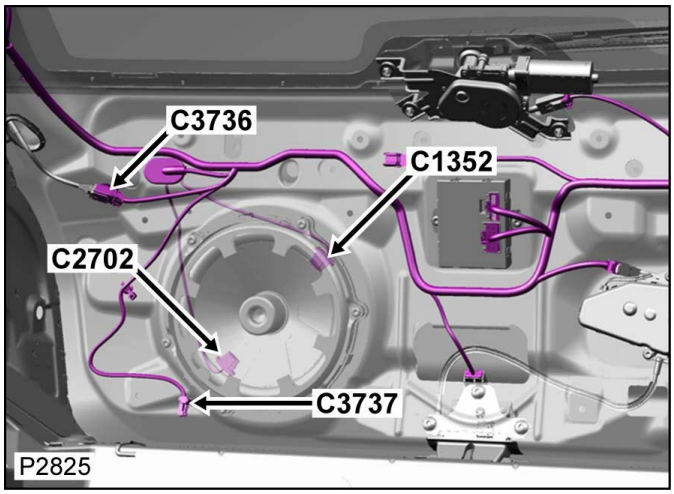


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	G	499	C2740
2	1.5	GW	499	C2740

Click here to print

Connector: C2712

CONNECTOR HOUSING NOT SERVICEABLE

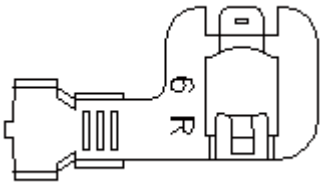

Part No.: YPG800220

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

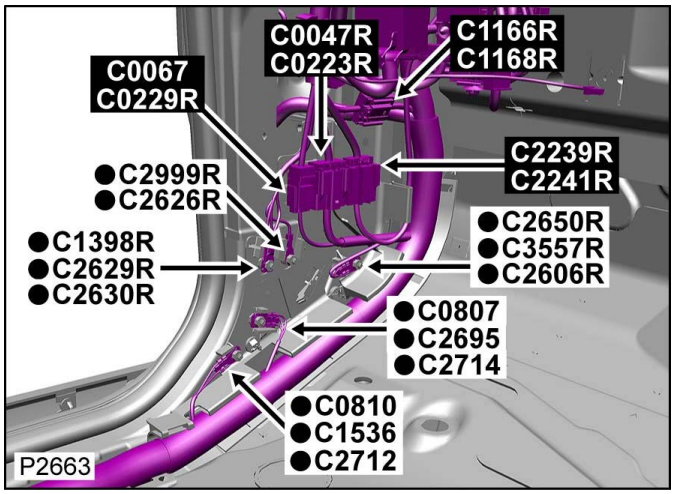


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	499	S/JOINT SJ53

Click here to print

Connector: C2714

CONNECTOR HOUSING NOT SERVICEABLE

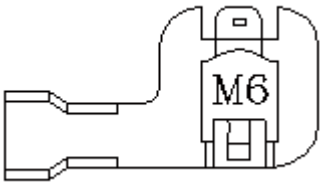

Part No.: YPG900310

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

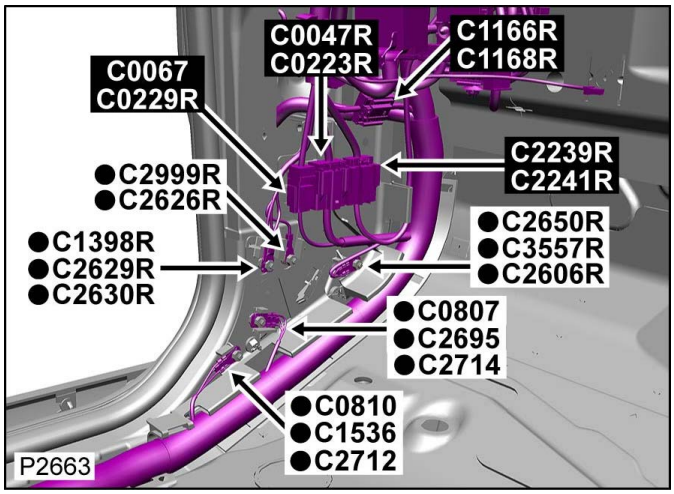


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	499S	C0698S
1	0.5	B	499S	C0961S
1	0.5	B	499T	C0698T
1	0.5	B	499T	C0961T

Click here to print

Connector: C2715T

CONNECTOR HOUSING NOT SERVICEABLE

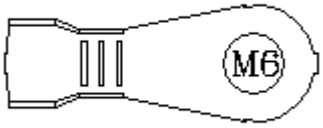

Part No.: YPG801380

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Behind luggage compartment carpet LH side

Qualifier:

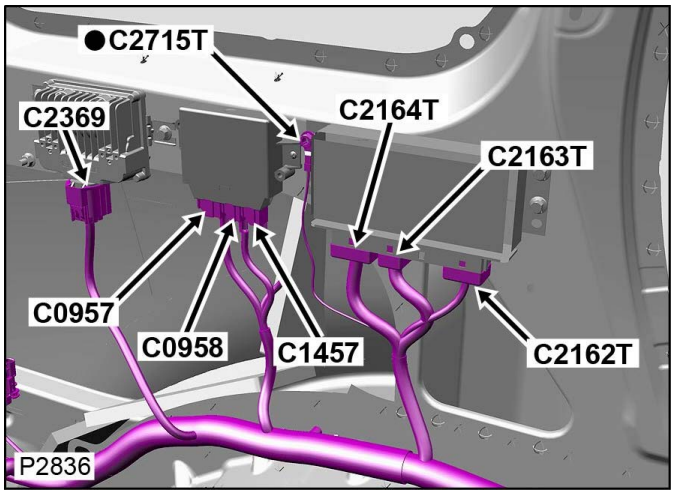


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	401T	C2163T
1	2.5	B	401T	C2163T

Click here to print

Connector: C2722

CONNECTOR HOUSING NOT SERVICEABLE

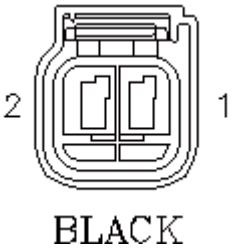

BLACK

Part No.: YPC901710

Colour: BLACK


Cavities: 2WY

Harness: KNOCK SENSORS PETROL HARNESS

Description: Sensor-Knock-Bank 1-Rear

Location: Top of engine - RH side

Qualifier:

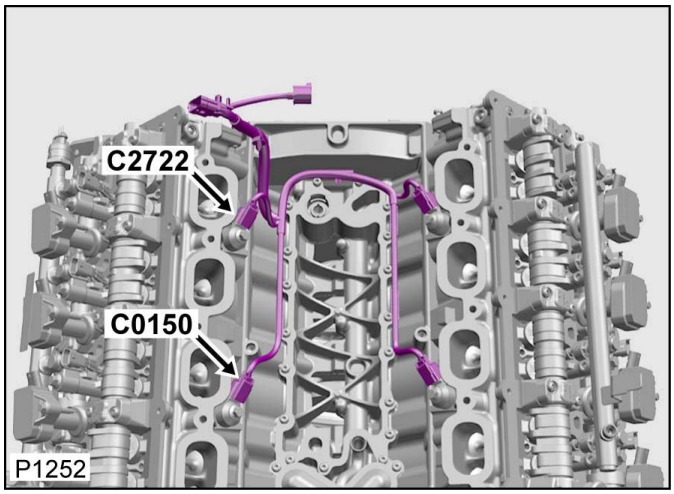


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	P	ALL	C0904	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	W	ALL	C0904	418-411-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2723

CONNECTOR HOUSING NOT SERVICEABLE

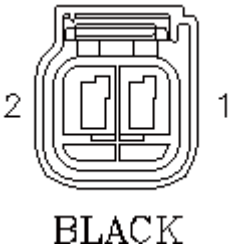

BLACK

Part No.: YPC901710

Colour: BLACK


Cavities: 2WY

Harness: KNOCK SENSORS PETROL HARNESS

Description: Sensor-Knock-Bank 2-Rear

Location: Top of engine - LH side

Qualifier:

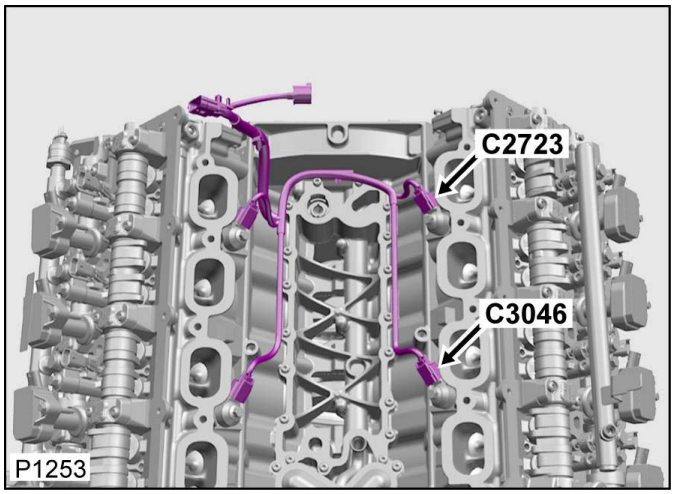

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	U	ALL	C0904	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	G	ALL	C0904	418-411-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C2724


CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine harness to engine compartment harness

Location: Rear RH side of engine compartment

Qualifier:

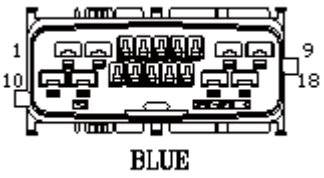

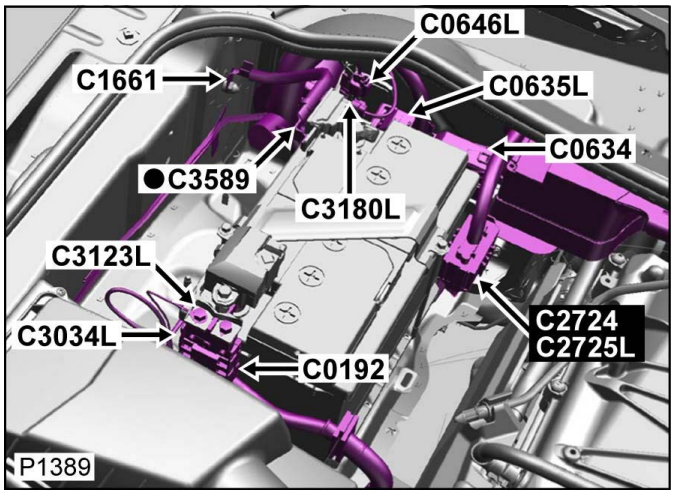

Part No.: YPC909680

Colour: BLUE

Cavities: 18WY

Harness: ENGINE PETROL AJ133 HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	1.0	W	(LRR)	S/JOINT PIS28	-	-	-	-	-	-	-
3	1.0	S	(LRR)	C0128	-	-	-	-	-	-	-
4	1.0	P	(LRR)	C0128	-	-	-	-	-	-	-
5	0.5	SY	(LRR)	C0634	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	S	(LRR)	S/JOINT PIS88	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	G	(LR-T5)	C0132	-	-	-	-	-	-	-
11	2.5	PO	(LRR)	C0179	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
12	0.5	WU	(LRR)	C0634	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	BO	(LRR)	S/JOINT PIS15	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
15	0.5	P	(LR-T5)	C0634	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
16	1.0	G	(LRR)	S/JOINT PIS84	-	-	-	-	-	-	-
17	1.0	S	(LRR)	C0645	-	-	-	-	-	-	-
18	1.0	P	(LRR)	C0644	-	-	-	-	-	-	-

Click here to print


Connector: C2725L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine compartment harness to engine harness

Location: Rear RH side of engine compartment

Qualifier:

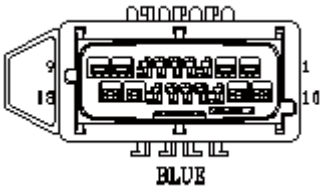

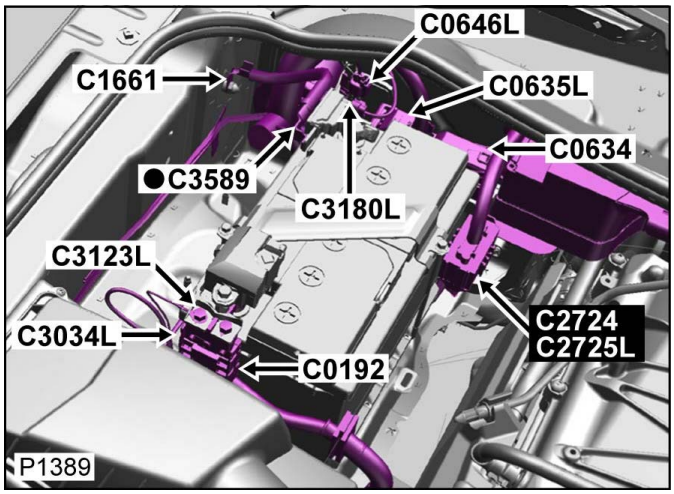

Part No.: YPC909620

Colour: BLUE

Cavities: 14WY

Harness: ENGINE COMPARTMENT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	1.5	B	282L	C0570L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
3	0.5	RG	282L	C2240L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	BG	282L	C2240L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	PB	282L	C3161	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.75	NK	282L	S/JOINT SJ450	-	-	-	-	-	-	-
8	0.5	G	282L	C0635L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
11	2.5	R	282L	C0570L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
12	0.5	WU	282L	C3161	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
14	0.75	NK	282L	S/JOINT SJ941	-	-	-	-	-	-	-
15	0.75	UB	282L	C0646L	-	-	-	-	-	-	-
16	1.0	WG	282L	S/JOINT SJ812	-	-	-	-	-	-	-
17	2.5	WG	282L	S/JOINT SJ931	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
18	2.5	WR	282L	S/JOINT SJ932	418-411-19	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C2725R

CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine compartment harness to engine harness

Location: Rear LH side of engine compartment

Qualifier:

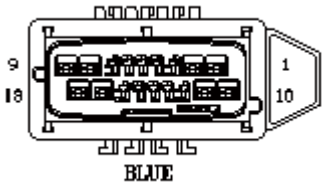


Part No.: YPC909650

Colour: BLUE

Cavities: 14WY

Harness: ENGINE COMPARTMENT HARNESS

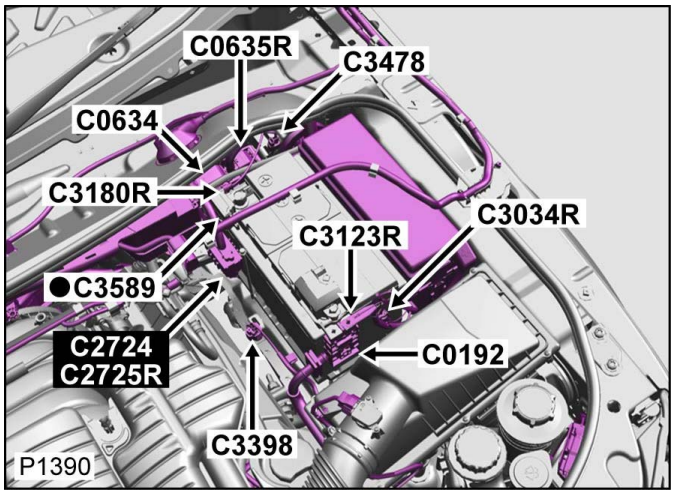

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	1.5	B	282R	C0570R	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
3	0.5	RG	282R	C2240R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	BG	282R	C2240R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	PB	282R	C3161	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.75	NK	282R	S/JOINT SJ1450	-	-	-	-	-	-	-
8	0.5	G	282R	C0635R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
11	2.5	R	282R	C0570R	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
12	0.5	WU	282R	C3161	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
14	0.75	NK	282R	C0570R	-	-	-	-	-	-	-
15	0.75	UB	282R	C3478	-	-	-	-	-	-	-
16	1.0	WG	282R	S/JOINT SJ1812	-	-	-	-	-	-	-
17	2.5	WG	282R	S/JOINT SJ1931	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
18	2.5	WR	282R	S/JOINT SJ1932	418-411-19	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C2727


CONNECTOR HOUSING NOT SERVICEABLE

Description: Instrument panel harness to ICE harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

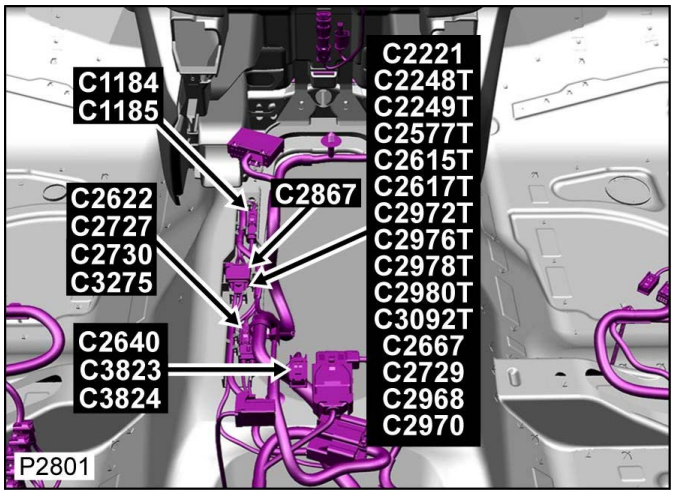

Part No.: XUD812160

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE LINK HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	989	C3461
1S	0.5	SCR	989	C3461
1	0.5	B	990	C3461
1S	0.5	SCR	990	C3461
2	0.5	B	989	C2821
2S	0.5	SCR	989	C2821

Click here to print

Connector: C2729


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to instrument panel harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

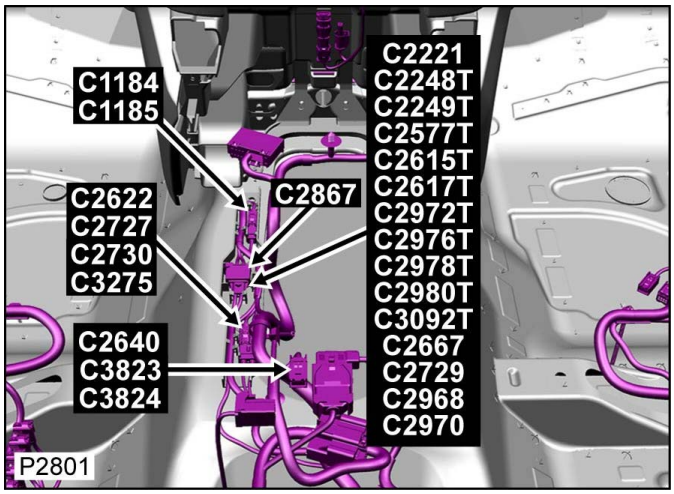

Part No.: XUD812310

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
2	0.5	B	1030S	C2770S
2S	SCR	SCR	1030S	C2770S
2	0.5	B	1030T	C2770T
2S	SCR	SCR	1030T	C2770T

Click here to print

Connector: C2730


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to instrument panel harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

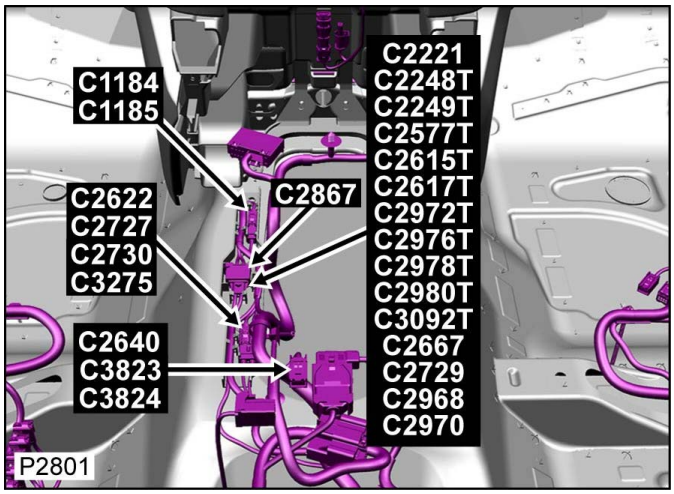

Part No.: XUD812230

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	148S	C1598S
1S	SCR	SCR	148S	C1598S
1	0.5	B	148T	C1598T
1S	SCR	SCR	148T	C1598T

Click here to print


Connector: C2731T

CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Video interface-Japan

Location: Behind luggage compartment carpet RH side

Qualifier:

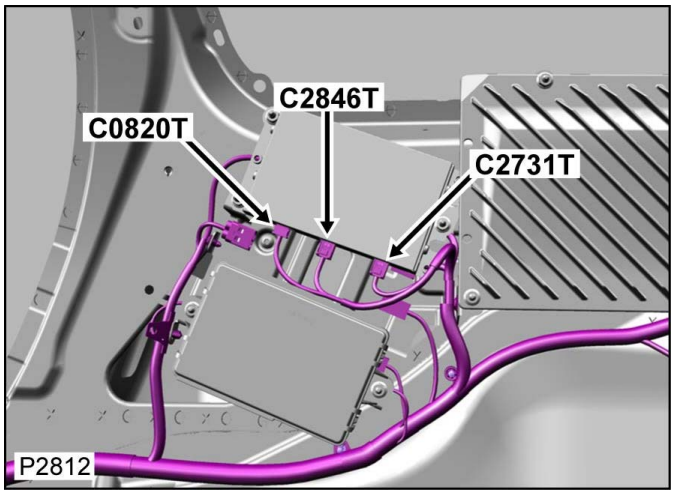

ASSEMBLY

Part No.: XUD815410

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	568T	C3740
2	0.5	Y	568T	C3740
3	SCR	SCR	568T	C3740

Click here to print


Connector: **C2739T**


CONNECTOR HOUSING SERVICEABLE

Description: Main harness to tailgate harness

Location: Rear of headlining

Qualifier:

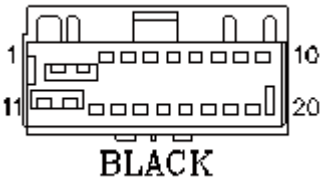

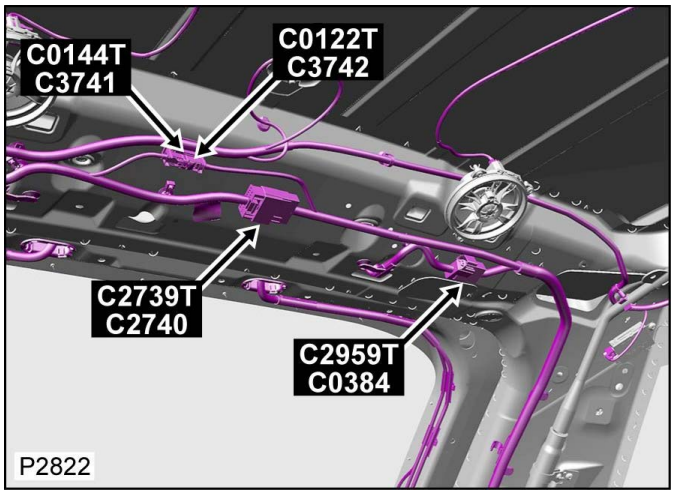

Part No.: YPC901760

Colour: BLACK

Cavities: 20WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	B	499T	S/JOINT SJ832T	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
2	1.5	S	499T	C0492T	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
3	0.75	B	499T	S/JOINT SJ832T	418-587-04	-	418-116A	418-117	-	418-112	418-107
5	0.75	KR	139TL	C0586L	418-587-04	-	418-116A	418-117	-	418-112	418-107
5	0.75	KR	200TR	C0586R	418-587-04	-	418-116A	418-117	-	418-112	418-107
6	0.5	PO	499T	S/JOINT SJ38	418-587-04	-	418-116A	418-117	-	418-112	418-107
7	0.5	YW	499T	S/JOINT SJ2006	418-587-04	-	418-116A	418-117	-	418-112	418-107
8	0.5	B	510T	S/JOINT SJ832T	418-587-04	-	418-116A	418-117	-	418-112	418-107
9	0.5	G	510T	S/JOINT SJ224	418-587-04	-	418-116A	418-117	-	418-112	418-107
10	0.5	YW	478TL	S/JOINT SJ2008	418-587-04	-	418-116A	418-117	-	418-112	418-107
10	0.5	YW	200TR	S/JOINT SJ2010	418-587-04	-	418-116A	418-117	-	418-112	418-107
11	1.0	GLG	499T	C2937T	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
12	1.5	NP	499T	C0492T	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	NG	139TL	C0586L	418-587-04	-	418-116A	418-117	-	418-112	418-107
14	0.5	NG	200TR	C0586R	418-587-04	-	418-116A	418-117	-	418-112	418-107
16	0.75	WO	499T	C3008	418-587-04	-	418-116A	418-117	-	418-112	418-107
17	0.5	YU	499T	S/JOINT SJ2007	418-587-04	-	418-116A	418-117	-	418-112	418-107
18	0.75	GP	139TL	C0586L	418-587-04	-	418-116A	418-117	-	418-112	418-107

18	0.75	GP	200TR	C0586R	418-587-04	-	418-116A	418-117	-	418-112	418-107
19	0.5	BS	200TR	C1165	418-587-04	-	418-116A	418-117	-	418-112	418-107
19	0.5	BS	139TL	C1166L	418-587-04	-	418-116A	418-117	-	418-112	418-107
20	0.5	YU	478TL	S/JOINT SJ2009	418-587-04	-	418-116A	418-117	-	418-112	418-107
20	0.5	YU	200TR	S/JOINT SJ2011	418-587-04	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2740


CONNECTOR HOUSING NOT SERVICEABLE

Description: Tailgate harness to main harness

Location: Rear of headlining

Qualifier:

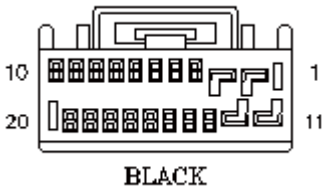

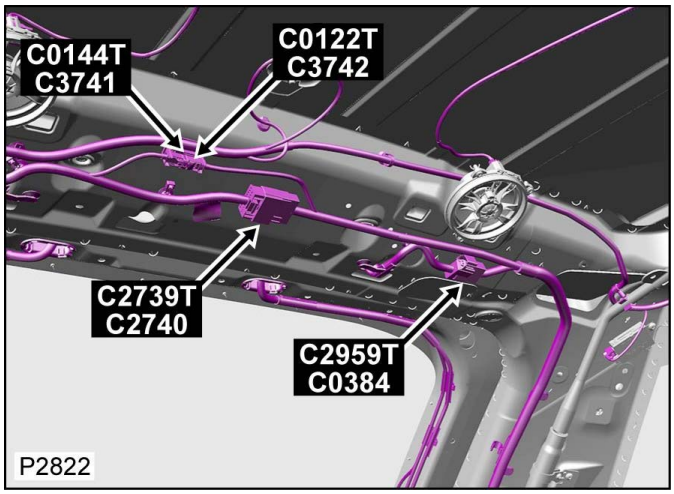

Part No.: YPC900780

Colour: BLACK

Cavities: 20WY

Harness: TAILGATE HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	B	499	C0388	-	-	-	-	-	-	-
2	1.5	GW	499	C2702	-	-	-	-	-	-	-
3	0.5	BP	499	C0832A	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	B	499	C0617	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	B	799	C3737	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	B	499	S/JOINT SJ1	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	B	510T	C3743	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	G	510T	C3743	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	B	499	S/JOINT SJ1	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
11	1.5	GLG	499	C0388	-	-	-	-	-	-	-
12	1.5	G	499	C2702	-	-	-	-	-	-	-
14	0.5	NG	499	C0388	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
16	0.75	B	499	C0617	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
17	0.5	B	499	S/JOINT SJ2	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
18	0.5	BK	499	C0832A	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
19	0.75	B	499	C0615	418-411-59	-	418-116A	418-117	418-104	418-112	418-107
20	0.5	B	499	S/JOINT SJ2	418-411-59	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2741

CONNECTOR HOUSING NOT SERVICEABLE

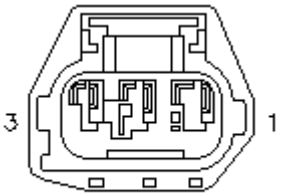

DARK GREY

Part No.: YPC903360

Colour: DARK GREY


Cavities: 3WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Differential pressure

Location: LH side of transfer box

Qualifier:

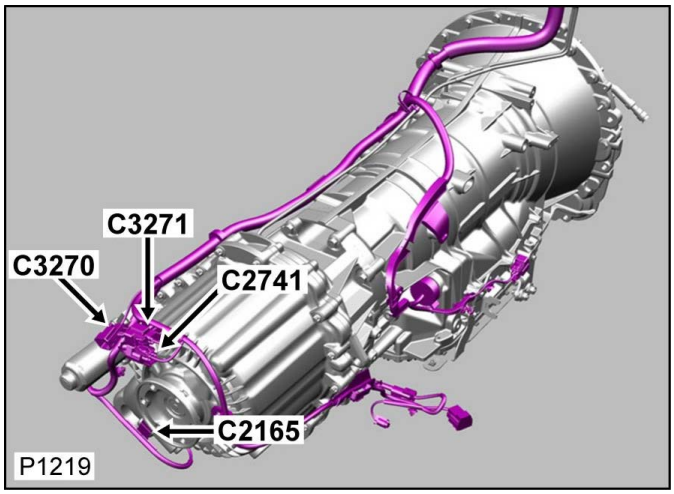


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	NR	819L	C2759H	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	NR	819R	C2759J	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	NR	991L	C3427M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	NR	991R	C3427N	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	YR	819L	C2759H	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	YR	819R	C2759J	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	YR	991L	C3427M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	YR	991R	C3427N	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	WU	819L	C2759H	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	WU	819R	C2759J	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	WU	991L	C3427M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	WU	991R	C3427N	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2741A

CONNECTOR HOUSING NOT SERVICEABLE

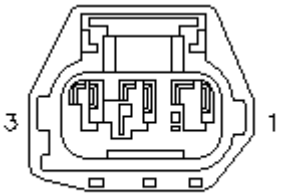

DARK GREY

Part No.: YPC903360

Colour: DARK GREY


Cavities: 3WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Differential pressure

Location: Top of transfer box

Qualifier:

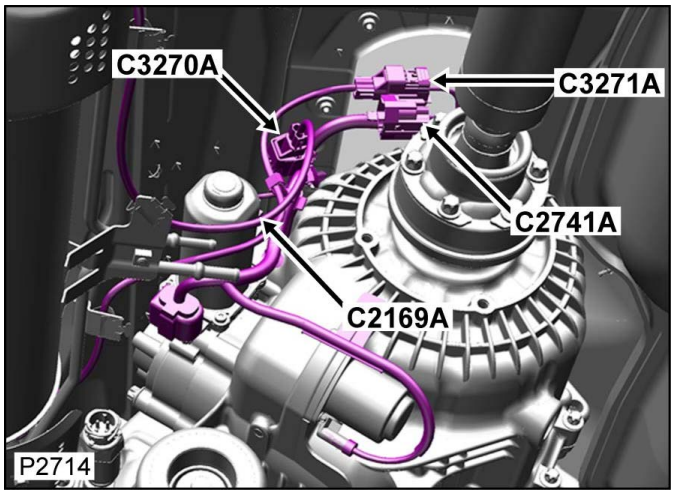

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	NR	983L	C3427P	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	NR	983R	C3427Q	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	YR	983L	C3427P	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	YR	983R	C3427Q	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	WU	983L	C3427P	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	WU	983R	C3427Q	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2754T

CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to console harness

Location: Beneath center console RH side

Qualifier: LHD condition illustrated




Part No.: YPC910190

Colour: LIGHT GREY

Cavities: 14WY

Harness: CABIN HARNESS

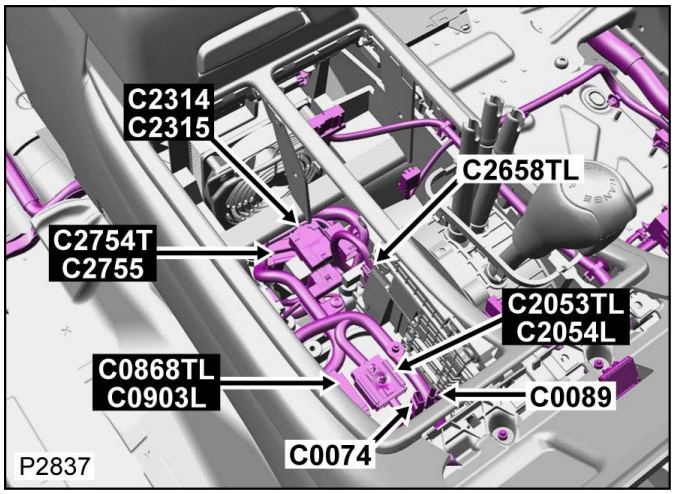

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	UK	572T	C2043	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	G	572T	C2043	-	-	-	-	-	-	-
3	0.35	U	572T	C2043	-	-	-	-	-	-	-
4	0.35	UK	572T	C2042	-	-	-	-	-	-	-
5	0.35	G	572T	C2042	-	-	-	-	-	-	-
6	0.35	U	572T	C2042	-	-	-	-	-	-	-
7	1.5	B	13T	C2566	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
8	1.5	PG	13T	S/JOINT SJ222	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
10	0.5	U	499T	C1165	-	-	-	-	-	-	-
11	0.5	R	499T	C1165	-	-	-	-	-	-	-
12	0.5	RN	572T	S/JOINT SJ2022	-	-	-	-	-	-	-
13	0.75	LGW	139TL	C2411L	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
13	0.75	LGW	200TR	C2242R	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
14	1.5	B	499T	C2566	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C2755

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC910210

Colour: LIGHT GREY


Cavities: 14WY

Harness: CONSOLE REAR HARNESS

Description: Link harness to seat harness

Location: Beneath center console RH side

Qualifier: LHD condition illustrated

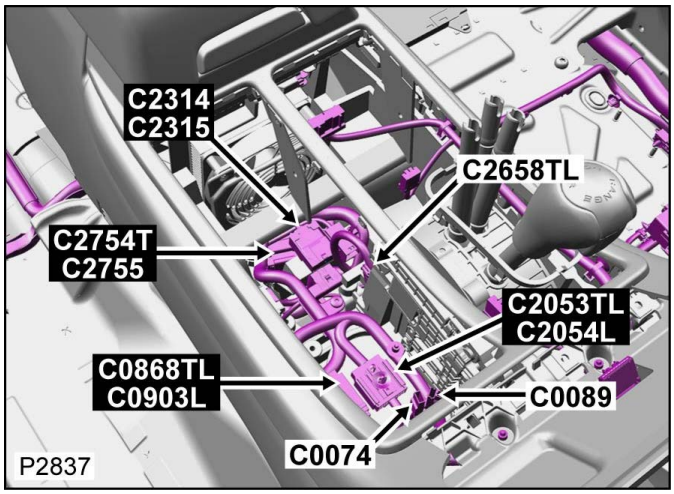

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	UK	572	C1403	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	G	572	C1403	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	U	572	C1403	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	UK	572	C1401	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	G	572	C1401	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	U	572	C1401	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
7	1.5	B	13	C1692	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
8	1.5	PG	13	C1692	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
10	0.5	U	499	C2831	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	R	499	C2831	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	RN	572	S/JOINT SJ300	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
13	0.75	LGW	424	C2773	-	-	-	-	-	-	-
14	1.5	B	499	S/JOINT SJ301	418-411-16	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C2758M


CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine harness to transmission harness

Location: Rear LH side of engine compartment

Qualifier: RHD condition illustrated

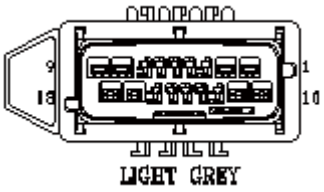

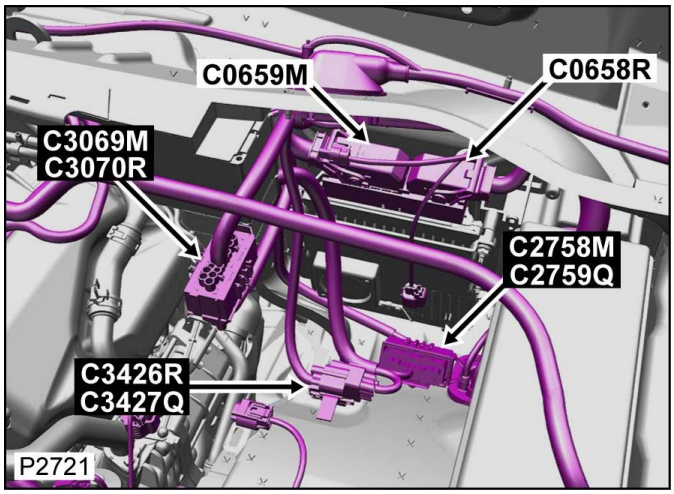

Part No.: YPC909610

Colour: LIGHT GREY

Cavities: 18WY

Harness: ENGINE DIESEL 3.0L HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	UN	798	C0659M	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	WO	798	C0659M	-	-	-	-	-	-	-
3	0.5	SO	798	C0659M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	YO	798	C0659M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	OS	798	C0659M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	SP	798	C0659M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	WN	798	C0659M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	G	798	C0659M	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	SP	798	C0659M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
13	0.5	N	798	C0659M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
14	0.75	OU	798	S/JOINT SJ14	-	-	-	-	-	-	-
15	0.5	YS	798	C0659M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
16	0.5	OG	798	C0659M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
17	0.5	PO	798	C0659M	418-411-73	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2759M


CONNECTOR HOUSING NOT SERVICEABLE

Description: Transmission harness to engine harness

Location: Rear RH side of engine compartment

Qualifier: LHD condition illustrated



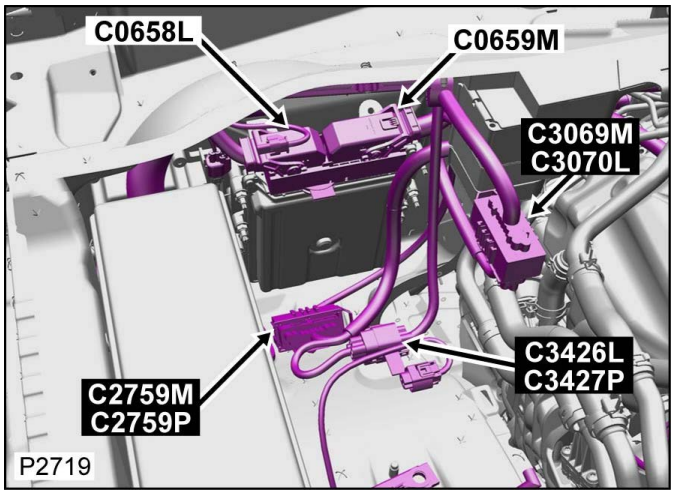

Part No.: YPC909670

Colour: LIGHT GREY

Cavities: 18WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	UN	993L	C1559	-	-	-	-	-	-	-
2	0.75	WO	993L	C1559	-	-	-	-	-	-	-
3	0.5	SO	993L	C1559	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	YO	991L	C3270	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	PN	991L	S/JOINT SJ806A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	SP	993L	C3418	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	WN	993L	C3418	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	SP	993L	C1559	-	-	-	-	-	-	-
12	0.5	G	993L	C1559	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
13	0.5	N	993L	C0103M	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
14	0.75	PN	993L	C0103M	-	-	-	-	-	-	-
15	0.5	YS	991L	C3073M	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
16	0.5	PR	991L	C3073M	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
17	0.5	PO	991L	C3271	-	-	-	-	-	-	-

Click here to print

Connector: C2759N


CONNECTOR HOUSING NOT SERVICEABLE

Description: Transmission harness to engine harness

Location: Rear LH side of engine compartment

Qualifier:



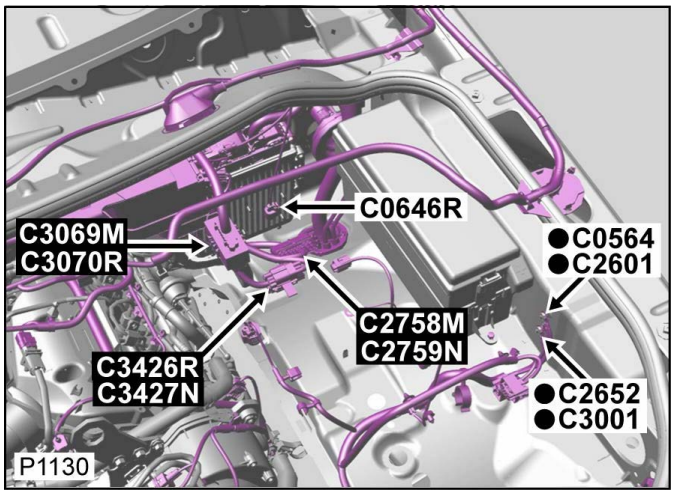

Part No.: YPC909670

Colour: LIGHT GREY

Cavities: 18WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	UN	993R	C1559	-	-	-	-	-	-	-
2	0.75	WO	993R	C1559	-	-	-	-	-	-	-
3	0.5	SO	993R	C1559	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	YO	991R	C3270	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	PN	991R	S/JOINT SJ806A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	SP	993R	C3418	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	WN	993R	C3418	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	SK	993R	C1559	-	-	-	-	-	-	-
12	0.5	G	993R	C1559	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
13	0.5	N	993R	C0103M	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
14	0.75	PB	993R	C0103M	-	-	-	-	-	-	-
15	0.5	YS	991R	C3073M	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
16	0.5	PR	991R	C3073M	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
17	0.5	PO	991R	C3271	-	-	-	-	-	-	-

Click here to print

Connector: C2759P

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC909670

Colour: LIGHT GREY


Cavities: 18WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Transmission harness to engine harness

Location: Rear RH side of engine compartment

Qualifier: LHD condition illustrated

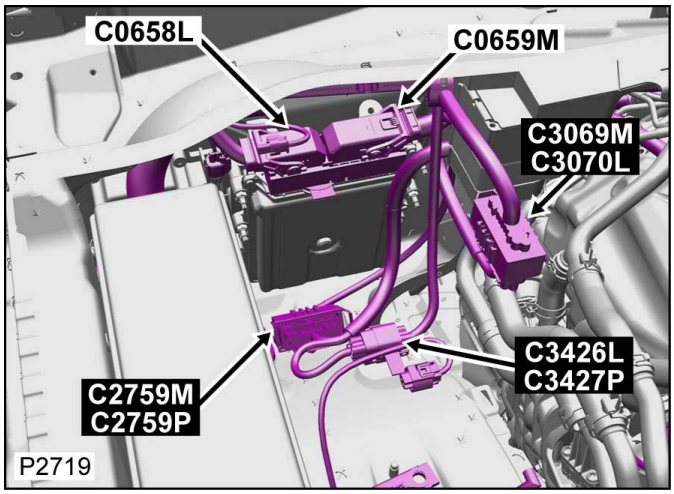

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	UN	982L	C1559A	-	-	-	-	-	-	-
2	0.75	WO	982L	C1559A	-	-	-	-	-	-	-
3	0.5	SO	982L	C1559A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	YO	983L	C3270A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	PN	983L	S/JOINT SJ806B	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	SP	982L	C3418A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	WN	982L	C3418A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	SP	982L	C1559A	-	-	-	-	-	-	-
12	0.5	G	982L	C1559A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
13	0.5	N	982L	C0103A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
14	0.75	PN	982L	C0103A	-	-	-	-	-	-	-
15	0.5	YS	983L	C3073A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
16	0.5	PN	983L	C3073A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
17	0.5	PO	983L	C3271A	-	-	-	-	-	-	-

Click here to print

Connector: C2759Q


CONNECTOR HOUSING NOT SERVICEABLE

Description: Transmission harness to engine harness

Location: Rear LH side of engine compartment

Qualifier: RHD condition illustrated



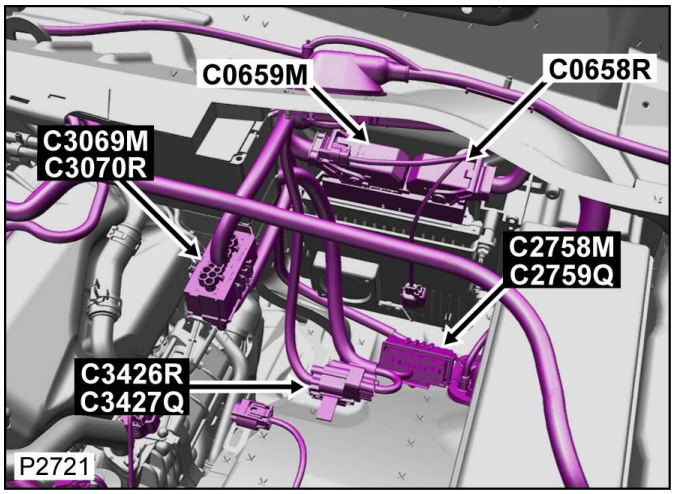

Part No.: YPC909670

Colour: LIGHT GREY

Cavities: 18WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	UN	982R	C1559A	-	-	-	-	-	-	-
2	0.75	WO	982R	C1559A	-	-	-	-	-	-	-
3	0.5	SO	982R	C1559A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	YO	983R	C3270A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	PN	983R	S/JOINT SJ806B	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	SP	982R	C3418A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	WN	982R	C3418A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	SP	982R	C1559A	-	-	-	-	-	-	-
12	0.5	G	982R	C1559A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
13	0.5	N	982R	C0103A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
14	0.75	PN	982R	C0103A	-	-	-	-	-	-	-
15	0.5	YS	983R	C3073A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
16	0.5	PN	983R	C3073A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
17	0.5	PO	983R	C3271A	-	-	-	-	-	-	-

Click here to print

Connector: **C2761**

CONNECTOR HOUSING NOT SERVICEABLE



BLACK

Part No.: YPC900510

Colour: BLACK


Cavities: 4WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Sensor-Mass air-flow (MAF)

Location: Front RH side of engine compartment

Qualifier:

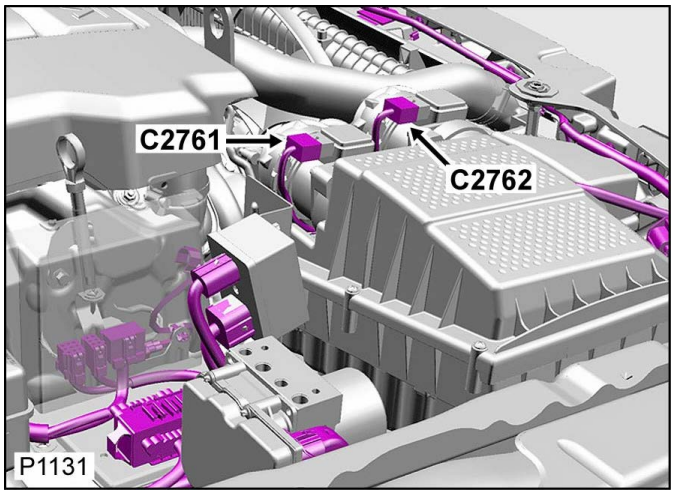

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	NB	798L	C0658L	418-411-58	-	418-116A	418-117	418-104	418-112	418-107
1	0.75	NB	798R	C0658R	418-411-58	-	418-116A	418-117	418-104	418-112	418-107
3	0.75	NR	798	S/JOINT SJ510	418-411-58	-	418-116A	418-117	418-104	418-112	418-107
4	0.75	RU	798	S/JOINT SJ511	418-411-58	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2762

CONNECTOR HOUSING NOT SERVICEABLE



BLACK

Part No.: YPC900510

Colour: BLACK


Cavities: 4WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Sensor-Mass air-flow (MAF)

Location: Front RH side of engine compartment

Qualifier:

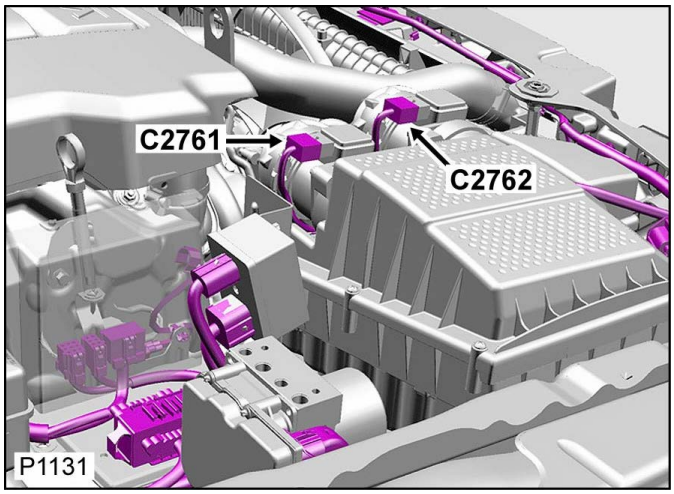

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	SR	798L	C0658L	418-411-58	-	418-116A	418-117	418-104	418-112	418-107
1	0.75	SR	798R	C0658R	418-411-58	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	RN	798L	C0658L	418-411-58	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	RN	798R	C0658R	418-411-58	-	418-116A	418-117	418-104	418-112	418-107
3	0.75	NR	798	S/JOINT SJ510	418-411-58	-	418-116A	418-117	418-104	418-112	418-107
4	0.75	UN	798L	S/JOINT SJ868	418-411-58	-	418-116A	418-117	418-104	418-112	418-107
4	0.75	UN	798R	S/JOINT SJ1868	418-411-58	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2770T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Rear seat entertainment module

Location: Behind luggage compartment carpet RH side

Qualifier:

ASSEMBLY

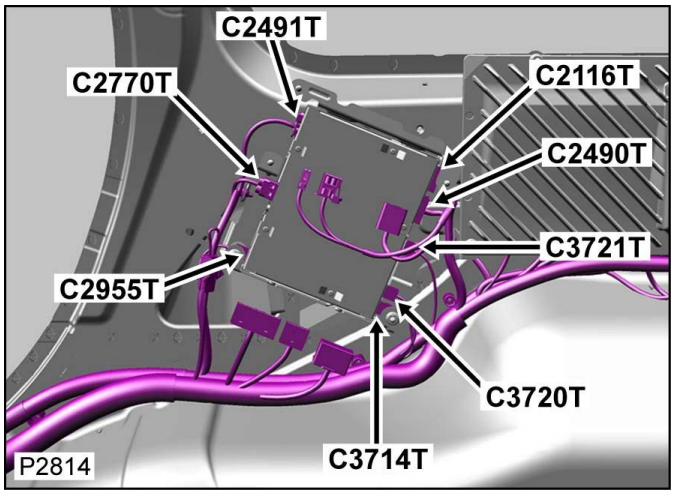

Part No.: XUD812420

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	1055T	C2970
1S	SCR	SCR	1055T	C2970
1	0.5	B	1056T	C2970
1S	SCR	SCR	1056T	C2970
1	0.5	B	1030T	C2729
1S	SCR	SCR	1030T	C2729
1	0.5	B	1029T	C2970
1S	SCR	SCR	1029T	C2970
2	0.5	B	1055T	C2868
2S	SCR	SCR	1055T	C2868
2	0.5	B	1056T	C2868
2S	SCR	SCR	1056T	C2868
2	0.5	B	1030T	C2618
2S	SCR	SCR	1030T	C2618
2	0.5	B	1029T	C2868
2S	SCR	SCR	1029T	C2868

Click here to print


Connector: C2771

CONNECTOR HOUSING NOT SERVICEABLE

Description: Screen-Rear seat-entertainment

Location: Behind front seat backrest

Qualifier:

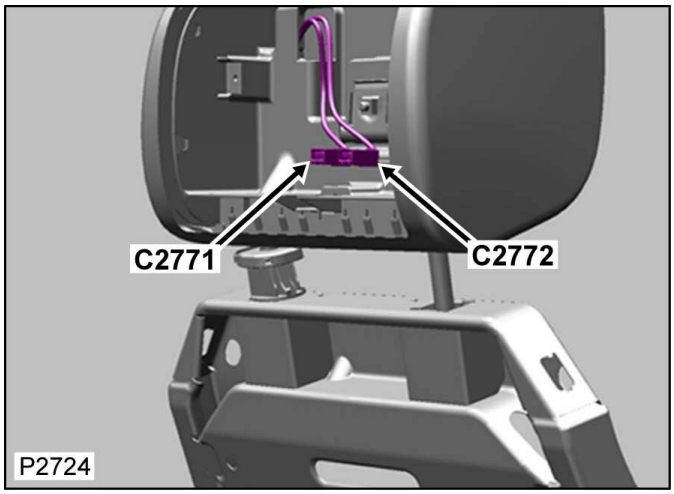

ASSEMBLY

Part No.: CASSY

Colour: NO COLOUR

Cavities: 1WY

Harness: SEAT ASSEMBLIES HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
SCR	0.08	SCR	425	C3776
1	0.08	N	425	C3776
2	0.08	P	425	C3776

Click here to print


Connector: C2772

CONNECTOR HOUSING NOT SERVICEABLE

Description: Screen-Rear seat-entertainment

Location: Behind front seat backrest

Qualifier:

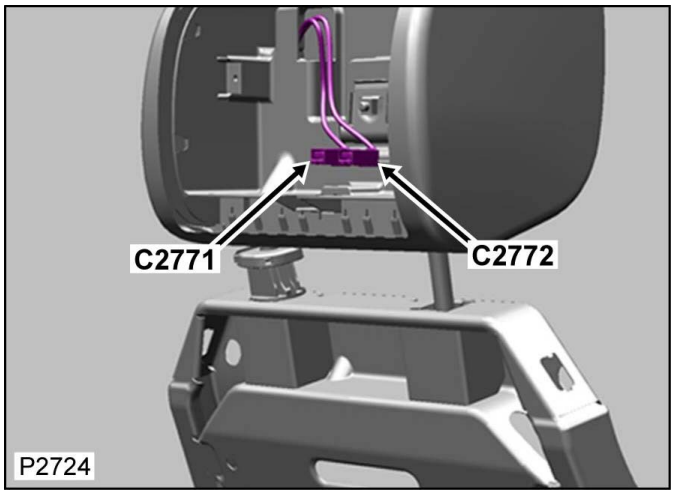

ASSEMBLY

Part No.: CASSY

Colour: NO COLOUR

Cavities: 1WY

Harness: SEAT ASSEMBLIES HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
7	0.35	WN	425	C3780
8	0.35	YS	425	C3780
10	0.35	NU	425	C3778
11	0.35	NU	425	C3778
12	0.35	WG	425	C3780

Click here to print

Connector: **C2773**

CONNECTOR HOUSING SERVICEABLE



Part No.: YPC801290

Colour: LIGHT GREY


Cavities: 2WY

Harness: CONSOLE REAR HARNESS

Description: Cool box

Location: Beneath Cubby box

Qualifier: LHD illustrated RHD similar

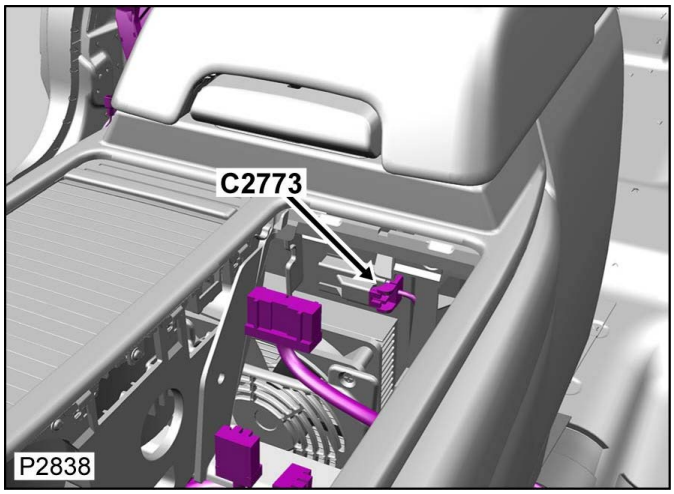

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	LGW	424	C2755	418-587-10	-	418-116A	418-117	-	418-112	418-107
2	0.75	B	424	S/JOINT SJ301	418-587-10	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2789T

CONNECTOR HOUSING NOT SERVICEABLE

Description: SDARS antenna

Location: Rear of headlining

Qualifier:

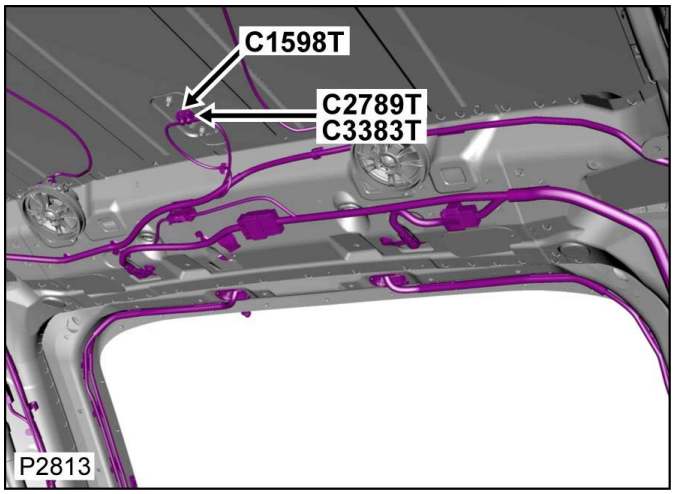

ASSEMBLY

Part No.: XUD812380

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	512T	C2223T
1S	SCR	SCR	512T	C2223T

Click here to print

Connector: C2819L

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC909560

Colour: GREY


Cavities: 16WY

Harness: FACIA COMPOSITE HARNESS

Description: Touch screen display

Location: Behind front touch screen display

Qualifier:

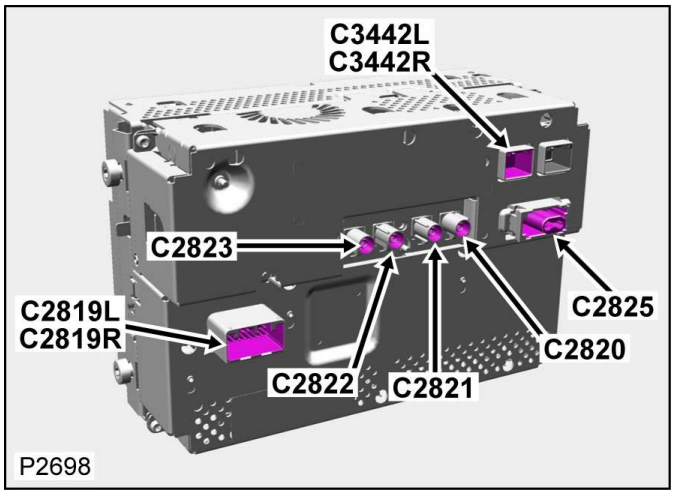

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	YU	124L	S/JOINT SJ976
2	0.5	YW	124L	S/JOINT SJ966
5	0.75	B	922L	S/JOINT SJ590L
8	0.5	R	922L	S/JOINT SJ131
12	0.5	UG	124L	C1168L
13	0.35	B	124L	C0082L
14	0.35	SR	922L	C0082L
16	0.5	PU	922L	S/JOINT SJ131

Click here to print

Connector: C2819R

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC909560

Colour: GREY


Cavities: 16WY

Harness: FACIA COMPOSITE HARNESS

Description: Touch screen display

Location: Behind front touch screen display

Qualifier:

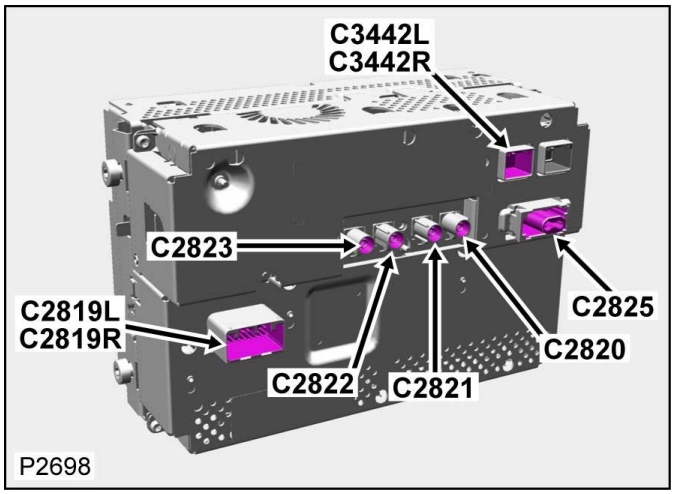

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	YU	124R	S/JOINT SJ976
2	0.5	YW	124R	S/JOINT SJ966
5	0.75	B	922R	S/JOINT SJ590R
8	0.5	R	922R	S/JOINT SJ131
12	0.5	UG	124R	C1168R
13	0.35	B	124R	C0082R
14	0.35	SR	922R	C0082R
15	0.5	UO	568	C2640R
16	0.5	PU	922R	S/JOINT SJ131

Click here to print

Connector: C2820

CONNECTOR HOUSING NOT SERVICEABLE

Description: Touch screen display

Location: Behind front touch screen display

Qualifier:


ASSEMBLY

Part No.: XUD815120

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE LINK HARNESS

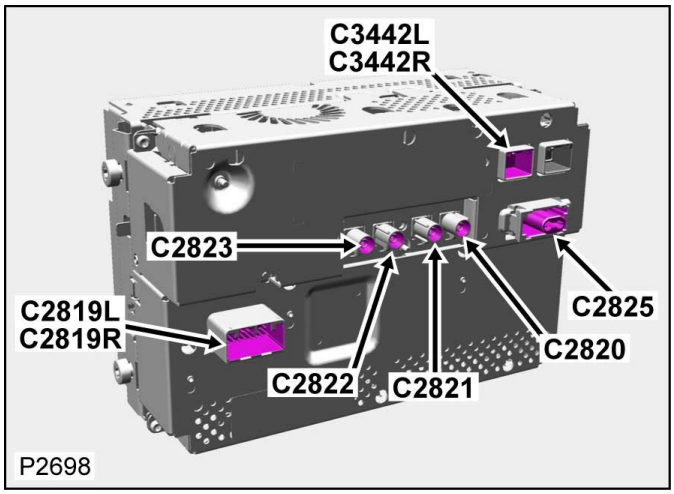

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	784	C1184
1S	0.5	SCR	784	C1184

Click here to print

Connector: C2821


CONNECTOR HOUSING NOT SERVICEABLE

Description: Touch screen display

Location: Behind front touch screen display

Qualifier:

ASSEMBLY

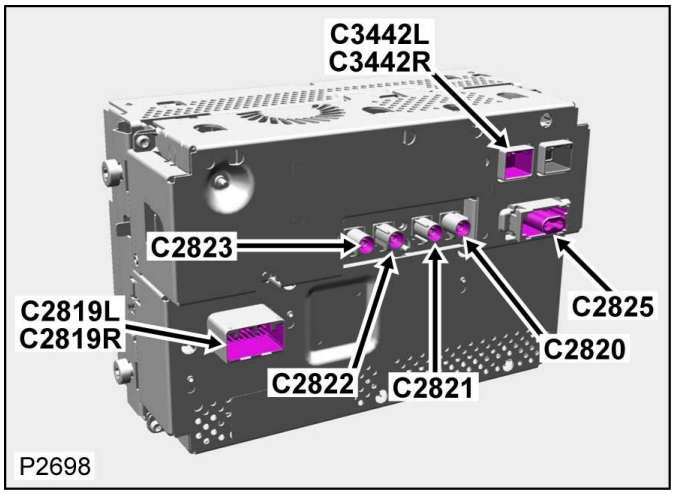

Part No.: XUD815140

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE LINK HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	989	C2727
1S	0.5	SCR	989	C2727

Click here to print


Connector: C2822

CONNECTOR HOUSING NOT SERVICEABLE

Description: Touch screen display

Location: Behind front touch screen display

Qualifier:

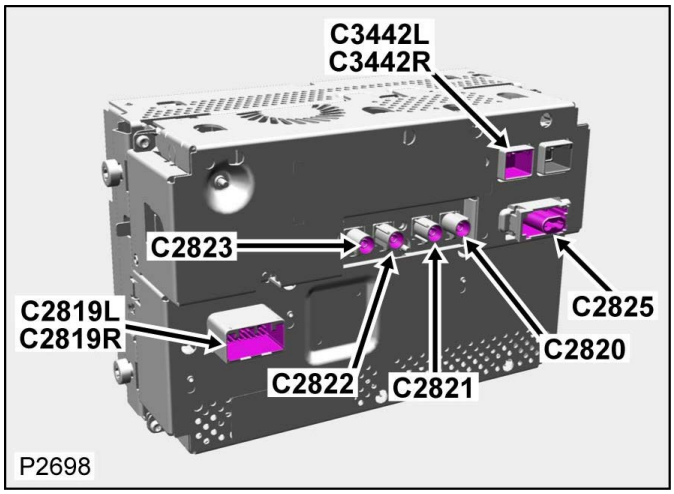

ASSEMBLY

Part No.: XUD812180

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE LINK HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1S	0.5	SCR	124	C3716
1	0.5	B	124	C3716

Click here to print

Connector: C2823


CONNECTOR HOUSING NOT SERVICEABLE

Description: Touch screen display

Location: Behind front touch screen display

Qualifier:

ASSEMBLY

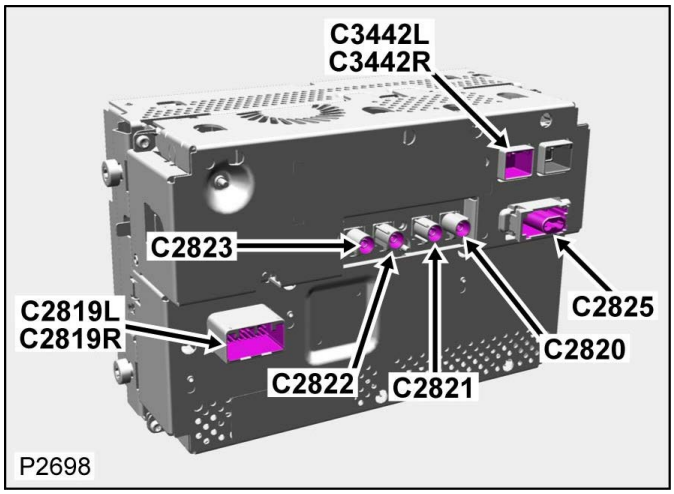

Part No.: XUD815150

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE LINK HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1S	0.5	SCR	706	C2967
1	0.5	B	706	C2967
1S	0.5	SCR	757	C2967
1	0.5	B	757	C2967

Click here to print

Connector: C2825


CONNECTOR HOUSING NOT SERVICEABLE

Description: Touch screen display

Location: Behind front touch screen display

Qualifier:

ASSEMBLY

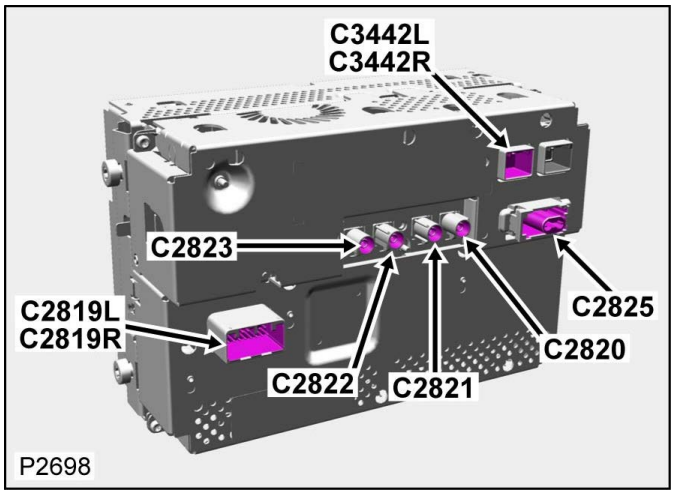

Part No.: XUD812600

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE LINK HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	452	C2867
2	POF	O	452	C2105

Click here to print

Connector: C2831

CONNECTOR HOUSING NOT SERVICEABLE

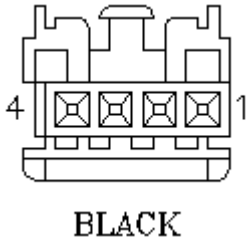

BLACK

Part No.: YPC902310

Colour: BLACK


Cavities: 4WY

Harness: CONSOLE REAR HARNESS

Description: AV input panel

Location: In rear of center console

Qualifier:

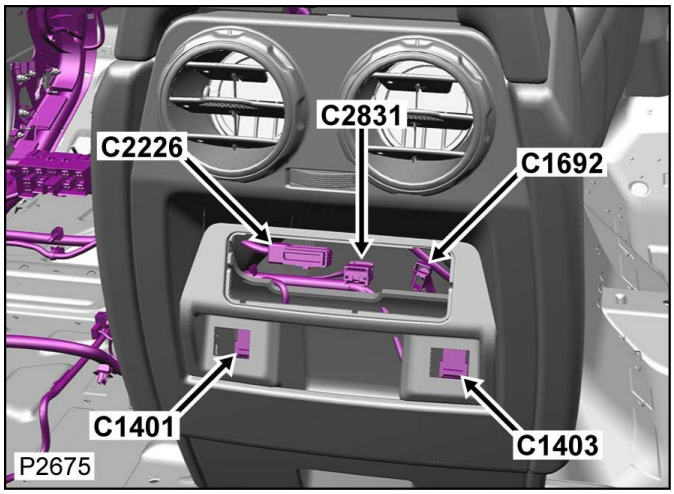

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	U	499	C2755	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	B	499	S/JOINT SJ302	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	499	S/JOINT SJ302	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.5	R	499	C2755	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C2837T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Antenna-VICS

Location: Rear of headlining - LH side

Qualifier:

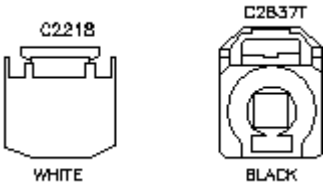

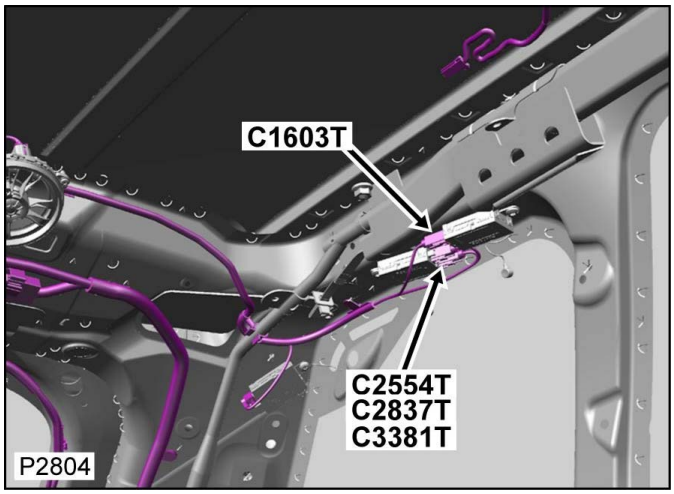

Part No.: XUD815630

Colour: BLACK

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	568T	C2218
1S	SCR	SCR	568T	C2218

Click here to print


Connector: C2846T

CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Video interface-Japan

Location: Behind luggage compartment carpet RH side

Qualifier:

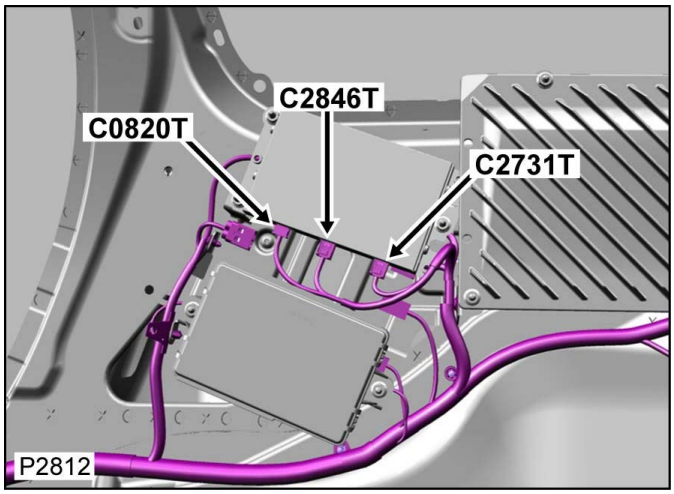

ASSEMBLY

Part No.: XUD815460

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	568T	C2974
2	0.5	Y	568T	C2974
3	SCR	SCR	568T	C2974

Click here to print

Connector: C2867


CONNECTOR HOUSING NOT SERVICEABLE

Description: Instrument panel harness to ICE harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

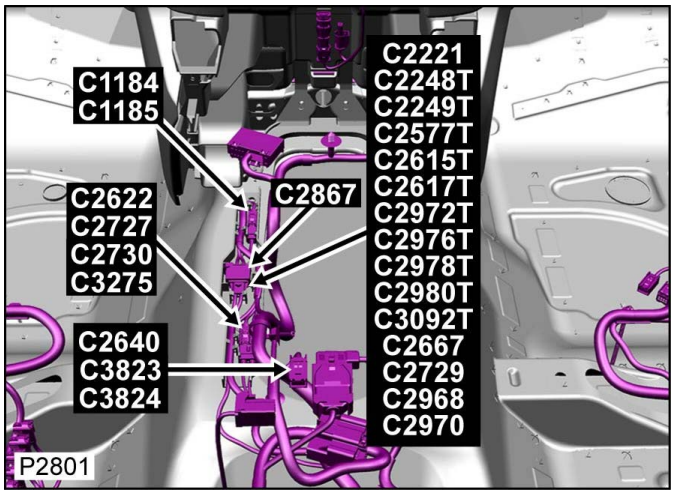

Part No.: XUD812600

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE LINK HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	452	C2105
2	POF	O	452	C2825

Click here to print


Connector: C2868

CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to ICE link harness

Location: Beneath center console RH side

Qualifier:

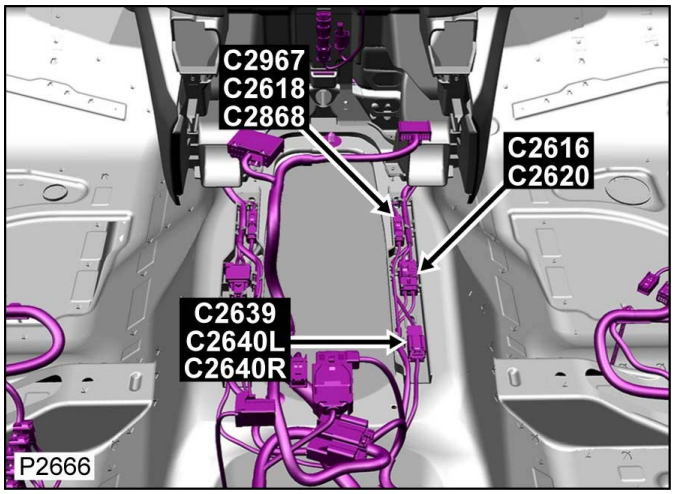

ASSEMBLY

Part No.: XUD812300

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	1055S	C2770S
1S	SCR	SCR	1055S	C2770S
1	0.5	B	1056S	C2770S
1S	SCR	SCR	1056S	C2770S
1	0.5	B	1029S	C2770S
1S	SCR	SCR	1029S	C2770S
1	0.5	B	1055T	C2770T
1S	SCR	SCR	1055T	C2770T
1	0.5	B	1056T	C2770T
1S	SCR	SCR	1056T	C2770T
1	0.5	B	1029T	C2770T
1S	SCR	SCR	1029T	C2770T

Click here to print

Connector: C2870M

CONNECTOR HOUSING NOT SERVICEABLE

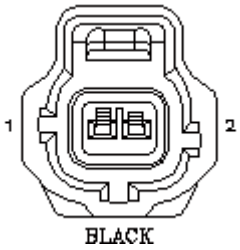

Part No.: YPC501080

Colour: BLACK


Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Sensor-Temperature-Air charge - DV6

Location: Top of engine - RH side

Qualifier:

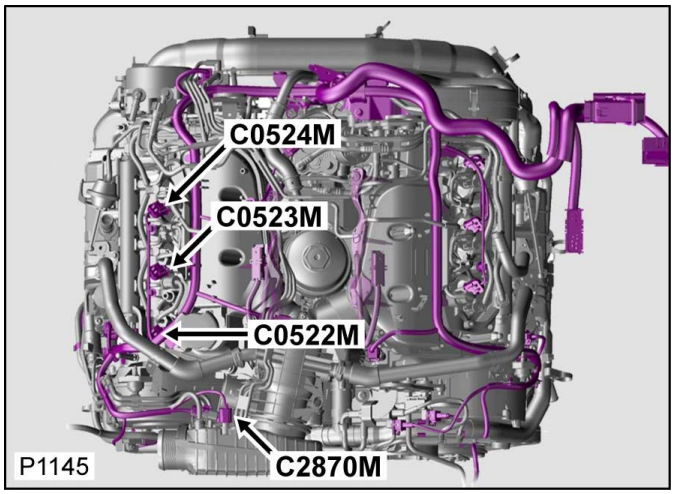

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	YP	798	C0659M	418-549-50	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	OU	798	S/JOINT SJ14	418-549-50	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: **C2875T**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Receiver-Radio-frequency (RF)

Location: Front of headlining in the center

Qualifier:

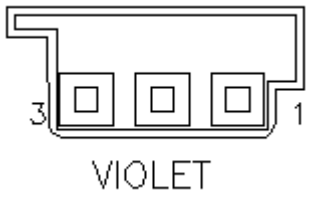

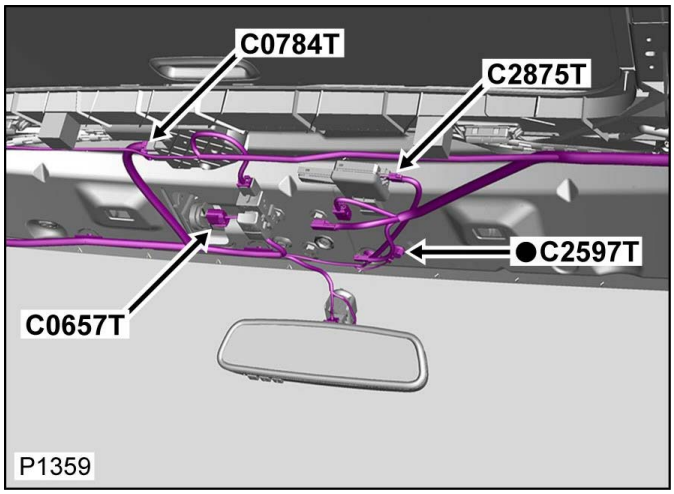

Part No.: YPC911600

Colour: VIOLET

Cavities: 3WY

Harness: CABIN HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	SN	591TL	C1166L	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
1	0.35	SN	591TR	C1166R	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.5	B	591T	C2597T	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
3	0.5	RU	591T	S/JOINT SJ206	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2920T

CONNECTOR HOUSING NOT SERVICEABLE

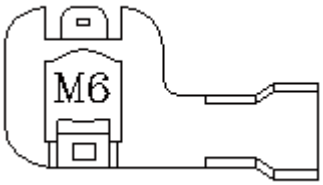

Part No.: YPG900260

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of 'D' post LH side

Qualifier:

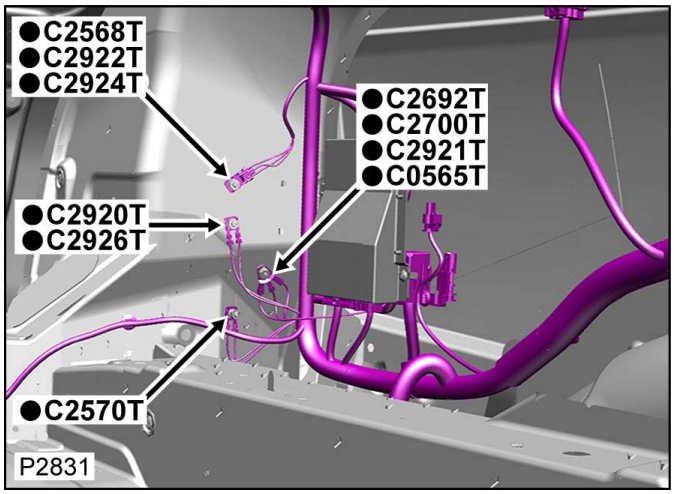


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	13T	C0942T

Click here to print

Connector: C2921T

CONNECTOR HOUSING NOT SERVICEABLE

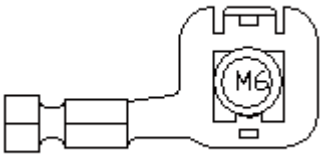

Part No.: YPG10051

Colour: UN-PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of 'D' post LH side

Qualifier:

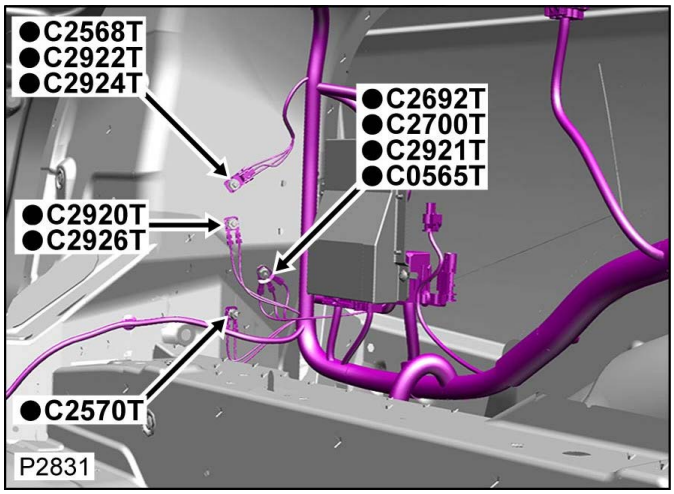


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	W	162T	C1388T

Click here to print

Connector: C2922T

CONNECTOR HOUSING NOT SERVICEABLE

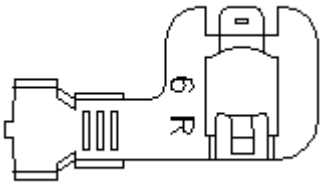

Part No.: YPG800220

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of 'D' post LH side

Qualifier:

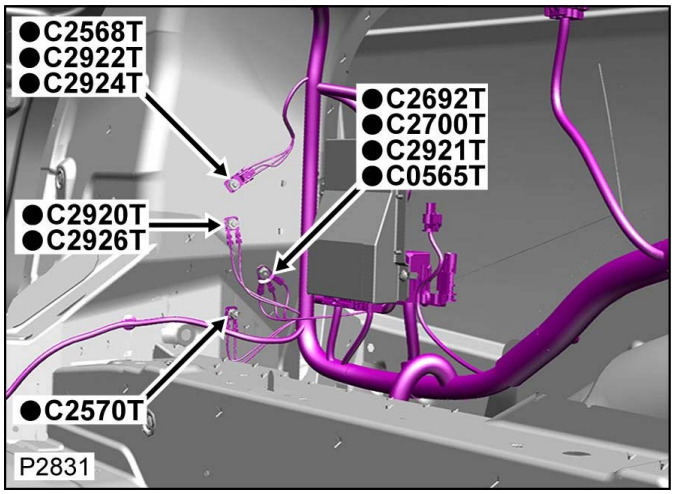


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	499T	S/JOINT SJ8

Click here to print

Connector: C2924T

CONNECTOR HOUSING NOT SERVICEABLE

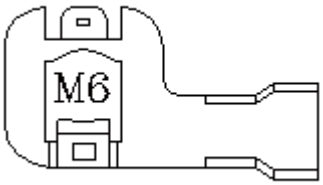

Part No.: YPG900260

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of 'D' post LH side

Qualifier:

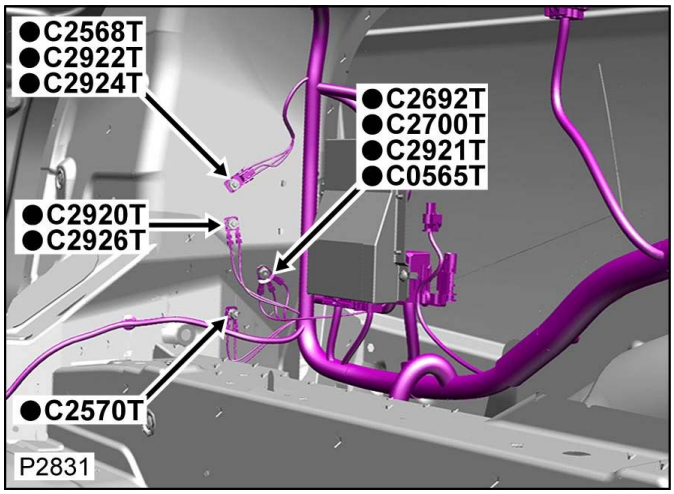


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	499T	S/JOINT SJ832T

Click here to print

Connector: C2926L

CONNECTOR HOUSING NOT SERVICEABLE

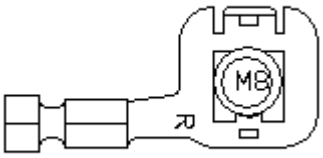

Part No.: YPG900100

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Front RH side of engine compartment

Qualifier:

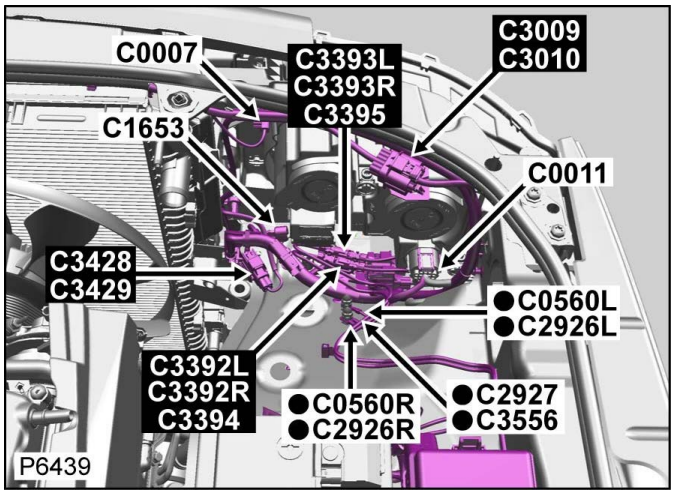


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	B	139L	C0570L

Click here to print

Connector: C2926R

CONNECTOR HOUSING NOT SERVICEABLE

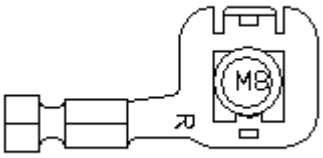

Part No.: YPG900100

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Front RH side of engine compartment

Qualifier:

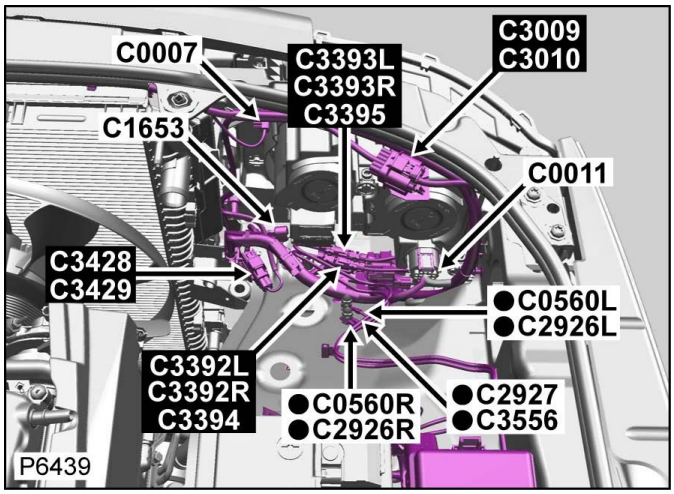


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	B	200R	C0570R

Click here to print

Connector: C2926T

CONNECTOR HOUSING NOT SERVICEABLE

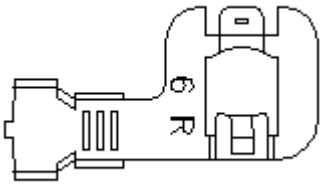

Part No.: YPG800220

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Base of 'D' post LH side

Qualifier:

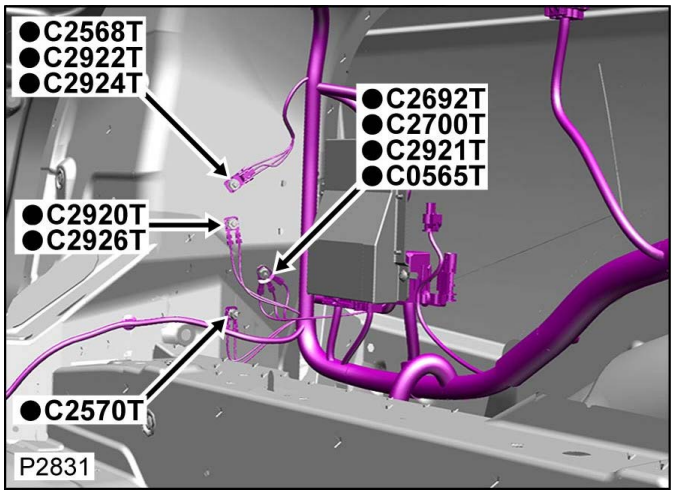


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	499T	C2959T

Click here to print

Connector: C2927

CONNECTOR HOUSING NOT SERVICEABLE

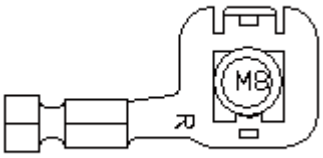

Part No.: YPG900120

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Front RH side of engine compartment

Qualifier:

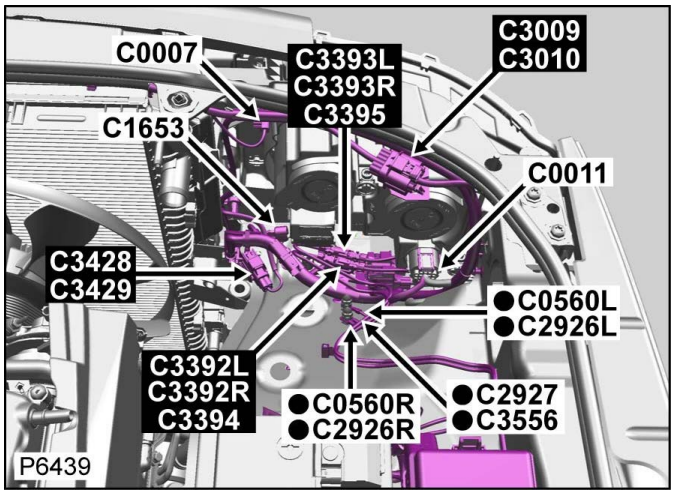

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	499	S/JOINT SJ877

Click here to print

Connector: C2930

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC801860

Colour: NATURAL


Cavities: 2WY

Harness: SEAT FRONT HARNESS

Description: Motor-Seat-Tilt-Driver

Location: Beneath driver seat

Qualifier:

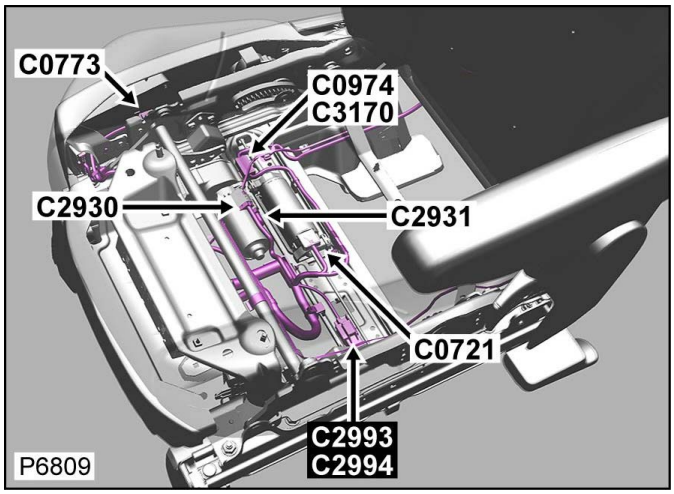


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	R	207	C2381	418-549-38	418-612	418-116A	418-117	-	418-113	418-108
1	0.75	K	439	C0773	-	-	-	-	-	-	-
2	1.5	R	207	C2381	418-549-38	418-612	418-116A	418-117	-	418-113	418-108
2	0.75	N	439	C0773	-	-	-	-	-	-	-

Click here to print

Connector: C2931

CONNECTOR HOUSING NOT SERVICEABLE

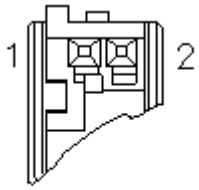

NATURAL

Part No.: YPC801050

Colour: NATURAL


Cavities: 2WY

Harness: SEAT FRONT HARNESS

Description: Motor-Seat-Tilt-Driver

Location: Beneath driver seat

Qualifier:

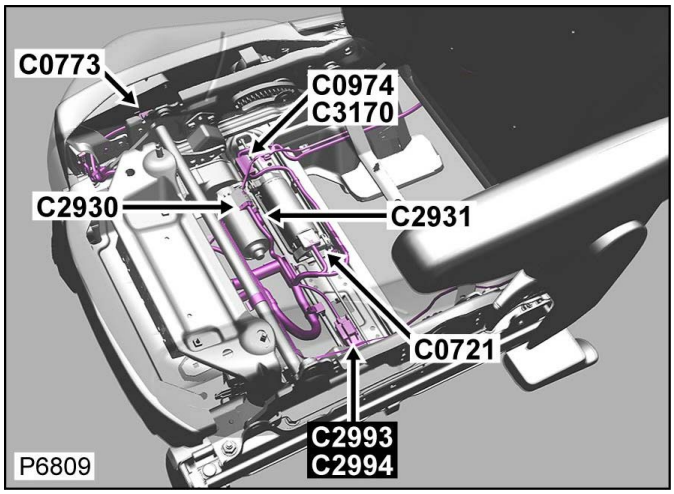


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	YP	207	C2382
2	0.35	RG	207	C2382

Click here to print

Connector: C2934L

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG800520

Colour: TIN PLATED


Cavities: 1WY

Harness: EARTH STRAP ENGINE-CHASSIS-BIW PETROL V8 HARNESS

Description: Ground point

Location: Below RH front wheelarch

Qualifier: LHD illustrated RHD similar

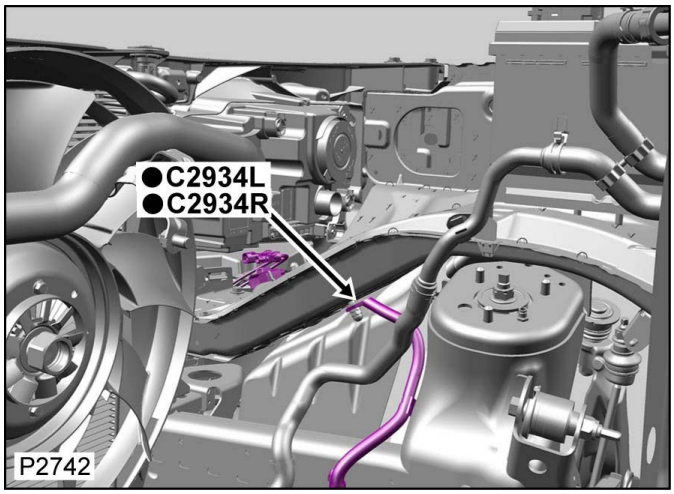

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0	B	499	C1547L

Click here to print

Connector: C2934M

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG901660

Colour: TIN PLATED


Cavities: 1WY

Harness: EARTH STRAP ENGINE-CHASSIS-BIW DIESEL V6 3.0L HARNESS

Description: Ground point

Location: Behind RH front fender splash shield

Qualifier:

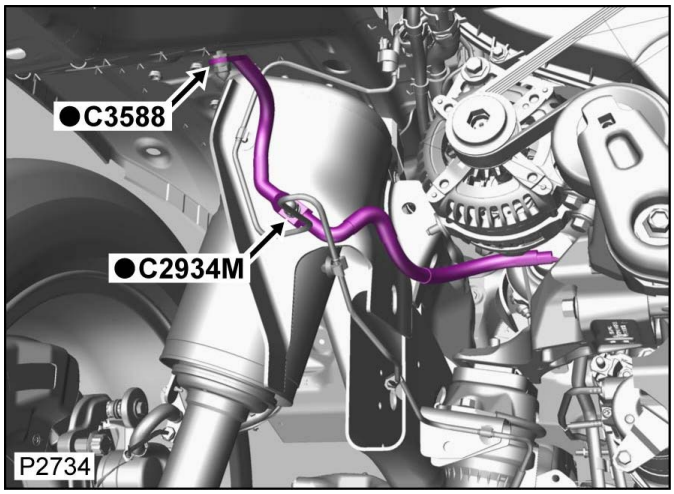


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	37.0	BRAID	499	C3588
1	50.0	B	499	C1547M

Click here to print

Connector: C2934R

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG800520

Colour: TIN PLATED


Cavities: 1WY

Harness: EARTH STRAP ENGINE-CHASSIS-BIW PETROL V8 RHD HARNESS

Description: Ground point

Location: Below RH front wheelarch

Qualifier: LHD illustrated RHD similar

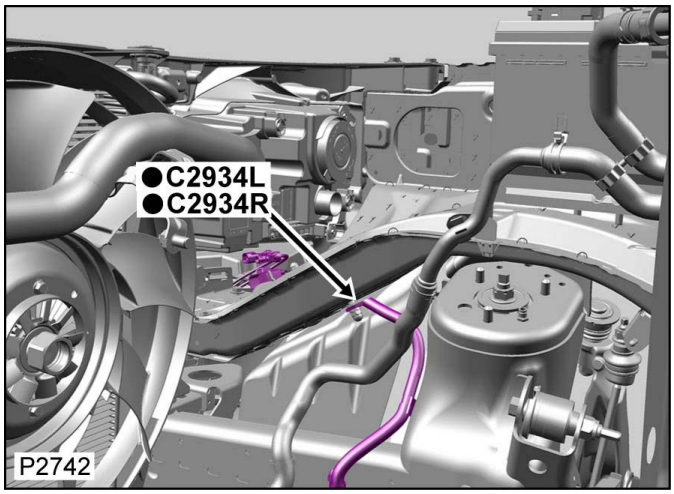


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0	B	499	C1547R

Click here to print

Connector: **C2937T**

CONNECTOR HOUSING NOT SERVICEABLE

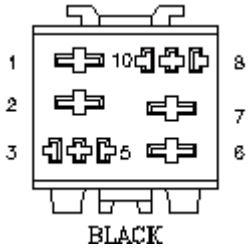

Part No.: YPP100180

Colour: BLACK


Cavities: 10WY

Harness: CABIN HARNESS

Description: Relay-Trailer-Rear wiper

Location: Behind luggage compartment carpet LH side

Qualifier:

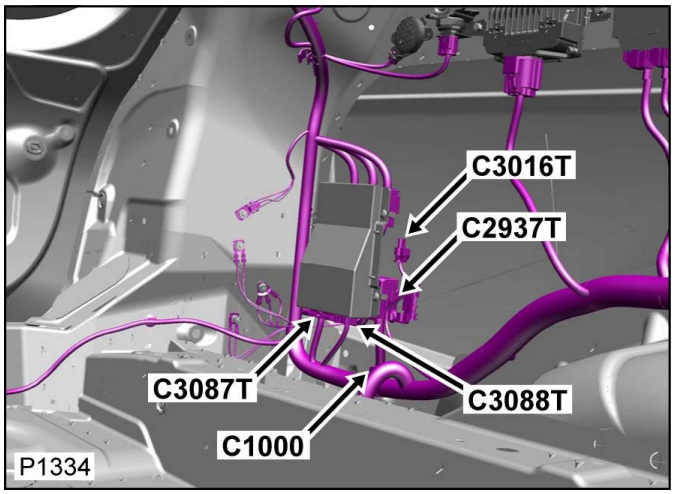


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	GLG	499T	C2739T
2	1.0	SK	193T	S/JOINT SJ28T
3	0.5	SP	193TL	C0586L
3	0.5	SP	193TR	C0586R
4	1.0	B	193T	S/JOINT SJ8
5	0.5	SK	193T	S/JOINT SJ28T
6	2.5	R	162T	C1388T
6	2.5	R	319TL	C1390T
7	2.5	RW	139TL	S/JOINT SJ260
7	2.5	RW	200TR	S/JOINT SJ1260
8	1.5	R	139TL	S/JOINT SJ260
8	1.5	R	200TR	S/JOINT SJ1260
10	0.5	B	139TL	C0586L
10	0.5	B	200TR	C0586R

Click here to print

Connector: C2946

CONNECTOR HOUSING NOT SERVICEABLE

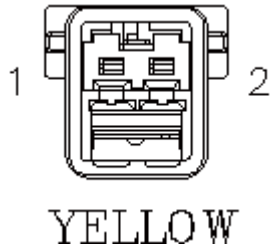

Part No.: YPC906270

Colour: YELLOW


Cavities: 2WY

Harness: SEAT ASSEMBLIES HARNESS

Description: Air bag-Side

Location: Beneath front seat

Qualifier:

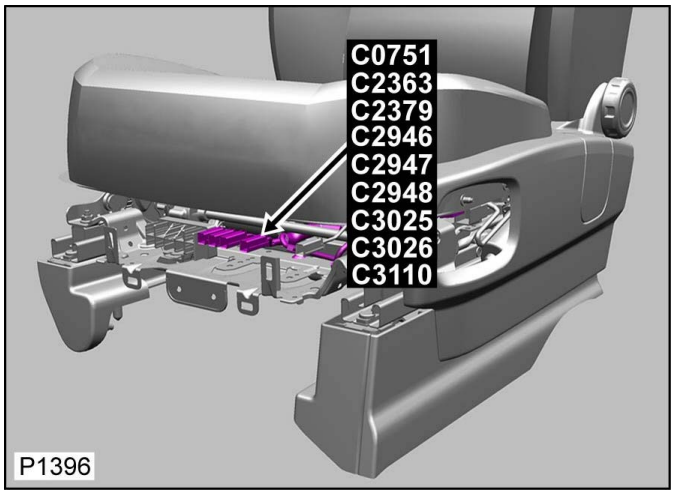


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	PS	216	C0251
2	0.5	YO	216	C0251

Click here to print

Connector: C2947

CONNECTOR HOUSING NOT SERVICEABLE

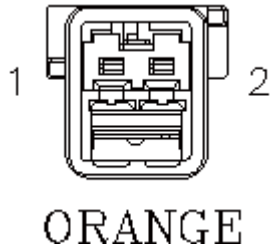

Part No.: YPC906280

Colour: ORANGE


Cavities: 2WY

Harness: SEAT ASSEMBLIES HARNESS

Description: Pre-tensioner-Front

Location: Beneath front seat

Qualifier:

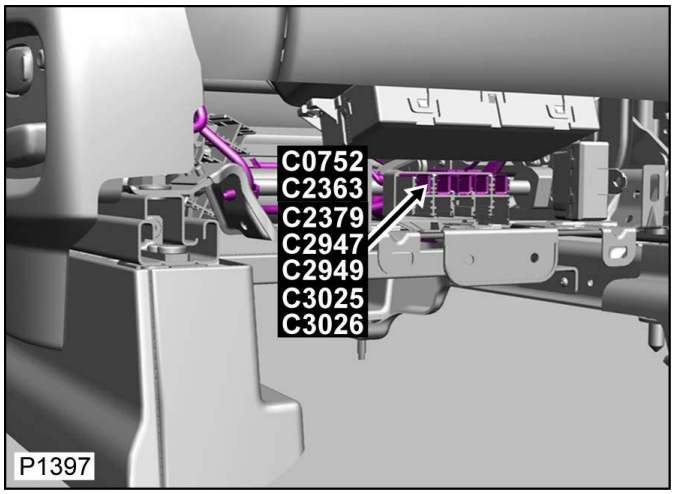


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	OB	499	C0252
2	0.5	OU	499	C0252

Click here to print

Connector: C2948

CONNECTOR HOUSING NOT SERVICEABLE

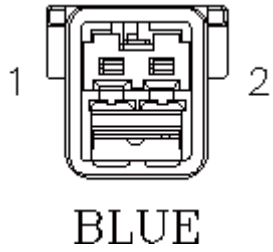

Part No.: YPC906310

Colour: BLUE


Cavities: 2WY

Harness: SEAT ASSEMBLIES HARNESS

Description: Switch-Buckle

Location: Beneath front seat

Qualifier:

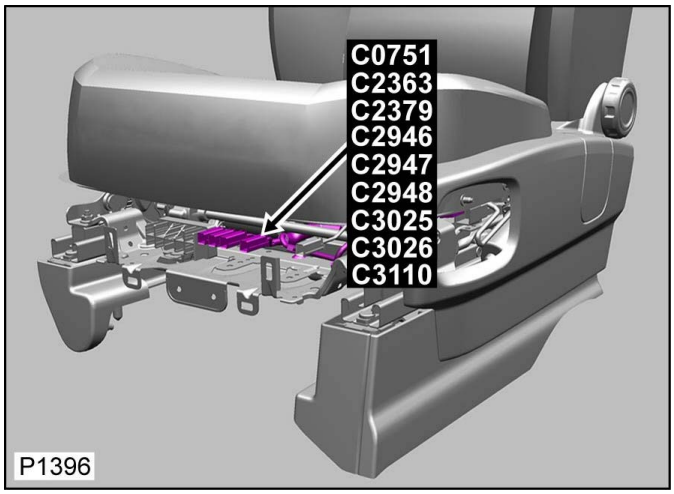


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	SP	499	C0100	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	O	499	C0100	418-411-12	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2949

CONNECTOR HOUSING NOT SERVICEABLE

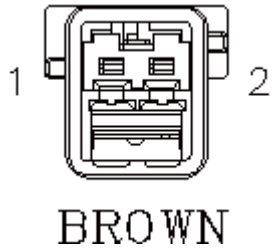

Part No.: YPC906300

Colour: BROWN


Cavities: 2WY

Harness: SEAT ASSEMBLIES HARNESS

Description: Mat-Belt minder

Location: Beneath front seat

Qualifier:

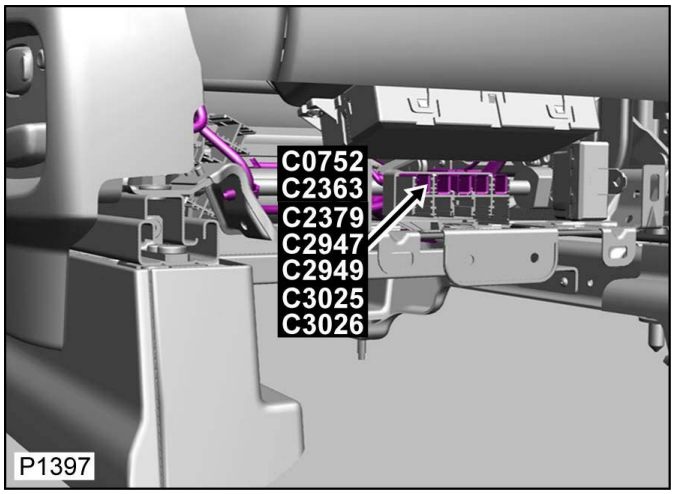

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	162	C3164	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	O	162	C3164	418-411-12	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2951


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to seat link harness

Location: Beneath LH Front seat

Qualifier:

ASSEMBLY

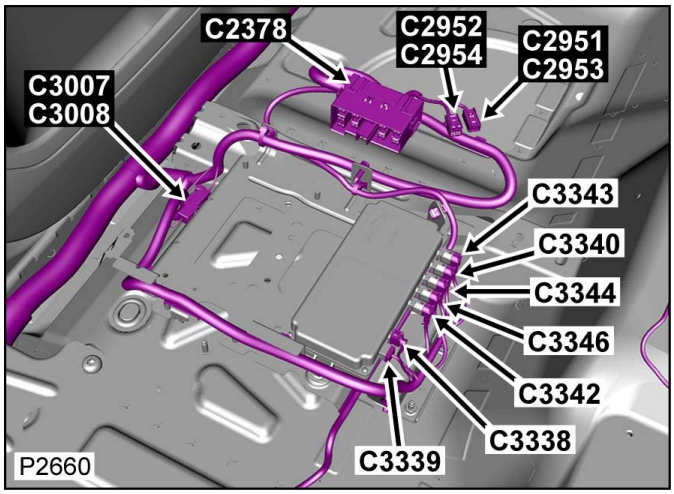

Part No.: XUD815470

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.08	N	514S	C3714S
1	0.08	N	514T	C3714T
2	0.08	P	514S	C3714S
2	0.08	P	514T	C3714T
3	SCR	SCR	514S	C3714S
3	SCR	SCR	514T	C3714T

Click here to print

Connector: C2952

CONNECTOR HOUSING SERVICEABLE



Part No.: YPC905670

Colour: GREY


Cavities: 8WY

Harness: ICE/NAVIGATION HARNESS

Description: ICE harness to seat harness

Location: Beneath LH Front seat

Qualifier:

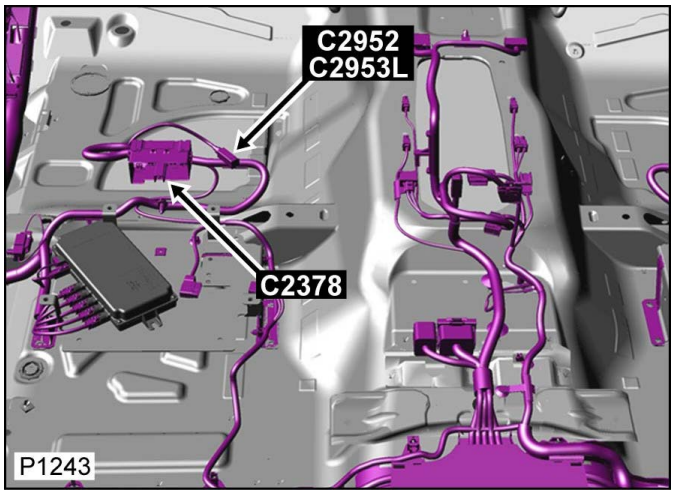

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	WG	514S	S/JOINT SJ11
1	0.35	WG	514T	S/JOINT SJ11
2	0.35	WN	514S	S/JOINT SJ6
2	0.35	WN	514T	S/JOINT SJ6
3	0.35	YS	514S	S/JOINT SJ7
3	0.35	YS	514T	S/JOINT SJ7
4	0.35	NU	514S	S/JOINT SJ10
4	0.35	NU	514T	S/JOINT SJ10
8	0.35	NU	514S	S/JOINT SJ10
8	0.35	NU	514T	S/JOINT SJ10

Click here to print


Connector: C2953


CONNECTOR HOUSING NOT SERVICEABLE

Description: Seat harness to ICE harness

Location: Beneath front seat

Qualifier: LH side illustrated RH side similar

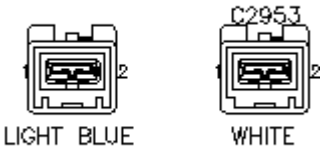

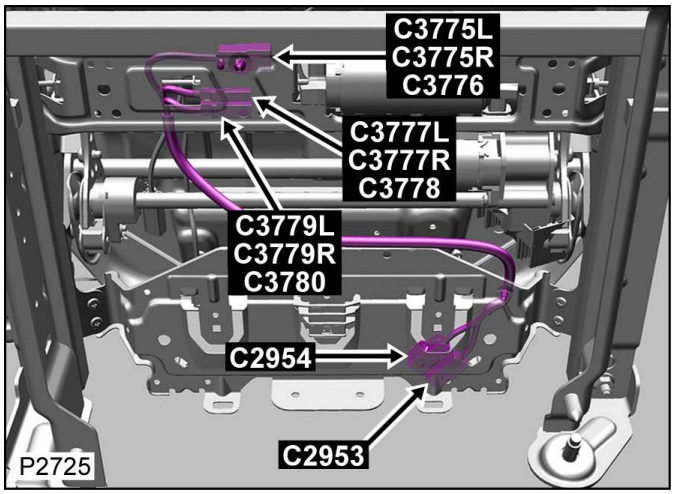

Part No.: XUD816140

Colour: NO COLOUR

Cavities: 1WY

Harness: FRONT SEAT RSE CABLE ASSY HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.08	N	790L	C3775L
1	0.08	N	790R	C3775R
2	0.08	P	790L	C3775L
2	0.08	P	790R	C3775R
3	SCR	SCR	790L	C3775L
3	SCR	SCR	790R	C3775R

Click here to print

Connector: C2954

CONNECTOR HOUSING SERVICEABLE

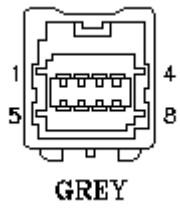

Part No.: YPC800310

Colour: GREY


Cavities: 8WY

Harness: FRONT SEAT RSE CABLE ASSY HARNESS

Description: Seat link harness to ice harness

Location: Beneath front seat

Qualifier: LH side illustrated RH side similar

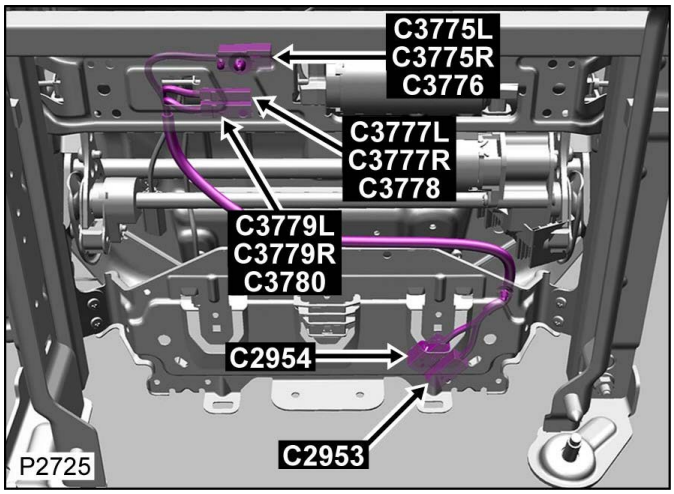

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	WG	790L	C3779L	418-411-47	-	418-116A	418-117	-	418-112	418-107
1	0.35	WG	790R	C3779R	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.35	WN	790L	C3779L	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.35	WN	790R	C3779R	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.35	YS	790L	C3779L	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.35	YS	790R	C3779R	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.35	NW	790L	C3777L	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.35	NW	790R	C3777R	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.35	NU	790L	C3777L	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.35	NU	790R	C3777R	418-411-47	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2955T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Rear seat entertainment module

Location: Behind luggage compartment carpet RH side

Qualifier:

ASSEMBLY

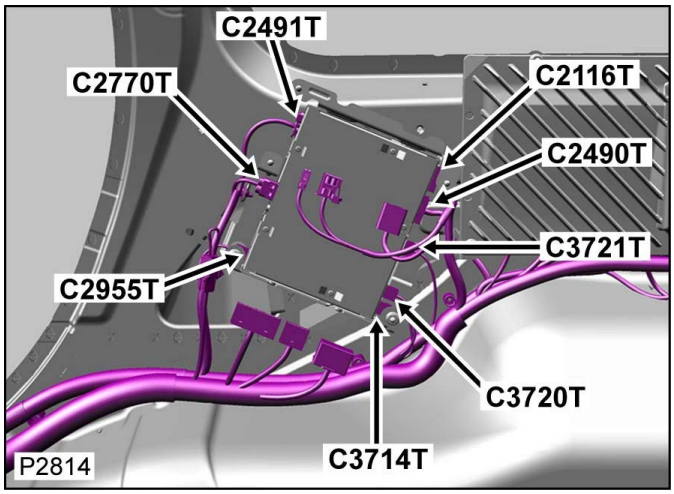

Part No.: XUD815310

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	N	706T	C3717
2	0.35	P	706T	C3717
3	SCR	SCR	706T	C3717

Click here to print

Connector: **C2959T**

CONNECTOR HOUSING SERVICEABLE

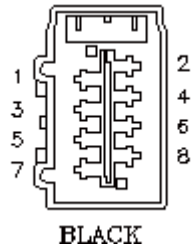

BLACK

Part No.: YPC901230

Colour: BLACK


Cavities: 8WY

Harness: CABIN HARNESS

Description: Main harness to tailgate harness

Location: Rear of headlining

Qualifier:

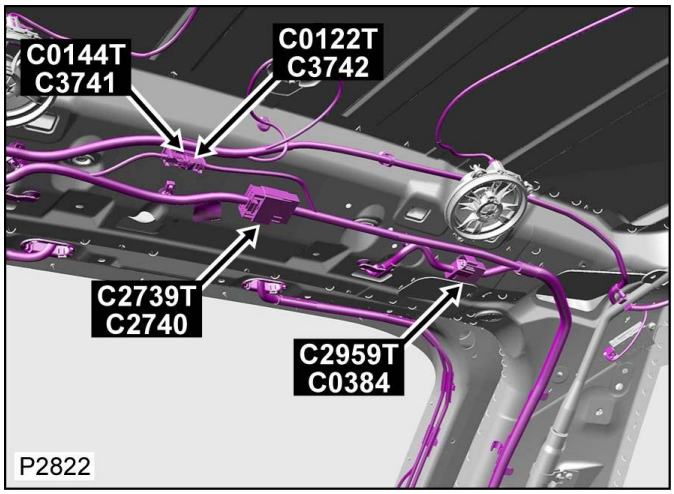

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	4.0	B	499T	C2926T	418-587-05	-	418-116A	418-117	-	418-114	418-109
2	4.0	NP	139TL	C0585L	418-587-05	-	418-116A	418-117	-	418-114	418-109
2	4.0	NP	200TR	C0585R	418-587-05	-	418-116A	418-117	-	418-114	418-109
3	2.5	NR	139TL	C2411L	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
3	2.5	NR	200TR	C0047R	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
4	1.5	Y	499T	C0492T	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
5	1.5	P	499T	C0492T	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
7	2.5	B	499T	S/JOINT SJ8	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
8	1.0	RB	499T	S/JOINT SJ22T	418-411-15	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C2967

CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE link harness to ICE harness

Location: Beneath center console RH side

Qualifier:

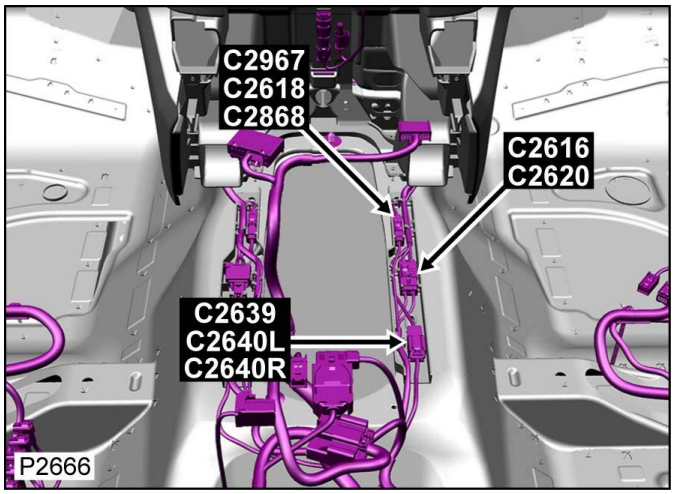

ASSEMBLY

Part No.: XUD815150

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE LINK HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1S	0.5	SCR	706	C2823
1	0.5	B	706	C2823
1S	0.5	SCR	757	C2823
1	0.5	B	757	C2823

Click here to print

Connector: C2968


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to instrument panel harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

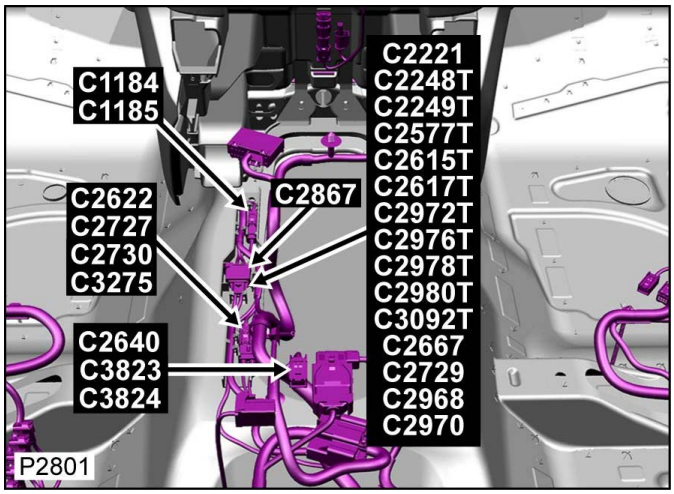

Part No.: XUD815570

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	568	C2225
2	SCR	SCR	568	C2225

Click here to print

Connector: C2970


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to instrument panel harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

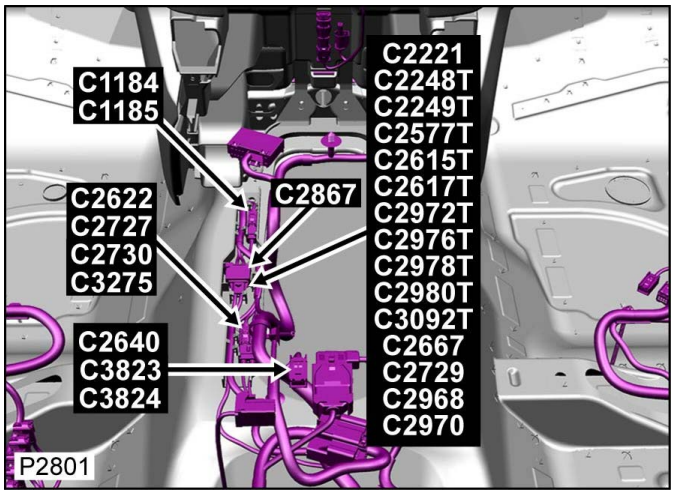

Part No.: XUD812300

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	1056S	C1598S
1S	SCR	SCR	1056S	C1598S
1	0.5	B	1029S	C1598S
1S	SCR	SCR	1029S	C1598S
1	0.5	B	1056T	C1598T
1S	SCR	SCR	1056T	C1598T
1	0.5	B	1029T	C1598T
1S	SCR	SCR	1029T	C1598T
2	0.5	B	1055S	C2770S
2S	SCR	SCR	1055S	C2770S
2	0.5	B	1056S	C2770S
2S	SCR	SCR	1056S	C2770S
2	0.5	B	1029S	C2770S
2S	SCR	SCR	1029S	C2770S
2	0.5	B	1055T	C2770T
2S	SCR	SCR	1055T	C2770T
2	0.5	B	1056T	C2770T
2S	SCR	SCR	1056T	C2770T
2	0.5	B	1029T	C2770T
2S	SCR	SCR	1029T	C2770T

Click here to print

Connector: C2972T


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to instrument panel harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

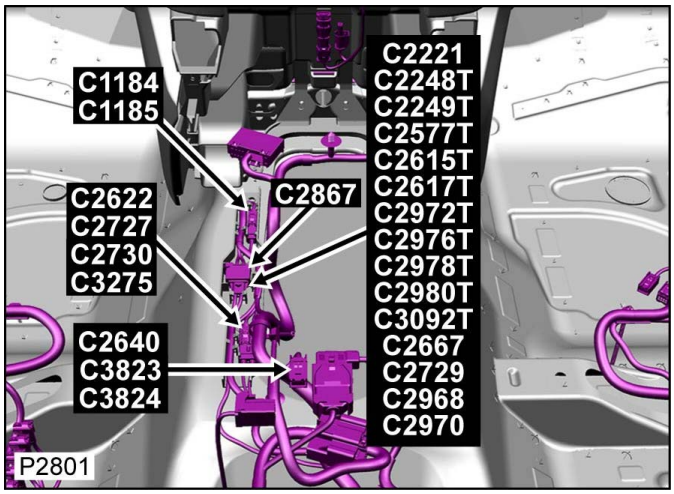

Part No.: XUD812740

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	658T	C2102T
2	POF	O	658T	C3759T

Click here to print


Connector: C2973L

CONNECTOR HOUSING NOT SERVICEABLE

Description: Instrument panel harness to ICE harness

Location: Beneath center console

Qualifier:

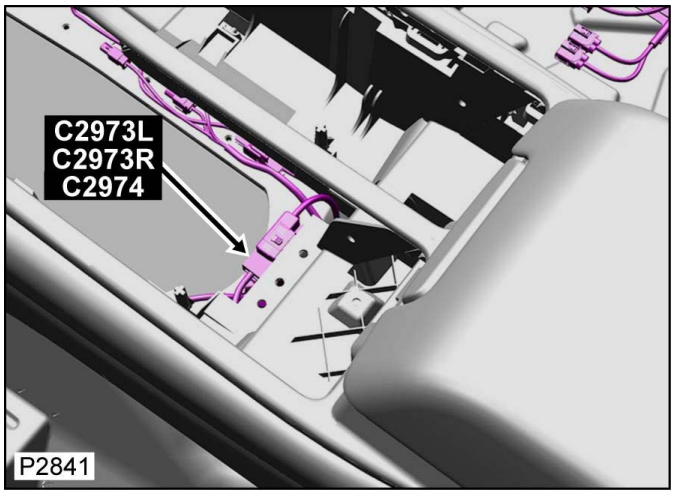

ASSEMBLY

Part No.: XUD815440

Colour: NO COLOUR

Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	N	1011L	C3442L
2	0.5	P	1011L	C3442L
3	0.5	SCR	1011L	C3442L

Click here to print


Connector: C2973R

CONNECTOR HOUSING NOT SERVICEABLE

Description: Instrument panel harness to ICE harness

Location: Beneath center console

Qualifier:

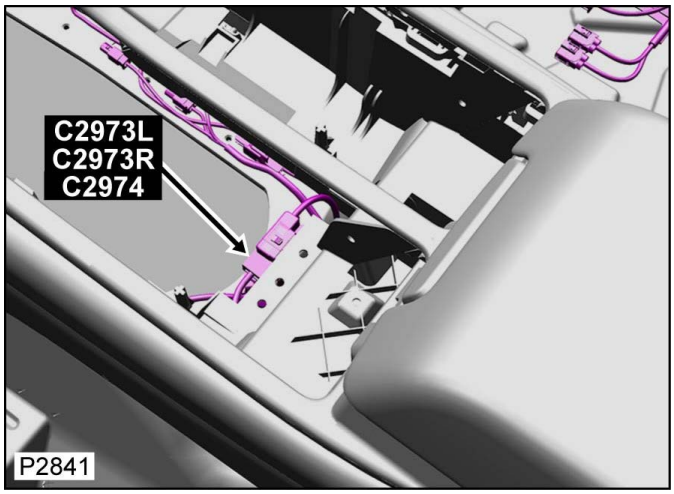

ASSEMBLY

Part No.: XUD815420

Colour: NO COLOUR

Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	N	568	C3442R
1	0.5	N	1011R	C3442R
2	0.5	P	568	C3442R
2	0.5	P	1011R	C3442R
3	0.5	SCR	568	C3442R
3	0.5	SCR	1011R	C3442R

Click here to print


Connector: C2974

CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to instrument panel harness

Location: Beneath center console

Qualifier:

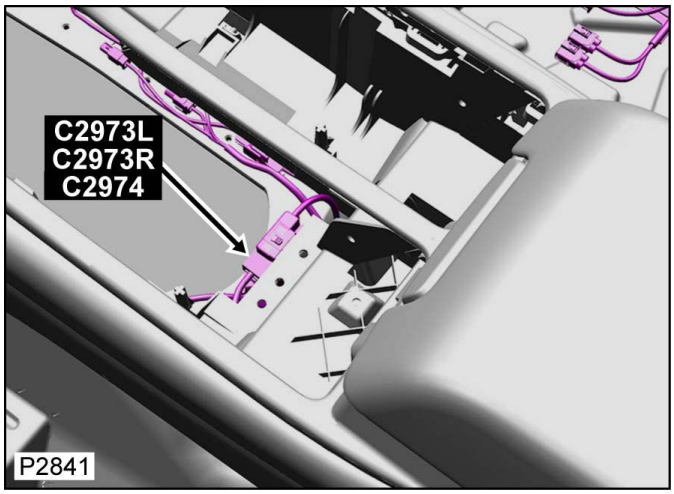

ASSEMBLY

Part No.: XUD815450

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	568S	C2846S
1	0.5	R	1011	C0898
1	0.5	R	568T	C2846T
2	0.5	Y	568S	C2846S
2	0.5	Y	1011	C0898
2	0.5	Y	568T	C2846T
3	SCR	SCR	568S	C2846S
3	SCR	SCR	1011	C0898
3	SCR	SCR	568T	C2846T

Click here to print

Connector: C2976T


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to ICE link harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

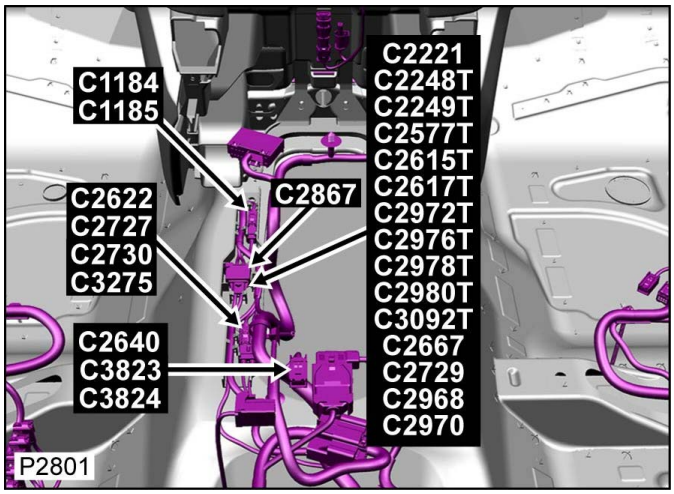

Part No.: XUD812820

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	1038T	C2102T
2	POF	O	1038T	C2104

Click here to print

Connector: C2978T


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to ICE link harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

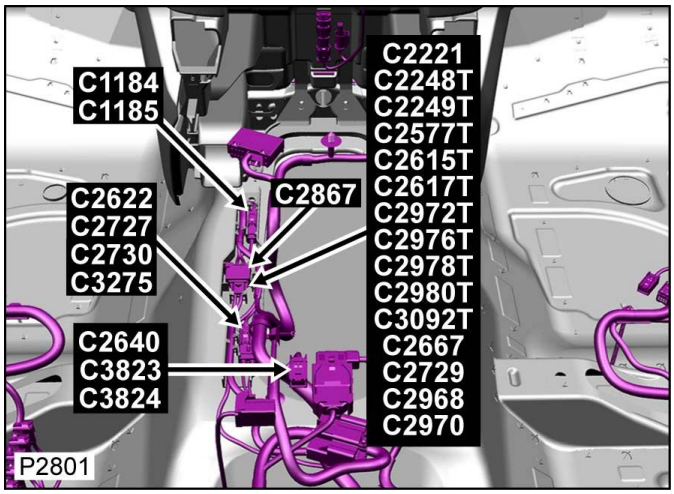

Part No.: XUD812840

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	1039T	C2102T
2	POF	O	1039T	C2104

Click here to print

Connector: C2980T


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to instrument panel harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

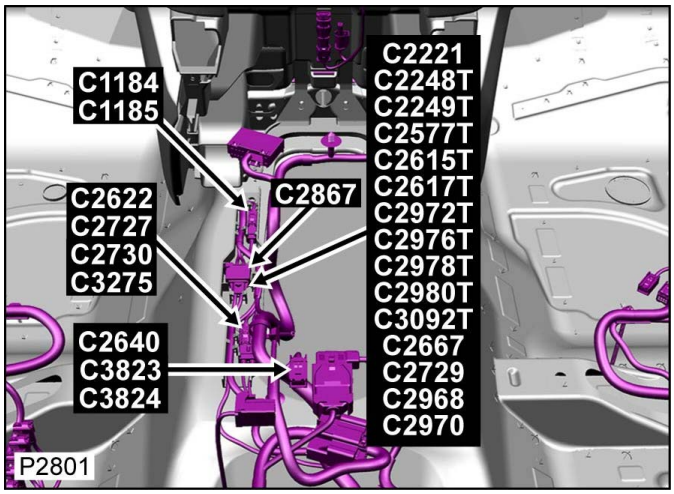

Part No.: XUD812760

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	689T	C2102T
2	POF	O	689T	C2106

Click here to print

Connector: C2987


CONNECTOR HOUSING NOT SERVICEABLE

Description: Receiver-Television

Location: Beneath RH Front seat

Qualifier:

ASSEMBLY

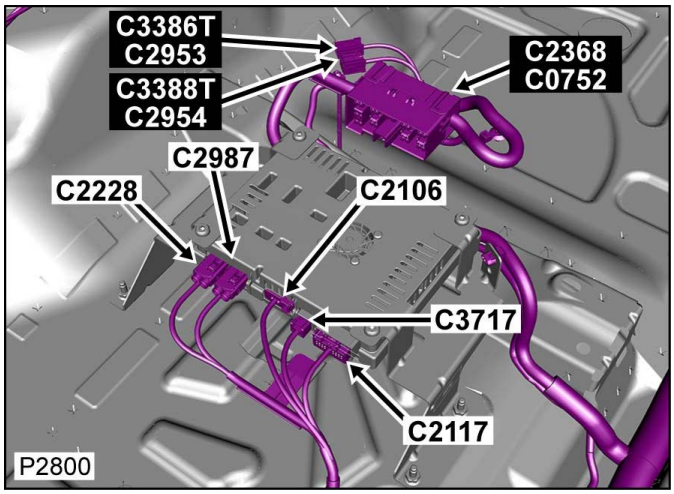

Part No.: XUD812290

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	310S	C1600S
1S	SCR	SCR	310S	C1600S
1	0.5	B	310T	C1600T
1S	SCR	SCR	310T	C1600T
2	0.5	B	310S	C1601S
2S	SCR	SCR	310S	C1601S
2	0.5	B	310T	C1601T
2S	SCR	SCR	310T	C1601T

Click here to print


Connector: C2989T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-SDARS

Location: Behind luggage compartment carpet RH side

Qualifier:

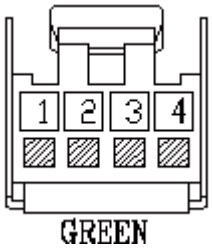

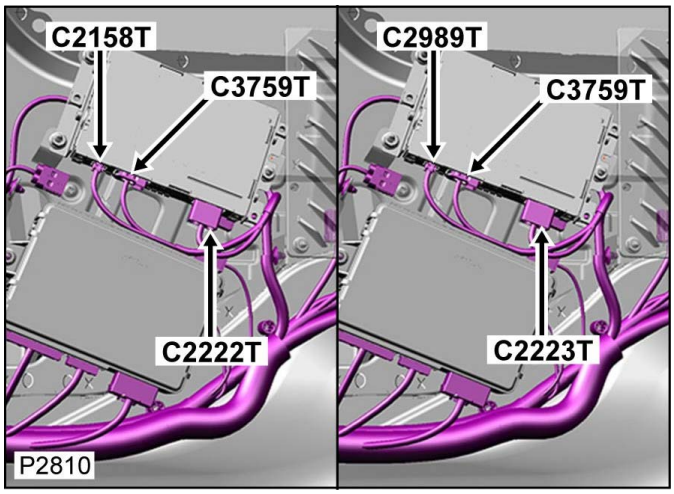

Part No.: YPC108210

Colour: GREEN

Cavities: 4WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	R	512T	S/JOINT SJ520	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.75	B	512T	C2647T	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2992

CONNECTOR HOUSING NOT SERVICEABLE

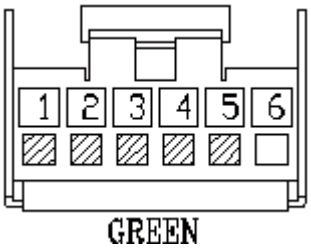

Part No.: YPC106440

Colour: GREEN


Cavities: 6WY

Harness: FACIA COMPOSITE HARNESS

Description: Switch-Passenger-Air bag disable

Location: Behind passenger side of Instrument panel

Qualifier:

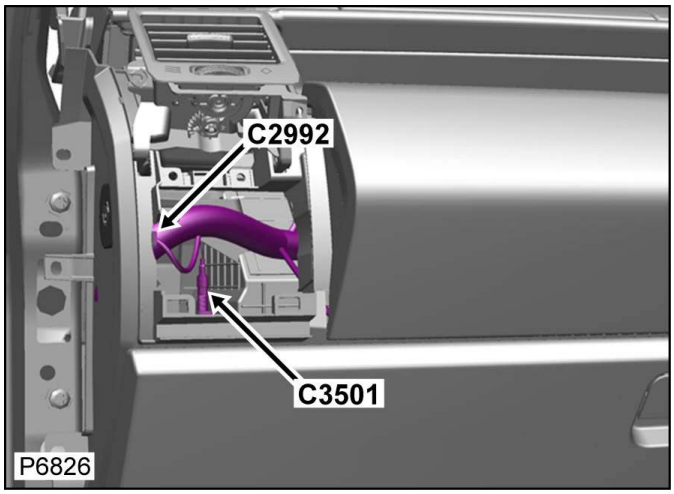


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	RU	216L	C1168L	418-587-02	-	418-116A	418-117	-	418-112	418-107
1	0.5	RU	216R	C0223R	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.5	RY	216L	C1168L	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.5	RY	216R	C0223R	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	B	216L	C2999L	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	B	216R	C2999R	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2993

CONNECTOR HOUSING NOT SERVICEABLE

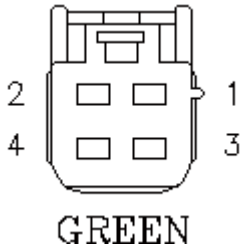

Part No.: YPC800430

Colour: GREEN


Cavities: 4WY

Harness: SEAT FRONT HARNESS

Description: Seat harness to seat link harness

Location: Beneath driver seat

Qualifier:

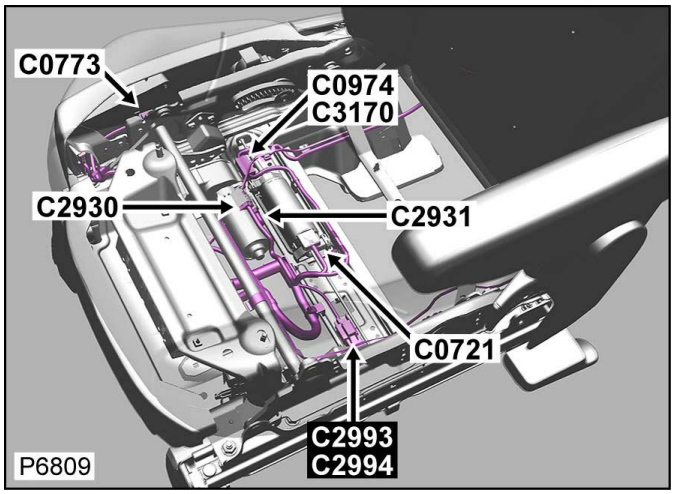


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	N	207	C2381	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
2	0.35	R	207	C2382	418-411-46	-	418-116A	418-117	418-104	418-112	418-107
3	1.5	K	207	C2381	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
4	0.35	YP	207	C2382	418-411-46	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2994

CONNECTOR HOUSING NOT SERVICEABLE

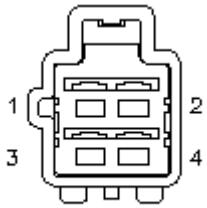

GREEN

Part No.: YPC800440

Colour: GREEN


Cavities: 4WY

Harness: SEAT LINK HARNESS

Description: Seat link harness to seat harness

Location: Beneath driver seat

Qualifier:

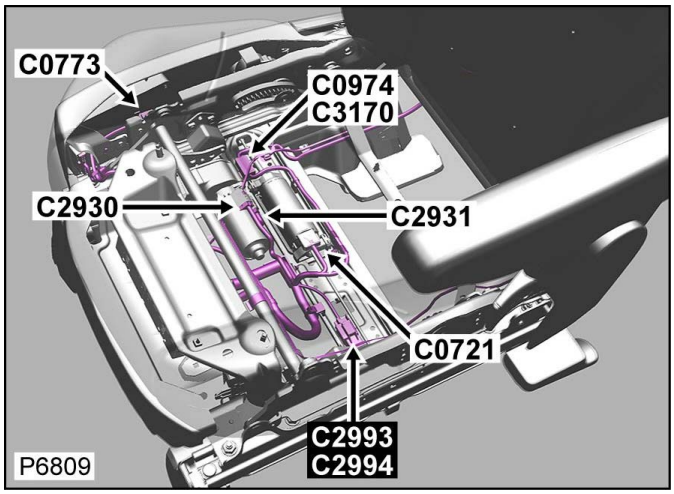


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	O	26	C0718	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
2	0.5	KU	26	C0718	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
3	1.5	S	26	C0718	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
4	0.5	BG	26	C0718	418-411-15	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2994

CONNECTOR HOUSING NOT SERVICEABLE

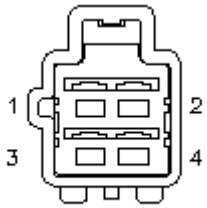

GREEN

Part No.: YPC800440

Colour: GREEN


Cavities: 4WY

Harness: SEAT LINK HARNESS

Description: Seat link harness to seat harness

Location: Beneath driver seat

Qualifier:

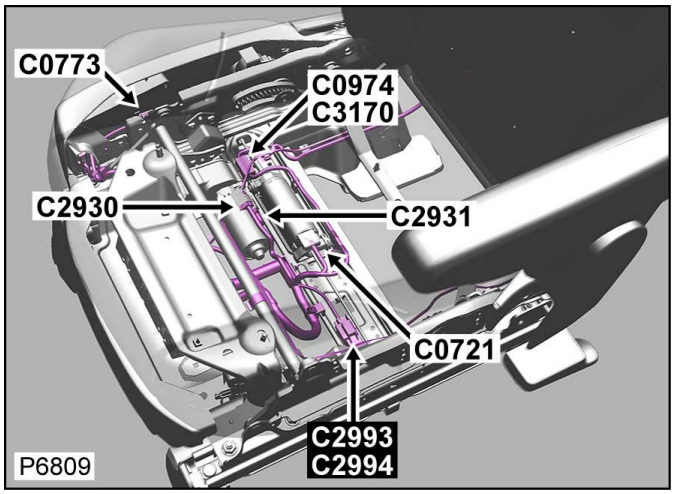

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	O	26	C0718	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
2	0.5	KU	26	C0718	418-411-15	-	418-116A	418-117	418-104	418-112	418-107
3	1.5	S	26	C0718	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
4	0.5	BG	26	C0718	418-411-15	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C2996L

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC119000

Colour: NATURAL


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to air conditioning harness

Location: Behind passenger side of Instrument panel

Qualifier:

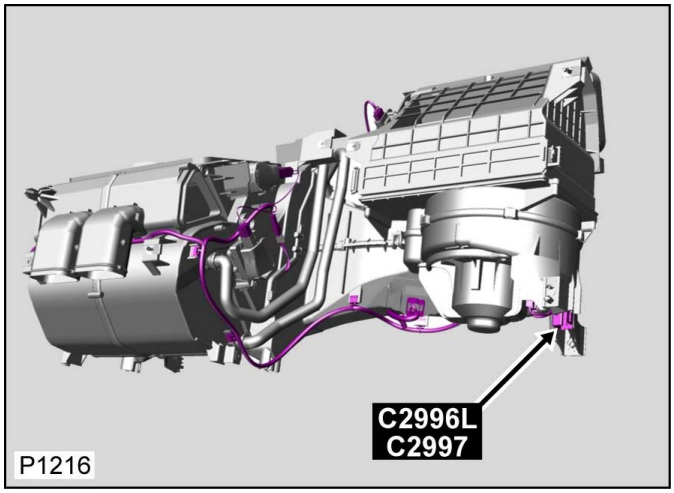

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	139L	C2606L
2	4.0	NR	139L	C0570L

Click here to print

Connector: **C2996R**

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC119000

Colour: NATURAL


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to air conditioning harness

Location: Climate control assembly-Passenger side

Qualifier:

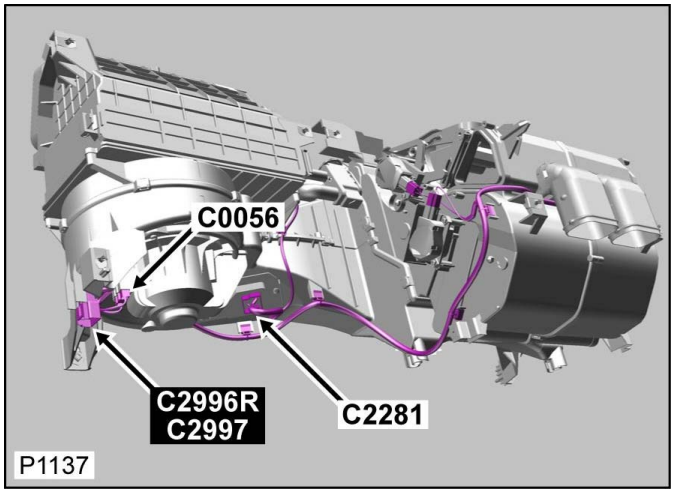

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	200R	C2606R
2	4.0	NR	200R	C0570R

Click here to print

Connector: C2997

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC119010

Colour: NATURAL


Cavities: 2WY

Harness: ATC RHD HARNESS

Description: Air conditioning (A/C) harness to engine compartment harness

Location: Climate control assembly-Passenger side

Qualifier:

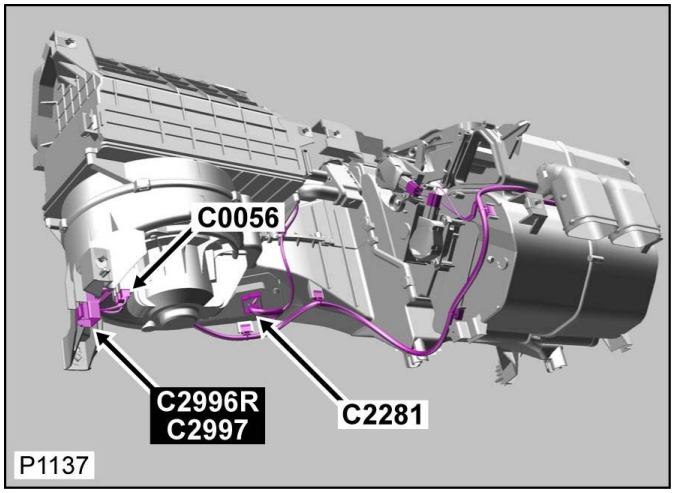


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	R	499	C2281
2	4.0	W	499	C0056

Click here to print

Connector: C2999L

CONNECTOR HOUSING NOT SERVICEABLE

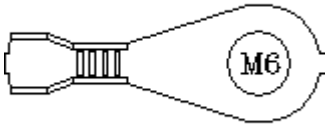

Part No.: YPG800660

Colour: TIN PLATED


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Ground point

Location: Base of RH 'A' post

Qualifier: LHD condition illustrated

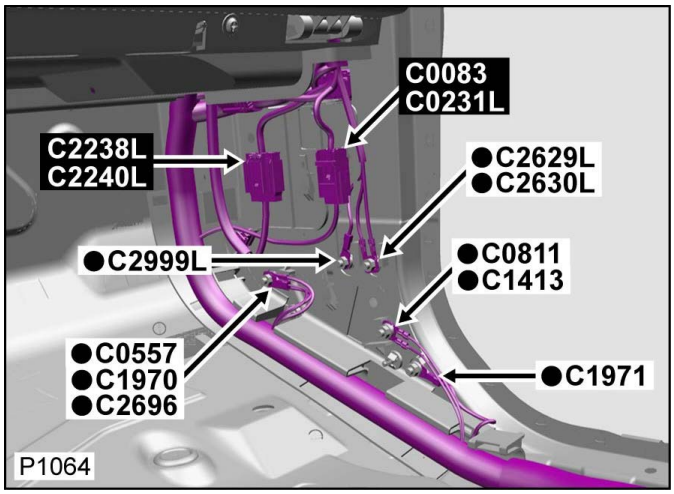


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	216L	C2637L
1	0.5	B	216L	C2992

Click here to print

Connector: C2999R

CONNECTOR HOUSING NOT SERVICEABLE

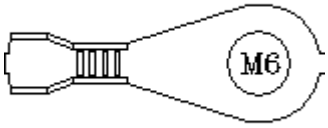

Part No.: YPG800660

Colour: TIN PLATED


Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

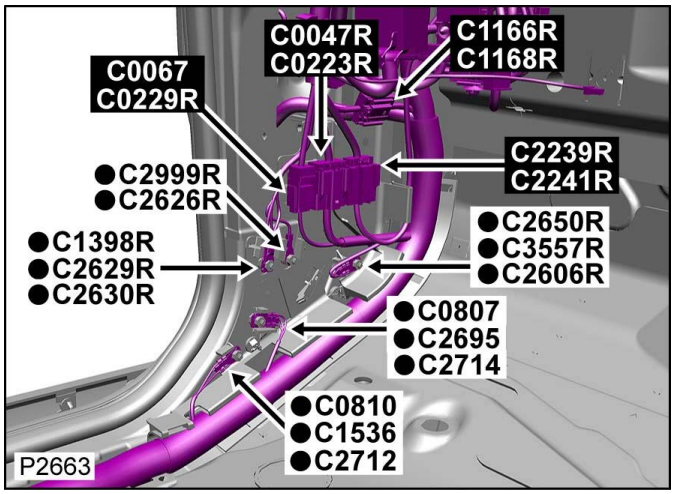


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	216R	C2637R
1	0.5	B	216R	C2992

Click here to print

Connector: C3001

CONNECTOR HOUSING NOT SERVICEABLE

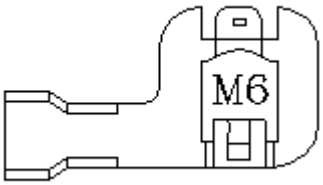

Part No.: YPG900310

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Rear LH side of engine compartment

Qualifier:

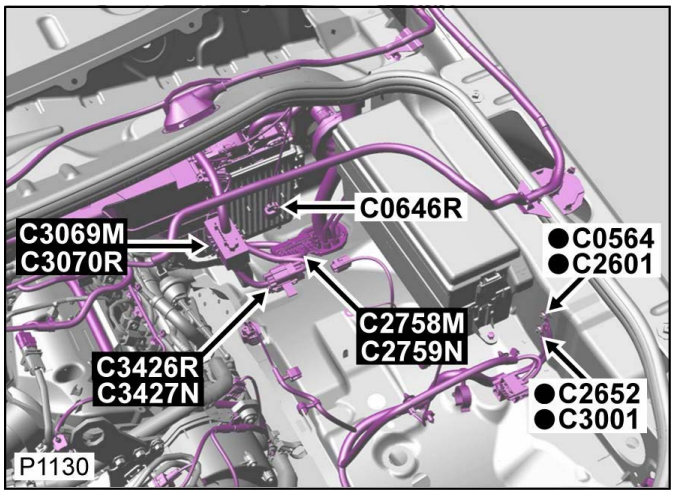


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	B	805	C2270

Click here to print

Connector: C3006

CONNECTOR HOUSING NOT SERVICEABLE

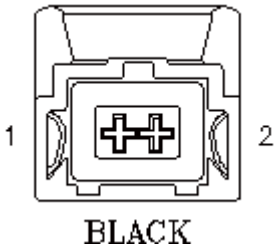

Part No.: YPC909150

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Pump-Supercharge-coolant

Location: Lower RH front of engine compartment

Qualifier:

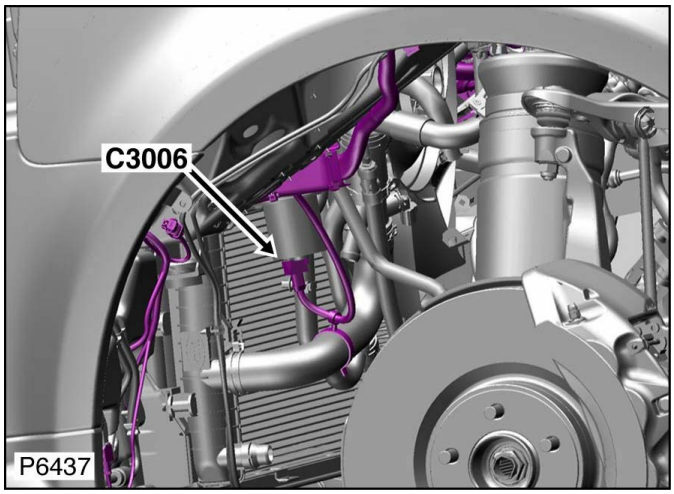


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	374	C2635
2	2.5	WR	374L	C0570L
2	2.5	WR	374R	C0570R

Click here to print

Connector: C3007

CONNECTOR HOUSING NOT SERVICEABLE

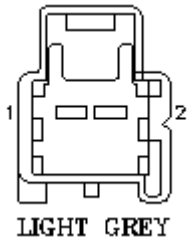

Part No.: YPC908580

Colour: LIGHT GREY


Cavities: 2WY

Harness: CABIN HARNESS

Description: Main harness to main harness

Location: Beneath LH Front seat

Qualifier:

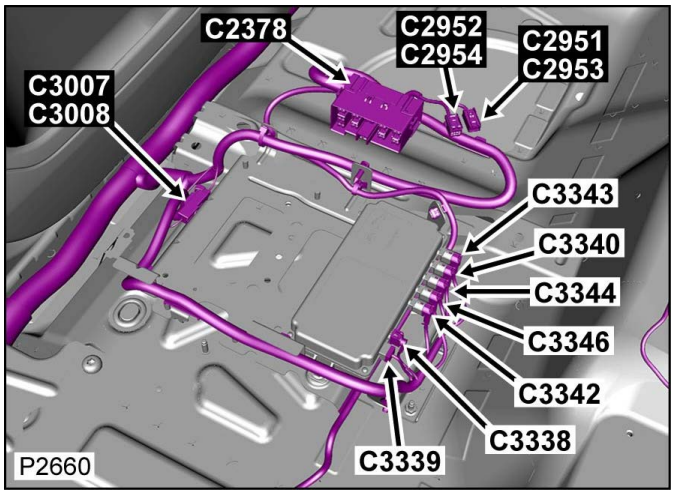


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	BP	41S	C0467	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
2	1.0	WO	41L	C0585L	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
2	1.0	WO	41R	C0585R	418-411-12	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3008

CONNECTOR HOUSING NOT SERVICEABLE

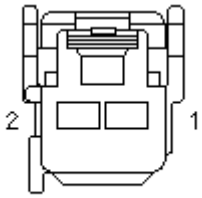

LIGHT GREY

Part No.: YPC910560

Colour: LIGHT GREY


Cavities: 2WY

Harness: CABIN HARNESS

Description: Main harness to main harness

Location: Beneath LH Front seat

Qualifier:

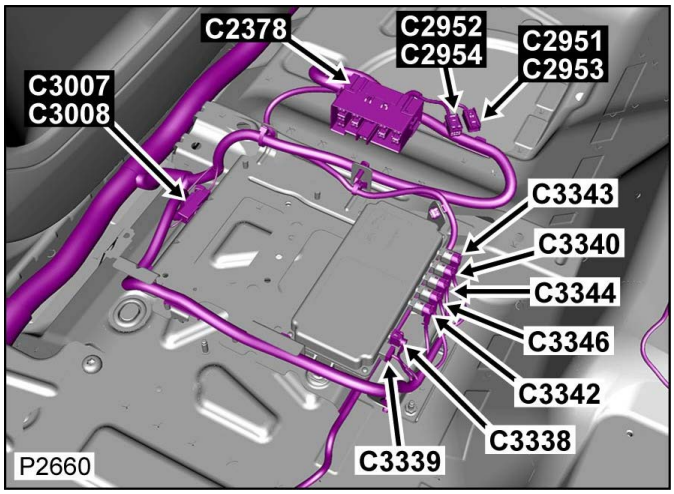

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	BP	41S	S/JOINT SJ256S	-	-	-	-	-	-	-
2	0.75	B	41S	C0383S	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	WO	499T	C2739T	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3009

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC903680

Colour: DARK GREY


Cavities: 12WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to air suspension harness

Location: Front RH side of engine compartment

Qualifier:

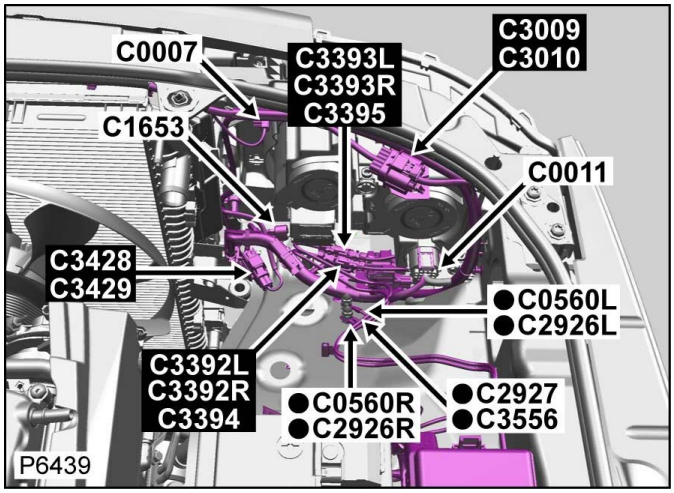

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	BY	419L	C2321L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	1.0	BY	419R	C2321R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	1.0	BG	419L	C2321L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	1.0	BG	419R	C2321R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	1.0	BW	419L	C2321L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	1.0	BW	419R	C2321R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	1.0	BU	419L	C2321L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	1.0	BU	419R	C2321R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	1.0	BP	419L	C2321L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	1.0	BP	419R	C2321R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	1.0	BO	419L	C2321L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	1.0	BO	419R	C2321R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	SY	419L	C2321L	-	-	-	-	-	-	-
7	0.35	SY	419R	C2321R	-	-	-	-	-	-	-
8	0.35	SU	419L	C2321L	-	-	-	-	-	-	-
8	0.35	SU	419R	C2321R	-	-	-	-	-	-	-
9	0.35	SR	419L	C2321L	-	-	-	-	-	-	-
9	0.35	SR	419R	C2321R	-	-	-	-	-	-	-
10	0.75	WR	245L	C2412L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
10	0.75	WR	245R	C2410R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
11	0.75	BR	825R	C0584R	418-411-09	-	418-116A	418-117	418-104	418-112	418-

											107
12	0.75	R	825R	C0584R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3010

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC501050

Colour: DARK GREY


Cavities: 12WY

Harness: AIR SUSPENSION HARNESS

Description: Air suspension harness to engine compartment harness

Location: Front RH side of engine compartment

Qualifier:

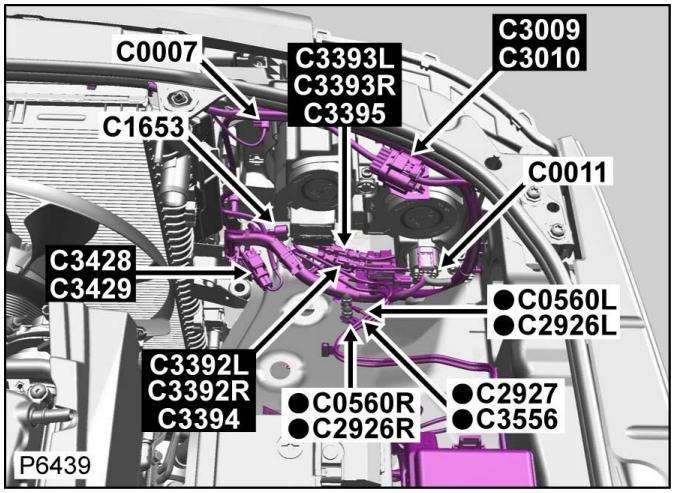


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	BY	419	C2099	-	-	-	-	-	-	-
2	1.0	BG	419	C2099	-	-	-	-	-	-	-
3	1.0	BW	419	C2099	-	-	-	-	-	-	-
4	1.0	BU	419	C2099	-	-	-	-	-	-	-
5	1.0	BP	419	C2099	-	-	-	-	-	-	-
6	1.0	BO	419	C2099	-	-	-	-	-	-	-
7	0.35	SY	809	C1697	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	SY	808	C3430	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	SY	245	C3421	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.35	SU	809	C1697	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.35	SU	808	C3430	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.35	SU	245	C3421	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	SR	809	C1697	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	SR	808	C3430	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	SR	245	C3421	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
10	0.35	WR	245	C3079	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
11	0.75	BR	825	C2038A	-	-	-	-	-	-	-
12	0.75	R	825	C2038A	-	-	-	-	-	-	-

Click here to print

Connector: C3016T

CONNECTOR HOUSING NOT SERVICEABLE

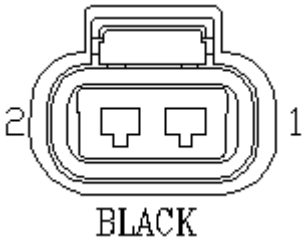

Part No.: YPC911650

Colour: BLACK


Cavities: 2WY

Harness: CABIN HARNESS

Description: Antenna-Loadspace-LHS

Location: Behind luggage compartment carpet LH side

Qualifier:

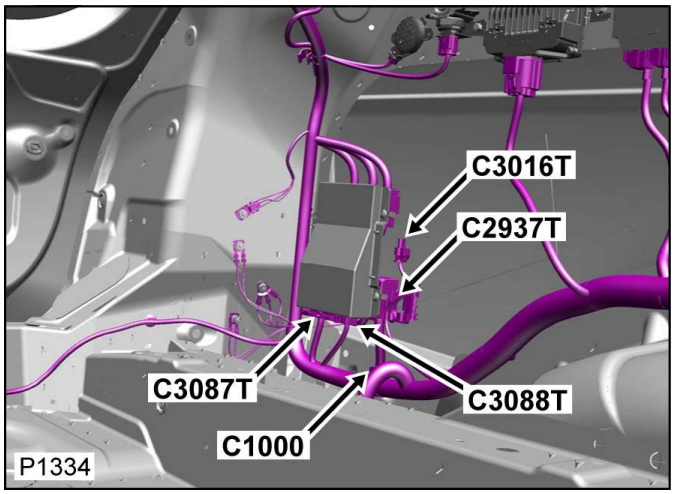


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	BW	810T	C2160T
2	0.35	BO	810T	C2160T

Click here to print

Connector: **C3017T**

CONNECTOR HOUSING NOT SERVICEABLE

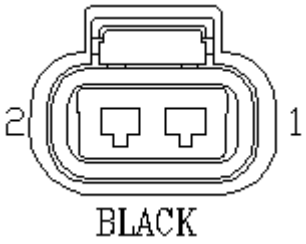

Part No.: YPC911650

Colour: BLACK


Cavities: 2WY

Harness: CABIN HARNESS

Description: Antenna-Loadspace-Center

Location: Rear of luggage compartment - Center

Qualifier:

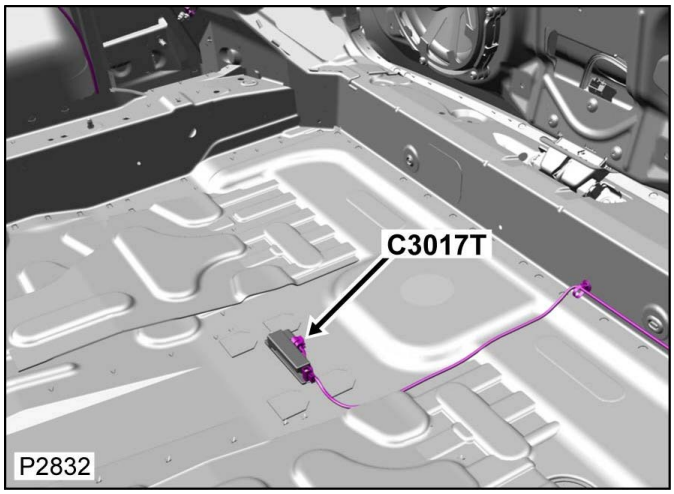


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	OR	810T	C2160T
2	0.35	OS	810T	C2160T

Click here to print

Connector: C3018T

CONNECTOR HOUSING NOT SERVICEABLE

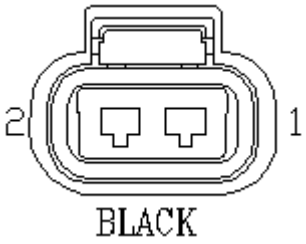

Part No.: YPC911650

Colour: BLACK


Cavities: 2WY

Harness: CABIN HARNESS

Description: Antenna-Rear Cabin-Interior

Location: Beneath rear seat - RH Side

Qualifier:

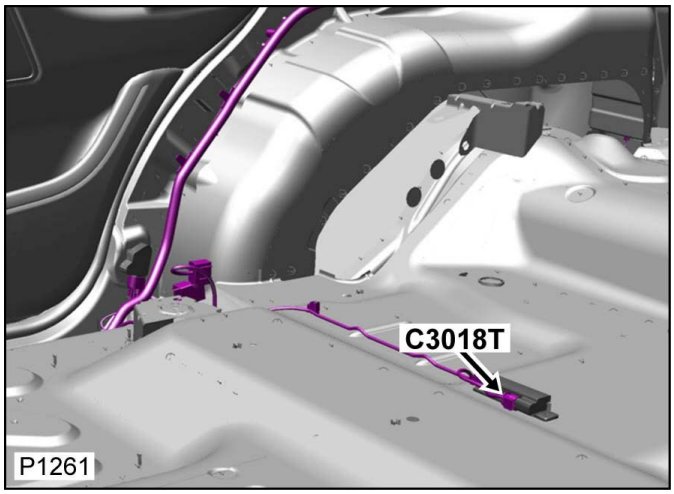


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	SP	810T	C2160T
2	0.35	SY	810T	C2160T

Click here to print

Connector: **C3019TL**

CONNECTOR HOUSING NOT SERVICEABLE

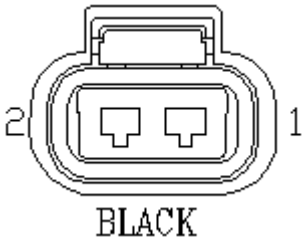

Part No.: YPC911650

Colour: BLACK


Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Description: Antenna-Front Cabin-Interior

Location: Behind heater control panel

Qualifier:

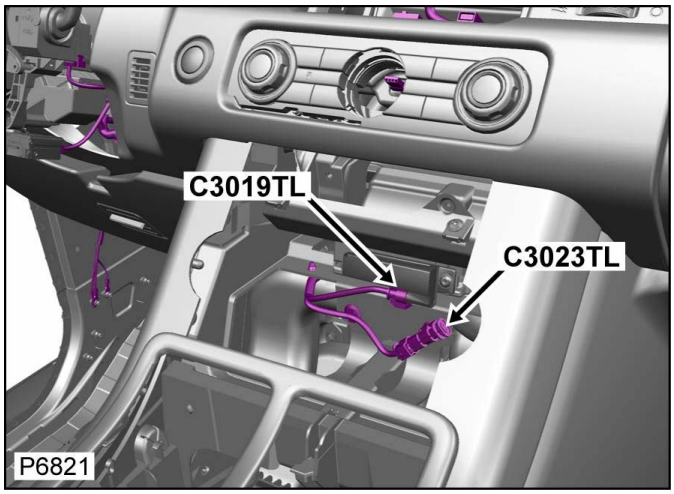


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	UR	139TL	C1167L
2	0.35	RU	139TL	C1167L

Click here to print

Connector: **C3019TR**

CONNECTOR HOUSING NOT SERVICEABLE

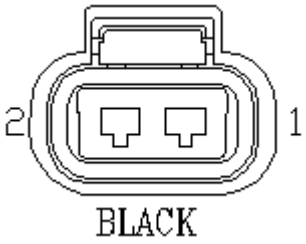

Part No.: YPC911650

Colour: BLACK


Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Description: Antenna-Front Cabin-Interior

Location: Behind heater control panel

Qualifier:

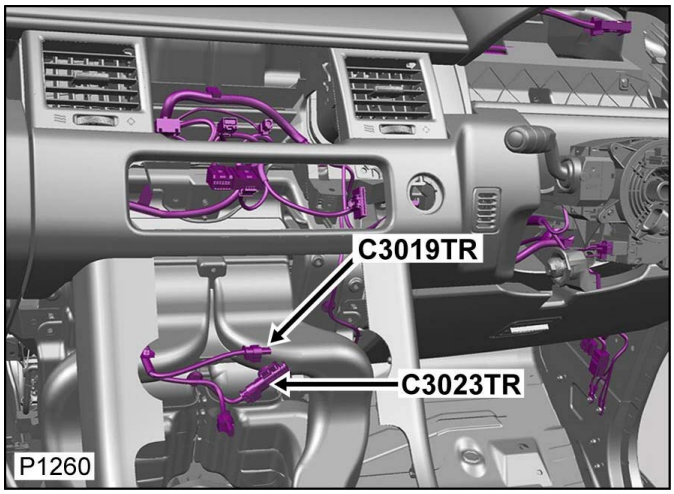


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	UR	200TR	C1167R
2	0.35	RU	200TR	C1167R

Click here to print

Connector: **C3023TL**

CONNECTOR HOUSING NOT SERVICEABLE

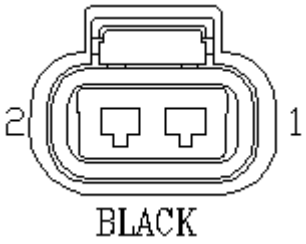

Part No.: YPC911650

Colour: BLACK


Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Description: Center console antenna-Front

Location: Behind heater control panel

Qualifier:

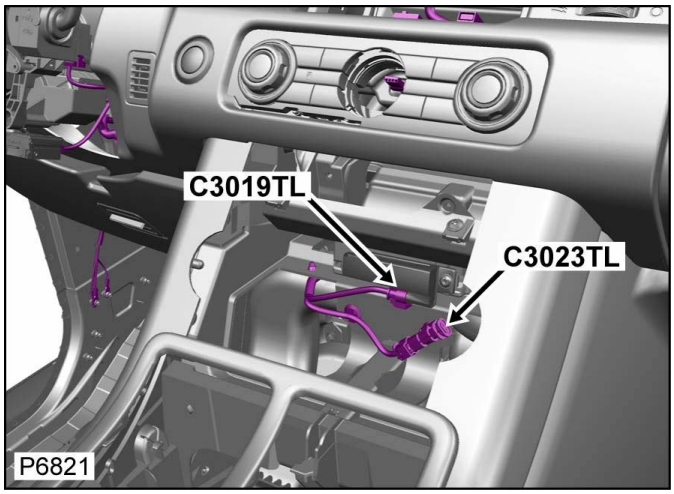


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	UR	139TL	C1167L
2	0.35	RU	139TL	C1167L

Click here to print

Connector: **C3023TR**

CONNECTOR HOUSING NOT SERVICEABLE

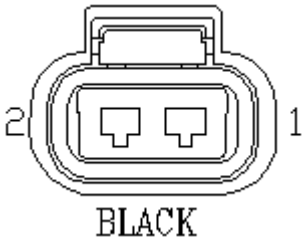

Part No.: YPC911650

Colour: BLACK


Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Description: Center console antenna-Front

Location: Behind heater control panel

Qualifier:

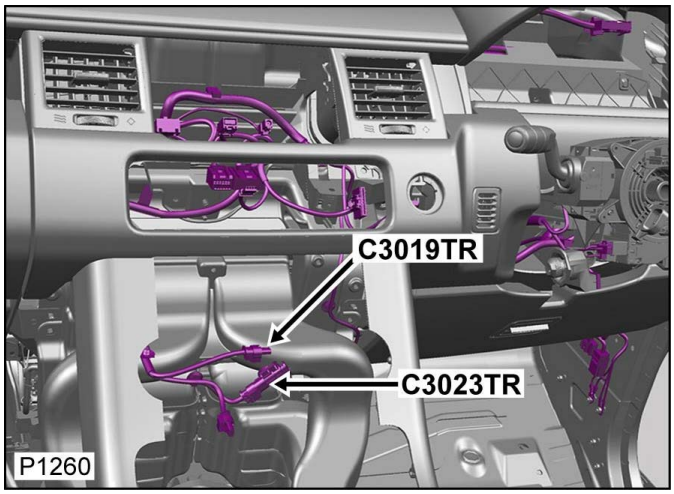


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	UR	200TR	C1167R
2	0.35	RU	200TR	C1167R

Click here to print

Connector: C3025

CONNECTOR HOUSING NOT SERVICEABLE

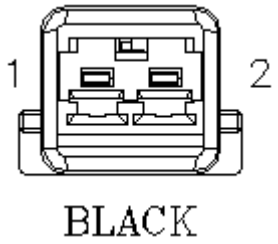

BLACK

Part No.: YPC801160

Colour: BLACK


Cavities: 2WY

Harness: SEAT FRONT HARNESS

Description: Seat harness to main harness

Location: Beneath front seat

Qualifier:

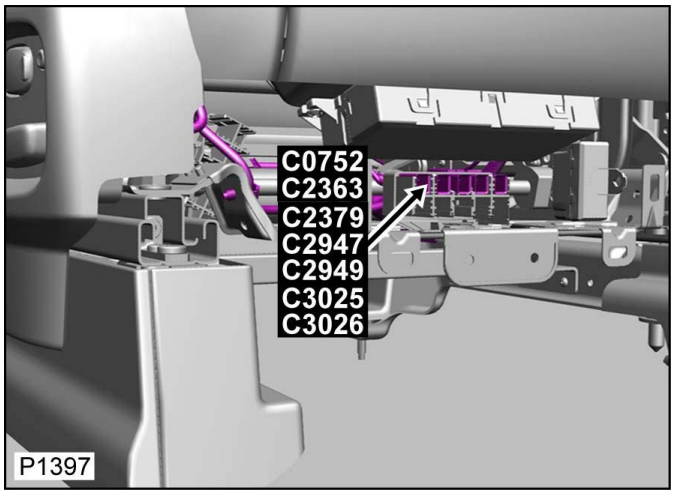


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	NP	207	C2381	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
1	1.5	NP	439	S/JOINT SJ1	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	B	207	S/JOINT SJ151	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	B	439	C0773	418-411-16	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C3026

CONNECTOR HOUSING NOT SERVICEABLE

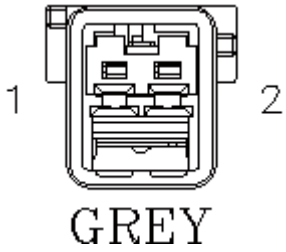

Part No.: YPC801170

Colour: GREY


Cavities: 2WY

Harness: SEAT FRONT HARNESS

Description: Seat harness to main harness

Location: Beneath front seat

Qualifier:

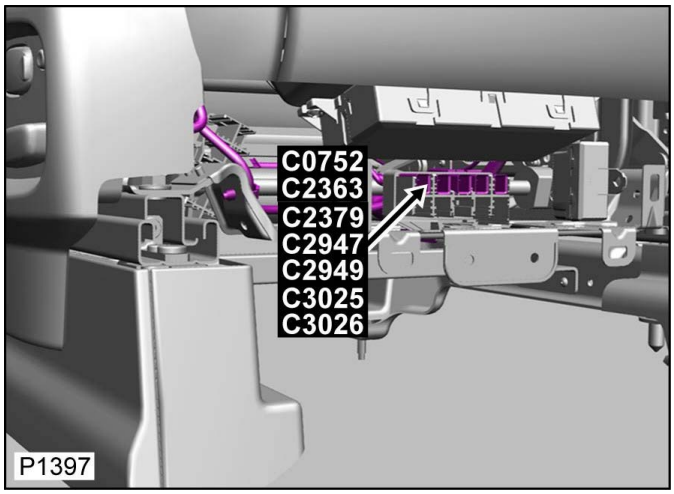


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GK	207	S/JOINT SJ998	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	GK	439	C0773	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	207	C2382	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
2	1.5	B	439	S/JOINT SJ151	418-411-65	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C3029L**

CONNECTOR HOUSING SERVICEABLE

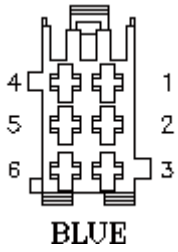

Part No.: YPC114160

Colour: BLUE


Cavities: 6WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Module-Control-Transfer case

Location: Driver side of engine compartment

Qualifier:

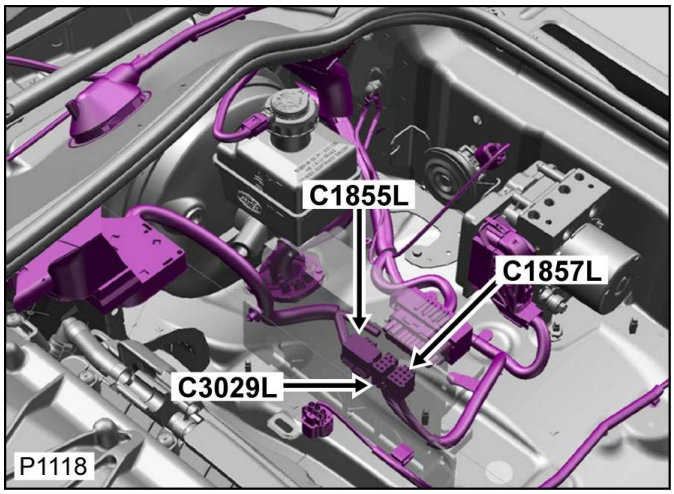


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	YB	139L	S/JOINT SJ776	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
3	0.75	R	139L	S/JOINT SJ242	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	YN	139L	S/JOINT SJ786	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
5	2.5	B	139L	S/JOINT SJ248	418-549-57	-	418-116A	418-117	418-104	418-113	418-108
6	2.5	PU	139L	S/JOINT SJ245	418-549-57	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: **C3029R**

CONNECTOR HOUSING SERVICEABLE

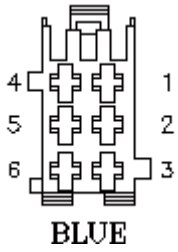

Part No.: YPC114160

Colour: BLUE


Cavities: 6WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Module-Control-Transfer case

Location: RH side of engine compartment

Qualifier: RHD condition illustrated

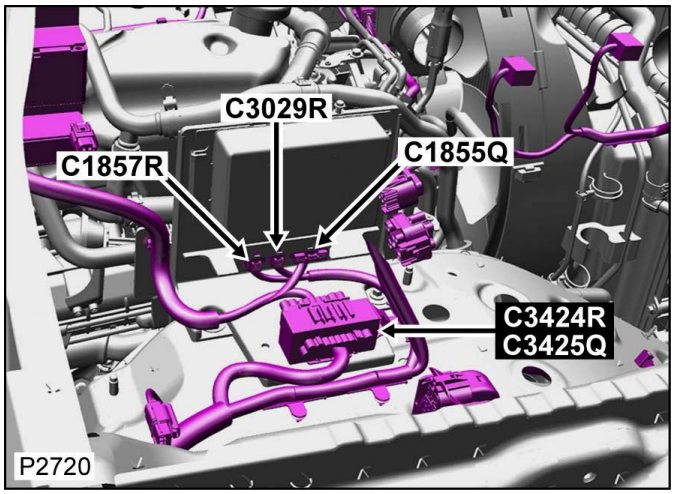

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	YB	200R	S/JOINT SJ1776	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
3	0.75	R	200R	S/JOINT SJ1242	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	YN	200R	S/JOINT SJ1786	418-549-55	-	418-116A	418-117	418-104	418-112	418-107
5	2.5	B	200R	S/JOINT SJ1248	418-549-57	-	418-116A	418-117	418-104	418-113	418-108
6	2.5	PU	200R	S/JOINT SJ1245	418-549-57	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: **C3030**

CONNECTOR HOUSING SERVICEABLE



Part No.: YPC901010

Colour: LIGHT GREY


Cavities: 2WY

Harness: SEAT FRONT HARNESS

Description: Seat harness to seat link harness

Location: Beneath front passenger seat

Qualifier:

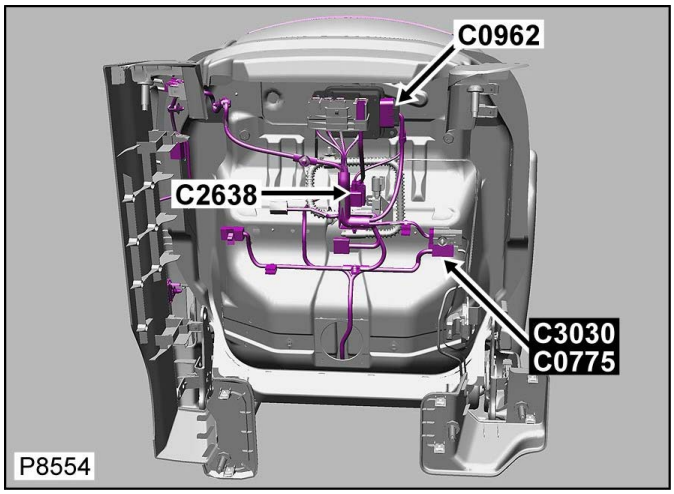


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	N	439	C0773	418-587-10	-	418-116A	418-117	-	418-112	418-107
2	1.5	N	439	C0773	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: **C3034L**

CONNECTOR HOUSING SERVICEABLE

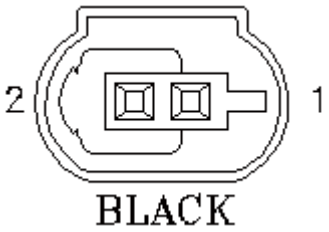

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Relay-Transit

Location: Rear RH side of engine compartment

Qualifier:

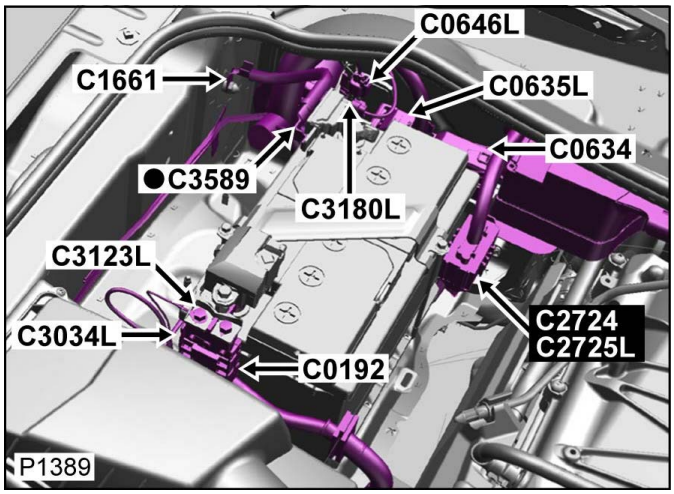


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	LGR	139L	S/JOINT SJ3	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	139L	S/JOINT SJ173	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C3034R**

CONNECTOR HOUSING SERVICEABLE

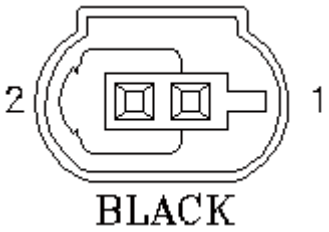

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Relay-Transit

Location: Rear LH side of engine compartment

Qualifier:

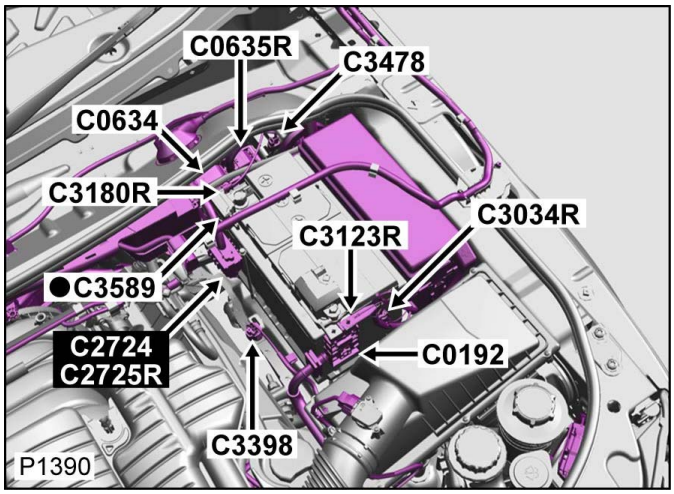


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	LGR	200R	S/JOINT SJ1003	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	200R	S/JOINT SJ171	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3046

CONNECTOR HOUSING NOT SERVICEABLE

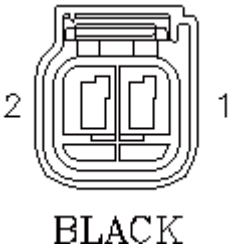

Part No.: YPC901710

Colour: BLACK


Cavities: 2WY

Harness: KNOCK SENSORS PETROL HARNESS

Description: Sensor-Knock-Bank 2-Front

Location: Top of engine - LH side

Qualifier:

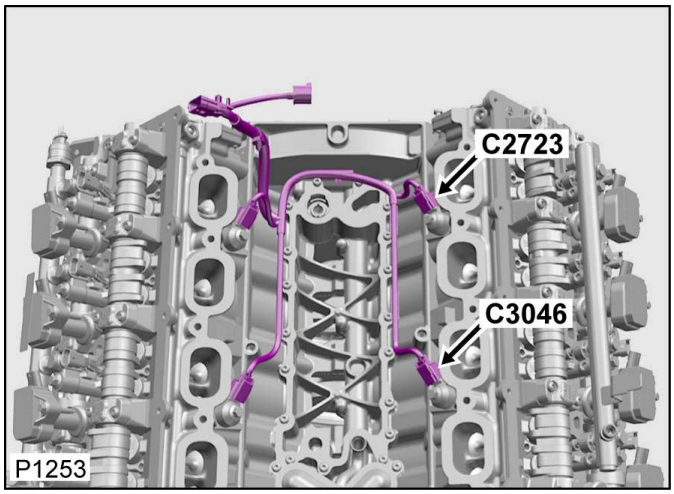


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	NU	ALL	C0904	418-411-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	NG	ALL	C0904	418-411-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3049

CONNECTOR HOUSING NOT SERVICEABLE

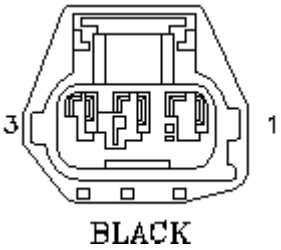

Part No.: YPC500530

Colour: BLACK


Cavities: 3WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Water in fuel sensor

Location: Beneath rear of vehicle RH side

Qualifier:

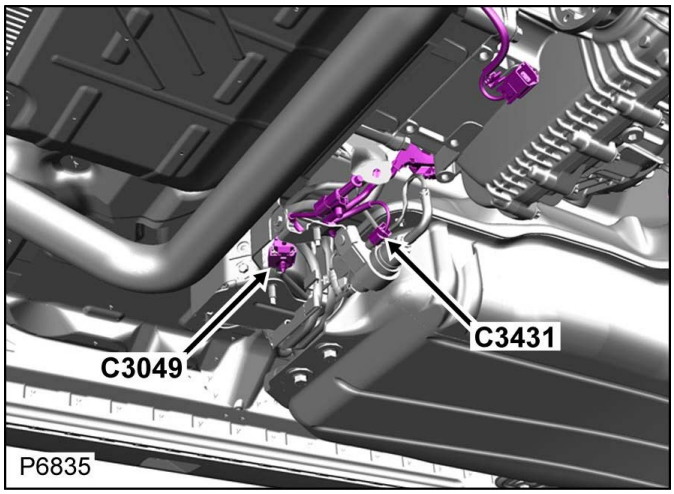


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	P	993L	C3427M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	P	993R	C3427N	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	UN	993L	C3427M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	UN	993R	C3427N	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	WO	993L	C3427M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	WO	993R	C3427N	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3049A

CONNECTOR HOUSING NOT SERVICEABLE

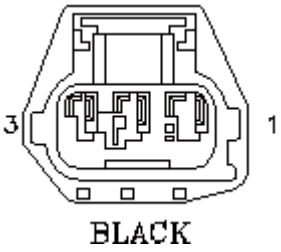

BLACK

Part No.: YPC500530

Colour: BLACK


Cavities: 3WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Water in fuel sensor

Location: RH side of transfer box

Qualifier:

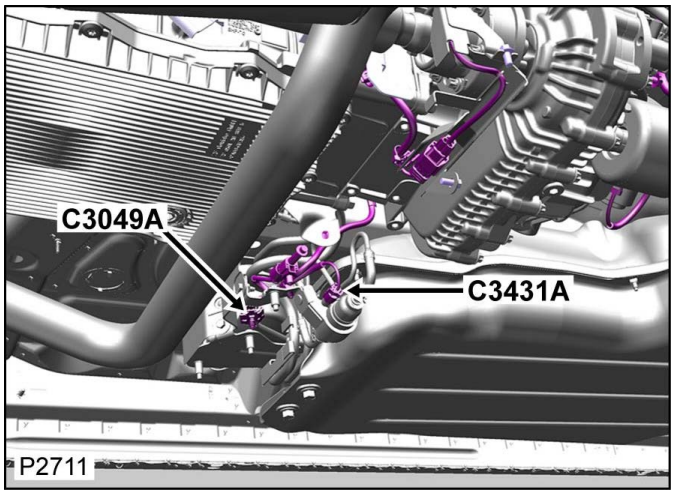

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	P	982L	C3427P	-	-	-	-	-	-	-
1	1.0	P	982R	C3427Q	-	-	-	-	-	-	-
2	0.5	UN	982L	C3427P	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	UN	982R	C3427Q	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	WO	982L	C3427P	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	WO	982R	C3427Q	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C3050


CONNECTOR HOUSING NOT SERVICEABLE

Description: Sensor-Oil temperature-level

Location: LH side of engine

Qualifier:

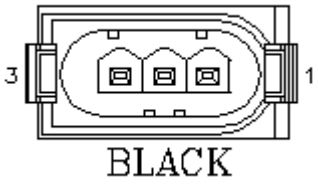

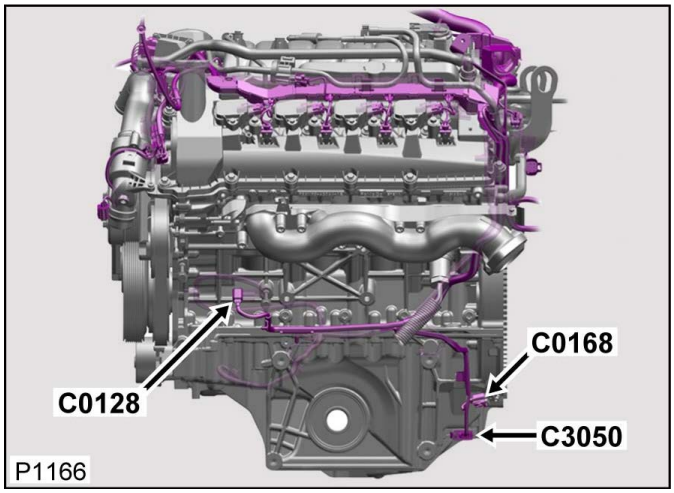

Part No.: YPC911380

Colour: BLACK

Cavities: 3WY

Harness: ENGINE PETROL AJ133 HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	BO	ALL	S/JOINT PIS15
2	0.5	SY	ALL	C0634
3	0.5	UO	ALL	C0634

Click here to print


Connector: C3050M


CONNECTOR HOUSING NOT SERVICEABLE

Description: Sensor-Oil quality and level

Location: RH side of engine

Qualifier:

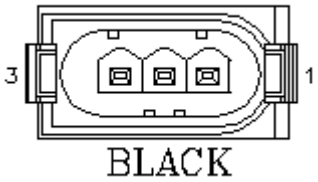

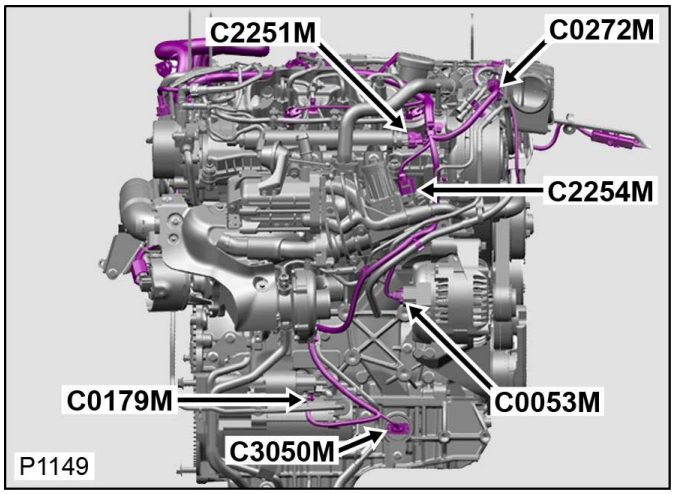

Part No.: YPC911380

Colour: BLACK

Cavities: 3WY

Harness: ENGINE DIESEL 3.0L HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	OB	798	C3069M
2	0.75	SY	798	C0659M
3	0.75	UO	798	C0659M

Click here to print

Connector: **C3058L**

CONNECTOR HOUSING SERVICEABLE



Part No.: YPC801290

Colour: LIGHT GREY


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to link harness

Location: Inside engine junction box

Qualifier:

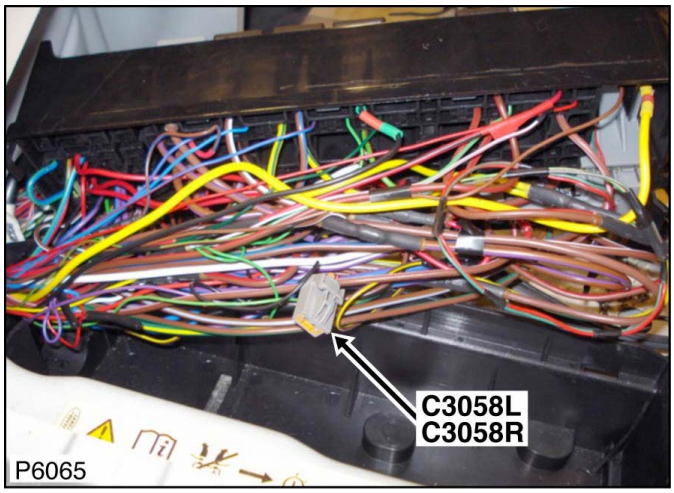

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	O	377L	C0570L	418-587-10	-	418-116A	418-117	-	418-112	418-107
2	0.5	YG	377L	S/JOINT SJ12	418-411-46	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C3058R**

CONNECTOR HOUSING SERVICEABLE



Part No.: YPC801290

Colour: LIGHT GREY


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to link harness

Location: Rear LH side of engine compartment

Qualifier:

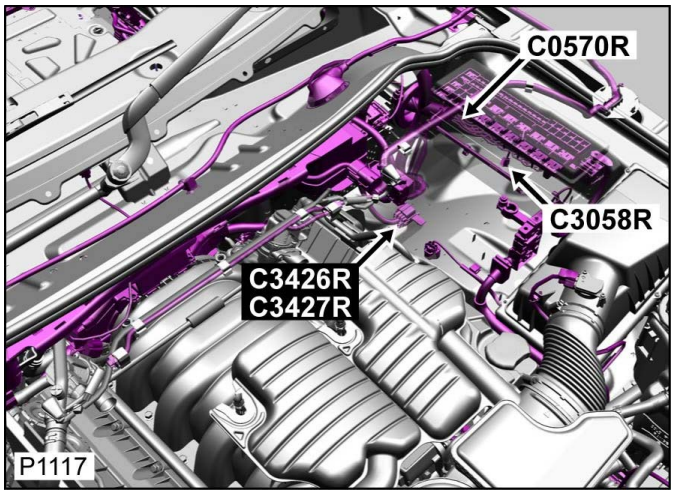

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	O	377R	C0570R	418-587-10	-	418-116A	418-117	-	418-112	418-107
2	0.5	YG	377R	S/JOINT SJ1012	418-411-46	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C3069M


CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine harness to engine compartment harness

Location: Rear LH side of engine compartment

Qualifier:

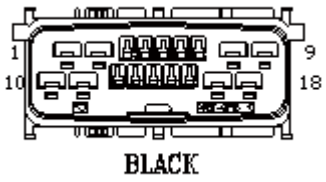

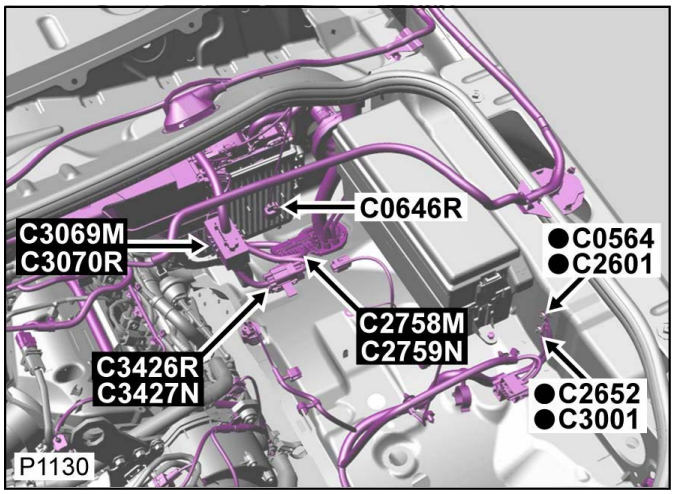

Part No.: YPC909660

Colour: BLACK

Cavities: 18WY

Harness: ENGINE DIESEL 3.0L HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	SO	798	C0179M	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
2	0.5	OU	798	C3417M	-	-	-	-	-	-	-
3	0.5	OY	798	C3417M	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
4	0.75	UN	798	C0053M	-	-	-	-	-	-	-
6	0.75	OB	798	C0659M	-	-	-	-	-	-	-
8	0.75	PW	798	C0182	-	-	-	-	-	-	-
9	1.0	PW	798	C0999M	-	-	-	-	-	-	-
10	0.75	OB	798	C3050M	-	-	-	-	-	-	-
11	0.5	O	798	C3417M	-	-	-	-	-	-	-
12	0.75	OS	798	S/JOINT SJ1	-	-	-	-	-	-	-
14	1.0	OW	798	S/JOINT SJ11	-	-	-	-	-	-	-
16	0.75	S	798	C0187M	-	-	-	-	-	-	-
17	1.0	BG	798	C0999M	-	-	-	-	-	-	-

Click here to print

Connector: C3070L

CONNECTOR HOUSING NOT SERVICEABLE

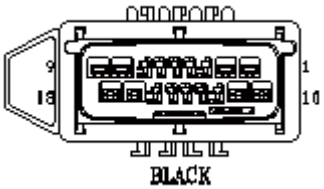

Part No.: YPC909600

Colour: BLACK


Cavities: 18WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to engine harness

Location: Passenger side of engine compartment

Qualifier:

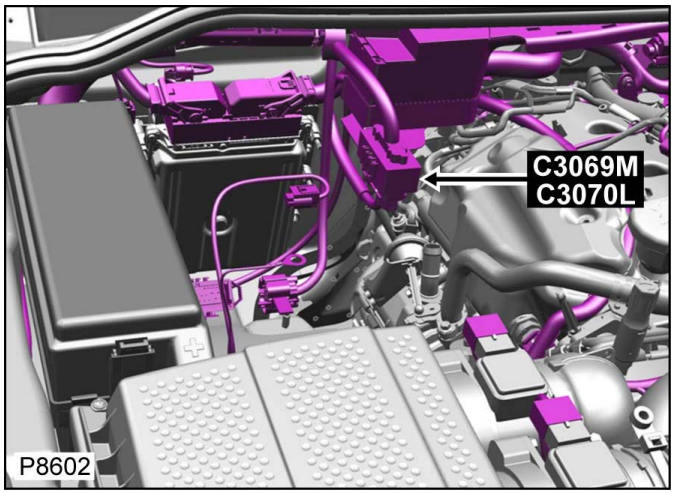

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	R	798L	C0570L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
2	0.5	YG	798L	S/JOINT SJ865	-	-	-	-	-	-	-
3	0.5	YG	798L	C0658L	-	-	-	-	-	-	-
4	0.5	UN	798L	C0658L	-	-	-	-	-	-	-
8	1.5	WR	798L	C0570L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
9	0.5	S	798L	C2240L	-	-	-	-	-	-	-
10	0.75	BN	798L	S/JOINT SJ630	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	OY	798L	S/JOINT SJ864	-	-	-	-	-	-	-
12	0.75	RU	798L	S/JOINT SJ511	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
14	1.0	U	798L	S/JOINT SJ933	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
16	0.75	S	798L	C0584L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
17	0.5	W	798L	C2240L	-	-	-	-	-	-	-

Click here to print


Connector: C3070R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Engine compartment harness to engine harness

Location: Rear LH side of engine compartment

Qualifier:

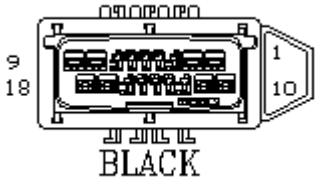

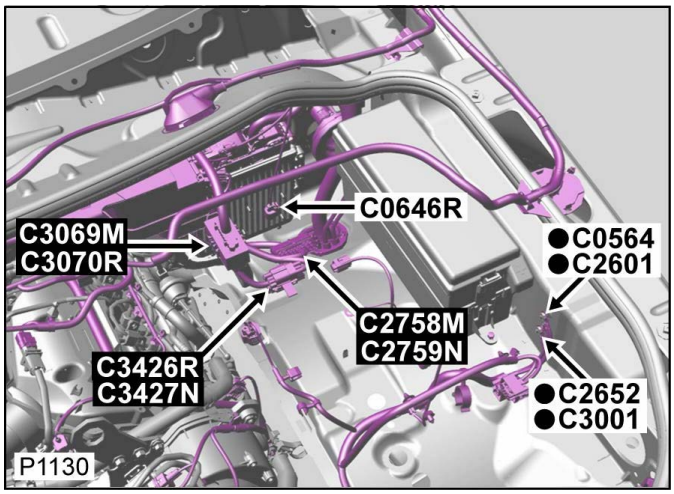

Part No.: YPC909630

Colour: BLACK

Cavities: 18WY

Harness: ENGINE COMPARTMENT HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	R	798R	C0570R	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
2	0.5	YG	798R	S/JOINT SJ1865	-	-	-	-	-	-	-
3	0.5	YG	798R	C0658R	-	-	-	-	-	-	-
4	0.5	UN	798R	C0658R	-	-	-	-	-	-	-
8	1.5	WR	798R	C0570R	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
9	0.5	S	798R	C2240R	-	-	-	-	-	-	-
10	0.75	BN	798R	S/JOINT SJ630	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	OY	798R	S/JOINT SJ1864	-	-	-	-	-	-	-
12	0.75	RU	798R	S/JOINT SJ511	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
14	1.0	U	798R	S/JOINT SJ1933	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
16	0.75	S	798R	C0584R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
17	0.5	W	798R	C2240R	-	-	-	-	-	-	-

Click here to print

Connector: **C3073A**

CONNECTOR HOUSING SERVICEABLE

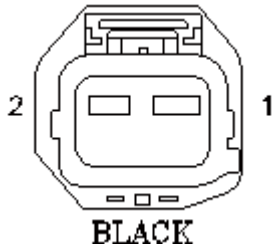

Part No.: YPC500550

Colour: BLACK


Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Temperature-Catalytic converter-Downstream

Location: LH side of transfer box

Qualifier:

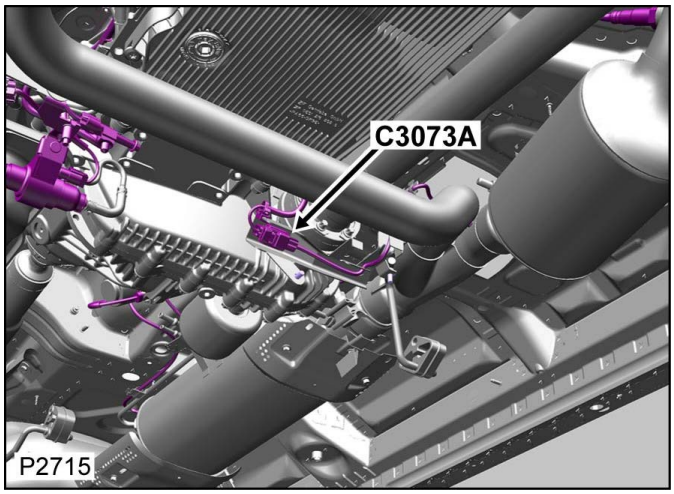


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	YS	983L	C2759P	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	YS	983R	C2759Q	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	PN	983L	C2759P	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	PN	983R	C2759Q	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C3073H**

CONNECTOR HOUSING SERVICEABLE

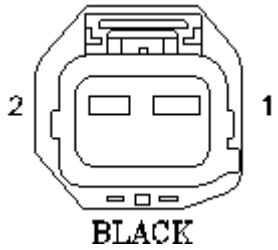

Part No.: YPC500550

Colour: BLACK


Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Temperature-Catalytic converter-Downstream

Location: LH side of gearbox

Qualifier:

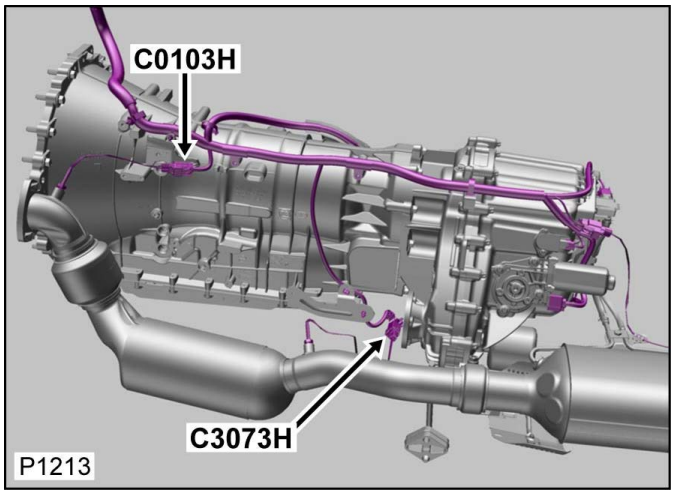


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WG	819L	C2759H	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	WG	819R	C2759J	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	NW	819L	S/JOINT SJ6806	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	NW	819R	S/JOINT SJ6806	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C3073M**

CONNECTOR HOUSING SERVICEABLE

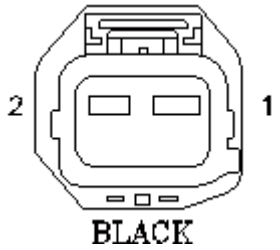

Part No.: YPC500550

Colour: BLACK


Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Catalyst

Location: LH side of gearbox

Qualifier:

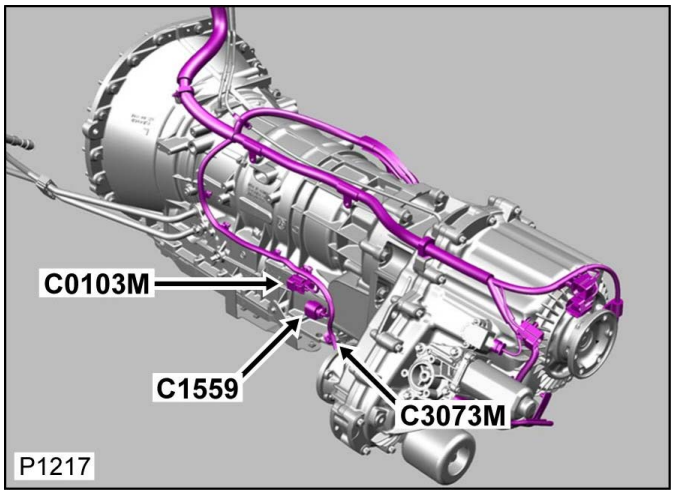

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	YS	991L	C2759M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	YS	991R	C2759N	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	PR	991L	C2759M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	PR	991R	C2759N	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C3078


CONNECTOR HOUSING NOT SERVICEABLE

Description: Solenoid-Damper-Front-LH

Location: LH suspension turret

Qualifier:

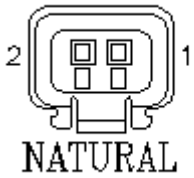

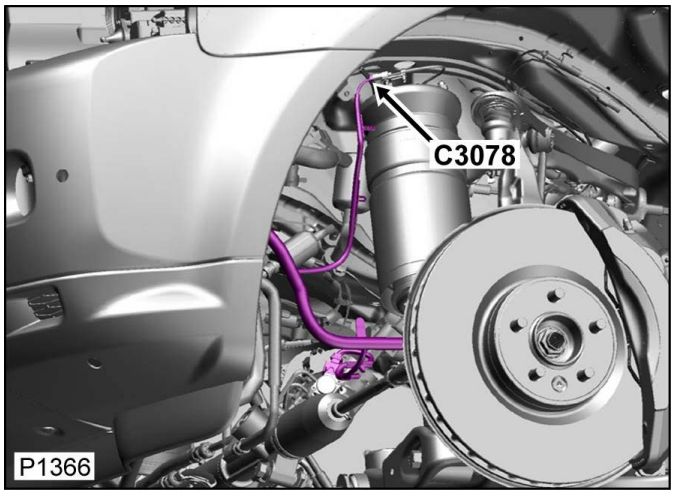

Part No.: YPC803430

Colour: NATURAL

Cavities: 2WY

Harness: CHASSIS HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	RW	245	C0391
2	0.35	WR	245	C0391

Click here to print


Connector: C3079


CONNECTOR HOUSING NOT SERVICEABLE

Description: Solenoid-Damper-Front-RH

Location: Below RH front wheelarch

Qualifier:

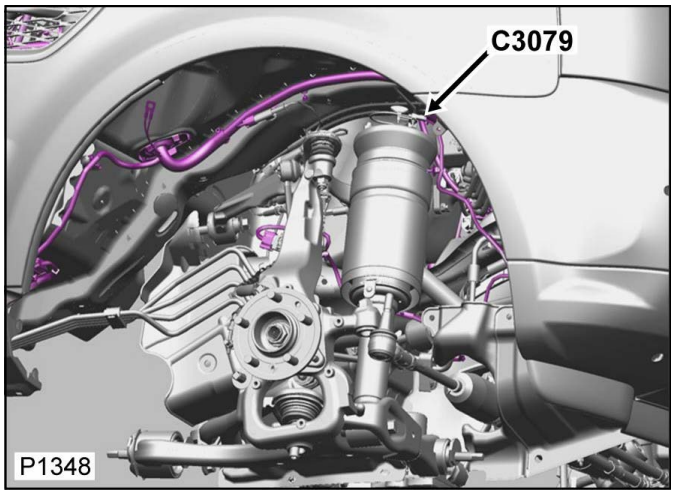

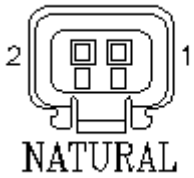

Part No.: YPC803430

Colour: NATURAL

Cavities: 2WY

Harness: AIR SUSPENSION HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	RW	245	C3429
2	0.35	WR	245	C3010

Click here to print

Connector: C3080

CONNECTOR HOUSING NOT SERVICEABLE

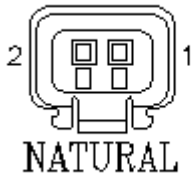

Part No.: YPC803430

Colour: NATURAL


Cavities: 2WY

Harness: CHASSIS HARNESS

Description: Solenoid-Damper-Rear-LH

Location: Below LH rear wheelarch

Qualifier:

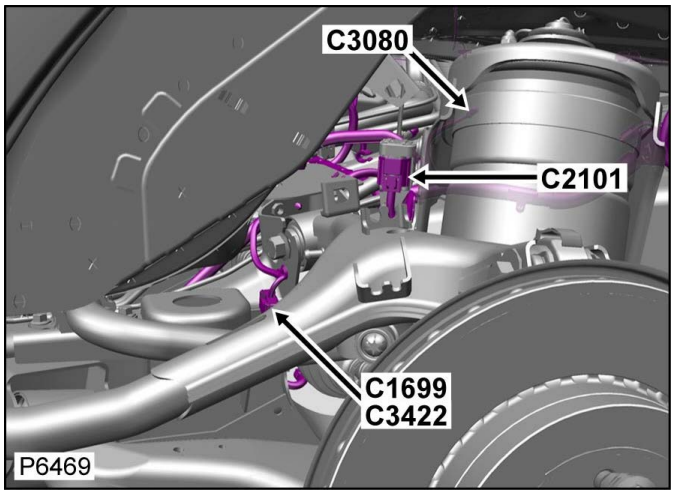


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	RW	245	C0391
2	0.35	WR	245	C0391

Click here to print

Connector: C3081

CONNECTOR HOUSING NOT SERVICEABLE

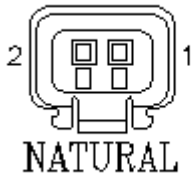

Part No.: YPC803430

Colour: NATURAL


Cavities: 2WY

Harness: CHASSIS HARNESS

Description: Solenoid-Damper Rear-RH

Location: Beneath rear of vehicle RH side

Qualifier:

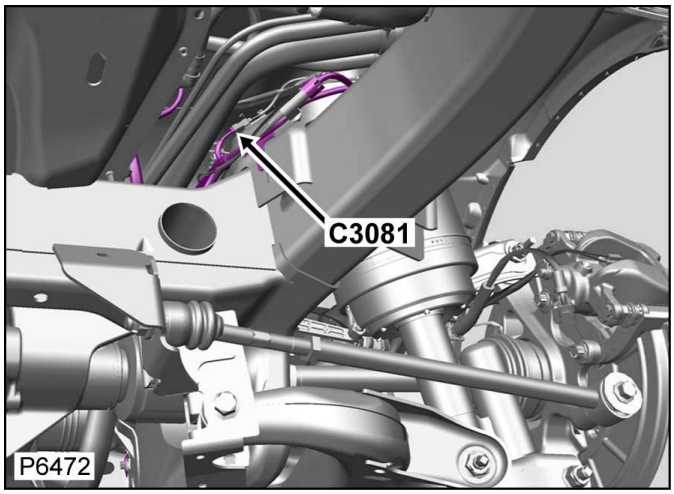

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	RW	245	C0391
2	0.35	WR	245	C0391

Click here to print


Connector: **C3087T**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Damping-Continuously variable

Location: Behind luggage compartment carpet LH side

Qualifier:

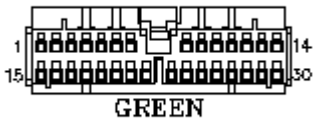

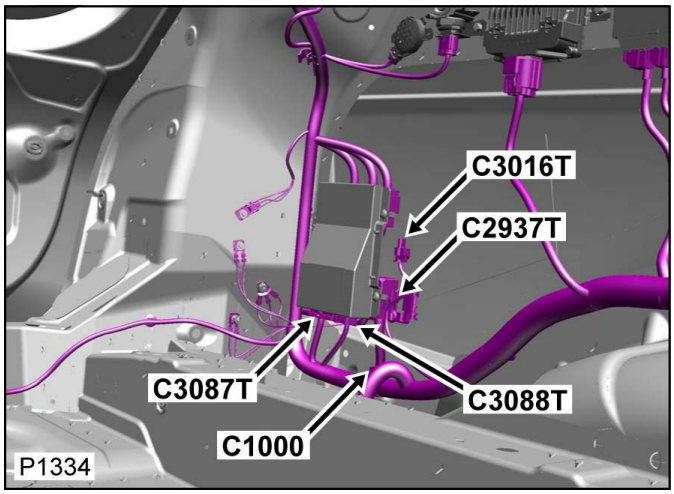

Part No.: YPC106500

Colour: GREEN

Cavities: 30WY

Harness: CABIN HARNESS

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	WR	245T	C0377T	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.75	RW	245T	C0377T	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.75	WR	245T	C0377T	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.75	RW	245T	C0377T	418-587-02	-	418-116A	418-117	-	418-112	418-107
6	0.75	RW	245T	C0377T	418-587-02	-	418-116A	418-117	-	418-112	418-107
7	0.75	WR	245T	C0377T	418-587-02	-	418-116A	418-117	-	418-112	418-107
8	0.75	WR	245TL	C2411L	418-587-02	-	418-116A	418-117	-	418-112	418-107
8	0.75	WR	245TR	C2409R	418-587-02	-	418-116A	418-117	-	418-112	418-107
9	0.75	RW	245TL	C2411L	418-587-02	-	418-116A	418-117	-	418-112	418-107
9	0.75	RW	245TR	C2409R	418-587-02	-	418-116A	418-117	-	418-112	418-107
10	0.35	BR	245TL	C2243L	418-587-02	-	418-116A	418-117	-	418-112	418-107
10	0.35	BR	245TR	C2409R	418-587-02	-	418-116A	418-117	-	418-112	418-107
12	0.35	BR	245T	C0377T	418-587-02	-	418-116A	418-117	-	418-112	418-107
13	0.35	BU	245T	S/JOINT SJ248T	418-587-02	-	418-116A	418-117	-	418-112	418-107
14	0.35	BR	245T	C0377T	418-587-02	-	418-116A	418-117	-	418-112	418-107
15	0.35	YB	245T	S/JOINT SJ1012T	418-587-02	-	418-116A	418-117	-	418-112	418-107
16	0.35	YN	245T	S/JOINT SJ1011T	418-587-02	-	418-116A	418-117	-	418-112	418-107
17	0.35	BR	245T	C1773T	418-587-02	-	418-116A	418-117	-	418-112	418-107

19	0.35	BY	245T	S/JOINT SJ249T	418-587-02	-	418-116A	418-117	-	418-112	418-107
22	0.35	BR	245T	C3433T	418-587-02	-	418-116A	418-117	-	418-112	418-107
23	0.35	BW	245T	S/JOINT SJ251T	418-587-02	-	418-116A	418-117	-	418-112	418-107
25	0.35	BG	245T	S/JOINT SJ250T	418-587-02	-	418-116A	418-117	-	418-112	418-107
27	0.35	BR	245TL	C2242L	418-587-02	-	418-116A	418-117	-	418-112	418-107
27	0.35	BR	245TR	C0047R	418-587-02	-	418-116A	418-117	-	418-112	418-107
28	0.35	BR	245T	C0377T	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: **C3088T**

CONNECTOR HOUSING NOT SERVICEABLE

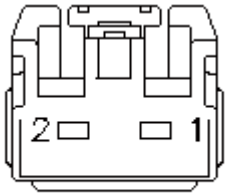

GREY

Part No.: YPC909710

Colour: GREY


Cavities: 2WY

Harness: CABIN HARNESS

Description: Module-Damping-Continuously variable

Location: Behind luggage compartment carpet LH side

Qualifier:

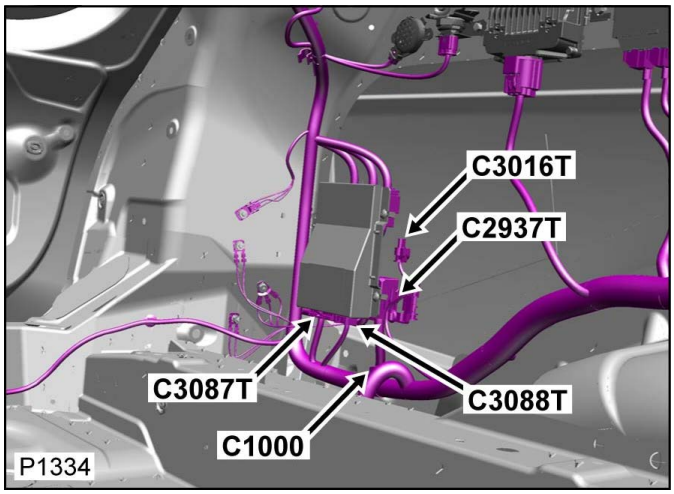

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	PO	245TL	C2242L	418-411-53	-	418-116A	418-117	418-104	418-113	418-108
1	1.5	PO	245TR	C2242R	418-411-53	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	B	245T	C2568T	418-411-53	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C3092T


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to ICE link harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

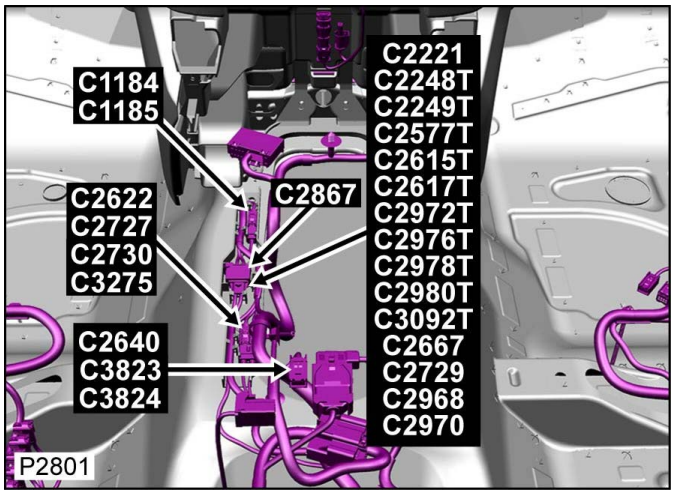

Part No.: XUD812750

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	866T	C2102T
2	POF	O	866T	C2106

Click here to print

Connector: **C3095**

CONNECTOR HOUSING SERVICEABLE

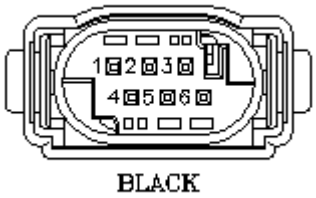

BLACK

Part No.: YPC803260

Colour: BLACK


Cavities: 6WY

Harness: CHASSIS HARNESS

Description: Sensor-Height-Front-LH

Location: Below LH front wheelarch

Qualifier:

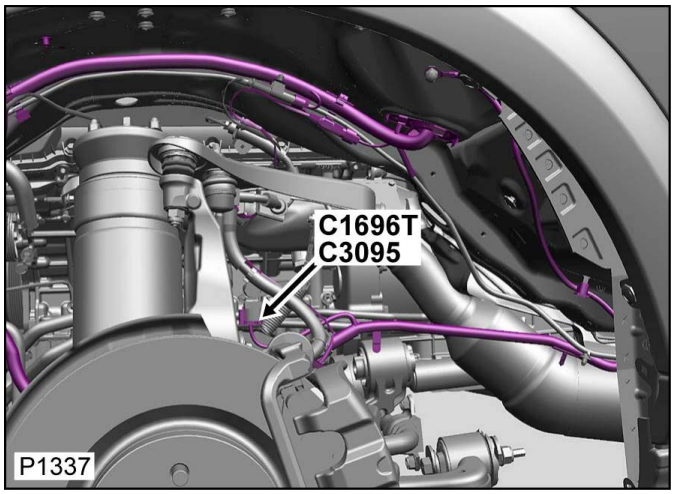


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	SB	245	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	BY	245	C0391	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	BU	245	C0391	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	SO	245	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	SG	245	C2294T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	BR	245	C0391	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3097

CONNECTOR HOUSING NOT SERVICEABLE

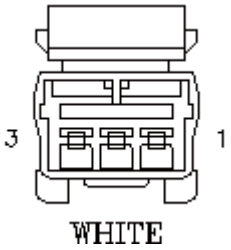

Part No.: YPC10272

Colour: WHITE


Cavities: 3WY

Harness: SEAT REAR HARNESS

Description: Heater-Seat backrest-Rear-RH

Location: Beneath rear seat

Qualifier:

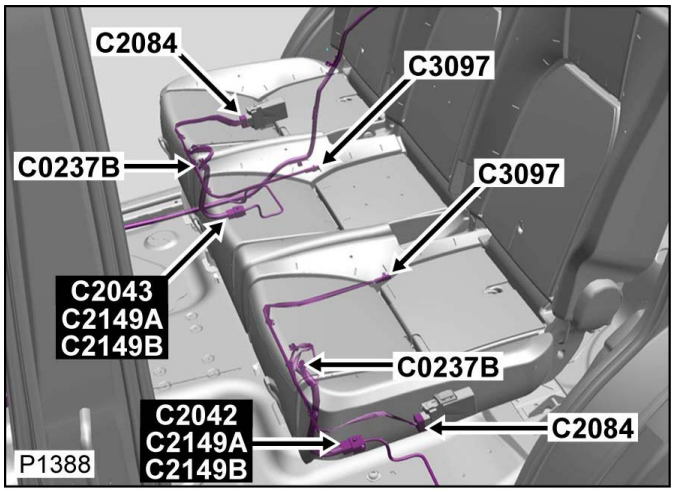


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	KW	572	C0237B	418-549-64	-	418-116A	-	418-104	418-112	418-107
3	1.5	UK	572	C2084	418-549-64	-	418-116A	-	418-104	418-112	418-107

Click here to print

Connector: **C3110**

CONNECTOR HOUSING NOT SERVICEABLE

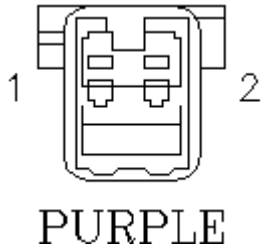

Part No.: YPC800260

Colour: PURPLE


Cavities: 2WY

Harness: SEAT ASSEMBLIES HARNESS

Description: Sensor-Seat position-Driver

Location: Beneath front seat

Qualifier:

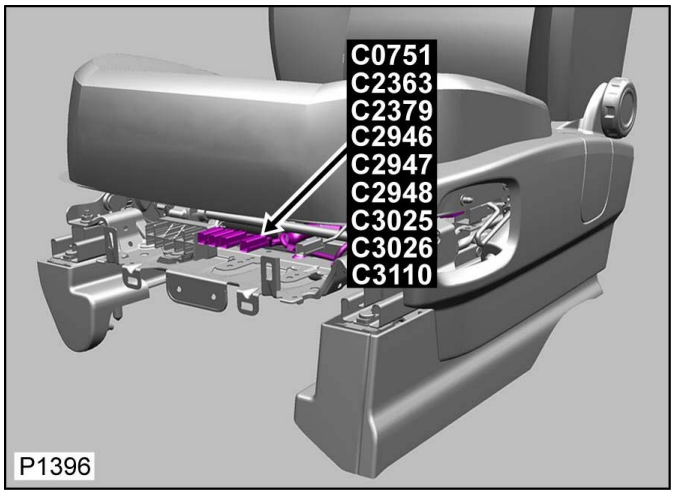


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	NB	216	C2919
2	0.5	LG	216	C2919

Click here to print

Connector: C3123L

CONNECTOR HOUSING NOT SERVICEABLE

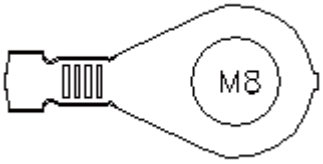

Part No.: YPG101220

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Relay-Transit

Location: Rear RH side of engine compartment

Qualifier:

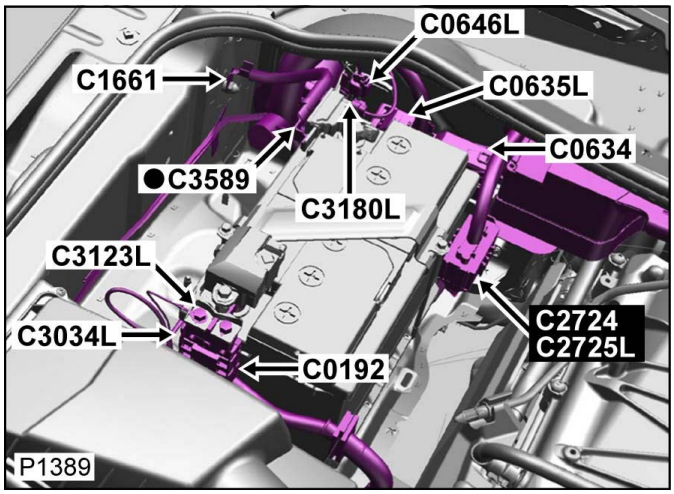


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	NU	807L	S/JOINT SJ35

Click here to print

Connector: C3123R

CONNECTOR HOUSING NOT SERVICEABLE

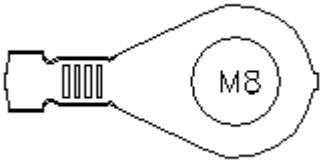

Part No.: YPG101220

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Relay-Transit

Location: Rear LH side of engine compartment

Qualifier:

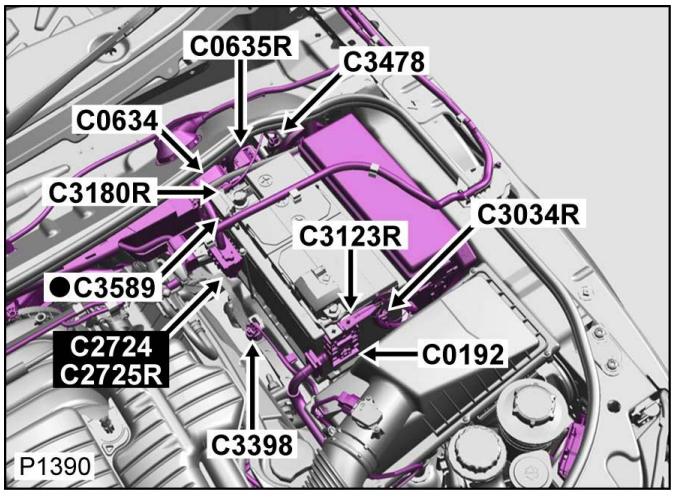


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	NU	807R	S/JOINT SJ1035

Click here to print

Connector: **C3126**

CONNECTOR HOUSING SERVICEABLE

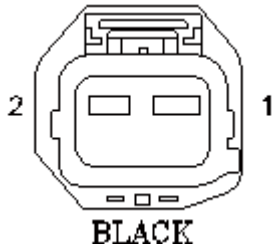

Part No.: YPC500550

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to link harness

Location: Behind RH front fender splash shield

Qualifier:

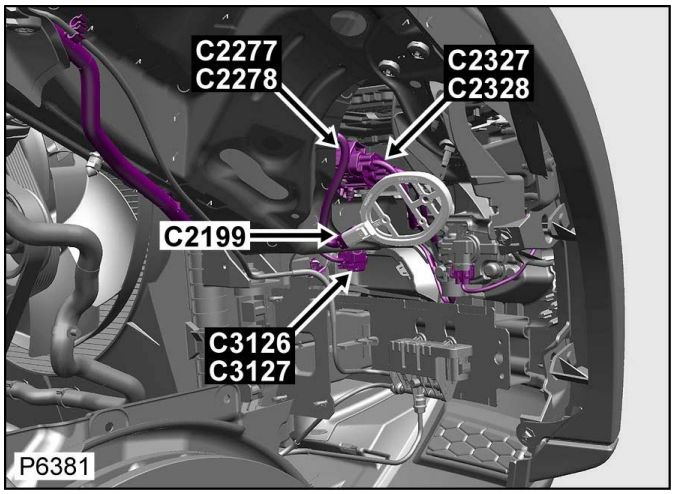


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	YG	798L	C0658L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	YG	252L	C0635L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	YG	797L	C0872L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	YG	798R	C0658R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	YG	252R	C0635R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	YG	797R	C0872R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	BN	282L	S/JOINT SJ939	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	BN	798L	C0658L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	BN	797L	C0872L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	BN	282R	S/JOINT SJ1939	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	BN	798R	C0658R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	BN	797R	C0872R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3127

CONNECTOR HOUSING NOT SERVICEABLE

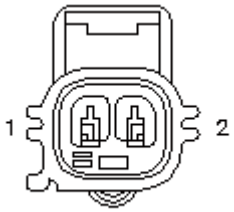

BLACK

Part No.: YPC500070

Colour: BLACK


Cavities: 2WY

Harness: ATC TEMP SENSOR LINK HARNESS

Description: Link harness to engine compartment harness

Location: Behind RH front fender splash shield

Qualifier:

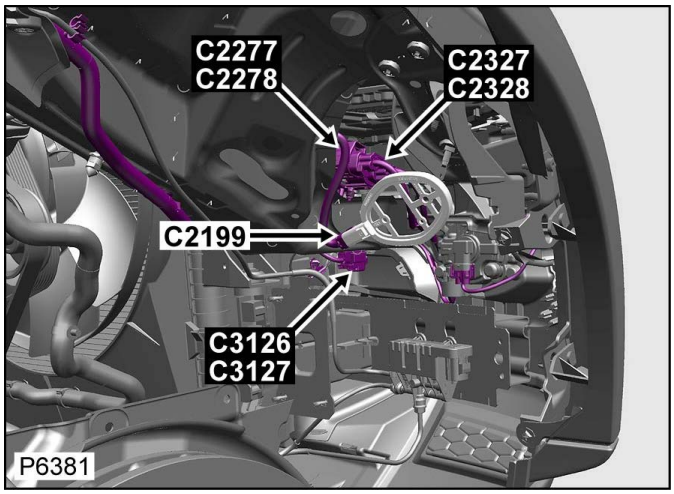


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	YG	713	C0412	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	BN	713	C0412	418-411-08	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C3161**

CONNECTOR HOUSING NOT SERVICEABLE

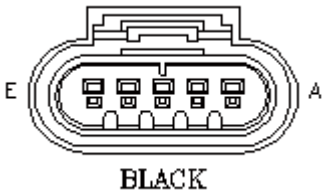

Part No.: YPC800240

Colour: BLACK


Cavities: 5WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Viscous fan - PV8

Location: Front LH side of engine compartment

Qualifier:

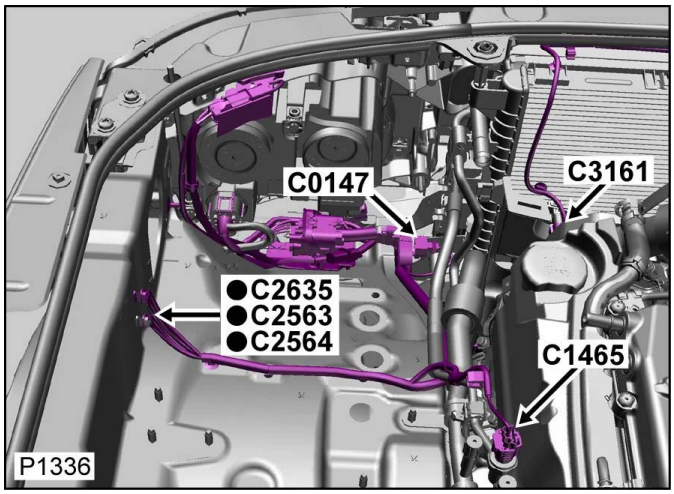

Wire Chart

CAV	CSA	COL	CCT	DESTN
C	0.5	WU	282L	C2725L
A	0.75	NK	282	S/JOINT SJ910
E	0.75	NK	282	S/JOINT SJ910
B	0.75	BN	282L	S/JOINT SJ939
D	0.5	PB	282L	C2725L
C	0.5	WU	282R	C2725R
B	0.75	BN	282R	S/JOINT SJ1939
D	0.5	PB	282R	C2725R

Click here to print

Connector: C3170


CONNECTOR HOUSING NOT SERVICEABLE

Description: Lumbar pump-solenoid-Driver

Location: Beneath driver seat

Qualifier:



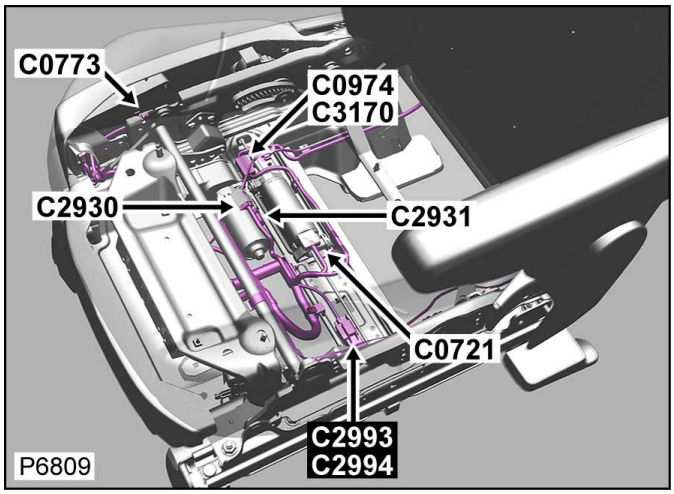

Part No.: YPC10315

Colour: WHITE

Cavities: 6WY

Harness: SEAT FRONT HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	NG	834	C0773	418-549-64	-	418-116A	-	418-104	418-112	418-107
2	0.5	WG	834	C0773	418-549-64	-	418-116A	-	418-104	418-112	418-107
3	0.5	SP	834	C0773	418-549-64	-	418-116A	-	418-104	418-112	418-107
4	0.5	B	834	S/JOINT SJ151	418-549-64	-	418-116A	-	418-104	418-112	418-107
5	0.5	RU	834	C0773	418-549-64	-	418-116A	-	418-104	418-112	418-107
6	0.5	UR	834	C0773	418-549-64	-	418-116A	-	418-104	418-112	418-107

Click here to print

Connector: C3180L

CONNECTOR HOUSING NOT SERVICEABLE

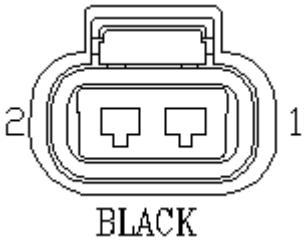

Part No.: YPC911650

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Module-Battery monitoring system

Location: Rear RH side of engine compartment

Qualifier:

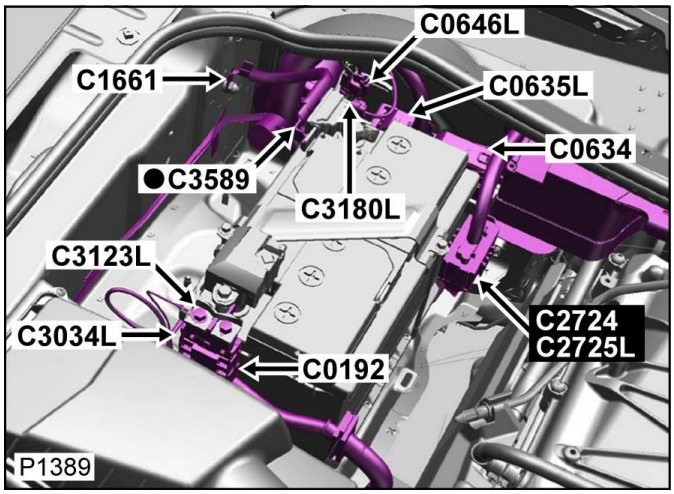


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	UN	807L	C0584L
2	1.0	NU	807L	S/JOINT SJ34

Click here to print

Connector: C3180R

CONNECTOR HOUSING NOT SERVICEABLE

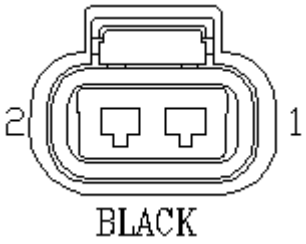

Part No.: YPC911650

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Module-Battery monitoring system

Location: Rear LH side of engine compartment

Qualifier:

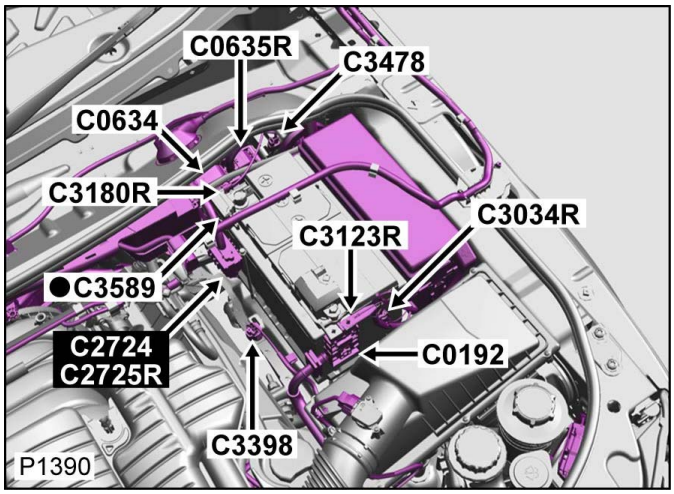


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	UN	807R	C0584R
2	1.0	NU	807R	S/JOINT SJ1034

Click here to print

Connector: C3196

CONNECTOR HOUSING NOT SERVICEABLE

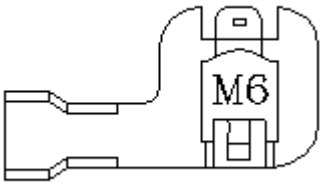

Part No.: YPG900310

Colour: TIN PLATED


Cavities: 1WY

Harness: CABIN HARNESS

Description: Ground point

Location: Behind center console

Qualifier:

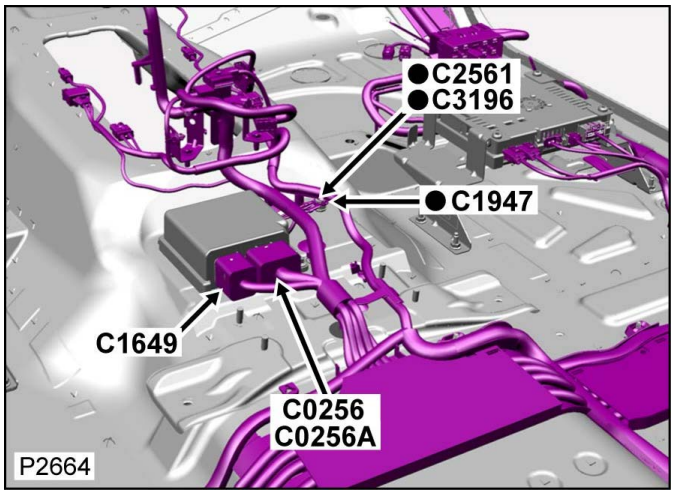

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	B	216	C2378
1	0.5	B	216L	C2378
1	0.5	B	200R	C2378

Click here to print


Connector: C3233M


CONNECTOR HOUSING NOT SERVICEABLE

Description: Solenoid-EGR cooling bypass

Location: Rear RH side of engine

Qualifier:

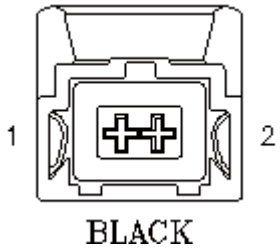

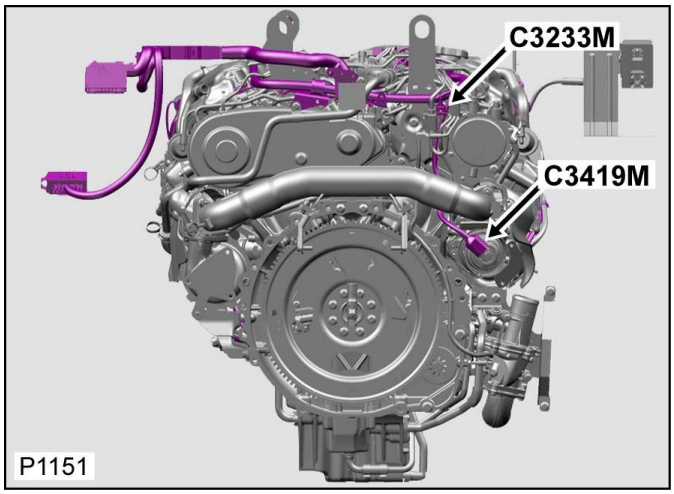

Part No.: YPC909150

Colour: BLACK

Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	OS	798	S/JOINT SJ1
2	0.75	YS	798	C0659M

Click here to print

Connector: C3270

CONNECTOR HOUSING SERVICEABLE

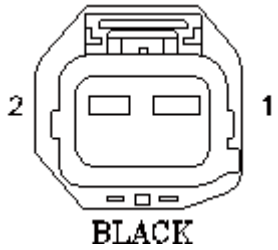

Part No.: YPC500550

Colour: BLACK


Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Temperature-DPF

Location: LH side of transfer box

Qualifier:

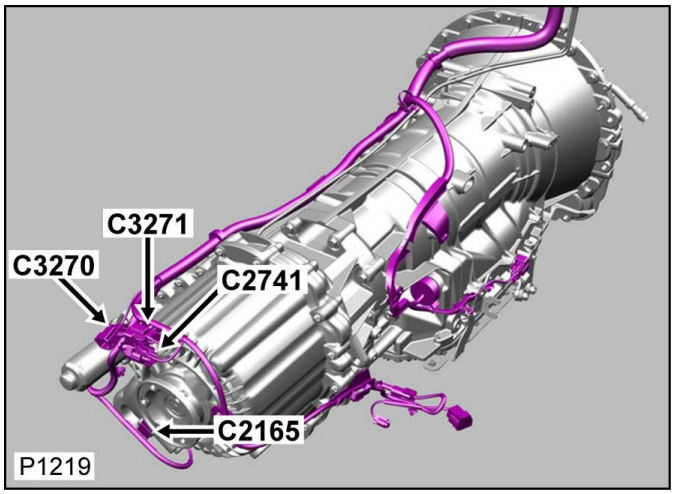


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WP	819L	C2759H	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	WP	819R	C2759J	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	YO	991L	C2759M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	YO	991R	C2759N	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	NW	819L	S/JOINT SJ6806	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	NW	819R	S/JOINT SJ6806	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	PN	991	S/JOINT SJ806A	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C3270A**

CONNECTOR HOUSING SERVICEABLE

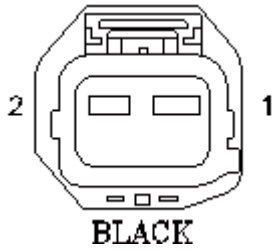

Part No.: YPC500550

Colour: BLACK


Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Temperature-DPF-Intake

Location: Top of transfer box

Qualifier:

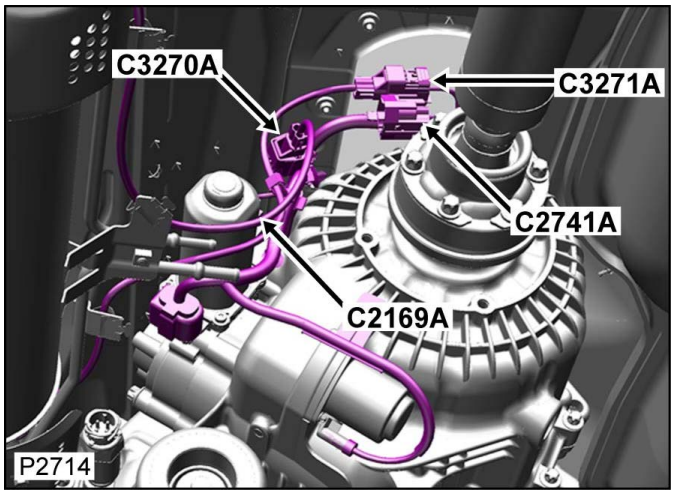

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	YO	983L	C2759P	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	YO	983R	C2759Q	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	PN	983	S/JOINT SJ806B	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3271

CONNECTOR HOUSING NOT SERVICEABLE



DARK GREY

Part No.: YPC903110

Colour: DARK GREY


Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Temperature-DPF-Intake

Location: LH side of transfer box

Qualifier:

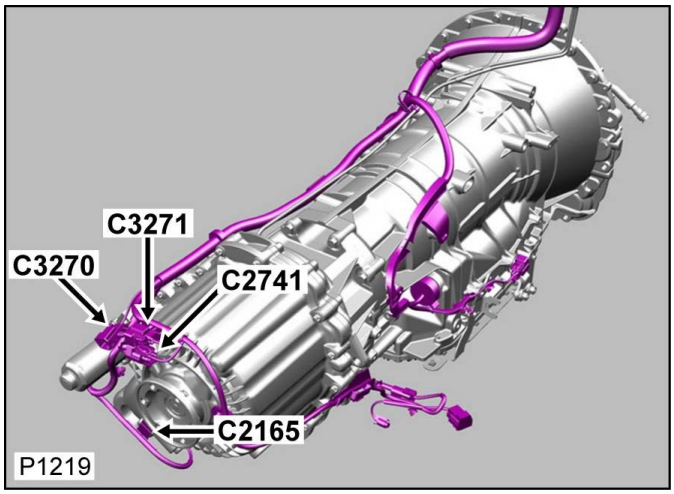

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	PO	991L	C2759M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	PO	991R	C2759N	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	PN	991	S/JOINT SJ806A	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3271A

CONNECTOR HOUSING NOT SERVICEABLE



DARK GREY

Part No.: YPC903110

Colour: DARK GREY


Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Temperature-DPF-Intake

Location: Top of transfer box

Qualifier:

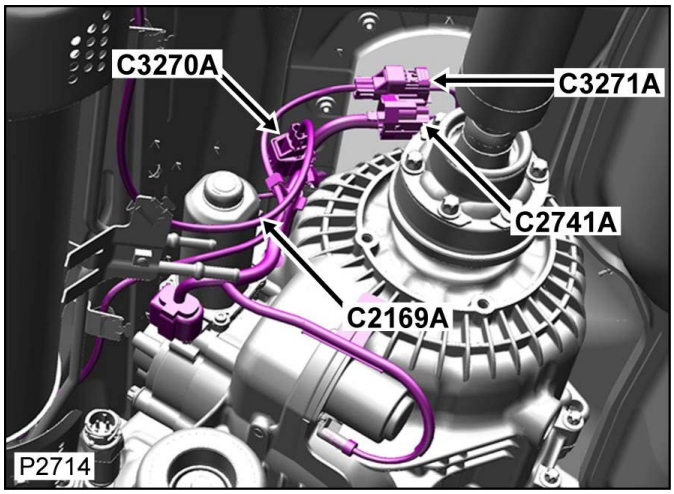

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	PO	983L	C2759P	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	PO	983R	C2759Q	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	PN	983	S/JOINT SJ806B	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3275


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to instrument panel harness

Location: Beneath center console LH side

Qualifier:

ASSEMBLY

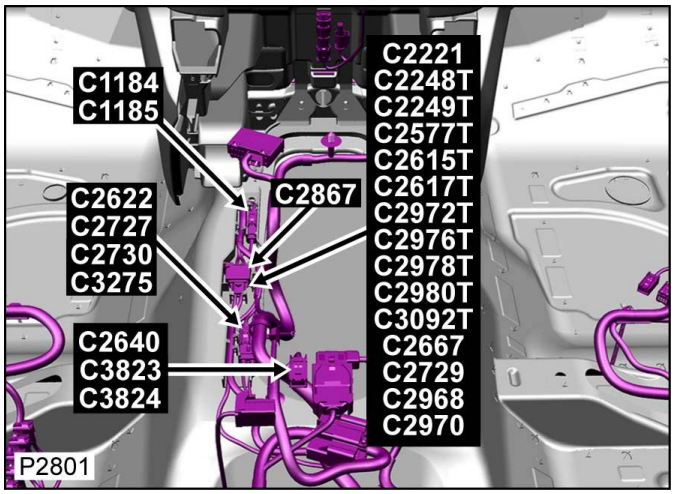

Part No.: XUD812270

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	1058S	C1598S
1S	SCR	SCR	1058S	C1598S
1	0.5	B	1058T	C1598T
1S	SCR	SCR	1058T	C1598T
2	0.5	B	1057	C2117
2S	SCR	SCR	1057	S/JOINT SJ690
2	0.5	B	1058S	C2117
2S	SCR	SCR	1058S	S/JOINT SJ690
2	0.5	B	1058T	C2117
2S	SCR	SCR	1058T	S/JOINT SJ690

Click here to print

Connector: C3283L

CONNECTOR HOUSING NOT SERVICEABLE

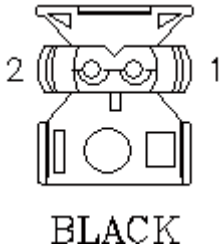

Part No.: XUD803980

Colour: BLACK


Cavities: 2WY

Harness: CABIN HARNESS

Description: Tensioner-Safety belt-LH

Location: Base of 'B' post LH side

Qualifier:

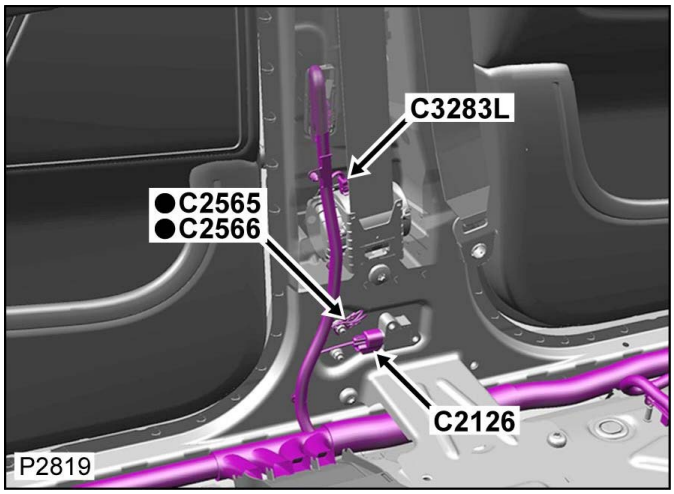


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	UR	216L	C0256
2	0.5	UR	216L	C0256

Click here to print

Connector: C3283R

CONNECTOR HOUSING NOT SERVICEABLE

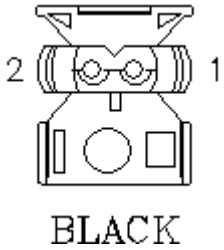

Part No.: XUD803980

Colour: BLACK


Cavities: 2WY

Harness: CABIN HARNESS

Description: Tensioner-Safety belt-RH

Location: Base of 'B' post RH side

Qualifier:

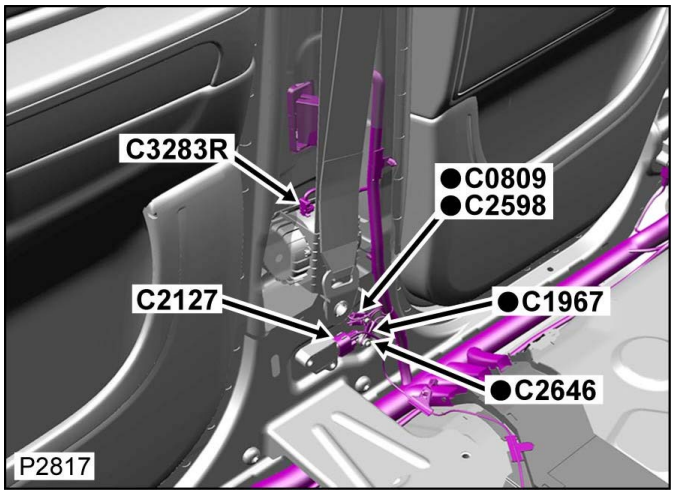

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	UR	216R	C0256
2	0.5	YB	216R	C0256

Click here to print


Connector: C3303


CONNECTOR HOUSING NOT SERVICEABLE

Description: RFI suppression lead

Location: Beneath rear of vehicle - Center

Qualifier:

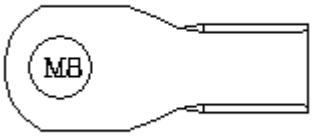

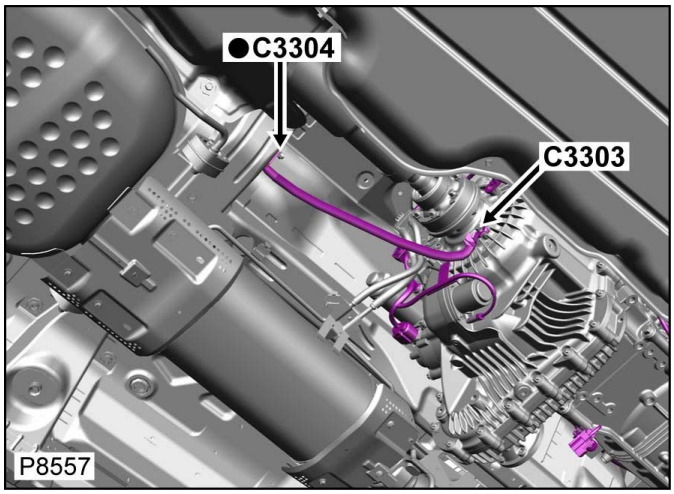

Part No.: 13H6840

Colour: TIN PLATED

Cavities: 1WY

Harness: RFI SUPPRESSION LEAD HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	12.0	BRAID	ALL	C3304

Click here to print

Connector: C3304

CONNECTOR HOUSING NOT SERVICEABLE

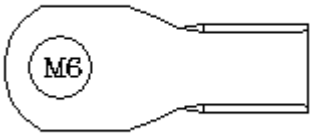

Part No.: 13H8293

Colour: TIN PLATED


Cavities: 1WY

Harness: RFI SUPPRESSION LEAD HARNESS

Description: RFI suppression lead 2

Location: Beneath rear of vehicle - Center

Qualifier:

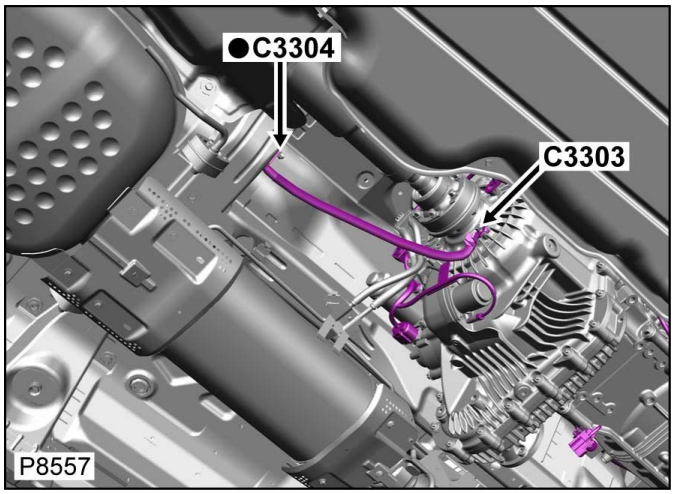


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	12.0	BRAID	ALL	C3303

Click here to print

Connector: C3305

CONNECTOR HOUSING NOT SERVICEABLE

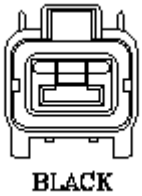

Part No.: YPC905140

Colour: BLACK


Cavities: 1WY

Harness: RFI SUPPRESSION LEAD HARNESS

Description: RFI suppression lead

Location: Rear of engine - Center

Qualifier:

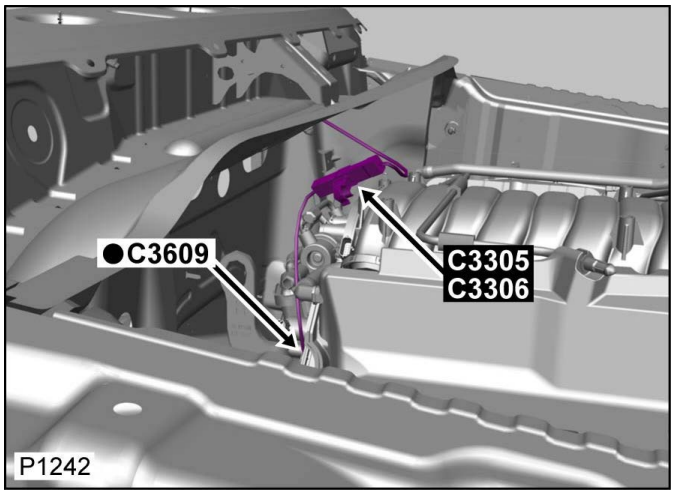


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	6.0	B	282	C3609

Click here to print

Connector: C3306

CONNECTOR HOUSING NOT SERVICEABLE

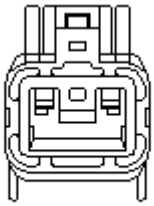

BLACK

Part No.: YPC905130

Colour: BLACK


Cavities: 1WY

Harness: RFI SUPPRESSION LEAD HARNESS

Description: RFI suppression lead 2

Location: Rear of engine - Center

Qualifier:

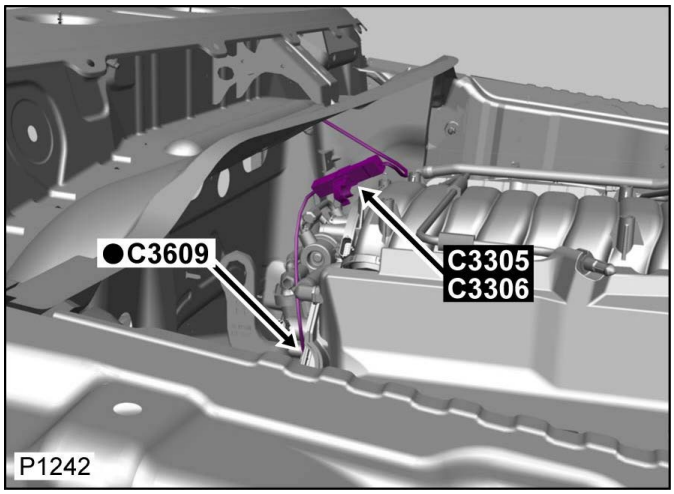


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	6.0	B	282	C3608

Click here to print

Connector: C3310R

CONNECTOR HOUSING NOT SERVICEABLE

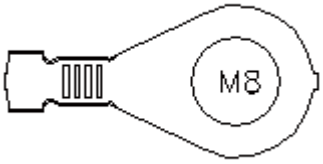

Part No.: YPG101220

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Behind RH front fender splash shield

Qualifier:

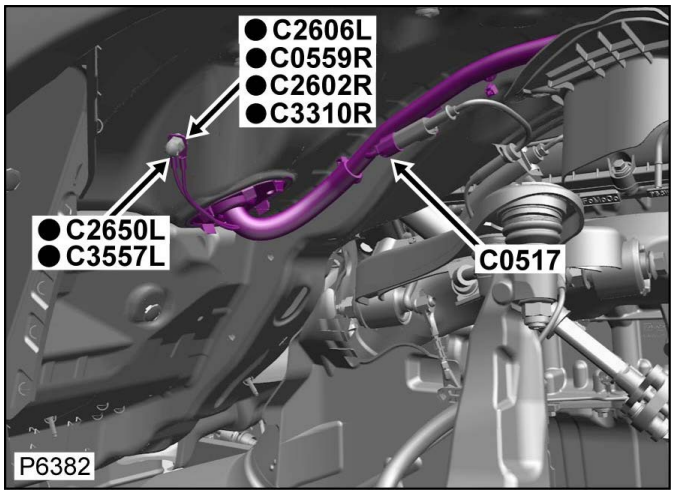

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	951R	C2321R

Click here to print


Connector: C3338


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Cameras

Location: Beneath LH Front seat

Qualifier:

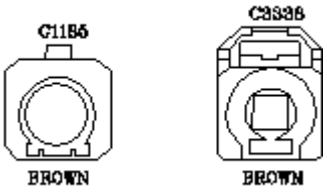

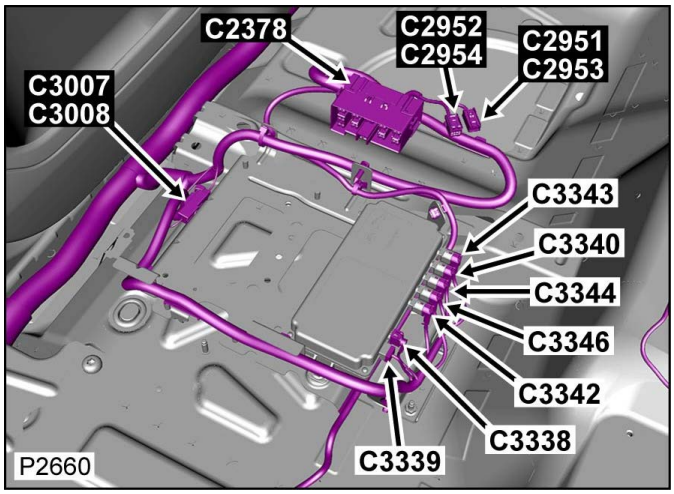

Part No.: XUD815640

Colour: BROWN

Cavities: 1WY

Harness: CABIN HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	784	C1185
1S	SCR	SCR	784	C1185

Click here to print

Connector: C3339

CONNECTOR HOUSING NOT SERVICEABLE

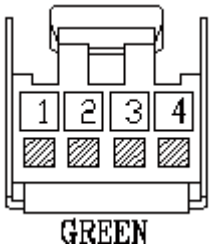

Part No.: YPC108210

Colour: GREEN


Cavities: 4WY

Harness: CABIN HARNESS

Description: Module-Cameras

Location: Beneath LH Front seat

Qualifier:

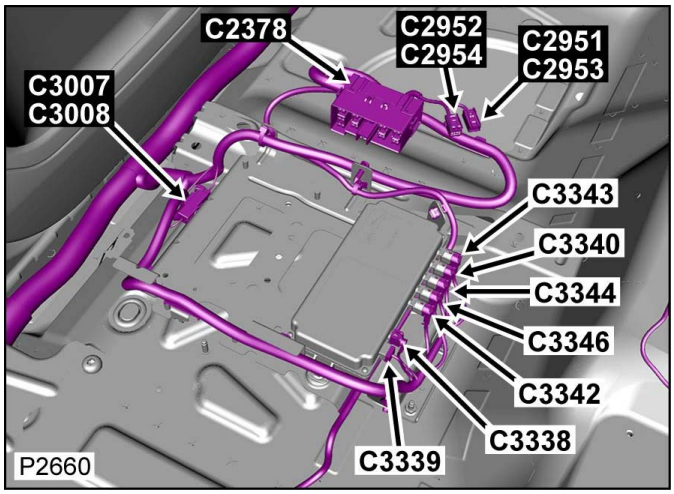

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	784	C2696	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.35	YW	784	S/JOINT SJ2006	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.35	YU	784	S/JOINT SJ2007	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	G	784L	C1166L	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	G	784R	C1166R	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C3340


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Cameras

Location: Beneath LH Front seat

Qualifier:

No connector face
Geen connector-vooraanzicht
Pas de face de connecteur
Kein diagramm
Senza faccia connettore
Sem imagen dos pinos da ficha
No hay cara de conector

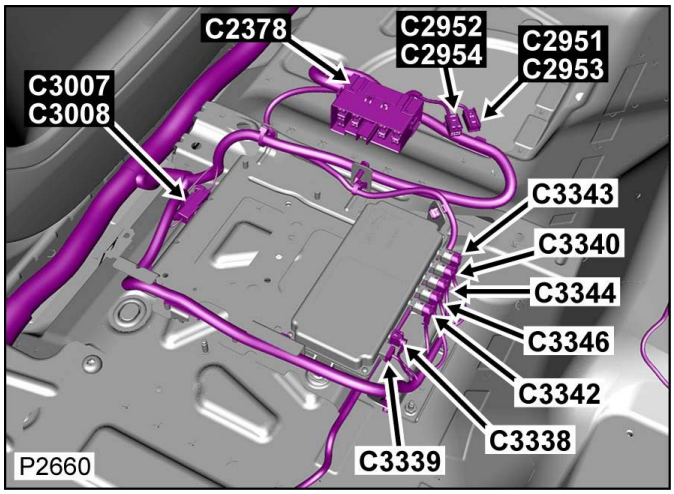

Part No.: XUD815650

Colour: NO COLOUR

Cavities: 4WY

Harness: CABIN HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	N	784L	C2674L
1	0.5	N	784R	C2674R
2	0.5	G	784L	C2674L
2	0.5	G	784R	C2674R
3	0.5	O	784L	C2674L
3	0.5	O	784R	C2674R
4	0.5	U	784L	C2674L
4	0.5	U	784R	C2674R

Click here to print

Connector: C3342


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Cameras

Location: Beneath LH Front seat

Qualifier:

No connector face
Geen connector-vooraanzicht
Pas de face de connecteur
Kein diagramm
Senza faccia connettore
Sem imagen dos pinos da ficha
No hay cara de conector

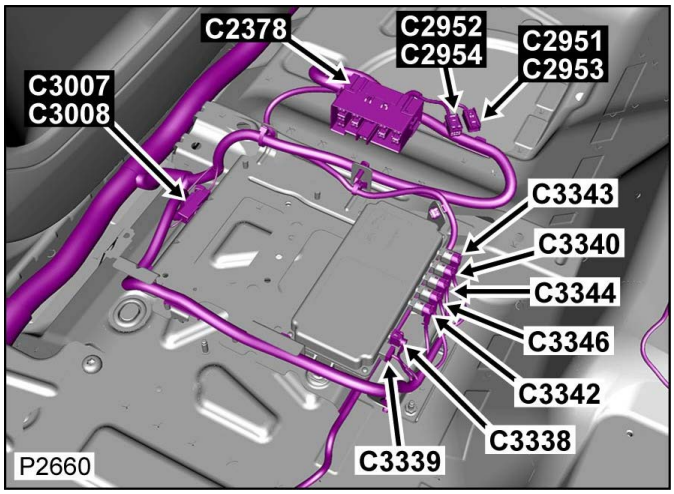

Part No.: XUD815670

Colour: NO COLOUR

Cavities: 4WY

Harness: CABIN HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	N	784L	C3359L
1	0.5	N	784R	C3359R
2	0.5	G	784L	C3359L
2	0.5	G	784R	C3359R
3	0.5	O	784L	C3359L
3	0.5	O	784R	C3359R
4	0.5	U	784L	C3359L
4	0.5	U	784R	C3359R

Click here to print


Connector: C3343


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Cameras

Location: Beneath LH Front seat

Qualifier:

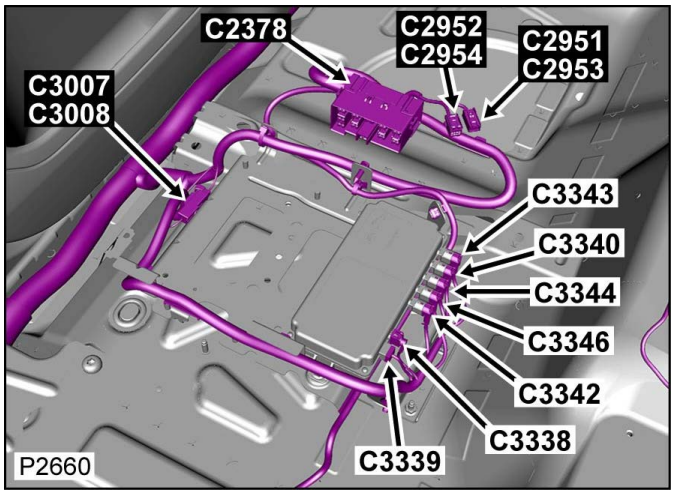

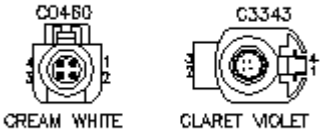

Part No.: XUD815690

Colour: NO COLOUR

Cavities: 4WY

Harness: CABIN HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	N	784	C0460
2	0.5	G	784	C0460
3	0.5	O	784	C0460
4	0.5	U	784	C0460

Click here to print

Connector: C3344


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Cameras

Location: Beneath LH Front seat

Qualifier:

No connector face
Geen connector-vooraanzicht
Pas de face de connecteur
Kein diagramm
Senza faccia connettore
Sem imagen dos pinos da ficha
No hay cara de conector

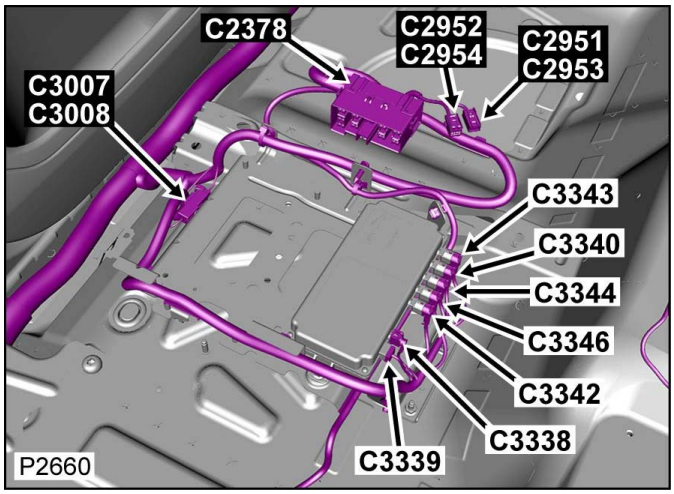

Part No.: XUD815700

Colour: NO COLOUR

Cavities: 4WY

Harness: CABIN HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	N	784	C0464
2	0.5	G	784	C0464
3	0.5	O	784	C0464
4	0.5	U	784	C0464

Click here to print

Connector: C3346


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Cameras

Location: Beneath LH Front seat

Qualifier:

No connector face
Geen connector-vooraanzicht
Pas de face de connecteur
Kein diagramm
Senza faccia connettore
Sem imagen dos pinos da ficha
No hay cara de conector

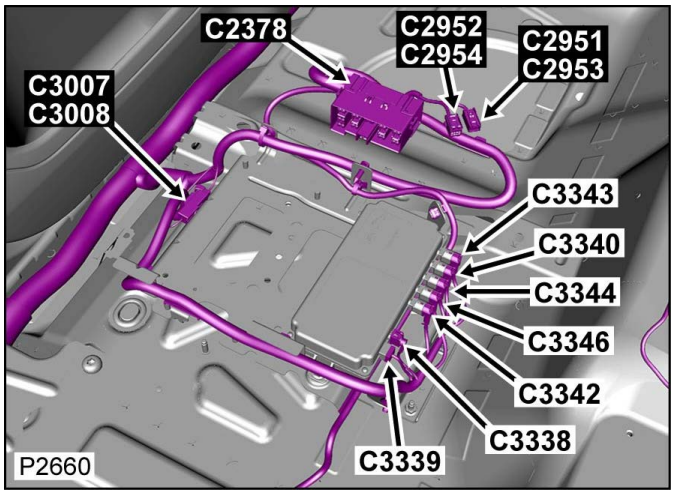

Part No.: XUD815710

Colour: NO COLOUR

Cavities: 4WY

Harness: CABIN HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	784S	C0122S
1	0.5	R	784T	C0122T
2	0.5	W	784S	C0122S
2	0.5	W	784T	C0122T
3	0.5	W	784S	C0122S
3	0.5	W	784T	C0122T
4	0.5	W	784S	C0122S
4	0.5	W	784T	C0122T

Click here to print

Connector: C3347

CONNECTOR HOUSING NOT SERVICEABLE

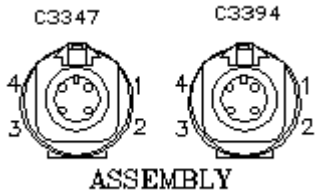

Part No.: XUD814250

Colour: NO COLOUR


Cavities: 4WY

Harness: FRONT BUMPER HARNESS

Description: Camera-Front-RH

Location: Behind RH side of front bumper

Qualifier:

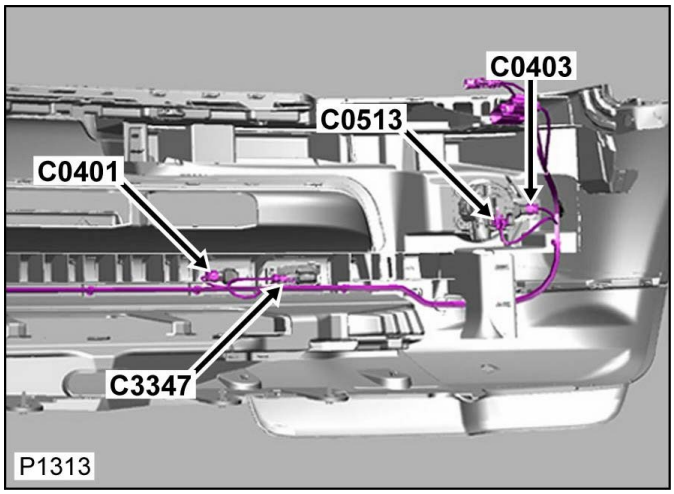


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	N	784	C3394
2	0.5	G	784	C3394
3	0.5	O	784	C3394
4	0.5	U	784	C3394

Click here to print

Connector: C3349

CONNECTOR HOUSING NOT SERVICEABLE

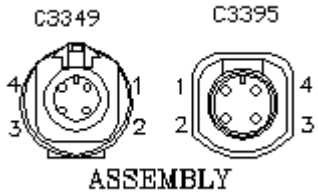

Part No.: XUD814240

Colour: NO COLOUR


Cavities: 4WY

Harness: FRONT BUMPER HARNESS

Description: Camera-Front-LH

Location: Behind LH side of front bumper

Qualifier:

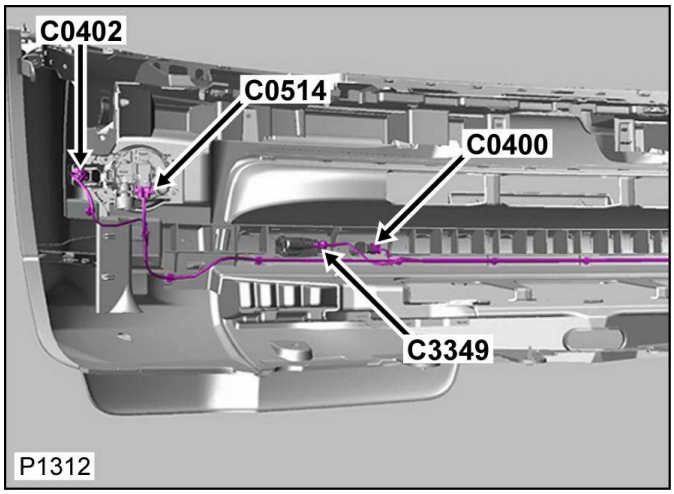


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	N	784	C3395
2	0.5	G	784	C3395
3	0.5	O	784	C3395
4	0.5	U	784	C3395

Click here to print

Connector: C3351

CONNECTOR HOUSING NOT SERVICEABLE

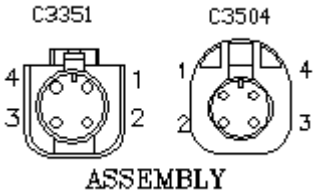

Part No.: XUD814070

Colour: NO COLOUR


Cavities: 4WY

Harness: DOORS FRONT HARNESS

Description: Camera-Mirror-Door-RH

Location: Behind passenger door trim panel

Qualifier: LHD condition illustrated

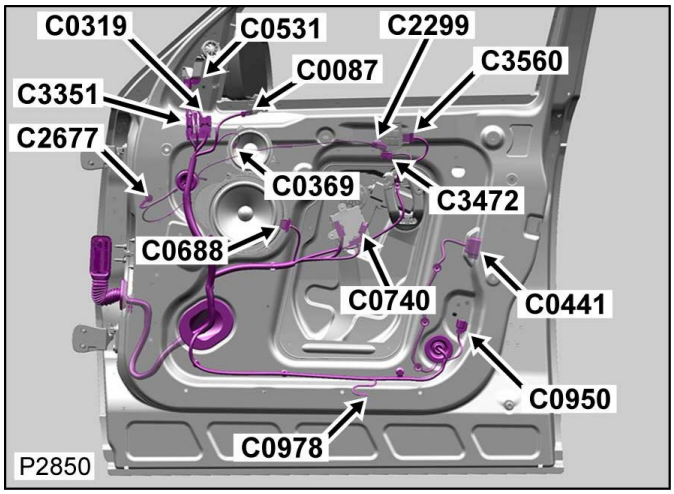


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784R	C3504
2	0.5	O	784R	C3504
3	0.5	G	784R	C3504
4	0.5	N	784R	C3504

Click here to print

Connector: C3353

CONNECTOR HOUSING NOT SERVICEABLE

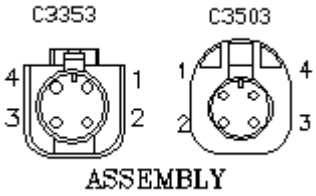

Part No.: XUD814080

Colour: NO COLOUR


Cavities: 4WY

Harness: DOORS FRONT HARNESS

Description: Camera-Mirror-Door-LH

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated

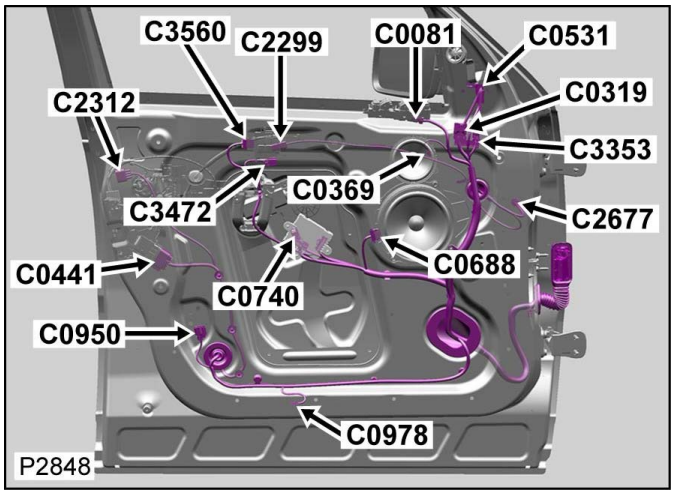

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784L	C3503
2	0.5	O	784L	C3503
3	0.5	G	784L	C3503
4	0.5	N	784L	C3503

Click here to print

Connector: **C3359L**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to engine compartment harness

Location: RH 'A' post

Qualifier: LHD condition illustrated

No connector face
Geen connector-vooraanzicht
Pas de face de connecteur
Kein diagramm
Senza faccia connettore
Sem imagen dos pinos da ficha
No hay cara de conector

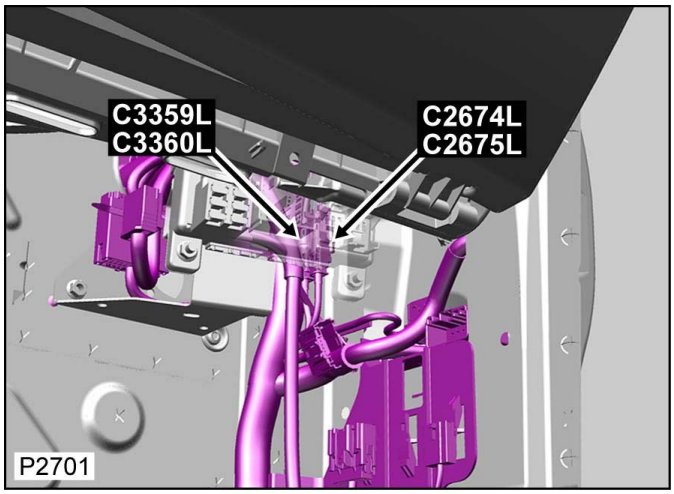

Part No.: XUD815670

Colour: NO COLOUR

Cavities: 4WY

Harness: CABIN HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784L	C3342
2	0.5	O	784L	C3342
3	0.5	G	784L	C3342
4	0.5	N	784L	C3342

Click here to print

Connector: **C3359R**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Main harness to engine compartment harness

Location: Behind passenger side of Instrument panel

Qualifier: RHD condition illustrated

No connector face
Geen connector-vooraanzicht
Pas de face de connecteur
Kein diagramm
Senza faccia connettore
Sem imagen dos pinos da ficha
No hay cara de conector

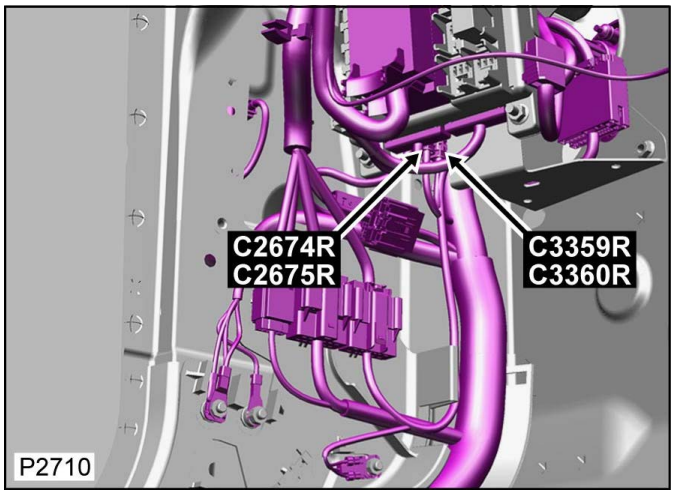

Part No.: XUD815680

Colour: NO COLOUR

Cavities: 4WY

Harness: CABIN HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784R	C3342
2	0.5	O	784R	C3342
3	0.5	G	784R	C3342
4	0.5	N	784R	C3342

Click here to print

Connector: C3360L

CONNECTOR HOUSING NOT SERVICEABLE

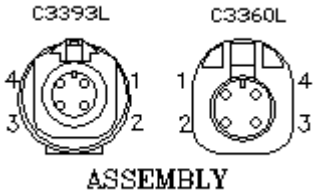

Part No.: XUD814110

Colour: NO COLOUR


Cavities: 4WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to main harness

Location: RH 'A' post

Qualifier: LHD condition illustrated

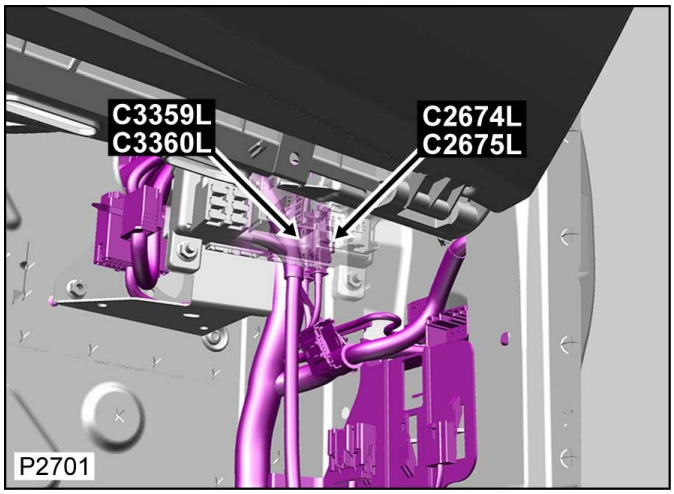


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784L	C3393L
2	0.5	O	784L	C3393L
3	0.5	G	784L	C3393L
4	0.5	N	784L	C3393L

Click here to print

Connector: C3360R

CONNECTOR HOUSING NOT SERVICEABLE

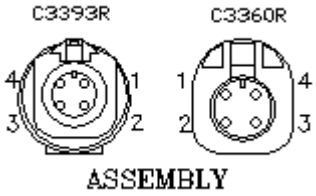

Part No.: XUD814120

Colour: NO COLOUR


Cavities: 4WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to main harness

Location: Behind passenger side of Instrument panel

Qualifier: RHD condition illustrated

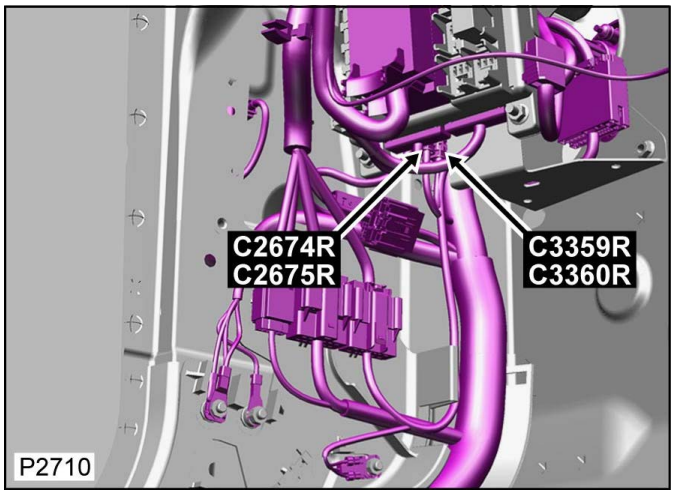

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784R	C3393R
2	0.5	O	784R	C3393R
3	0.5	G	784R	C3393R
4	0.5	N	784R	C3393R

Click here to print


Connector: C3381T

CONNECTOR HOUSING NOT SERVICEABLE

Description: Antenna-DAB

Location: Rear of headlining - LH side

Qualifier:

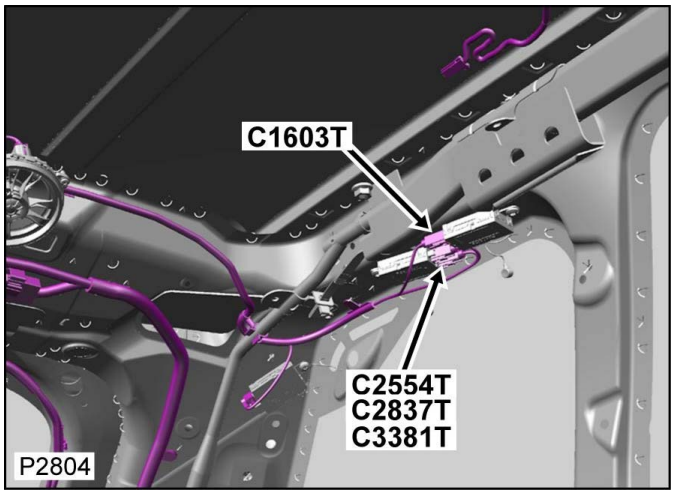

ASSEMBLY

Part No.: XUD812370

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	449T	C2222T
1S	SCR	SCR	449T	C2222T

Click here to print


Connector: **C3383T**

CONNECTOR HOUSING NOT SERVICEABLE

Description: Antenna-DAB

Location: Rear of headlining

Qualifier:

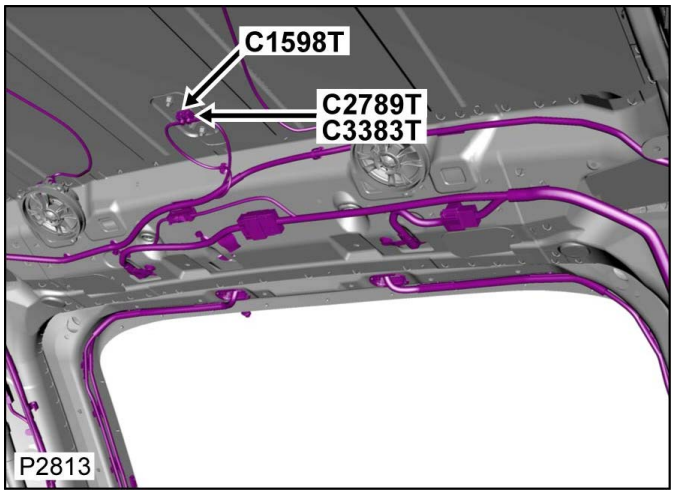

ASSEMBLY

Part No.: XUD812370

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	449T	C2222T
1S	SCR	SCR	449T	C2222T

Click here to print

Connector: C3386T


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to seat link harness

Location: Beneath RH Front seat

Qualifier:

ASSEMBLY

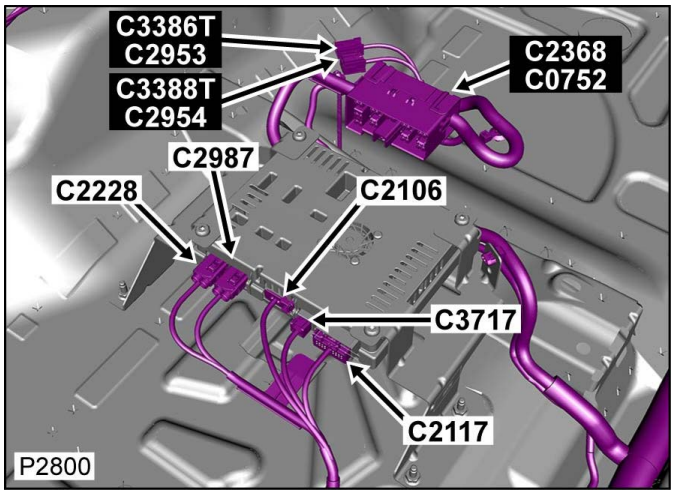

Part No.: XUD815500

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.08	N	514T	C3720T
2	0.08	P	514T	C3720T
3	SCR	SCR	514T	C3720T

Click here to print

Connector: **C3388T**

CONNECTOR HOUSING SERVICEABLE

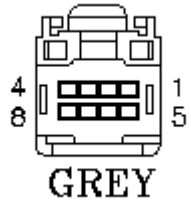

Part No.: YPC905670

Colour: GREY


Cavities: 8WY

Harness: ICE/NAVIGATION HARNESS

Description: ICE harness to seat link harness

Location: Beneath RH Front seat

Qualifier:

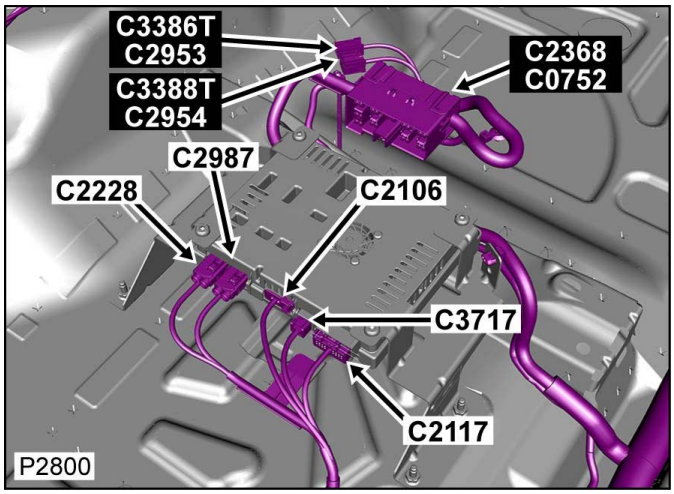


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	WG	514T	S/JOINT SJ11
2	0.35	WN	514T	S/JOINT SJ6
3	0.35	YS	514T	S/JOINT SJ7
8	0.35	NU	514T	S/JOINT SJ10

Click here to print

Connector: C3392L

CONNECTOR HOUSING NOT SERVICEABLE

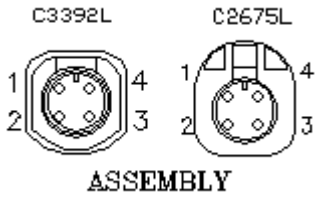

Part No.: XUD814090

Colour: NO COLOUR


Cavities: 4WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to bumper harness

Location: Front RH side of engine compartment

Qualifier:

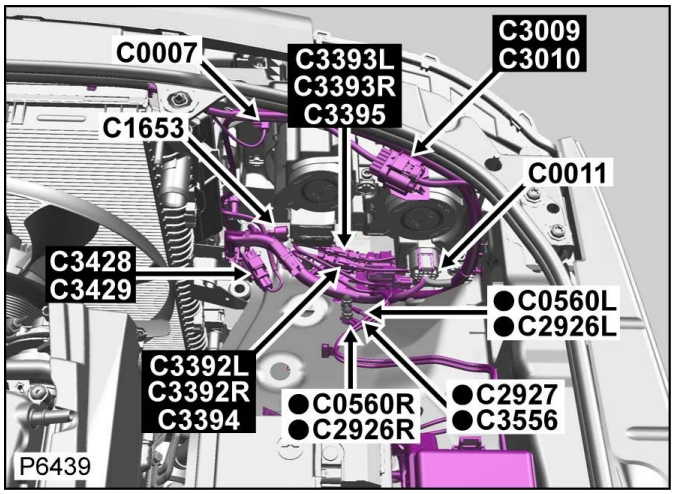


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784L	C2675L
2	0.5	O	784L	C2675L
3	0.5	G	784L	C2675L
4	0.5	N	784L	C2675L

Click here to print

Connector: C3392R

CONNECTOR HOUSING NOT SERVICEABLE

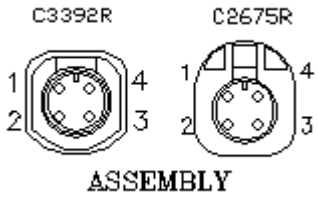

Part No.: XUD814100

Colour: NO COLOUR


Cavities: 4WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to bumper harness

Location: Front RH side of engine compartment

Qualifier:

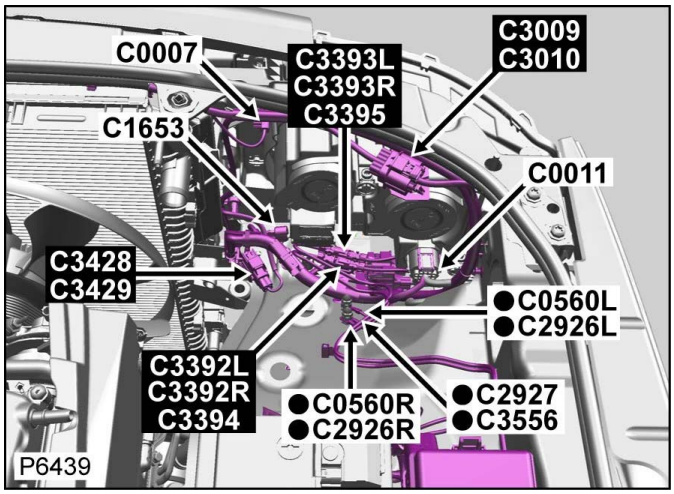


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784R	C2675R
2	0.5	O	784R	C2675R
3	0.5	G	784R	C2675R
4	0.5	N	784R	C2675R

Click here to print

Connector: C3393L

CONNECTOR HOUSING NOT SERVICEABLE

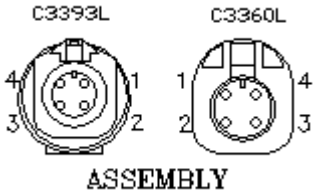

Part No.: XUD814110

Colour: NO COLOUR


Cavities: 4WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to bumper harness

Location: Front RH side of engine compartment

Qualifier:

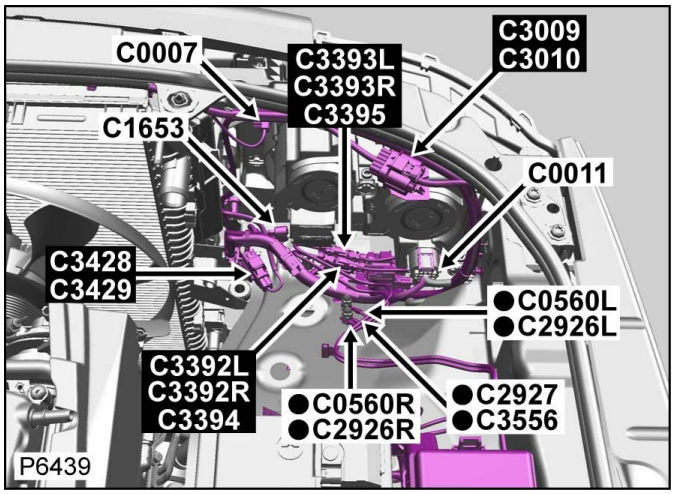


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784L	C3360L
2	0.5	O	784L	C3360L
3	0.5	G	784L	C3360L
4	0.5	N	784L	C3360L

Click here to print

Connector: C3393R

CONNECTOR HOUSING NOT SERVICEABLE

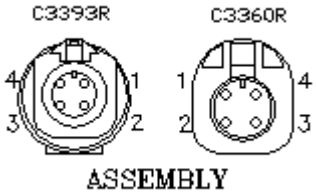

Part No.: XUD814120

Colour: NO COLOUR


Cavities: 4WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to bumper harness

Location: Front RH side of engine compartment

Qualifier:

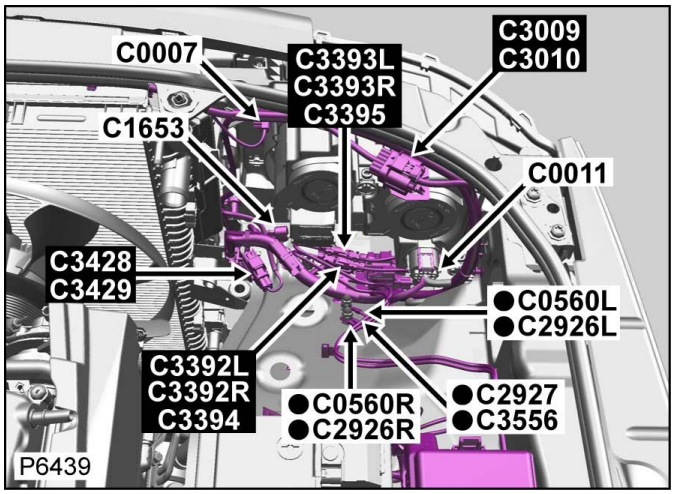


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784R	C3360R
2	0.5	O	784R	C3360R
3	0.5	G	784R	C3360R
4	0.5	N	784R	C3360R

Click here to print

Connector: C3394

CONNECTOR HOUSING NOT SERVICEABLE

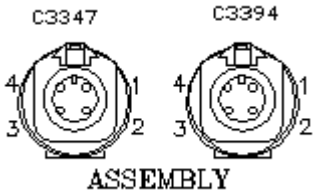

Part No.: XUD814250

Colour: NO COLOUR


Cavities: 4WY

Harness: FRONT BUMPER HARNESS

Description: Bumper harness to engine compartment harness

Location: Front RH side of engine compartment

Qualifier:

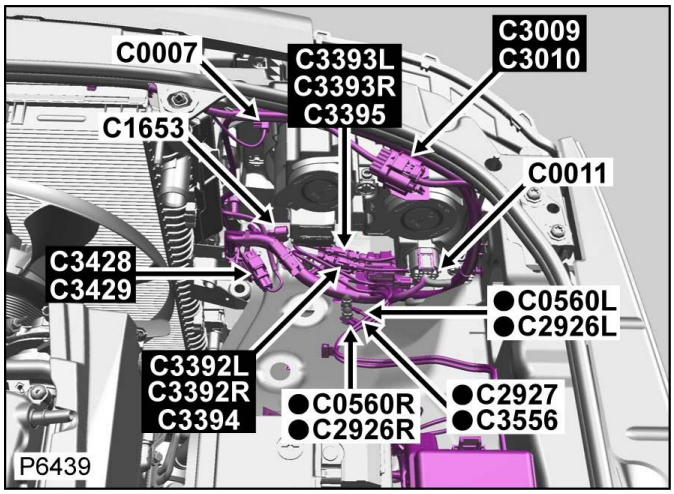


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784	C3347
2	0.5	O	784	C3347
3	0.5	G	784	C3347
4	0.5	N	784	C3347

Click here to print

Connector: C3395

CONNECTOR HOUSING NOT SERVICEABLE

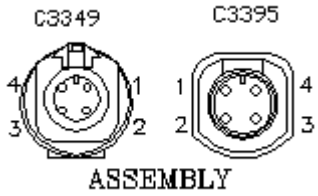

Part No.: XUD814240

Colour: NO COLOUR


Cavities: 4WY

Harness: FRONT BUMPER HARNESS

Description: Bumper harness to engine compartment harness

Location: Front RH side of engine compartment

Qualifier:

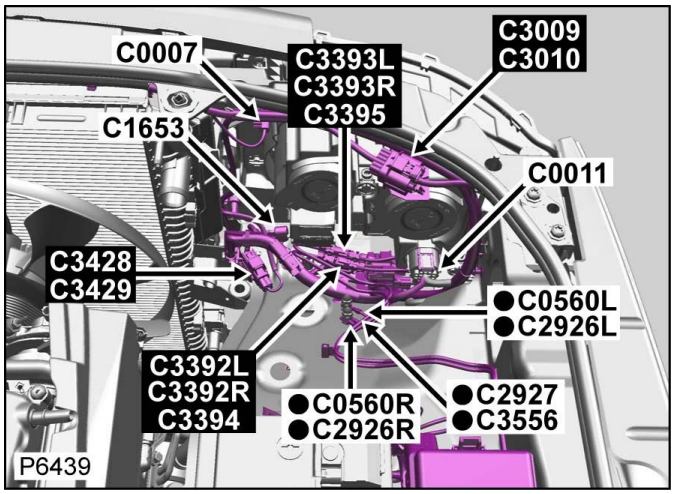


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784	C3349
2	0.5	O	784	C3349
3	0.5	G	784	C3349
4	0.5	N	784	C3349

Click here to print

Connector: C3398

CONNECTOR HOUSING NOT SERVICEABLE

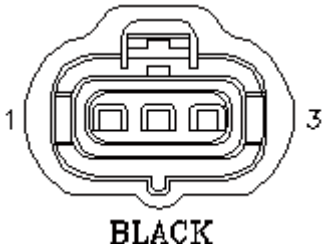

Part No.: YPC19170

Colour: BLACK


Cavities: 3WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Sensor-Pressure-Refrigerant

Location: Rear LH side of engine compartment

Qualifier:

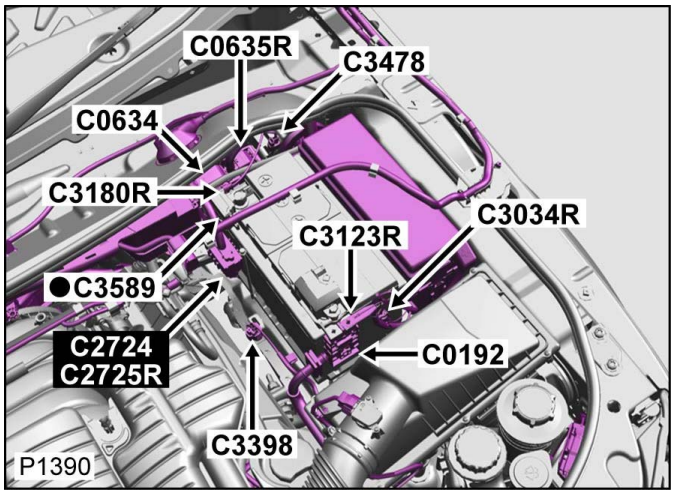


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	WU	282L	C2444L
1	0.5	WU	282R	C2241R
2	0.5	UN	282L	C2444L
2	0.5	UN	282R	C2241R
3	0.5	R	282L	C2444L
3	0.5	R	282R	C2241R

Click here to print

Connector: C3417M

CONNECTOR HOUSING NOT SERVICEABLE

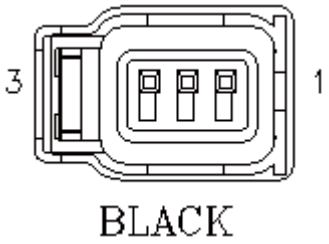

Part No.: YPC909100

Colour: BLACK


Cavities: 3WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Sensor-Boost air pressure

Location: Front of engine - center

Qualifier:

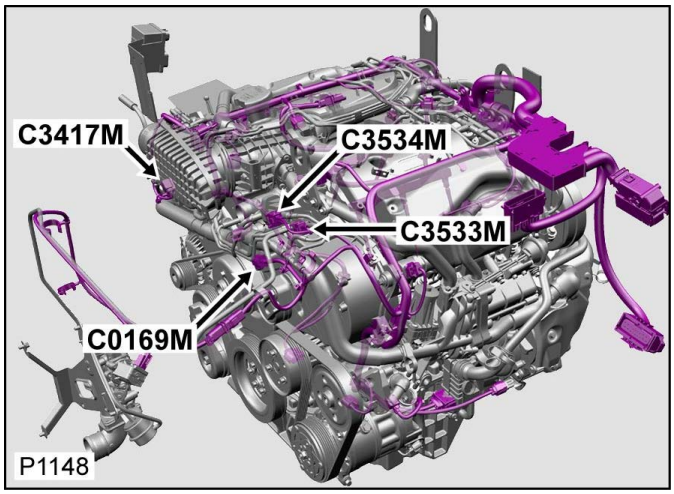

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	OU	798	C3069M
2	0.5	OY	798	C3069M
3	0.5	O	798	C3069M

Click here to print

Connector: C3418

CONNECTOR HOUSING NOT SERVICEABLE



DARK GREY

Part No.: YPC903110

Colour: DARK GREY


Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Sensor-Outlet temperature-Fixed turbocharger

Location: RH side of gearbox

Qualifier:

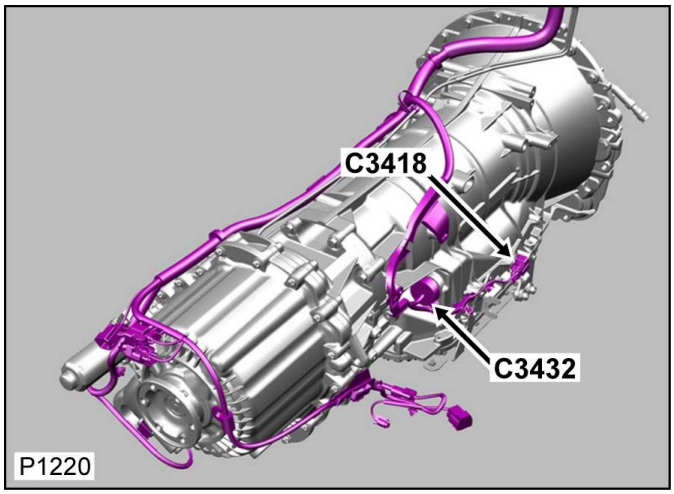

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	SP	993L	C2759M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	SP	993R	C2759N	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	WN	993L	C2759M	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	WN	993R	C2759N	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3418A

CONNECTOR HOUSING NOT SERVICEABLE

Description: Sensor-Outlet temperature-Fixed turbocharger

Location: RH side of gearbox

Qualifier:




DARK GREY

Part No.: YPC903110

Colour: DARK GREY

Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

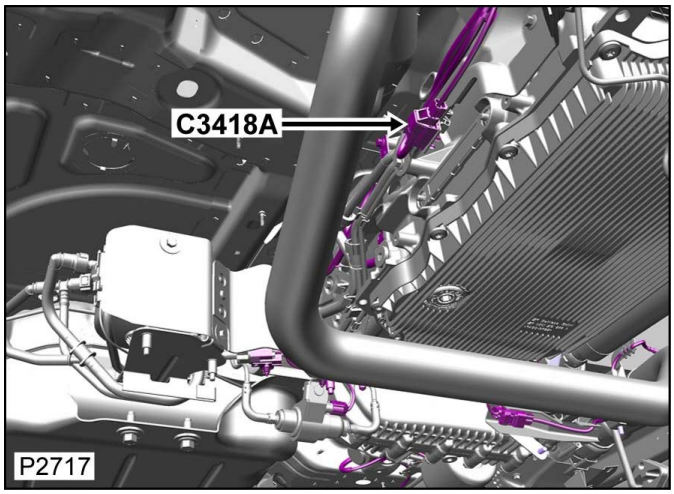

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	SP	982L	C2759P	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	SP	982R	C2759Q	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	WN	982L	C2759P	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	WN	982R	C2759Q	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C3419M


CONNECTOR HOUSING NOT SERVICEABLE

Description: Sensor-Valve position-Turbine intake

Location: Rear RH side of engine

Qualifier:

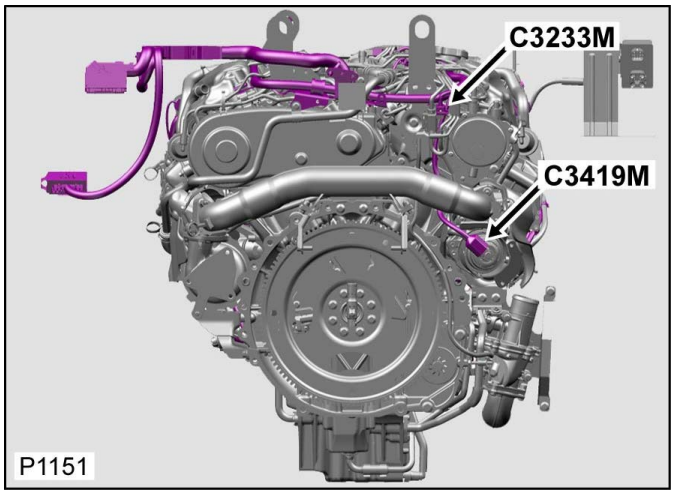

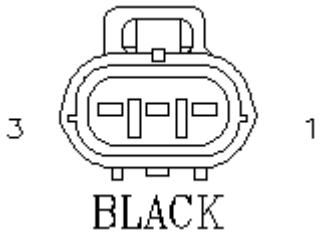

Part No.: YPC912720

Colour: BLACK

Cavities: 3WY

Harness: ENGINE DIESEL 3.0L HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	PN	798	C0659M
2	0.5	Y	798	C0659M
3	0.5	S	798	C0659M

Click here to print

Connector: C3421

CONNECTOR HOUSING SERVICEABLE

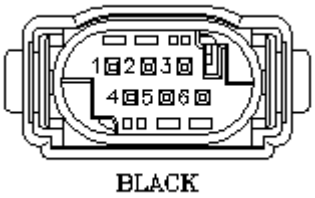

BLACK

Part No.: YPC803260

Colour: BLACK


Cavities: 6WY

Harness: AIR SUSPENSION HARNESS

Description: Sensor-Height-Front-RH

Location: Behind RH front fender splash shield

Qualifier:

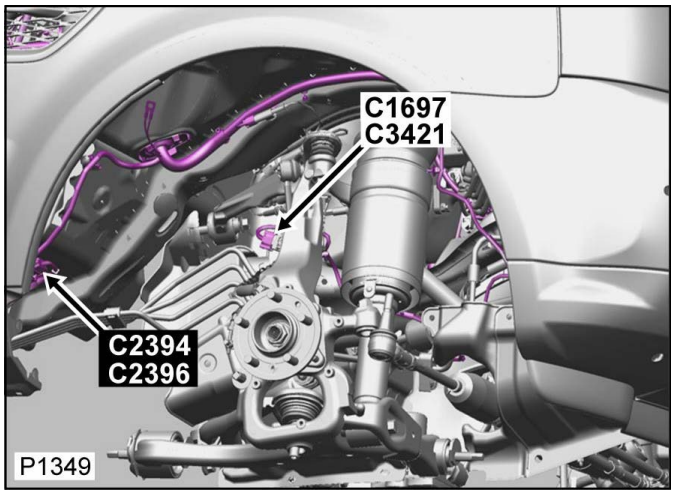


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	SR	245	C3010	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	BY	245	C3429	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	BU	245	C3429	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	SU	245	C3010	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	SY	245	C3010	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	BR	245	C3429	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3422

CONNECTOR HOUSING SERVICEABLE

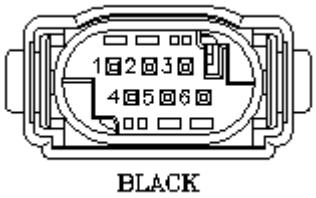

BLACK

Part No.: YPC803260

Colour: BLACK


Cavities: 6WY

Harness: CHASSIS HARNESS

Description: Sensor-Height-Rear-LH

Location: Below LH rear wheelarch

Qualifier:

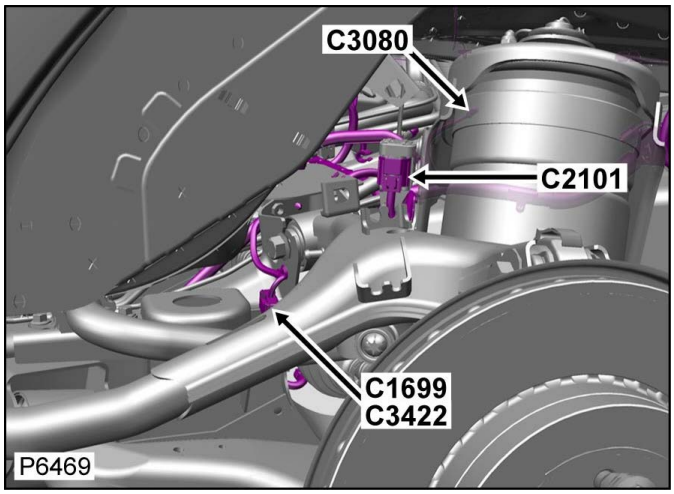


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	OB	245	C0390	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	BY	245	C0391	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	BU	245	C0391	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	OR	245	C0390	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	OY	245	C0390	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	BR	245	C0391	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3423

CONNECTOR HOUSING SERVICEABLE

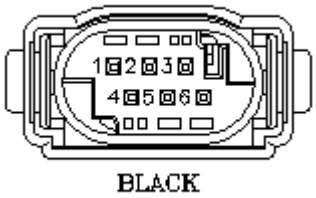

BLACK

Part No.: YPC803260

Colour: BLACK


Cavities: 6WY

Harness: CHASSIS HARNESS

Description: Sensor-Height-Rear-RH

Location: Below RH rear wheelarch

Qualifier:

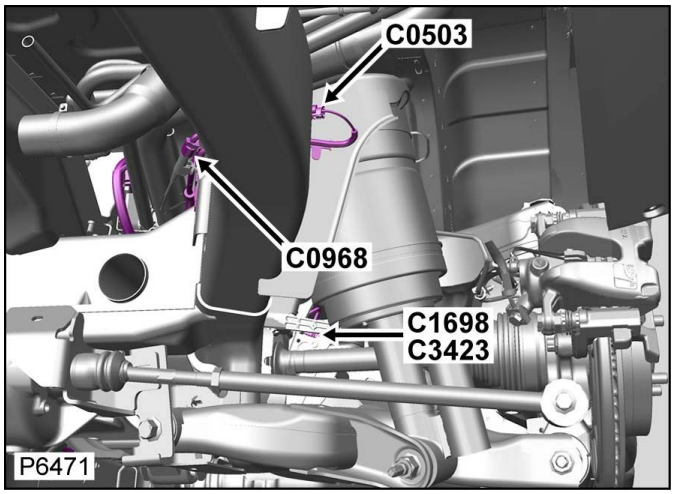


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	SR	245	C0390	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	BY	245	C0391	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	BU	245	C0391	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	SU	245	C0390	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	SY	245	C0390	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	BR	245	C0391	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3424L

CONNECTOR HOUSING NOT SERVICEABLE

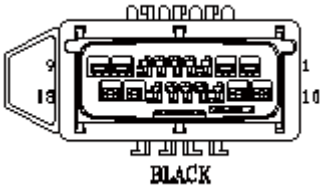

Part No.: YPC909600

Colour: BLACK


Cavities: 18WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to transmission harness

Location: Driver side of engine compartment

Qualifier:

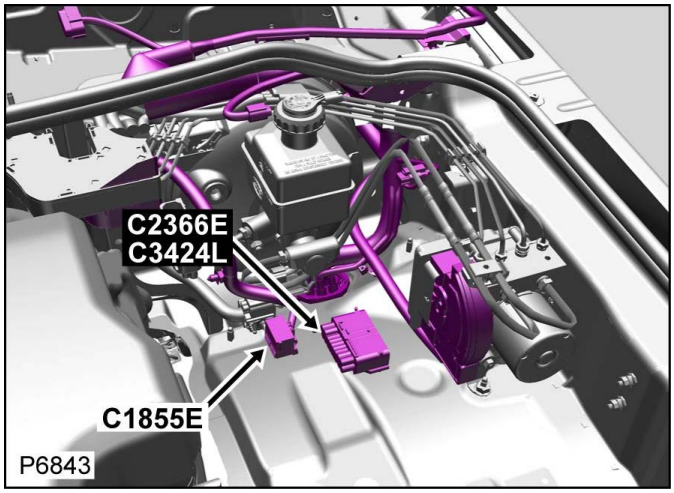

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	PY	797L	C0570L	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
2	0.35	YN	797L	S/JOINT SJ786	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	YB	797L	S/JOINT SJ776	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	YN	807L	S/JOINT SJ785	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	YB	807L	S/JOINT SJ775	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	YN	797L	S/JOINT SJ785	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	YB	797L	S/JOINT SJ775	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	YN	807L	S/JOINT SJ786	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.75	R	797L	S/JOINT SJ242	-	-	-	-	-	-	-
6	0.5	YB	807L	S/JOINT SJ776	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	BG	797L	C2412L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	BG	807L	C2412L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	B	815L	S/JOINT SJ9	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	GO	797L	S/JOINT SJ905	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
9	0.35	N	797L	C2412L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	GW	798L	C2245L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
10	1.5	B	797L	S/JOINT SJ173	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
11	0.5	S	798L	C2245L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107

11	0.35	Y	797L	C2412L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
12	0.35	N	807L	C2412L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
13	0.5	Y	797L	C2244L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
13	0.35	Y	807L	C2412L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	R	797L	C2244L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	R	807L	C2244L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
15	0.35	G	797L	C2412L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
15	0.5	Y	807L	C2244L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
16	0.35	GW	797L	C2240L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
16	0.35	G	807L	C2412L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
17	0.5	WU	815L	C0925	418-411-73	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3424R

CONNECTOR HOUSING NOT SERVICEABLE

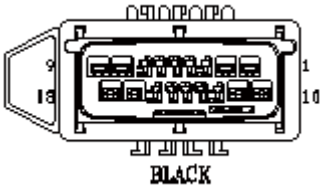

Part No.: YPC909600

Colour: BLACK


Cavities: 18WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to transmission harness

Location: RH side of engine compartment

Qualifier: RHD condition illustrated

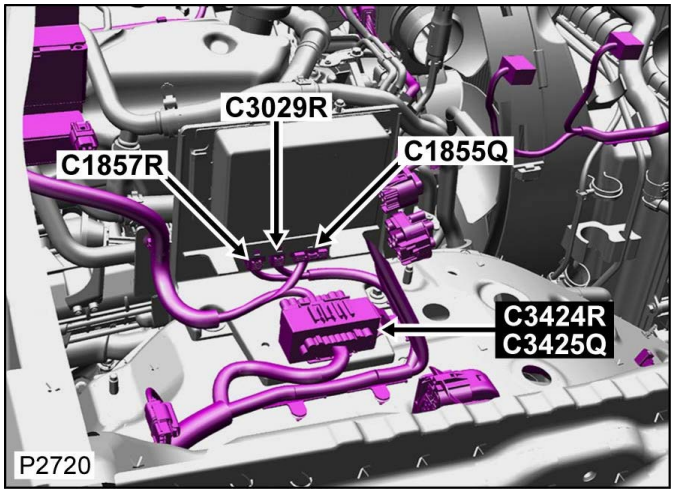

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	PY	797R	C0570R	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
2	0.35	YN	797R	S/JOINT SJ1786	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	YB	797R	S/JOINT SJ1776	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	YN	807R	S/JOINT SJ1785	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	YB	807R	S/JOINT SJ1775	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	YN	797R	S/JOINT SJ1785	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	YB	797R	S/JOINT SJ1775	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	YN	807R	S/JOINT SJ1786	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.75	R	797R	S/JOINT SJ1242	-	-	-	-	-	-	-
6	0.5	YB	807R	S/JOINT SJ1776	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	BG	797R	C2245R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.35	BG	807R	C2245R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	B	815R	S/JOINT SJ9	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	GO	797R	S/JOINT SJ1905	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
9	0.5	N	797R	C2245R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	GW	798R	C2410R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
10	1.5	B	797R	S/JOINT SJ171	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
11	0.5	S	798R	C2410R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107

11	0.5	Y	797R	C2245R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
12	0.35	N	807R	C2245R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
13	0.5	Y	797R	C2245R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
13	0.35	Y	807R	C2245R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	R	797R	C2245R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	R	807R	C2245R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
15	0.5	G	797R	C2245R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
15	0.5	Y	807R	C2245R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
16	0.35	GW	797R	C2241R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
16	0.35	G	807R	C2245R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
17	0.5	WU	815R	C0925	418-411-73	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3425A

CONNECTOR HOUSING NOT SERVICEABLE

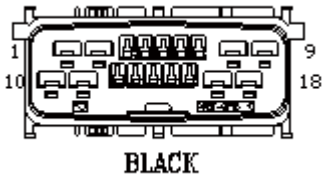

Part No.: YPC909660

Colour: BLACK


Cavities: 18WY

Harness: TRANSMISSION AUTO-PETROL HARNESS

Description: Transmission harness to engine compartment harness

Location: Driver side of engine compartment

Qualifier:

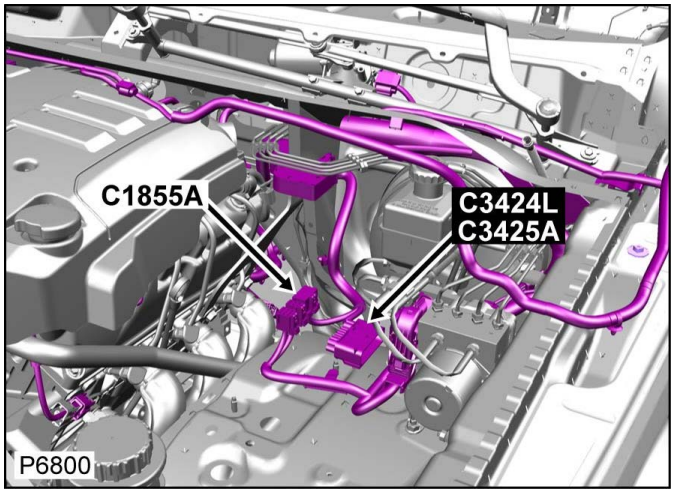


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	PY	281L	S/JOINT SJ1410	-	-	-	-	-	-	-
2	0.5	YN	281L	S/JOINT SJ720	-	-	-	-	-	-	-
3	0.5	YB	281L	S/JOINT SJ721	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	YN	281L	S/JOINT SJ720	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	YB	281L	S/JOINT SJ721	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	1.0	GW	281L	C0193A	-	-	-	-	-	-	-
7	0.5	BG	281L	C0193A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	GO	281L	C0193A	-	-	-	-	-	-	-
9	0.5	N	281L	C0193A	-	-	-	-	-	-	-
10	1.0	B	281L	S/JOINT SJ1409	-	-	-	-	-	-	-
11	0.5	Y	281L	C0193A	-	-	-	-	-	-	-
13	0.5	Y	281L	C0193A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	R	281L	C0193A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
15	0.5	G	281L	C0193A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
16	0.5	GW	281L	C0193A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
18	2.5	NK	281L	S/JOINT SJ1444	418-411-18	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C3425L

CONNECTOR HOUSING NOT SERVICEABLE

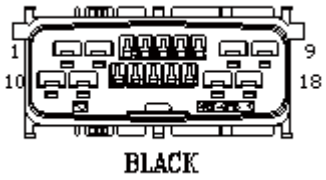

Part No.: YPC909660

Colour: BLACK


Cavities: 18WY

Harness: TRANSMISSION AUTO-PETROL HARNESS

Description: Transmission harness to engine compartment harness

Location: Rear LH side of engine compartment

Qualifier:

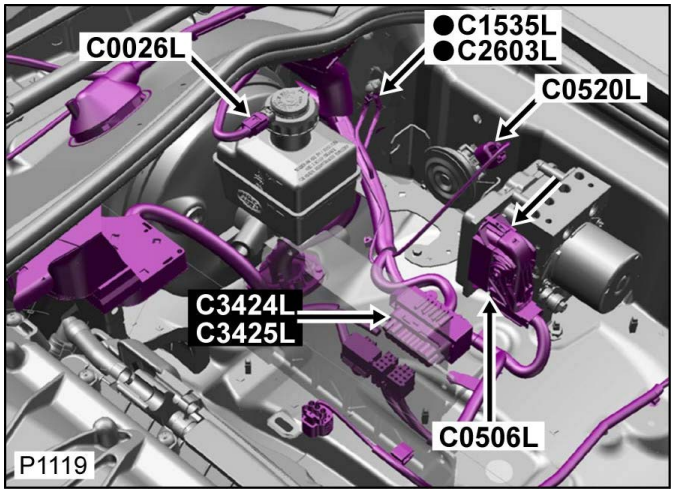


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
3	0.5	YN	282L	S/JOINT SJ720	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	YB	282L	S/JOINT SJ721	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	YN	282L	S/JOINT SJ720	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	YB	282L	S/JOINT SJ721	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	BG	282L	C0193	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	N	282L	C0193	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
13	0.5	Y	282L	C0193	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	R	282L	C0193	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
15	0.5	Y	282L	C0193	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
16	0.5	G	282L	C0193	418-411-08	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3425M

CONNECTOR HOUSING NOT SERVICEABLE

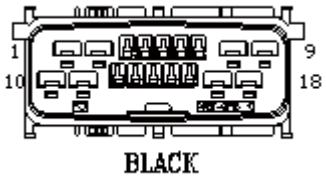

Part No.: YPC909660

Colour: BLACK


Cavities: 18WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Transmission harness to engine compartment harness

Location: Rear LH side of engine compartment

Qualifier:

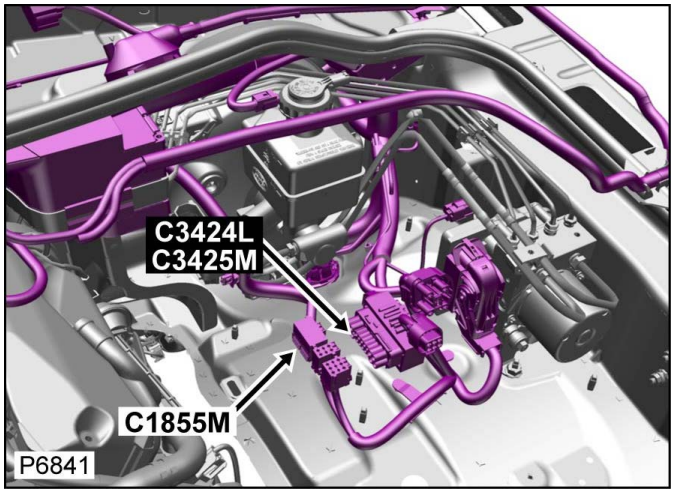


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
3	0.5	YN	993L	S/JOINT SJ4720	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	YB	993L	S/JOINT SJ4721	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	YN	993L	S/JOINT SJ4720	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	YB	993L	S/JOINT SJ4721	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	BG	993L	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	B	994L	C3431	-	-	-	-	-	-	-
12	0.5	N	993L	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
13	0.5	Y	993L	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	R	993L	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
15	0.5	YW	993L	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
16	0.5	G	993L	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
17	0.5	WU	994L	C3431	-	-	-	-	-	-	-

Click here to print

Connector: C3425N

CONNECTOR HOUSING NOT SERVICEABLE

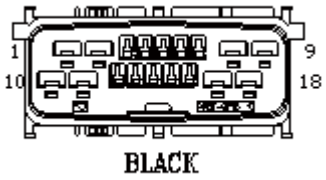

Part No.: YPC909660

Colour: BLACK


Cavities: 18WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Transmission harness to engine compartment harness

Location: Driver side of engine compartment

Qualifier:

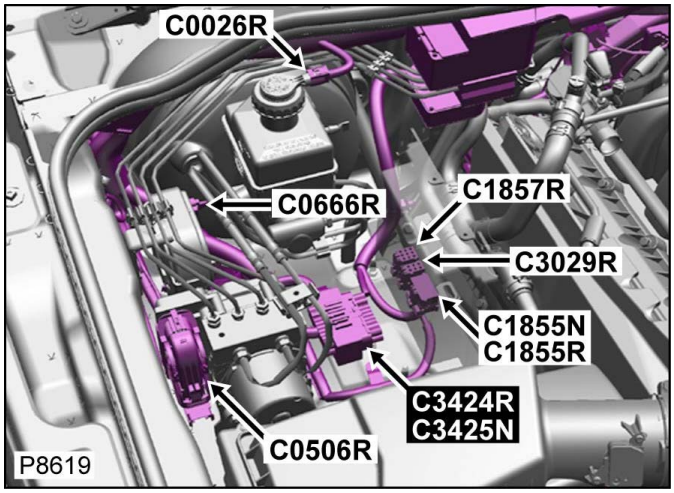


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
3	0.5	YN	993R	S/JOINT SJ4720	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	YB	993R	S/JOINT SJ4721	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	YN	993R	S/JOINT SJ4720	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	YB	993R	S/JOINT SJ4721	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	BG	993R	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	B	994R	C3431	-	-	-	-	-	-	-
12	0.5	N	993R	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
13	0.5	Y	993R	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	R	993R	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
15	0.5	YW	993R	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
16	0.5	G	993R	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
17	0.5	WU	994R	C3431	-	-	-	-	-	-	-

Click here to print

Connector: C3425P

CONNECTOR HOUSING NOT SERVICEABLE

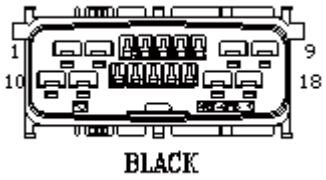

Part No.: YPC909660

Colour: BLACK


Cavities: 18WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Transmission harness to engine compartment harness

Location: Rear LH side of engine compartment

Qualifier: LHD condition illustrated

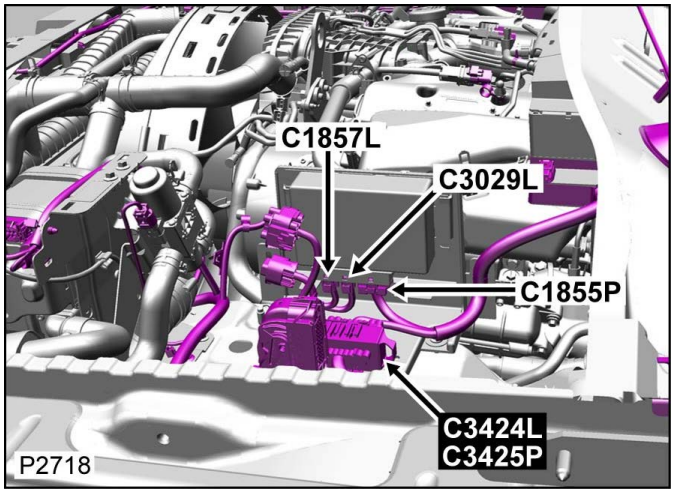


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
3	0.5	YN	982L	S/JOINT SJ4422	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	YB	982L	S/JOINT SJ4423	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	YN	982L	S/JOINT SJ4422	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	YB	982L	S/JOINT SJ4423	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.75	B	984L	C3431A	-	-	-	-	-	-	-
10	0.75	GW	982L	C3432A	-	-	-	-	-	-	-
11	0.75	S	982L	C3432A	-	-	-	-	-	-	-
17	0.75	WU	984L	C3431A	-	-	-	-	-	-	-

Click here to print

Connector: C3425Q

CONNECTOR HOUSING NOT SERVICEABLE

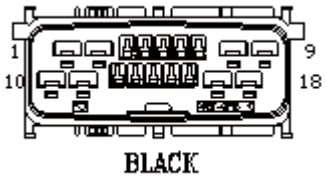

Part No.: YPC909660

Colour: BLACK


Cavities: 18WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Transmission harness to engine compartment harness

Location: RH side of engine compartment

Qualifier: RHD condition illustrated

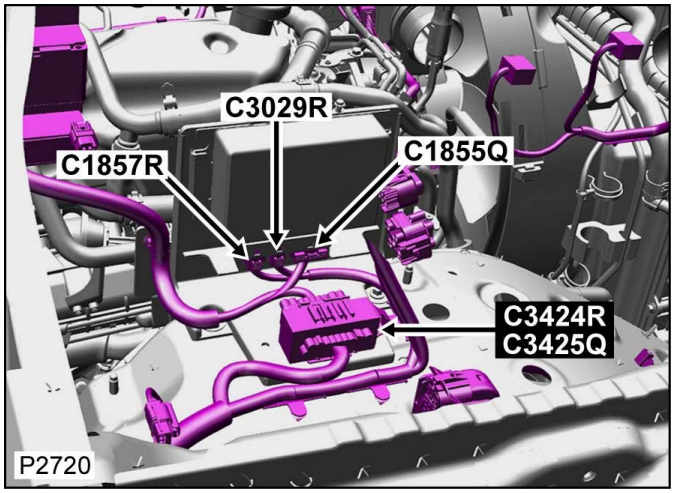


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
3	0.5	YN	982R	S/JOINT SJ4422	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	YB	982R	S/JOINT SJ4423	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	YN	982R	S/JOINT SJ4422	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	YB	982R	S/JOINT SJ4423	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.75	B	984R	C3431A	-	-	-	-	-	-	-
10	0.75	GW	982R	C3432A	-	-	-	-	-	-	-
11	0.75	S	982R	C3432A	-	-	-	-	-	-	-
17	0.75	WU	984R	C3431A	-	-	-	-	-	-	-

Click here to print

Connector: C3425R

CONNECTOR HOUSING NOT SERVICEABLE

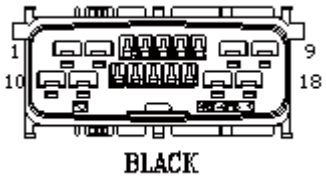

Part No.: YPC909660

Colour: BLACK


Cavities: 18WY

Harness: TRANSMISSION AUTO-PETROL HARNESS

Description: Transmission harness to engine compartment harness

Location: Rear RH side of engine compartment

Qualifier:

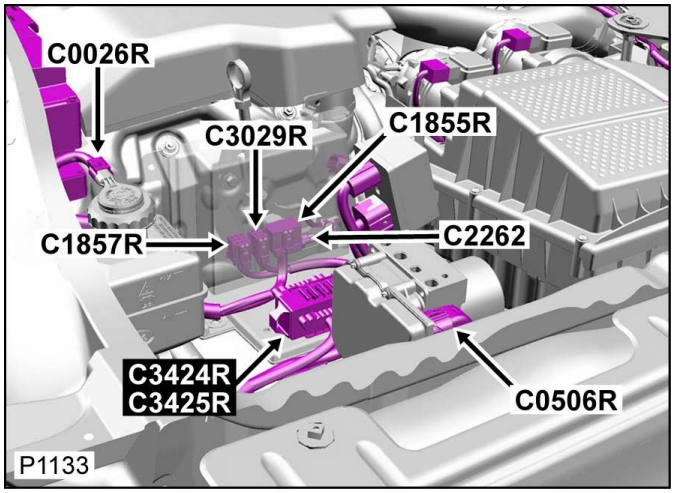


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
3	0.5	YN	282R	S/JOINT SJ720	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	YB	282R	S/JOINT SJ721	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	YN	282R	S/JOINT SJ720	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	YB	282R	S/JOINT SJ721	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	BG	282R	C0193	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	N	282R	C0193	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
13	0.5	Y	282R	C0193	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
14	0.5	R	282R	C0193	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
15	0.5	Y	282R	C0193	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
16	0.5	G	282R	C0193	418-411-08	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3426L

CONNECTOR HOUSING NOT SERVICEABLE

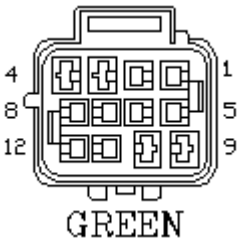

Part No.: YPC803080

Colour: GREEN


Cavities: 12WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to transmission harness

Location: Rear RH side of engine compartment

Qualifier:

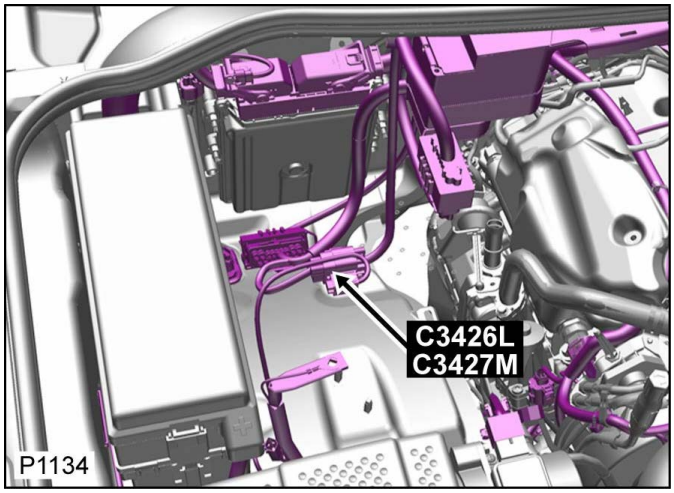


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	R	807L	S/JOINT SJ242	-	-	-	-	-	-	-
2	0.75	WO	282L	C0635L	-	-	-	-	-	-	-
2	0.5	P	798L	S/JOINT SJ866	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.75	UN	798L	S/JOINT SJ868	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
3	2.5	WR	282L	S/JOINT SJ932	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
4	1.5	PY	807L	S/JOINT SJ1061	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
5	0.5	GO	807L	S/JOINT SJ905	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.75	WP	282L	C0635L	-	-	-	-	-	-	-
6	0.5	UN	798L	C0658L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	WU	282L	C0635L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	WO	798L	S/JOINT SJ867	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	RB	282L	C0635L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	NR	798L	C0658L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
9	1.5	B	807L	S/JOINT SJ173	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
10	2.5	WG	282L	S/JOINT SJ931	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
11	0.5	U	282L	C0635L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	YR	798L	C0658L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	RB	282L	C0635L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	WU	798L	C0658L	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3426R

CONNECTOR HOUSING NOT SERVICEABLE

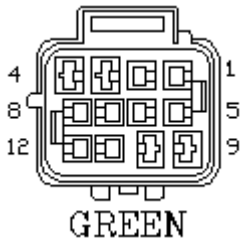

Part No.: YPC803080

Colour: GREEN


Cavities: 12WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to transmission harness

Location: Rear LH side of engine compartment

Qualifier: RHD condition illustrated

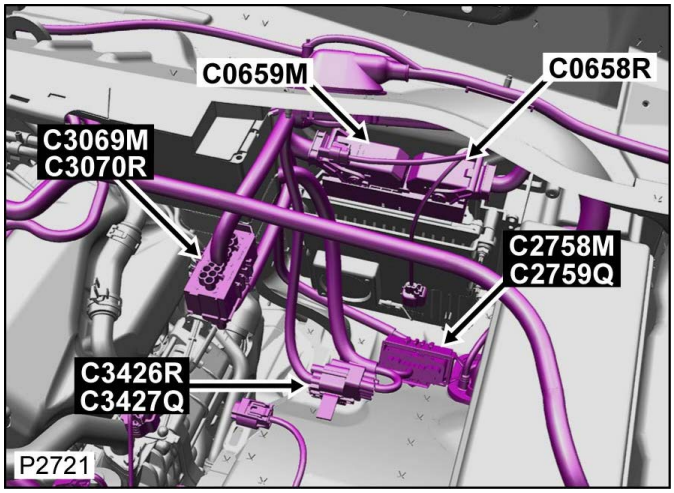


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	R	807R	S/JOINT SJ1242	-	-	-	-	-	-	-
2	0.75	WO	282R	C0635R	-	-	-	-	-	-	-
2	0.5	P	798R	S/JOINT SJ1866	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
3	0.75	UN	798R	S/JOINT SJ1868	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
3	2.5	WR	282R	S/JOINT SJ1932	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
4	1.5	PY	807R	S/JOINT SJ1062	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
5	0.5	GO	807R	S/JOINT SJ1905	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
6	0.75	G	282R	C0635R	-	-	-	-	-	-	-
6	0.5	UN	798R	C0658R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	WU	282R	C0635R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	WO	798R	S/JOINT SJ1867	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	RB	282R	C0635R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	NR	798R	C0658R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
9	1.5	B	807R	S/JOINT SJ173	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
10	2.5	WG	282R	S/JOINT SJ1931	418-411-19	-	418-116A	418-117	418-104	418-113	418-108
11	0.5	U	282R	C0635R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	YR	798R	C0658R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	RB	282R	C0635R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	WU	798R	C0658R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3427L

CONNECTOR HOUSING NOT SERVICEABLE

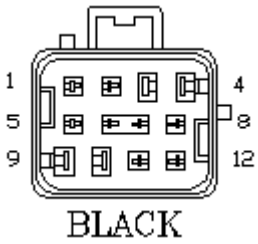

Part No.: YPC803050

Colour: GREEN


Cavities: 12WY

Harness: TRANSMISSION AUTO-PETROL HARNESS

Description: Transmission harness to engine compartment harness

Location: Rear RH side of engine compartment

Qualifier:

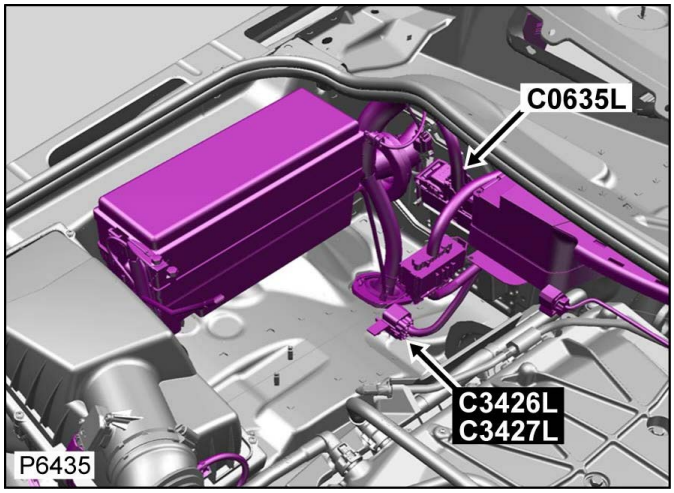


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	R	282L	C0193	-	-	-	-	-	-	-
2	1.0	WO	282L	C0642	-	-	-	-	-	-	-
3	1.5	WR	282L	C0908	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
4	1.0	PY	282L	C0193	-	-	-	-	-	-	-
5	0.5	GO	282L	C0193	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	1.0	G	282L	C0908	-	-	-	-	-	-	-
7	0.5	WU	282L	C0908	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	RB	282L	C0642	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
9	1.0	B	282L	S/JOINT SJ8409	-	-	-	-	-	-	-
10	1.5	WG	282L	C0642	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
11	0.5	U	282L	C0642	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	RB	282L	C0908	418-411-08	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3427M

CONNECTOR HOUSING NOT SERVICEABLE

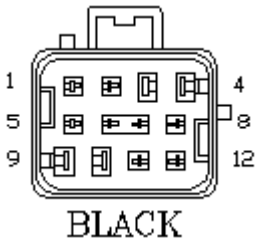

Part No.: YPC803050

Colour: GREEN


Cavities: 12WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Transmission harness to engine compartment harness

Location: Rear RH side of engine compartment

Qualifier:

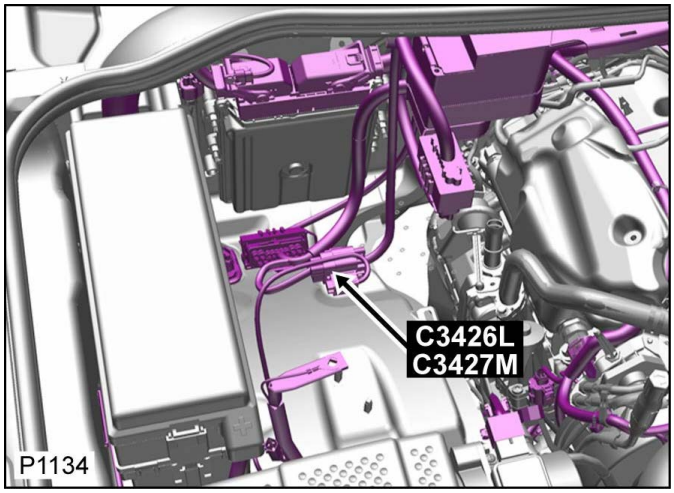


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	RW	993L	C3432	-	-	-	-	-	-	-
2	0.5	P	993L	C3049	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
3	0.75	B	993L	C1559	-	-	-	-	-	-	-
4	1.0	PY	993L	C3432	-	-	-	-	-	-	-
5	0.5	GO	993L	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	UN	993L	C3049	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	WO	993L	C3049	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	NR	991L	C2741	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
9	1.0	B	993L	S/JOINT SJ4409	-	-	-	-	-	-	-
11	0.5	YR	991L	C2741	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	WU	991L	C2741	418-411-08	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3427N

CONNECTOR HOUSING NOT SERVICEABLE

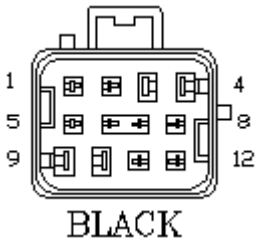

Part No.: YPC803050

Colour: GREEN


Cavities: 12WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Transmission harness to engine compartment harness

Location: Rear LH side of engine compartment

Qualifier:

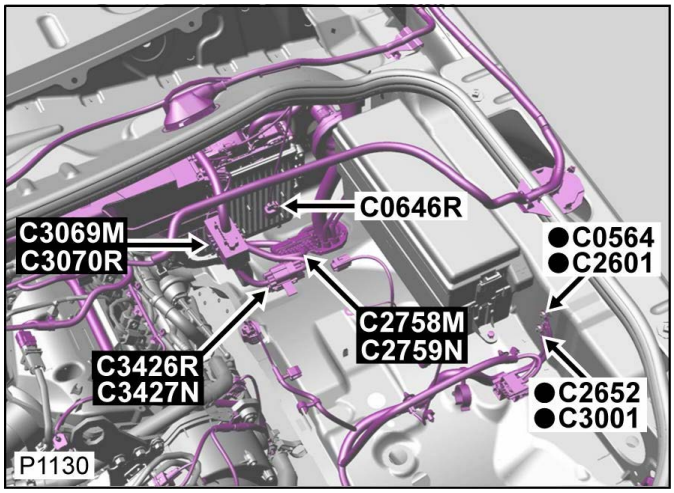


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	RW	993R	C3432	-	-	-	-	-	-	-
2	0.5	P	993R	C3049	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
3	0.75	B	993R	C1559	-	-	-	-	-	-	-
4	1.0	PY	993R	C3432	-	-	-	-	-	-	-
5	0.5	GO	993R	C3432	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	UN	993R	C3049	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	WO	993R	C3049	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	NR	991R	C2741	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
9	1.0	B	993R	S/JOINT SJ4409	-	-	-	-	-	-	-
11	0.5	YR	991R	C2741	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	WU	991R	C2741	418-411-08	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3427P

CONNECTOR HOUSING NOT SERVICEABLE

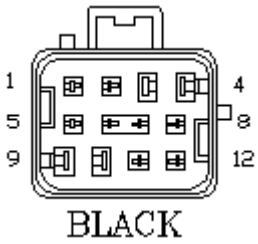

Part No.: YPC803050

Colour: GREEN


Cavities: 12WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Transmission harness to engine compartment harness

Location: Rear RH side of engine compartment

Qualifier: LHD condition illustrated

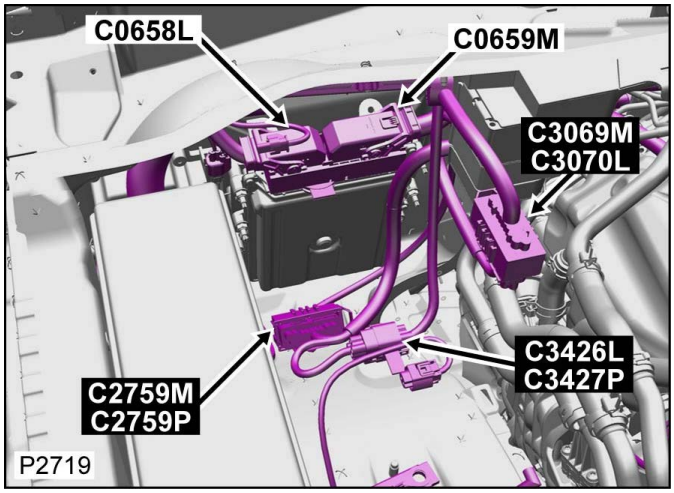


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	R	982L	C3432A	-	-	-	-	-	-	-
2	1.0	P	982L	C3049A	-	-	-	-	-	-	-
3	0.75	B	982L	C1559A	-	-	-	-	-	-	-
4	1.5	PY	982L	C3432A	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
6	0.5	UN	982L	C3049A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	WO	982L	C3049A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	NR	983L	C2741A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
9	1.5	B	982L	C3432A	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
11	0.5	YR	983L	C2741A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	WU	983L	C2741A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3427Q

CONNECTOR HOUSING NOT SERVICEABLE

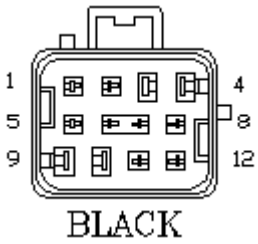

Part No.: YPC803050

Colour: GREEN


Cavities: 12WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Transmission harness to engine compartment harness

Location: Rear LH side of engine compartment

Qualifier: RHD condition illustrated

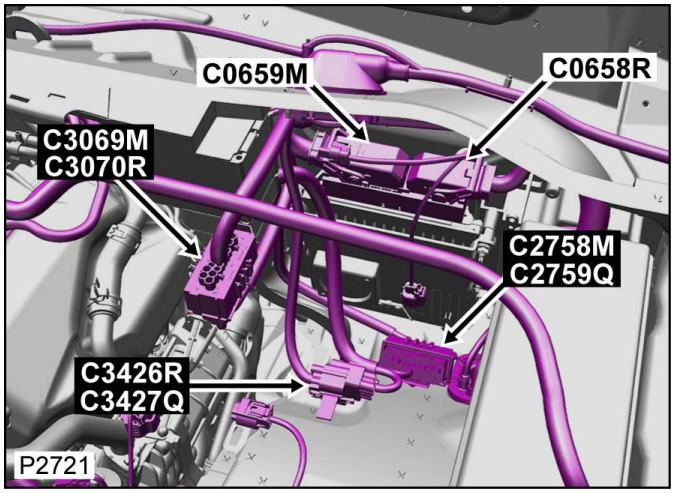


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	R	982R	C3432A	-	-	-	-	-	-	-
2	1.0	P	982R	C3049A	-	-	-	-	-	-	-
3	0.75	B	982R	C1559A	-	-	-	-	-	-	-
4	1.5	PY	982R	C3432A	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
6	0.5	UN	982R	C3049A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	WO	982R	C3049A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	NR	983R	C2741A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
9	1.5	B	982R	C3432A	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
11	0.5	YR	983R	C2741A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	WU	983R	C2741A	418-411-08	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3427R

CONNECTOR HOUSING NOT SERVICEABLE

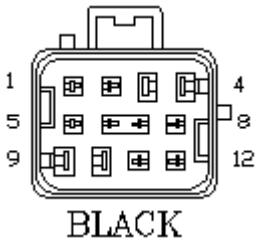

Part No.: YPC803050

Colour: GREEN


Cavities: 12WY

Harness: TRANSMISSION AUTO-PETROL HARNESS

Description: Transmission harness to engine compartment harness

Location: Rear LH side of engine compartment

Qualifier:

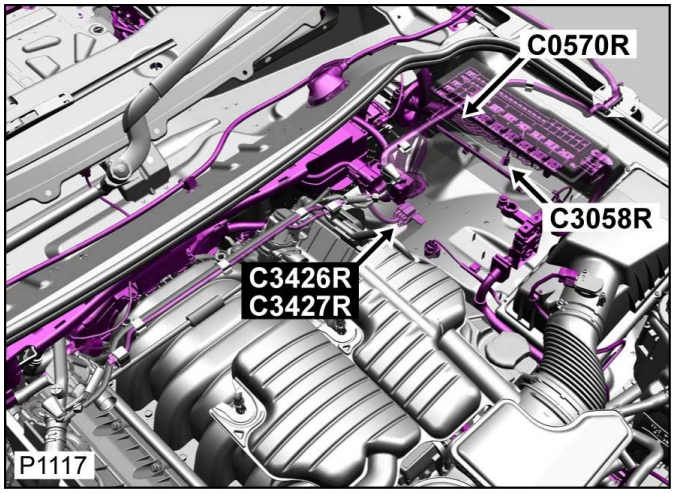

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	R	282R	C0193	-	-	-	-	-	-	-
2	1.0	WO	282R	C0642	-	-	-	-	-	-	-
3	1.5	WR	282R	C0908	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
4	1.0	PY	282R	C0193	-	-	-	-	-	-	-
5	0.5	GO	282R	C0193	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
6	1.0	G	282R	C0908	-	-	-	-	-	-	-
7	0.5	WU	282R	C0908	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
8	0.5	RB	282R	C0642	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
9	1.0	B	282R	S/JOINT SJ8409	-	-	-	-	-	-	-
10	1.5	WG	282R	C0642	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
11	0.5	U	282R	C0642	418-411-08	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	RB	282R	C0908	418-411-08	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3428

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC500600

Colour: DARK GREY


Cavities: 4WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to link harness

Location: Front RH side of engine compartment

Qualifier:

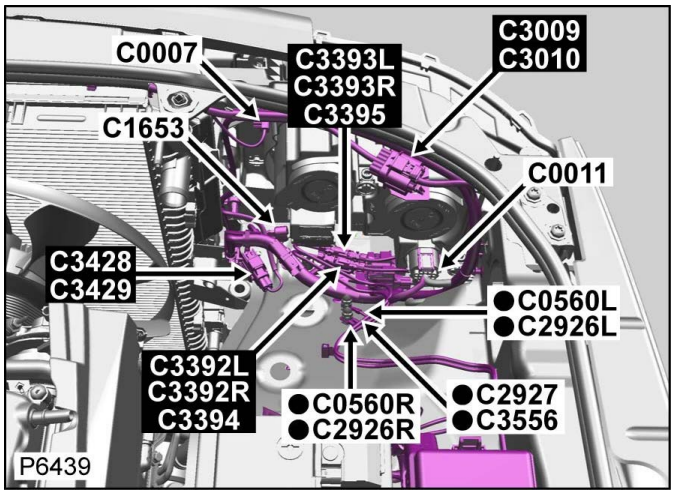


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	BU	245L	C2412L	-	-	-	-	-	-	-
1	0.35	BU	245R	C2241R	-	-	-	-	-	-	-
2	0.35	BR	245L	C2244L	-	-	-	-	-	-	-
2	0.35	BR	245R	C2241R	-	-	-	-	-	-	-
3	0.35	BY	245L	C2412L	-	-	-	-	-	-	-
3	0.35	BY	245R	C2241R	-	-	-	-	-	-	-
4	0.75	RW	245L	C2412L	418-411-73	-	418-116A	418-117	418-104	418-112	418-107
4	0.75	RW	245R	C2410R	418-411-73	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3429

CONNECTOR HOUSING NOT SERVICEABLE

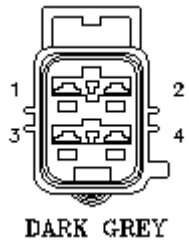

Part No.: YPC900130

Colour: DARK GREY


Cavities: 4WY

Harness: AIR SUSPENSION HARNESS

Description: Air suspension harness to engine compartment harness

Location: Front RH side of engine compartment

Qualifier:

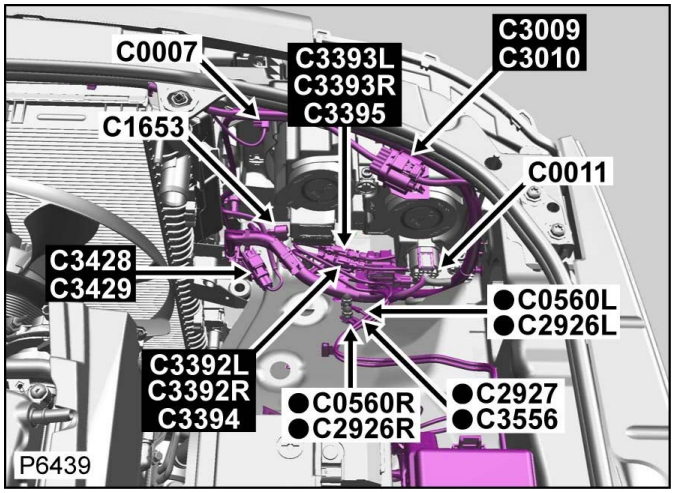


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	BU	245	C3421
2	0.5	BR	245	C3421
3	0.5	BY	245	C3421
4	0.35	RW	245	C3079

Click here to print

Connector: C3430

CONNECTOR HOUSING SERVICEABLE

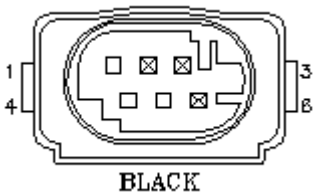

Part No.: YPC803250

Colour: BLACK


Cavities: 3WY

Harness: AIR SUSPENSION HARNESS

Description: Sensor-Height-Front-RH

Location: Behind RH front fender splash shield

Qualifier:

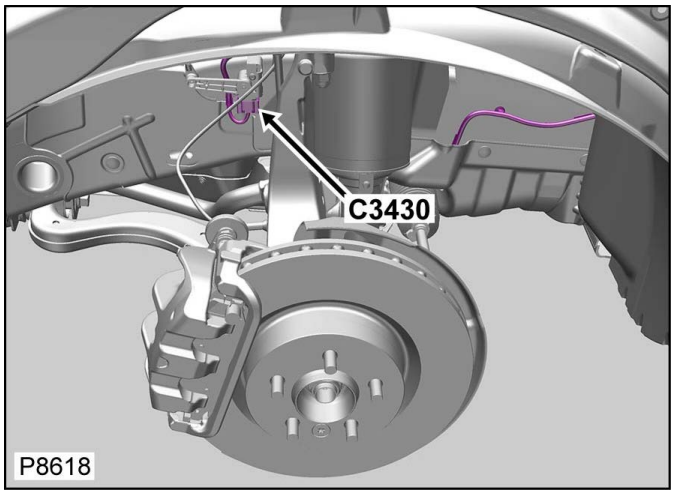


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	SR	808	C3010	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
4	0.35	SU	808	C3010	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	SY	808	C3010	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C3431**

CONNECTOR HOUSING SERVICEABLE

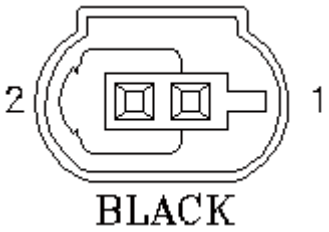

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Fuel fired booster heater pump

Location: Beneath rear of vehicle RH side

Qualifier:

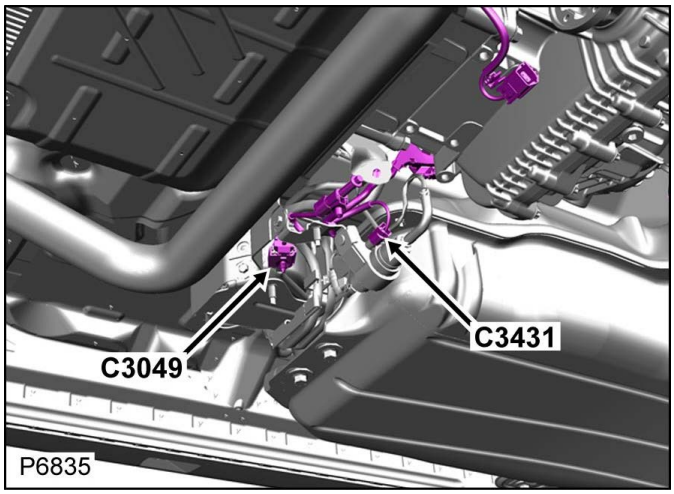


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WU	994L	C3425M	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	WU	994R	C3425N	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	994L	C3425M	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	994R	C3425N	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: **C3431A**

CONNECTOR HOUSING SERVICEABLE

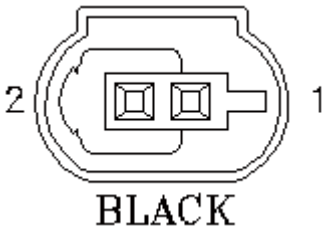

Part No.: YPC500360

Colour: BLACK


Cavities: 2WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: Fuel fired booster heater pump

Location: RH side of transfer box

Qualifier:

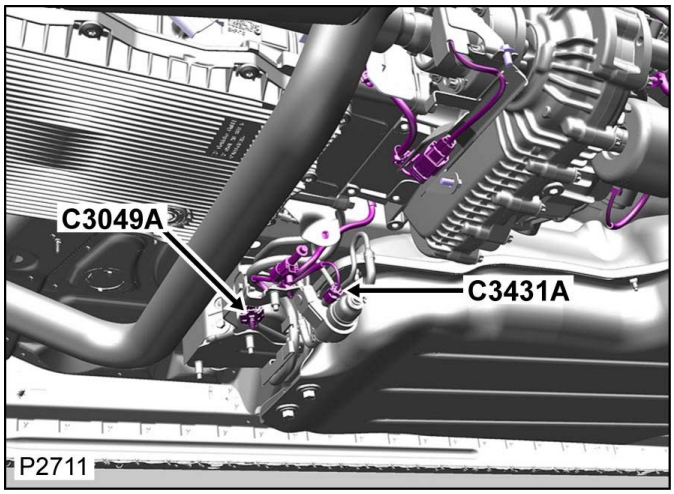

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	WU	984L	C3425P	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
1	0.75	WU	984R	C3425Q	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	B	984L	C3425P	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	B	984R	C3425Q	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C3432


CONNECTOR HOUSING NOT SERVICEABLE

Description: TCM and Control Valve Body

Location: RH side of gearbox

Qualifier:

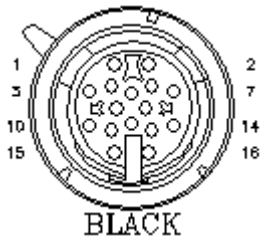

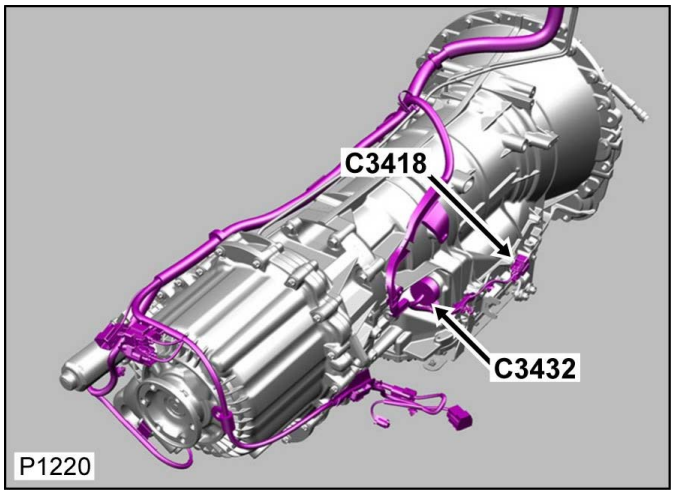

Part No.: YPC501330

Colour: BLACK

Cavities: 16WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Wire Chart and Service Repair Kit Information


CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	BG	729L	C2366H	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	BG	729R	C2366J	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	BG	993L	C3425M	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	BG	993R	C3425N	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	YB	797	S/JOINT SJ721	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	YB	993	S/JOINT SJ4721	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	GW	729L	C2366H	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	GW	729R	C2366J	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	N	729L	C2366H	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	N	729R	C2366J	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	N	993L	C3425M	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
4	0.5	N	993R	C3425N	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	Y	729L	C2366H	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	Y	729R	C2366J	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	Y	993L	C3425M	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
5	0.5	Y	993R	C3425N	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	YN	797	S/JOINT SJ720	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	YN	993	S/JOINT SJ4720	418-549-58	-	418-116A	418-117	418-104	418-112	418-107

7	0.5	R	729L	C2366H	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	R	729R	C2366J	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	R	993L	C3425M	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
7	0.5	R	993R	C3425N	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
9	1.0	GW	729L	C2366H	418-072	-	418-116A	418-117	-	418-112	418-107
9	1.0	GW	729R	C2366J	418-072	-	418-116A	418-117	-	418-112	418-107
9	0.75	RW	993L	C3427M	418-072	-	418-116A	418-117	-	418-112	418-107
9	0.75	RW	993R	C3427N	418-072	-	418-116A	418-117	-	418-112	418-107
10	0.5	GO	729L	C2366H	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	GO	729R	C2366J	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	GO	993L	C3427M	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
10	0.5	GO	993R	C3427N	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	YW	729L	C2366H	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	YW	729R	C2366J	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	YW	993L	C3425M	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	YW	993R	C3425N	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	G	729L	C2366H	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	G	729R	C2366J	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	G	993L	C3425M	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
12	0.5	G	993R	C3425N	418-549-58	-	418-116A	418-117	418-104	418-112	418-107
13	1.0	B	797	S/JOINT SJ4409	418-072	-	418-116A	418-117	-	418-112	418-107
13	1.0	B	993	S/JOINT SJ4409	418-072	-	418-116A	418-117	-	418-112	418-107
14	1.0	PY	797	S/JOINT SJ4410	418-072	-	418-116A	418-117	-	418-112	418-107
14	1.0	PY	993L	C3427M	418-072	-	418-116A	418-117	-	418-112	418-107
14	1.0	PY	993R	C3427N	418-072	-	418-116A	418-117	-	418-112	418-107
16	1.0	B	797	S/JOINT SJ4409	418-072	-	418-116A	418-117	-	418-112	418-107
16	1.0	B	993	S/JOINT SJ4409	418-072	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: **C3432A**

CONNECTOR HOUSING SERVICEABLE

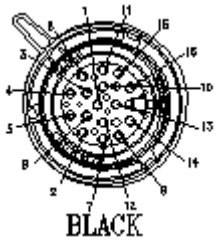

Part No.: YPC912850

Colour: BLACK


Cavities: 16WY

Harness: TRANSMISSION AUTO-DIESEL HARNESS

Description: TCM and Control Valve Body

Location: RH side of gearbox

Qualifier:

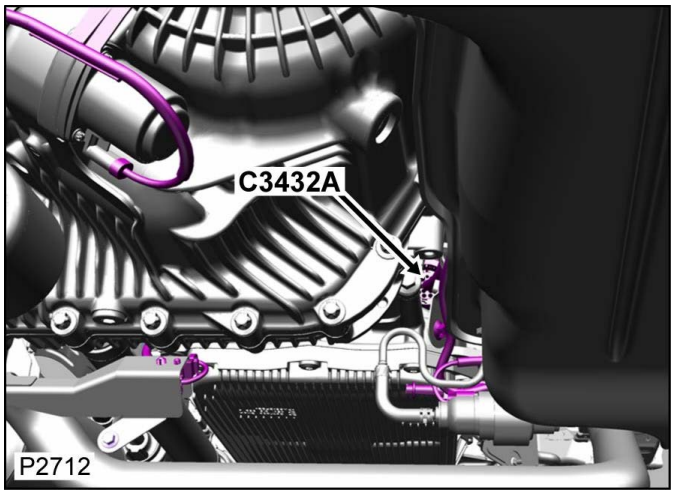


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	GW	982L	C3425P	418-072	-	418-116A	418-117	-	418-112	418-107
1	0.75	GW	982R	C3425Q	418-072	-	418-116A	418-117	-	418-112	418-107
4	0.75	S	982L	C3425P	418-072	-	418-116A	418-117	-	418-112	418-107
4	0.75	S	982R	C3425Q	418-072	-	418-116A	418-117	-	418-112	418-107
5	0.75	YN	982	S/JOINT SJ4422	418-072	-	418-116A	418-117	-	418-112	418-107
6	0.75	YB	982	S/JOINT SJ4423	418-072	-	418-116A	418-117	-	418-112	418-107
9	0.75	R	982L	C3427P	418-072	-	418-116A	418-117	-	418-112	418-107
9	0.75	R	982R	C3427Q	418-072	-	418-116A	418-117	-	418-112	418-107
13	1.5	PY	982L	C3427P	-	-	-	-	-	-	-
13	1.5	PY	982R	C3427Q	-	-	-	-	-	-	-
14	1.5	B	982L	C3427P	-	-	-	-	-	-	-
14	1.5	B	982R	C3427Q	-	-	-	-	-	-	-

Click here to print

Connector: C3433T

CONNECTOR HOUSING NOT SERVICEABLE

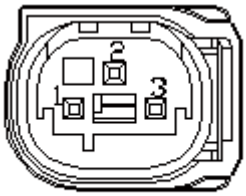

BLACK

Part No.: YPC802330

Colour: BLACK


Cavities: 3WY

Harness: CABIN HARNESS

Description: Accelerometer-Rear right

Location: RH rear of vehicle

Qualifier:

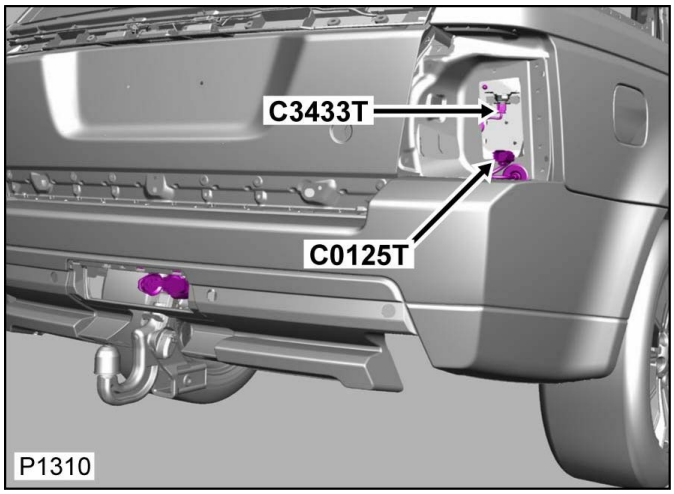


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	BR	245T	C3087T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.35	BW	245T	S/JOINT SJ251T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	BG	245T	S/JOINT SJ250T	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3434L

CONNECTOR HOUSING NOT SERVICEABLE

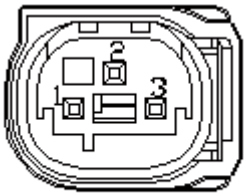

BLACK

Part No.: YPC802330

Colour: BLACK


Cavities: 3WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Accelerometer-Front

Location: Beneath RH side of air intake plenum

Qualifier:

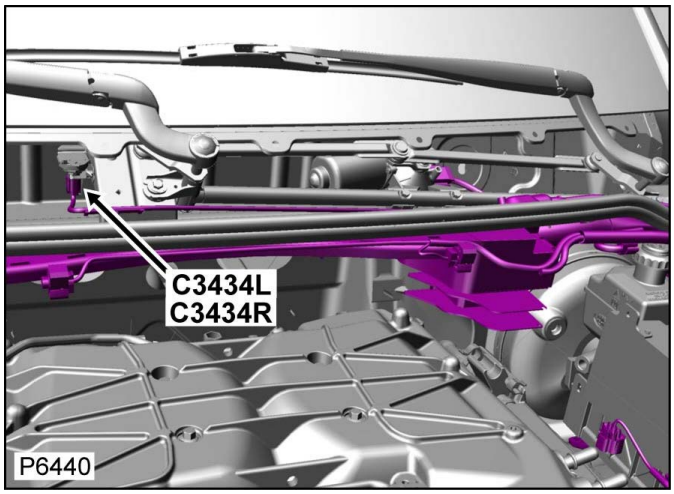


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	BR	245L	C2245L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	BW	245L	C2245L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	BG	245L	C2245L	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3434R

CONNECTOR HOUSING NOT SERVICEABLE

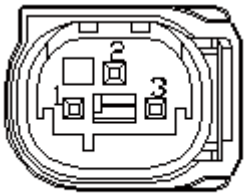

BLACK

Part No.: YPC802330

Colour: BLACK


Cavities: 3WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Accelerometer-Front

Location: Beneath RH side of air intake plenum

Qualifier:

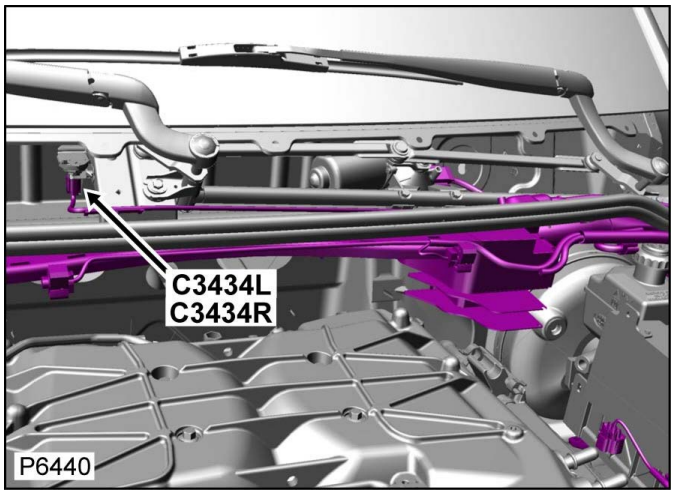

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	BR	245R	C2410R	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	BW	245R	C2410R	418-549-11	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	BG	245R	C2410R	418-549-11	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3442L


CONNECTOR HOUSING NOT SERVICEABLE

Description: Touch screen display

Location: Behind front touch screen display

Qualifier:

ASSEMBLY

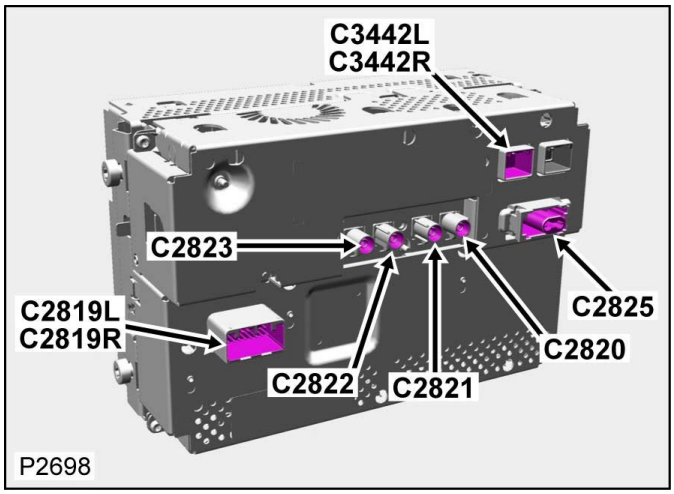

Part No.: XUD815290

Colour: NO COLOUR

Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	N	1011L	C2973L
1	0.5	N	1048L	C3462
2	0.5	P	1011L	C2973L
2	0.5	P	1048L	C3462
3	0.5	SCR	1011L	C2973L
3	0.5	SCR	1048L	C3462

Click here to print

Connector: C3442R


CONNECTOR HOUSING NOT SERVICEABLE

Description: Touch screen display

Location: Behind front touch screen display

Qualifier:

ASSEMBLY

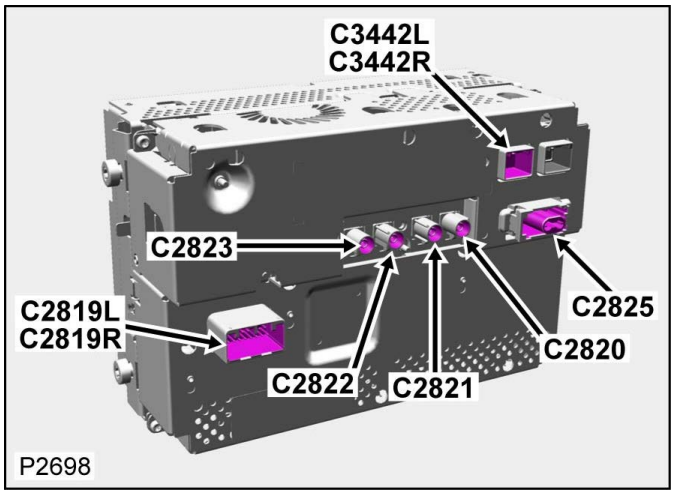

Part No.: XUD815300

Colour: NO COLOUR

Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	N	568	C2973R
1	0.5	N	1011R	C2973R
1	0.5	N	1048R	C3462
2	0.5	P	568	C2973R
2	0.5	P	1011R	C2973R
2	0.5	P	1048R	C3462
3	0.5	SCR	568	C2973R
3	0.5	SCR	1011R	C2973R
3	0.5	SCR	1048R	C3462

Click here to print


Connector: C3461

CONNECTOR HOUSING NOT SERVICEABLE

Description: Audio head unit

Location: Behind front touch screen display

Qualifier:

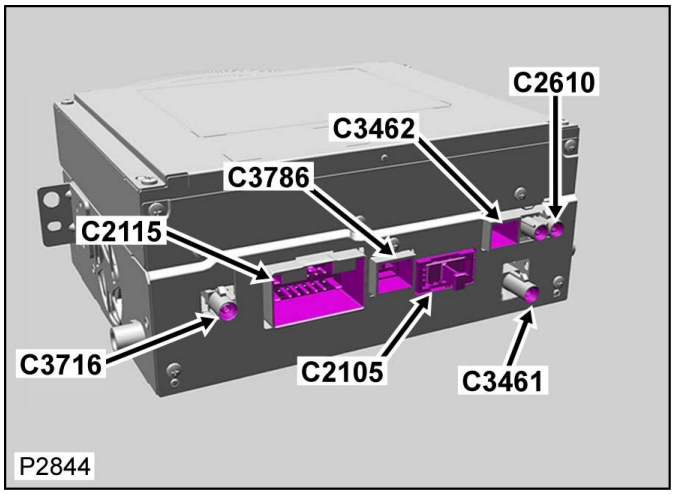

ASSEMBLY

Part No.: XUD812160

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE LINK HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	989	C2727
1S	0.5	SCR	989	C2727
1	0.5	B	990	C2727
1S	0.5	SCR	990	C2727

Click here to print

Connector: C3462

CONNECTOR HOUSING NOT SERVICEABLE

Description: Audio head unit

Location: Behind front touch screen display

Qualifier:


ASSEMBLY

Part No.: XUD815290

Colour: NO COLOUR

Cavities: 2WY

Harness: FACIA COMPOSITE HARNESS

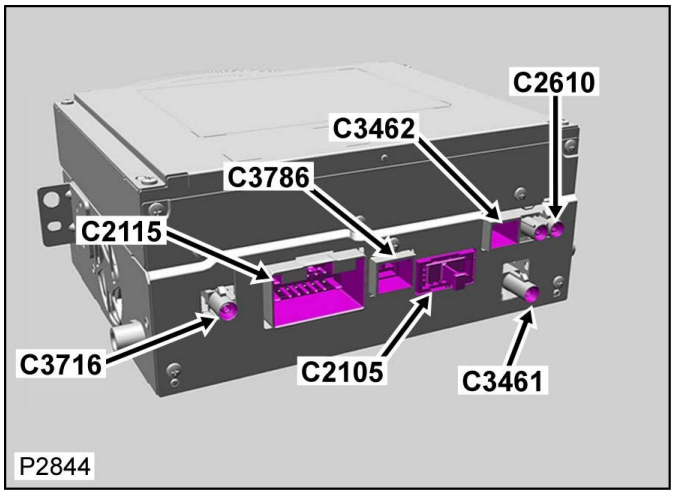

Wire Chart

CAV	CSA	COL	CCT	DESTN
SCR	0.5	SCR	1048L	C3442L
SCR	0.5	SCR	1048R	C3442R
1	0.5	N	1048L	C3442L
1	0.5	N	1048R	C3442R
2	0.5	P	1048L	C3442L
2	0.5	P	1048R	C3442R

Click here to print

Connector: C3470

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC909480

Colour: NATURAL


Cavities: 26WY

Harness: FACIA COMPOSITE HARNESS

Description: Module-Climate Control

Location: Climate control assembly-Driver side

Qualifier:

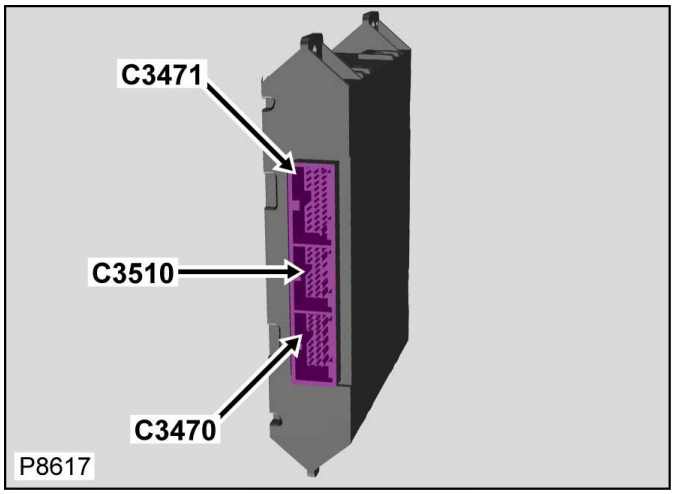

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	GP	499	S/JOINT SJ553	-	-	-	-	-	-	-
2	0.5	RB	254L	C2443	418-411-33	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RB	254R	C2238R	418-411-33	-	418-116A	418-117	418-104	418-112	418-107
3	0.75	OG	21L	C0469L	-	-	-	-	-	-	-
3	0.75	OG	21R	C0469R	-	-	-	-	-	-	-
5	0.35	LGW	139L	C2238L	418-411-33	-	418-116A	418-117	418-104	418-112	418-107
5	0.35	LGW	200R	C2239R	418-411-33	-	418-116A	418-117	418-104	418-112	418-107
6	1.0	B	139L	C2629L	-	-	-	-	-	-	-
6	1.0	B	200R	C2629R	-	-	-	-	-	-	-
9	0.5	BU	139L	C2238L	-	-	-	-	-	-	-
9	0.5	BU	200R	C2238R	-	-	-	-	-	-	-
10	0.5	RU	139L	C2238L	-	-	-	-	-	-	-
10	0.5	RU	200R	C2238R	-	-	-	-	-	-	-
12	0.5	YW	499	S/JOINT SJ730	-	-	-	-	-	-	-
13	0.5	YU	499	S/JOINT SJ731	-	-	-	-	-	-	-
14	0.5	O	19R	C2238R	-	-	-	-	-	-	-
15	0.5	BG	19R	C2238R	-	-	-	-	-	-	-
16	0.5	UY	19L	C1443L	-	-	-	-	-	-	-
16	0.5	UY	19R	S/JOINT SJ784	-	-	-	-	-	-	-
17	0.5	RG	139L	C2443	-	-	-	-	-	-	-
17	0.5	RG	19R	S/JOINT SJ880	-	-	-	-	-	-	-
22	0.5	UN	139L	C2443	-	-	-	-	-	-	-
22	0.5	UN	200R	C2239R	-	-	-	-	-	-	-
23	0.5	GW	19L	C0790L	-	-	-	-	-	-	-
23	0.5	GW	19R	C0790R	-	-	-	-	-	-	-

24	0.5	WU	19L	C0790L	-	-	-	-	-	-	-
24	0.5	WU	19R	C0790R	-	-	-	-	-	-	-
25	0.5	WR	19L	C0790L	-	-	-	-	-	-	-
25	0.5	WR	19R	C0790R	-	-	-	-	-	-	-
26	0.5	BG	499	S/JOINT SJ550	-	-	-	-	-	-	-

Click here to print

Connector: C3471

CONNECTOR HOUSING NOT SERVICEABLE


Description: Module-Climate Control

Location: Climate control assembly-Driver side

Qualifier:



NATURAL

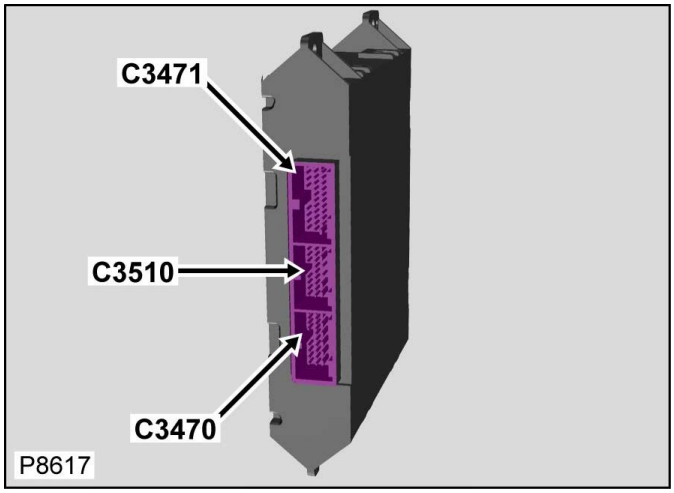

Part No.: YPC909490

Colour: NATURAL

Cavities: 30WY

Harness: ATC RHD HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GY	499	S/JOINT SJ1	418-411-33	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	N	499	C0419	-	-	-	-	-	-	-
5	0.5	NB	499	C0417	-	-	-	-	-	-	-
7	0.5	LGB	499	C2281	-	-	-	-	-	-	-
9	0.5	GB	499	C0419	-	-	-	-	-	-	-
11	0.5	RY	499	S/JOINT SJ4	-	-	-	-	-	-	-
13	0.5	WU	499	C0797	-	-	-	-	-	-	-
17	0.5	YB	499	C0419	-	-	-	-	-	-	-
19	0.5	G	499	C2281	-	-	-	-	-	-	-
21	0.5	RW	499	C0419	-	-	-	-	-	-	-
25	0.5	O	499	S/JOINT SJ2	-	-	-	-	-	-	-
26	0.5	P	499	S/JOINT SJ3	-	-	-	-	-	-	-

Click here to print

Connector: C3472

CONNECTOR HOUSING NOT SERVICEABLE

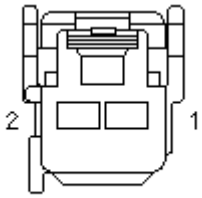

LIGHT GREY

Part No.: YPC910560

Colour: LIGHT GREY


Cavities: 2WY

Harness: DOORS FRONT HARNESS

Description: Illumination-Door-Front

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated

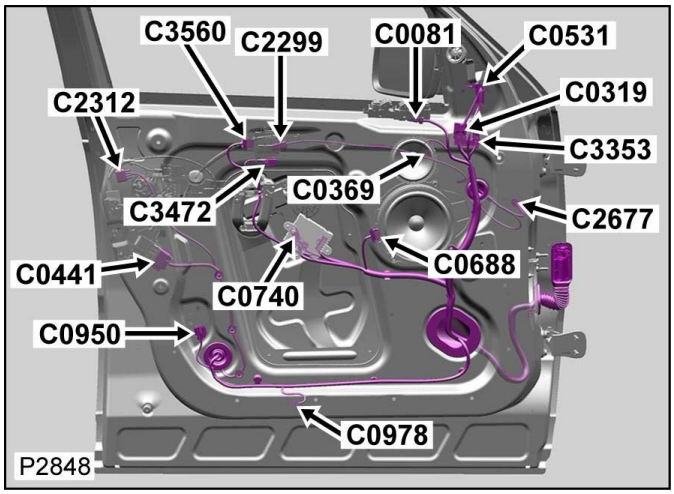


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	827L	C0439	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	B	827R	C3646	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	827	S/JOINT SJ840	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3474

CONNECTOR HOUSING NOT SERVICEABLE

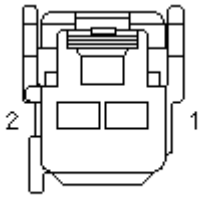

LIGHT GREY

Part No.: YPC910560

Colour: LIGHT GREY


Cavities: 2WY

Harness: REAR DOOR HARNESS

Description: LED-Door handle-Rear

Location: Behind rear door trim panel

Qualifier: LH side illustrated RH side similar

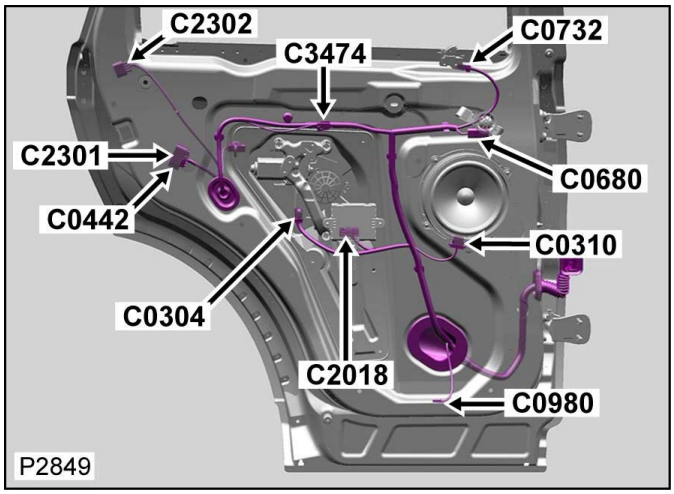


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	827R	C0804	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
1	0.5	B	827L	C0803	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	B	827	S/JOINT SJ200	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3476

CONNECTOR HOUSING NOT SERVICEABLE

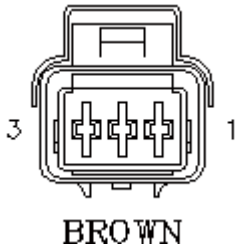

BROWN

Part No.: YPC900500

Colour: BROWN


Cavities: 3WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Engine compartment harness to glow plug harness

Location: Top of engine - RH side

Qualifier:

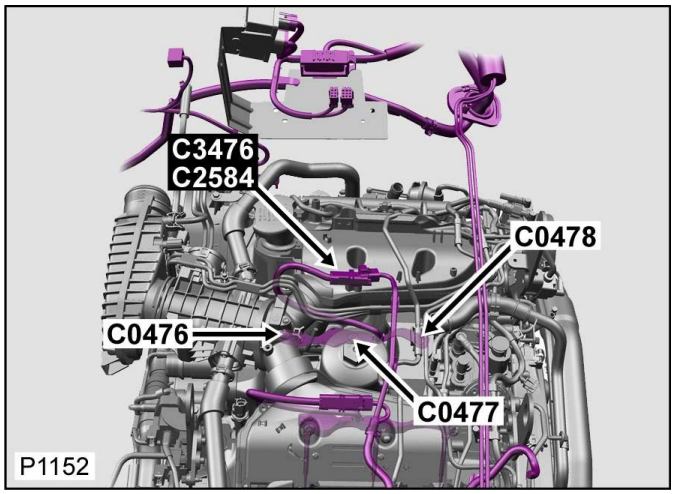


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.5	SP	798L	C0189L
1	1.5	SP	798R	C0189R
2	1.5	NU	798L	C0189L
2	1.5	NU	798R	C0189R
3	1.5	PW	798L	C0189L
3	1.5	PW	798R	C0189R

Click here to print

Connector: C3478

CONNECTOR HOUSING NOT SERVICEABLE

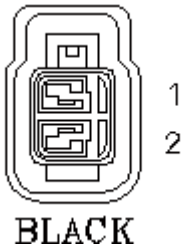

Part No.: YPC500750

Colour: BLACK


Cavities: 2WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Fan-Cooling-E box

Location: Rear LH side of engine compartment

Qualifier:

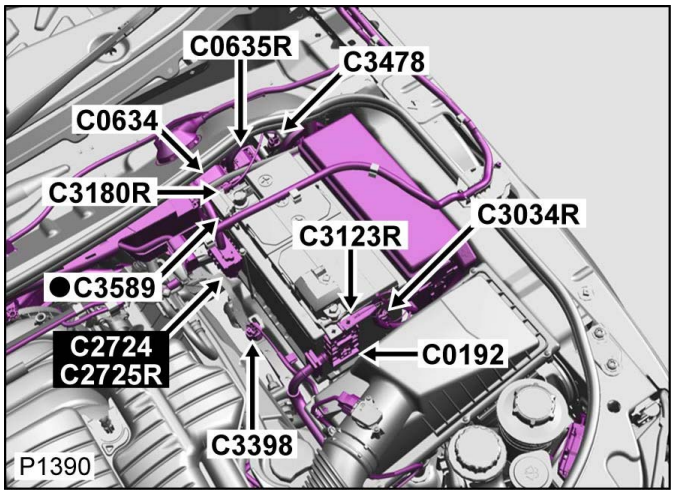

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	UB	282R	C2725R	418-411-09	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	NK	282R	S/JOINT SJ1450	418-411-09	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C3483


CONNECTOR HOUSING NOT SERVICEABLE

Description: Sensor-Camshaft position-Bank 1-Intake

Location: Front RH side of engine

Qualifier:

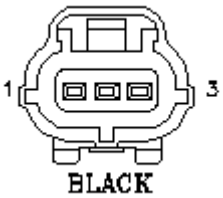

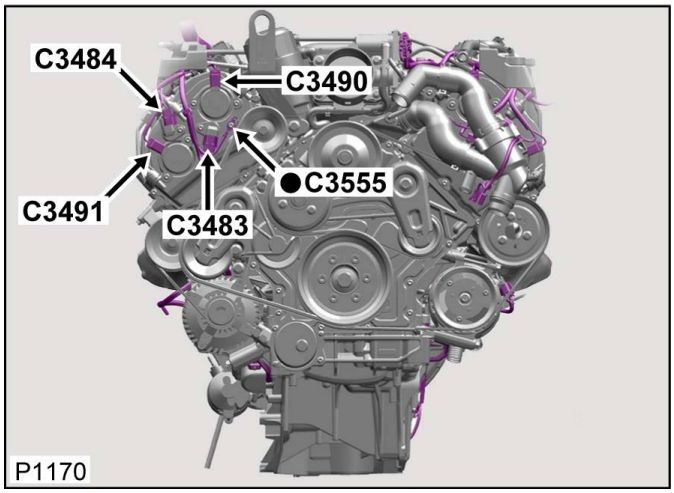

Part No.: YPC911080

Colour: BLACK

Cavities: 3WY

Harness: ENGINE PETROL AJ133 HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	GP	ALL	S/JOINT PIS08
2	0.5	YP	ALL	S/JOINT PIS07
3	0.5	N	ALL	C0634

Click here to print


Connector: C3484


CONNECTOR HOUSING NOT SERVICEABLE

Description: Sensor-Camshaft position-Bank 1-Outlet

Location: Front RH side of engine

Qualifier:

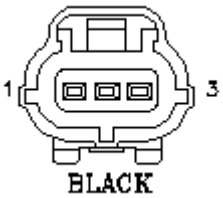

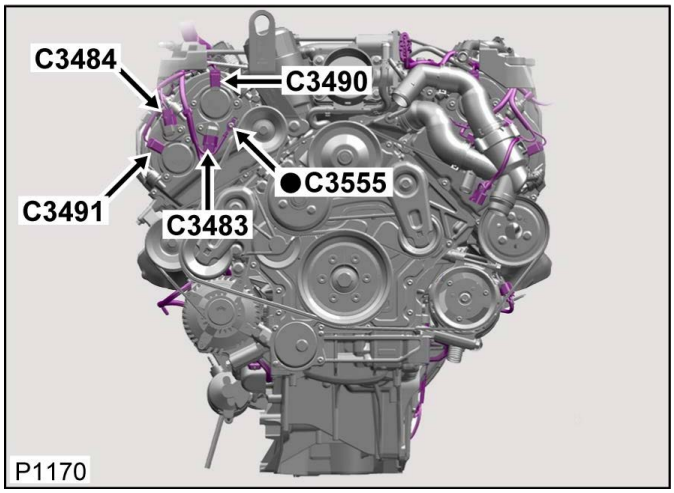

Part No.: YPC911080

Colour: BLACK

Cavities: 3WY

Harness: ENGINE PETROL AJ133 HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	GP	ALL	S/JOINT PIS08
2	0.5	YP	ALL	S/JOINT PIS07
3	0.5	WG	ALL	C0634

Click here to print

Connector: C3485

CONNECTOR HOUSING NOT SERVICEABLE

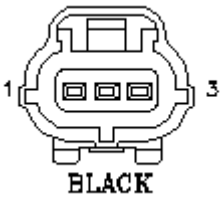

Part No.: YPC911080

Colour: BLACK


Cavities: 3WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Sensor-Camshaft position-Bank 2-Intake

Location: Front LH side of engine

Qualifier:

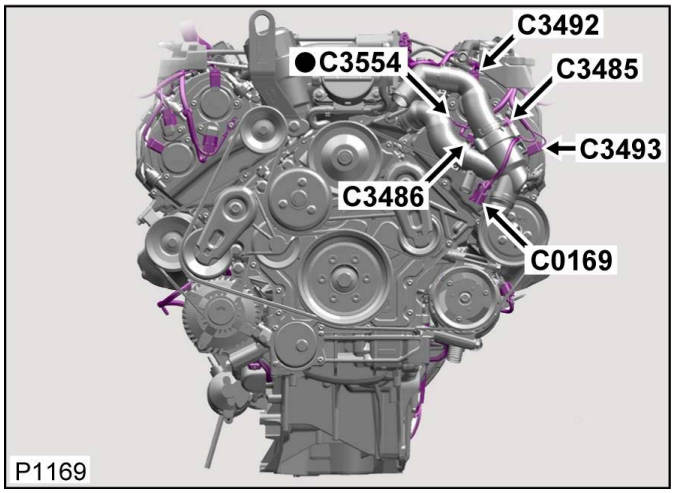


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	NU	ALL	S/JOINT PIS31
2	0.5	GN	ALL	S/JOINT PIS06
3	0.5	P	ALL	C0634

Click here to print

Connector: C3486

CONNECTOR HOUSING NOT SERVICEABLE

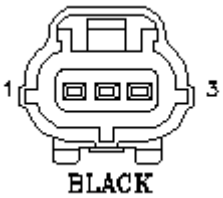

Part No.: YPC911080

Colour: BLACK


Cavities: 3WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Sensor-Camshaft position-Bank 2-Outlet

Location: Front LH side of engine

Qualifier:

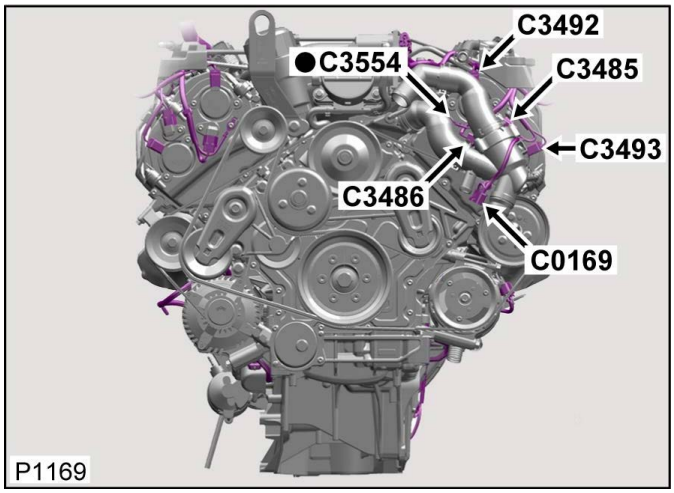

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	NU	ALL	S/JOINT PIS31
2	0.5	GN	ALL	S/JOINT PIS06
3	0.5	YU	ALL	C0634

Click here to print


Connector: C3487


CONNECTOR HOUSING NOT SERVICEABLE

Description: Valve-Manifold tuning

Location: Rear of engine - Center

Qualifier:

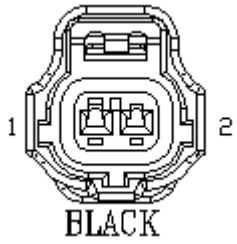

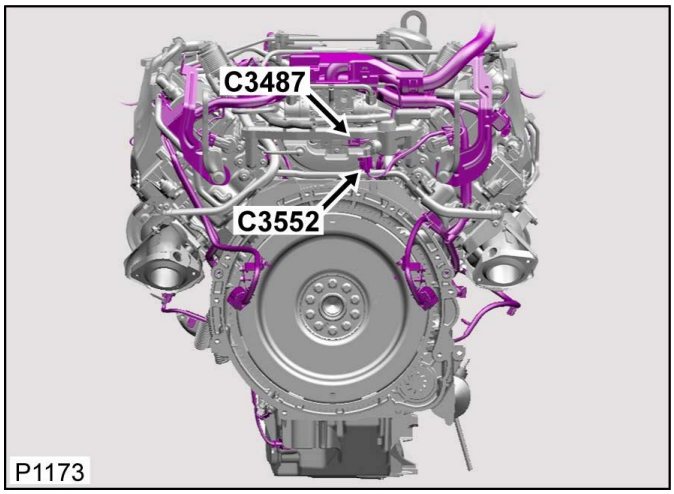

Part No.: YPC913910

Colour: BLACK

Cavities: 2WY

Harness: KNOCK SENSORS PETROL HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	S	ALL	C0904
2	0.5	G	ALL	C0904

Click here to print

Connector: C3488

CONNECTOR HOUSING NOT SERVICEABLE

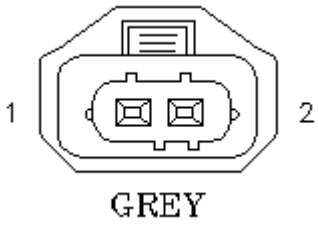

Part No.: YPC913410

Colour: GREY


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Solenoid-Camshaft profile switching-bank 1

Location: Rear RH side of engine

Qualifier:

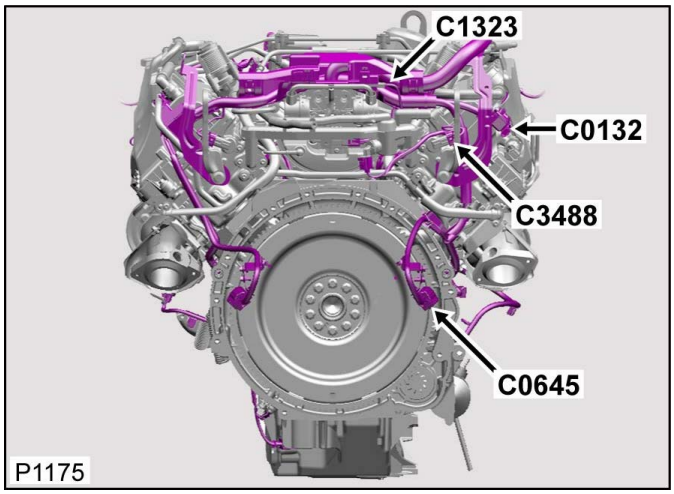


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	Y	(EN_RX)	C0634
2	0.5	S	(EN_RX)	S/JOINT PIS88

Click here to print

Connector: C3489

CONNECTOR HOUSING NOT SERVICEABLE

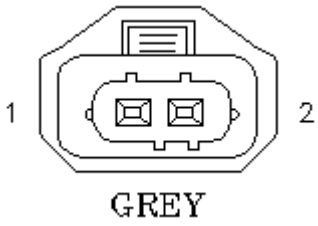

Part No.: YPC913410

Colour: GREY


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Solenoid-Camshaft profile switching-bank 2

Location: Rear LH side of engine

Qualifier:

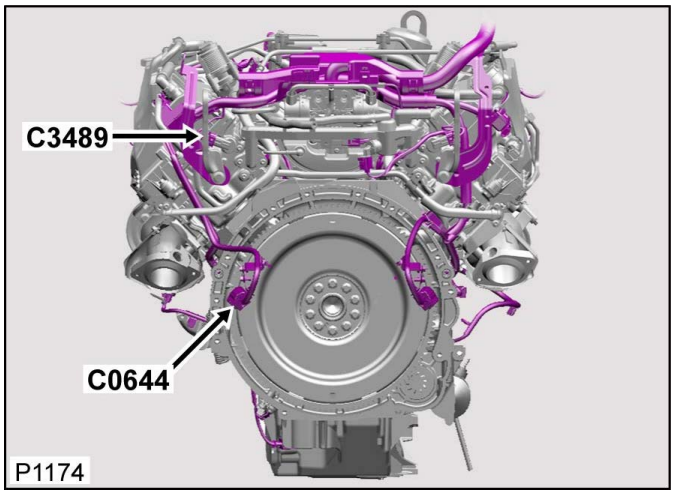

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	O	(EN_RX)	C0634
2	0.5	S	(EN_RX)	S/JOINT PIS88

Click here to print

Connector: C3490

CONNECTOR HOUSING NOT SERVICEABLE



BLACK

Part No.: YPC908800

Colour: BLACK


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Solenoid-VVT-Bank 1-Intake

Location: Front RH side of engine

Qualifier:

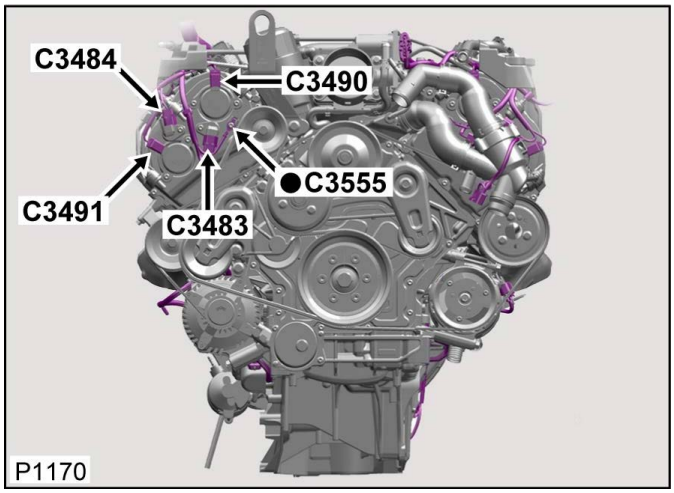

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	PN	ALL	C0634
2	0.5	G	ALL	S/JOINT PIS84

Click here to print

Connector: C3491

CONNECTOR HOUSING NOT SERVICEABLE



BLACK

Part No.: YPC908800

Colour: BLACK


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Solenoid-VVT-Bank 1-Exhaust

Location: Front RH side of engine

Qualifier:

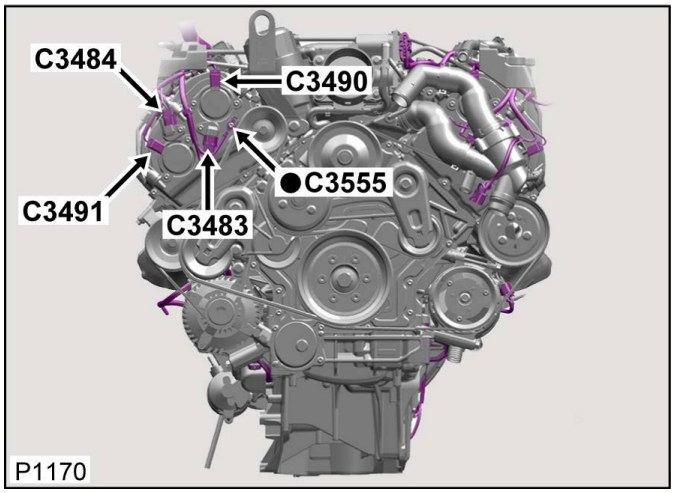

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	PS	ALL	C0634
2	0.5	G	ALL	S/JOINT PIS84

Click here to print

Connector: C3492

CONNECTOR HOUSING NOT SERVICEABLE



BLACK

Part No.: YPC908800

Colour: BLACK


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Solenoid-VVT-Bank 2-Intake

Location: Front LH side of engine

Qualifier:

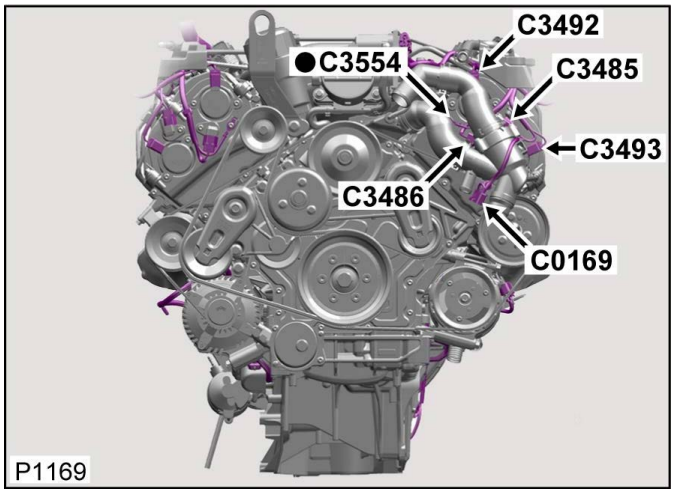

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	WG	ALL	C0634
2	0.5	G	ALL	S/JOINT PIS84

Click here to print

Connector: C3493

CONNECTOR HOUSING NOT SERVICEABLE

Description: Solenoid-VVT-Bank 2-Exhaust

Location: Lower front of engine - LH side

Qualifier:




BLACK

Part No.: YPC908800

Colour: BLACK

Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

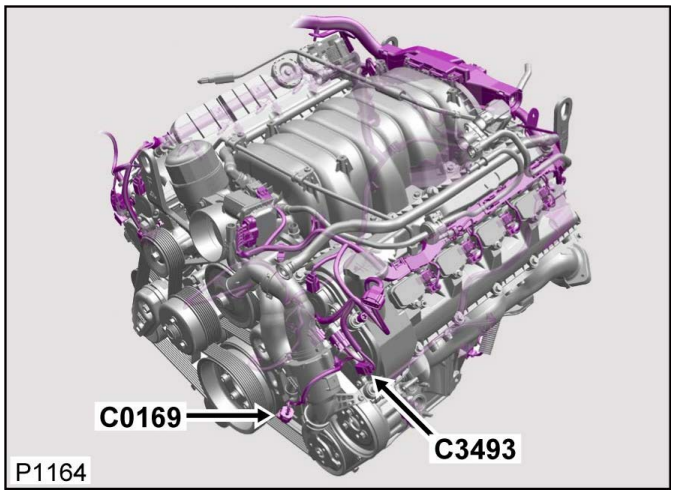

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	WO	ALL	C0634
2	0.5	G	ALL	S/JOINT PIS84

Click here to print


Connector: C3501


CONNECTOR HOUSING NOT SERVICEABLE

Description: VICS receiver

Location: Behind passenger side of Instrument panel

Qualifier:

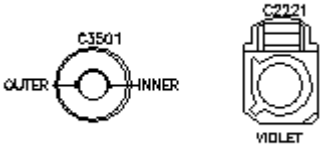

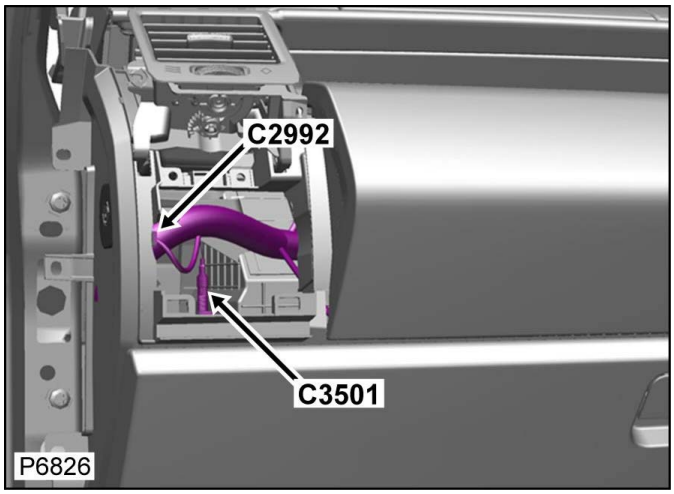

Part No.: XUD815580

Colour: NO COLOUR

Cavities: 1WY

Harness: FACIA COMPOSITE HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	B	568	C2221
1S	0.5	SCR	568	C2221

Click here to print

Connector: C3503

CONNECTOR HOUSING NOT SERVICEABLE

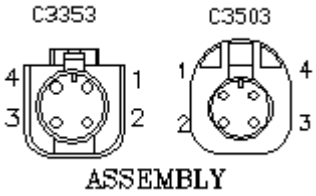

Part No.: XUD814080

Colour: NO COLOUR


Cavities: 4WY

Harness: DOORS FRONT HARNESS

Description: Door harness to main harness

Location: LH 'A' post

Qualifier:

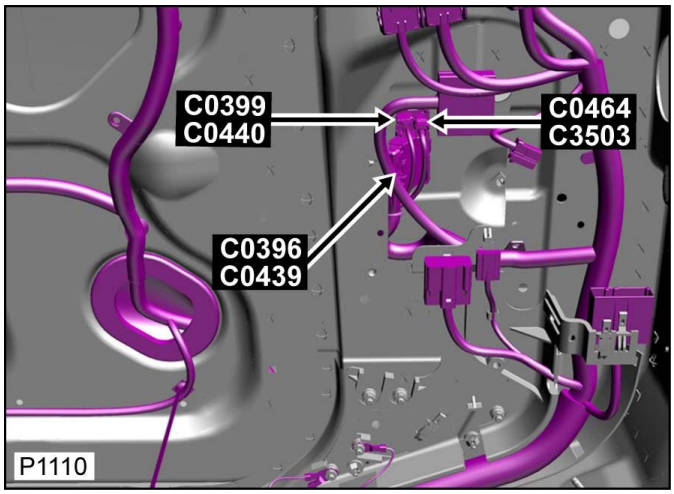


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784L	C3353
2	0.5	O	784L	C3353
3	0.5	G	784L	C3353
4	0.5	N	784L	C3353

Click here to print

Connector: **C3504**

CONNECTOR HOUSING NOT SERVICEABLE

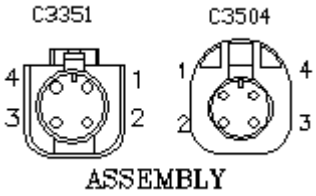

Part No.: XUD814070

Colour: NO COLOUR


Cavities: 4WY

Harness: DOORS FRONT HARNESS

Description: Door harness to main harness

Location: RH 'A' post

Qualifier:

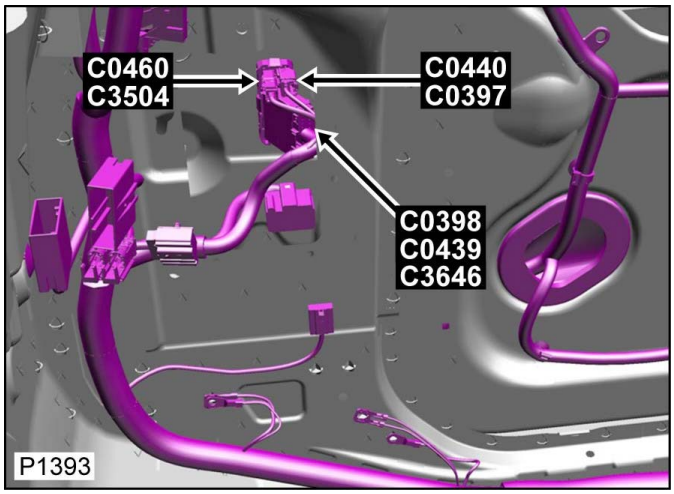

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	784R	C3351
2	0.5	O	784R	C3351
3	0.5	G	784R	C3351
4	0.5	N	784R	C3351

Click here to print

Connector: C3505T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Amplifier-Antenna

Location: Rear of headlining - RH side

Qualifier:

ASSEMBLY

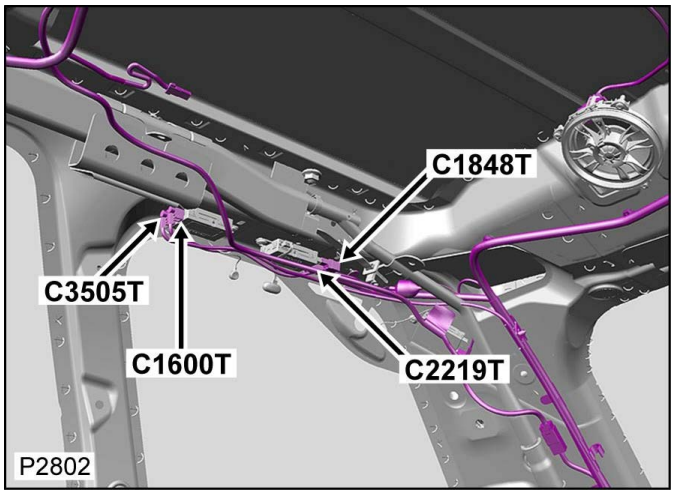

Part No.: XUD815210

Colour: NO COLOUR

Cavities: 2WY

Harness: REMOTE PARK HEAT HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	PN	692T	C2229
1S	SCR	SCR	692T	C2229

Click here to print


Connector: C3507


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Driver door

Location: Behind driver door trim panel

Qualifier: RHD condition illustrated

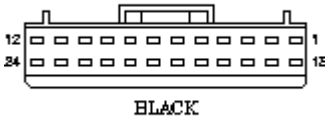

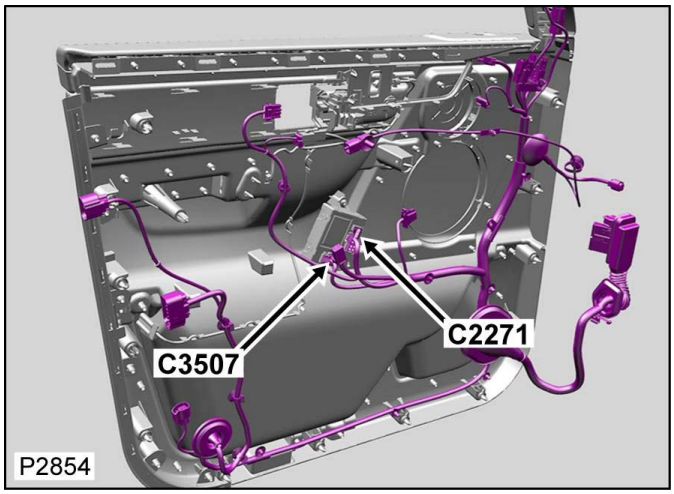

Part No.: YPC908640

Colour: BLACK

Cavities: 24WY

Harness: DOORS FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
3	0.5	B	674	C3646	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.35	SP	674	C0319	-	-	-	-	-	-	-
7	0.35	Y	674	C0319	-	-	-	-	-	-	-
8	0.5	WN	674	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.5	GW	674	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.35	WO	674	C0319	-	-	-	-	-	-	-
11	0.5	GW	674	C2677	418-411-45	-	418-116A	418-117	-	418-112	418-107
12	0.5	P	674	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.5	B	674	C3646	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.5	BN	674	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.35	UO	674	C0319	-	-	-	-	-	-	-
19	0.35	NG	674	C0319	-	-	-	-	-	-	-
22	0.5	B	674	C0441	418-411-45	-	418-116A	418-117	-	418-112	418-107
23	0.35	YO	674	C0319	-	-	-	-	-	-	-
24	0.5	WP	674	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C3508


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Passenger door

Location: Behind passenger door trim panel

Qualifier: RHD condition illustrated

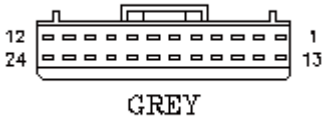

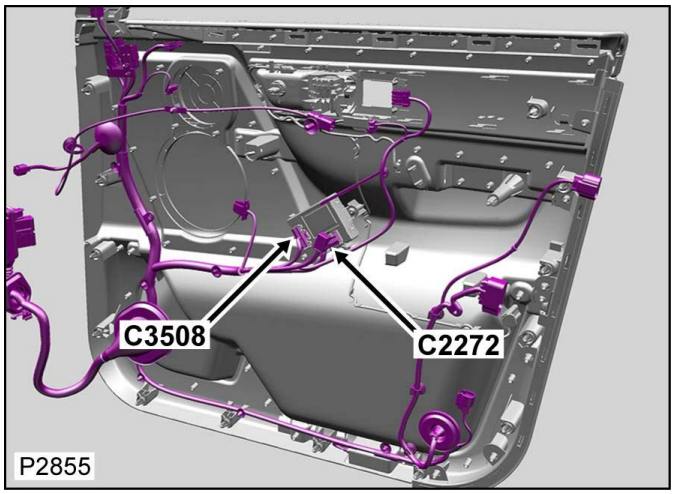

Part No.: YPC908650

Colour: GREY

Cavities: 24WY

Harness: DOORS FRONT HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
3	0.5	B	675	C0439	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.35	SP	675	C0319	-	-	-	-	-	-	-
7	0.35	Y	675	C0319	-	-	-	-	-	-	-
8	0.5	WN	675	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.5	GW	675	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
10	0.35	WO	675	C0319	-	-	-	-	-	-	-
11	0.5	GW	675	C2677	418-411-45	-	418-116A	418-117	-	418-112	418-107
12	0.5	P	675	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
15	0.5	B	675	C0439	418-411-45	-	418-116A	418-117	-	418-112	418-107
17	0.5	BN	675	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.35	UO	675	C0319	-	-	-	-	-	-	-
19	0.35	NG	675	C0319	-	-	-	-	-	-	-
22	0.5	B	675	C0441	418-411-45	-	418-116A	418-117	-	418-112	418-107
23	0.35	YO	675	C0319	-	-	-	-	-	-	-
24	0.5	WP	675	C0319	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C3510

CONNECTOR HOUSING NOT SERVICEABLE

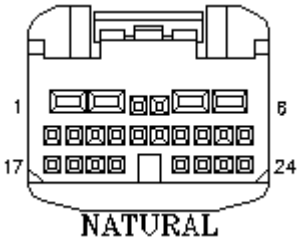

Part No.: YPC803460

Colour: NATURAL


Cavities: 24WY

Harness: FACIA COMPOSITE HARNESS

Description: Module-Climate Control

Location: Climate control assembly-Driver side

Qualifier:

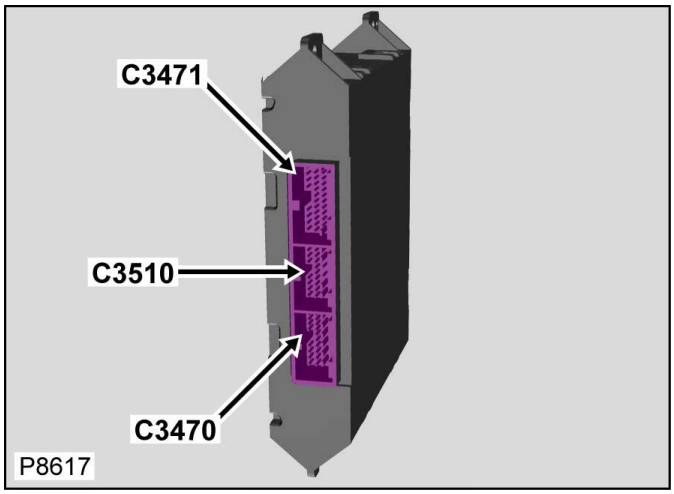


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
4	0.5	B	499	C1270	-	-	-	-	-	-	-
6	0.5	N	139L	C2238L	418-411-33	-	418-116A	418-117	418-104	418-112	418-107
6	0.5	N	200R	C2239R	418-411-33	-	418-116A	418-117	418-104	418-112	418-107
11	0.5	B	499	C1270	-	-	-	-	-	-	-
13	0.5	B	499	C1270	-	-	-	-	-	-	-

Click here to print

Connector: C3521A

CONNECTOR HOUSING NOT SERVICEABLE

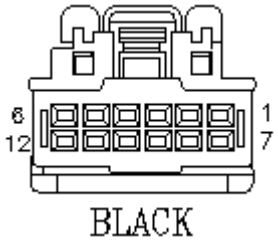

Part No.: YPC913980

Colour: BLACK


Cavities: 12WY

Harness: CONSOLE FRONT HARNESS

Description: Selector-Automatic transmission

Location: Beneath center console LH side

Qualifier: LHD condition illustrated

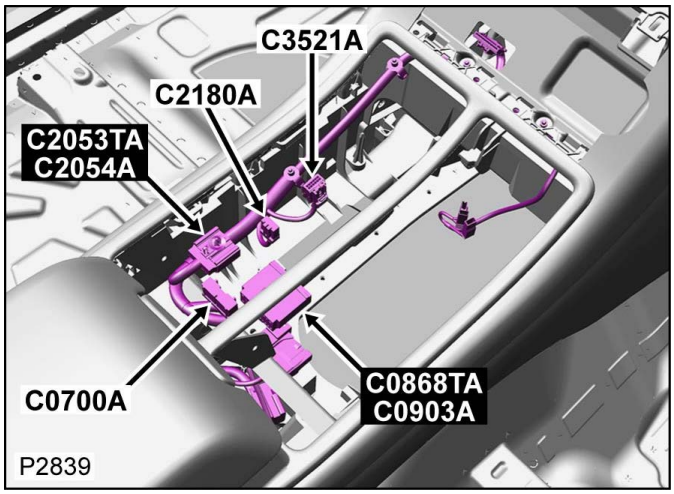


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	PY	982L	C0903A	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	RB	982L	C0903A	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	S	982L	C0903A	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.35	YN	982L	S/JOINT SJ1030	-	-	-	-	-	-	-
6	0.35	YB	982L	S/JOINT SJ1031	-	-	-	-	-	-	-
10	0.5	GW	982L	C0903A	418-411-45	-	418-116A	418-117	-	418-112	418-107
11	0.5	GO	982L	C0903A	418-411-45	-	418-116A	418-117	-	418-112	418-107
12	0.5	B	982L	S/JOINT SJ323	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C3521B

CONNECTOR HOUSING NOT SERVICEABLE

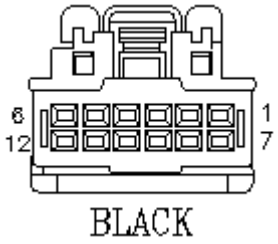

Part No.: YPC913980

Colour: BLACK


Cavities: 12WY

Harness: CONSOLE FRONT HARNESS

Description: Selector-Automatic transmission

Location: Beneath center console RH side

Qualifier: RHD condition illustrated

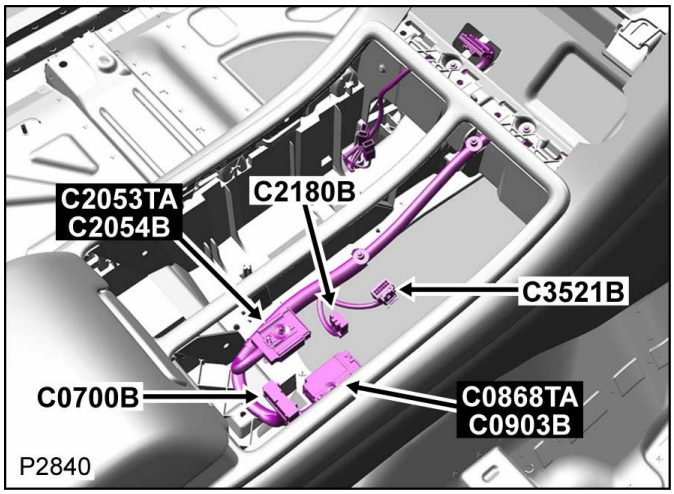


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	PY	982R	C0903B	418-411-45	-	418-116A	418-117	-	418-112	418-107
2	0.5	RB	982R	C0903B	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	S	982R	C0903B	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.35	YN	982R	S/JOINT SJ1038	-	-	-	-	-	-	-
6	0.35	YB	982R	S/JOINT SJ1039	-	-	-	-	-	-	-
10	0.5	GW	982R	C0903B	418-411-45	-	418-116A	418-117	-	418-112	418-107
11	0.5	GO	982R	C0903B	418-411-45	-	418-116A	418-117	-	418-112	418-107
12	0.5	B	982R	S/JOINT SJ323	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C3532M

CONNECTOR HOUSING NOT SERVICEABLE

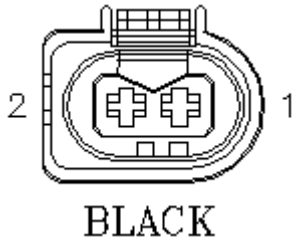

Part No.: YPC913000

Colour: BLACK


Cavities: 2WY

Harness: T5 ELECTRIC RECIRC JUMPER HARNESS

Description: Solenoid-Boost air recirculation

Location: Behind radiator

Qualifier:

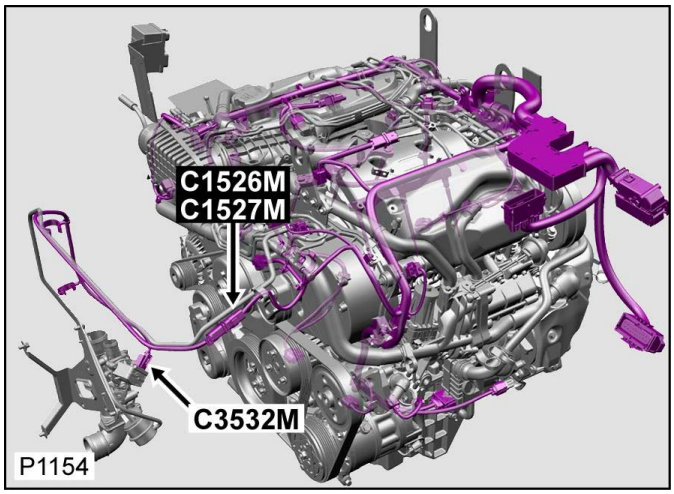


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.75	RD-YE	499	C1527M	418-549-18	-	418-116A	418-117	418-104	418-112	418-107
2	0.75	BN-RD	499	C1527M	418-549-18	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3533M

CONNECTOR HOUSING NOT SERVICEABLE

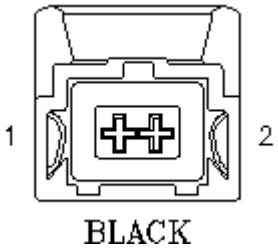

Part No.: YPC909150

Colour: BLACK


Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Solenoid-Boost air

Location: Front of engine - center

Qualifier:

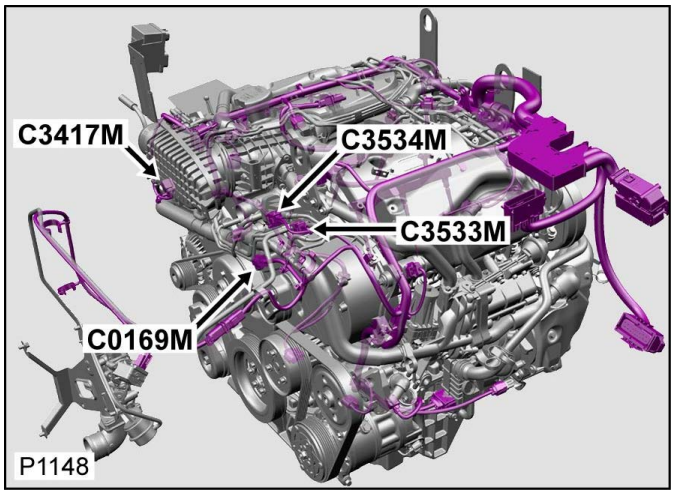


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	OS	798	S/JOINT SJ1
2	0.75	GU	798	C0659M

Click here to print

Connector: C3534M

CONNECTOR HOUSING NOT SERVICEABLE

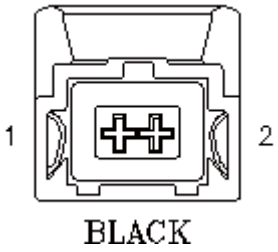

Part No.: YPC909150

Colour: BLACK


Cavities: 2WY

Harness: ENGINE DIESEL 3.0L HARNESS

Description: Solenoid-Turbine intake

Location: Front of engine - center

Qualifier:

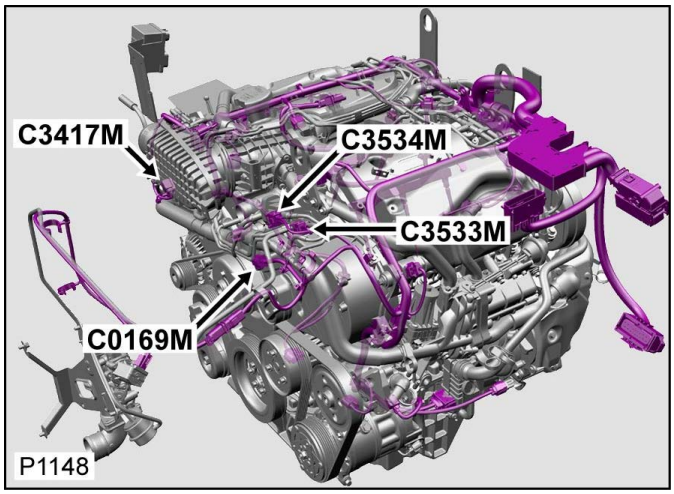

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.75	OS	798	S/JOINT SJ1
2	0.75	YU	798	C0659M

Click here to print

Connector: C3542


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Heated seat-Front

Location: Beneath front seat

Qualifier:



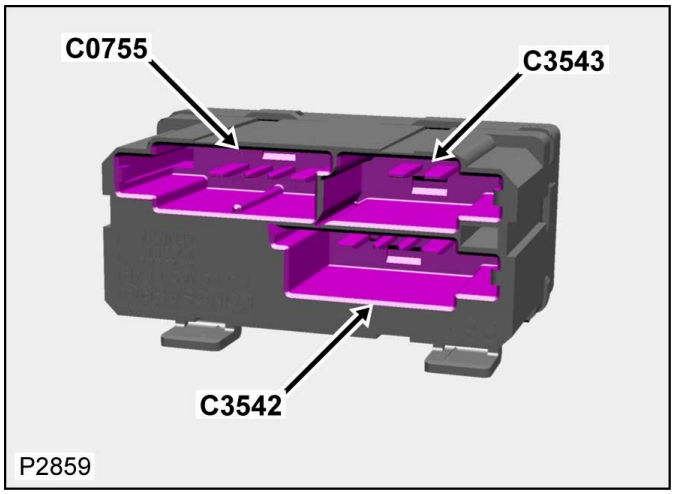

Part No.: YPC913340

Colour: GREEN

Cavities: 4WY

Harness: SEAT ASSEMBLIES HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	S	204	C0969	418-587-10	-	418-116A	418-117	-	418-112	418-107
2	0.35	Y	204	C2197	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
3	0.35	Y	204	C2197	418-411-13	-	418-116A	418-117	418-104	418-112	418-107
4	1.0	N	204	C0969	418-587-10	-	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C3543


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Heated seat-Front

Location: Beneath front seat

Qualifier:

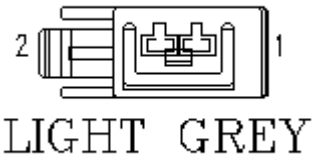

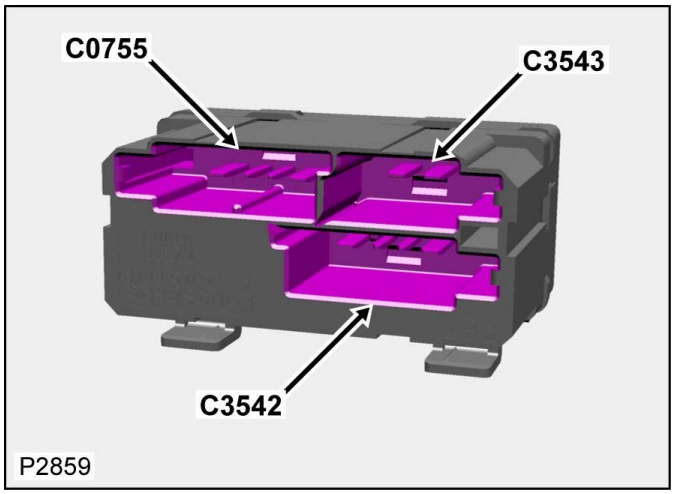

Part No.: YPC913200

Colour: LIGHT GREY

Cavities: 2WY

Harness: SEAT ASSEMBLIES HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.0	B	204	C0971	418-587-10	-	418-116A	418-117	-	418-112	418-107
2	1.0	N	204	C0971	418-587-10	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C3544


CONNECTOR HOUSING NOT SERVICEABLE

Description: Upshift paddle switch

Location: In center of steering wheel

Qualifier:

ASSEMBLY

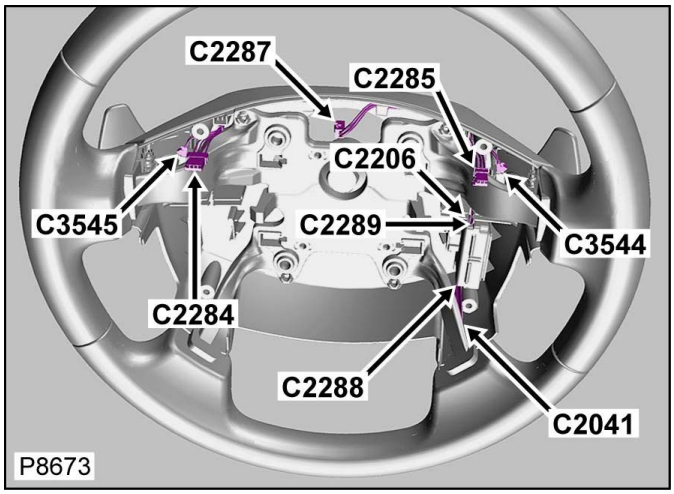

Part No.: CASSY

Colour: NO COLOUR

Cavities: 1WY

Harness: STEERING WHEEL HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	B	499	S/JOINT SJ7
2	0.35	S	499	C2284
3	0.35	R	499	S/JOINT SJ8

Click here to print

Connector: C3545


CONNECTOR HOUSING NOT SERVICEABLE

Description: Downshift paddle switch

Location: In center of steering wheel

Qualifier:

ASSEMBLY

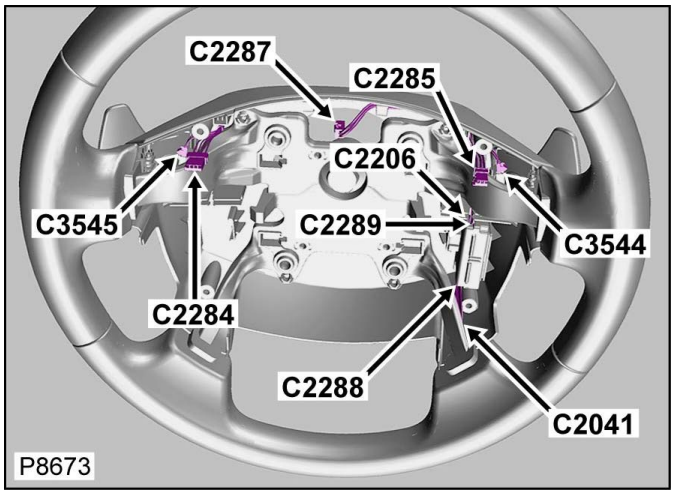

Part No.: CASSY

Colour: NO COLOUR

Cavities: 1WY

Harness: STEERING WHEEL HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	W	499	S/JOINT SJ7
2	0.35	S	499	C2284
3	0.35	B	499	S/JOINT SJ8

Click here to print

Connector: C3552

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC909170

Colour: GREY


Cavities: 2WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Sensor 1-Engine coolant temperature (ECT) - PV8

Location: Rear of engine - Center

Qualifier:

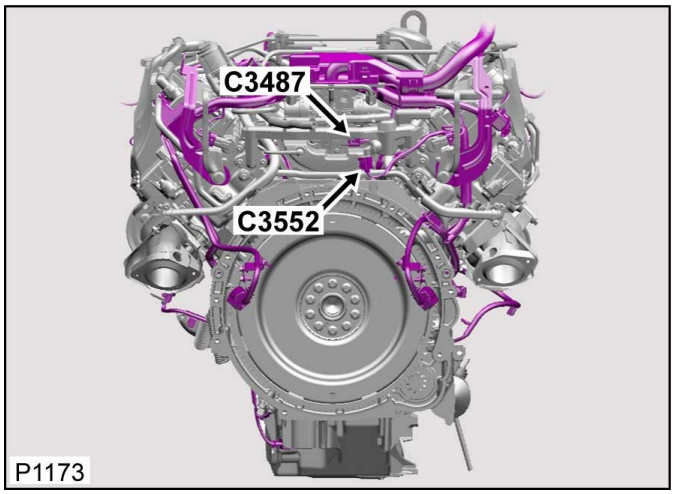


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	Y	ALL	C0634	418-549-66	-	418-116A	418-117	418-104	418-113	418-108
2	0.5	NG	ALL	S/JOINT PIS43	418-549-66	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C3554

CONNECTOR HOUSING NOT SERVICEABLE

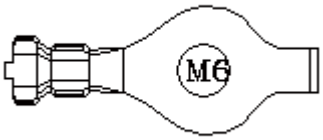

Part No.: YPG800190

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE PETROL AJ133 HARNESS

Description: Ground point

Location: Front LH side of engine

Qualifier:

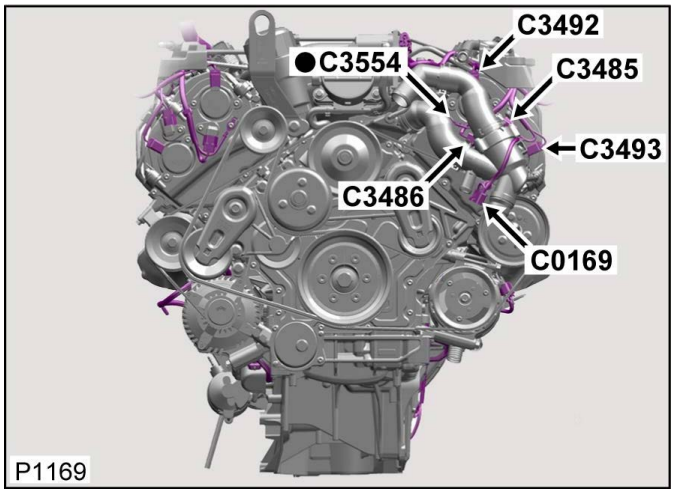

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	B	ALL	S/JOINT PIS21

Click here to print


Connector: C3555


CONNECTOR HOUSING NOT SERVICEABLE

Description: Ground point

Location: Front RH side of engine

Qualifier:

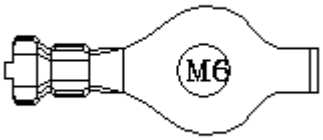

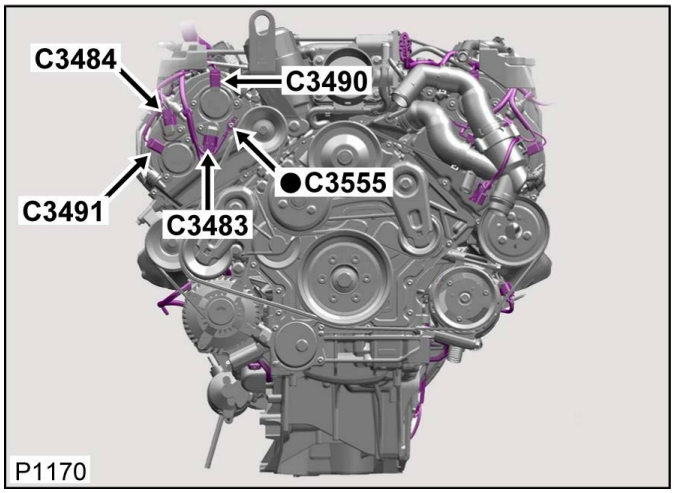

Part No.: YPG900330

Colour: TIN PLATED

Cavities: 1WY

Harness: ENGINE PETROL AJ133 HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	1.0	B	ALL	S/JOINT PIS26
1	1.0	B	ALL	C1323

Click here to print

Connector: C3556

CONNECTOR HOUSING NOT SERVICEABLE

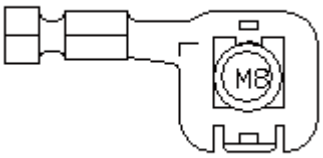

Part No.: YPG900110

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Front RH side of engine compartment

Qualifier:

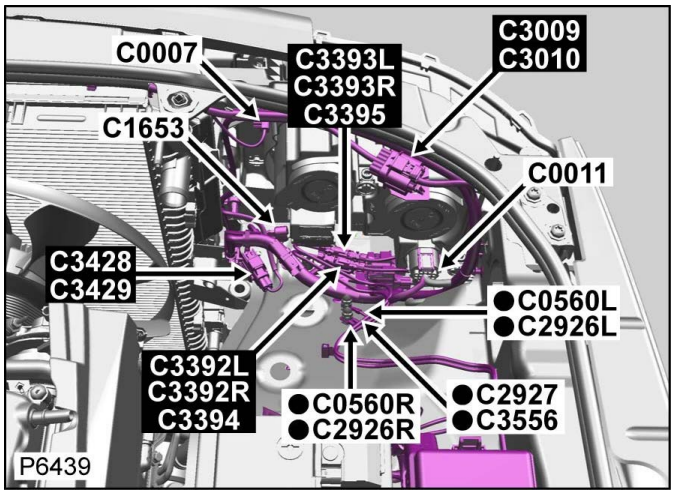


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	499	S/JOINT SJ878

Click here to print

Connector: C3557L

CONNECTOR HOUSING NOT SERVICEABLE

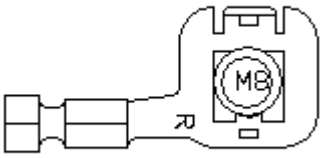

Part No.: YPG900120

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Behind RH front fender splash shield

Qualifier:

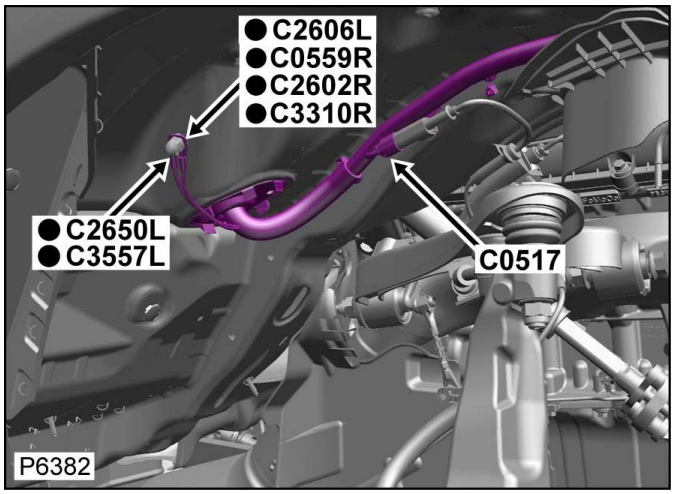


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	798L	C0658L
1	2.5	B	798L	C0658L
1	2.5	B	252L	C0635L
1	2.5	B	252L	C0635L
1	1.5	B	797L	C0872L
1	1.5	B	797L	C0872L

Click here to print

Connector: C3557R

CONNECTOR HOUSING NOT SERVICEABLE

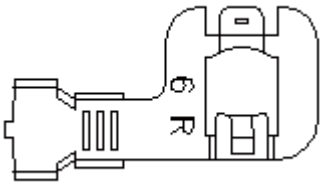

Part No.: YPG800220

Colour: TIN PLATED


Cavities: 1WY

Harness: ENGINE COMPARTMENT HARNESS

Description: Ground point

Location: Base of LH 'A' post

Qualifier: RHD condition illustrated

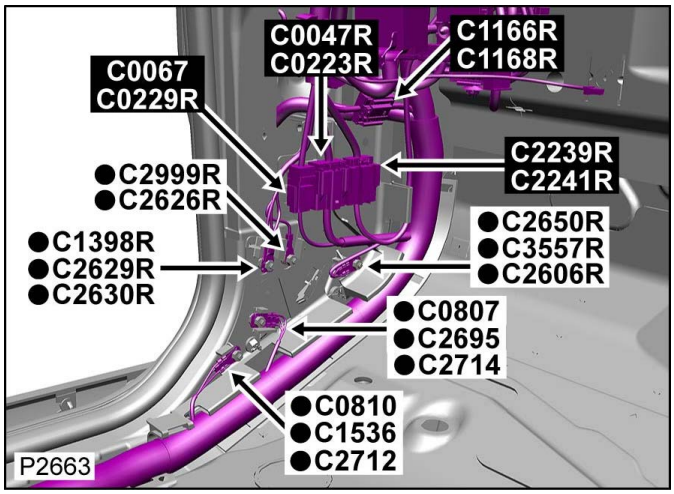

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	B	798R	C0658R
1	2.5	B	798R	C0658R
1	2.5	B	252R	C0635R
1	2.5	B	252R	C0635R
1	1.5	B	797R	C0872R
1	1.5	B	797R	C0872R

Click here to print


Connector: C3560


CONNECTOR HOUSING NOT SERVICEABLE

Description: Switch pack-Seat

Location: Behind driver door trim panel

Qualifier: LHD condition illustrated

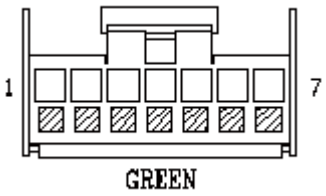

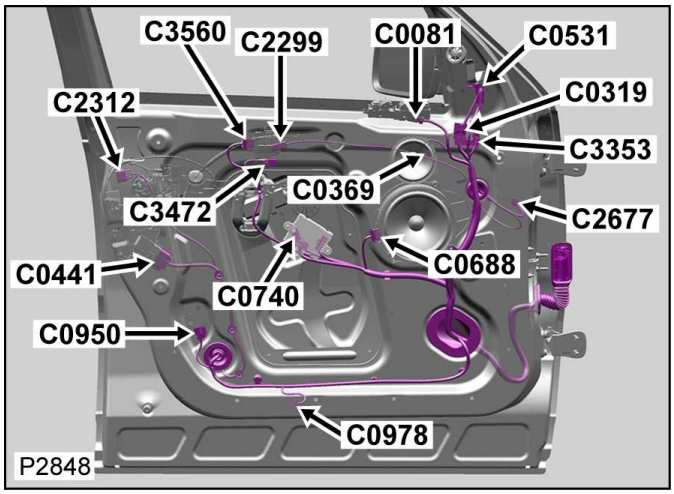

Part No.: YPC106450

Colour: GREEN

Cavities: 7WY

Harness: DOORS FRONT HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	787	C0439	418-587-02	-	418-116A	418-117	-	418-112	418-107
1	0.5	B	788	C3646	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.5	B	787	C0440	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.5	B	788	C0440	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	481	S/JOINT SJ2024	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	673	C0440	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	675	C0440	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	B	672	C2017	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	B	482	S/JOINT SJ841	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	B	674	C2271	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	B	672	C0439	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	B	482	S/JOINT SJ840	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	B	674	C3646	418-587-02	-	418-116A	418-117	-	418-112	418-107
6	0.5	B	207L	C0439	418-587-02	-	418-116A	418-117	-	418-112	418-107
6	0.5	B	207R	C3646	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C3588

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG800520

Colour: TIN PLATED


Cavities: 1WY

Harness: EARTH STRAP ENGINE-CHASSIS-BIW DIESEL V6 3.0L HARNESS

Description: Ground point

Location: Behind RH front fender splash shield

Qualifier:

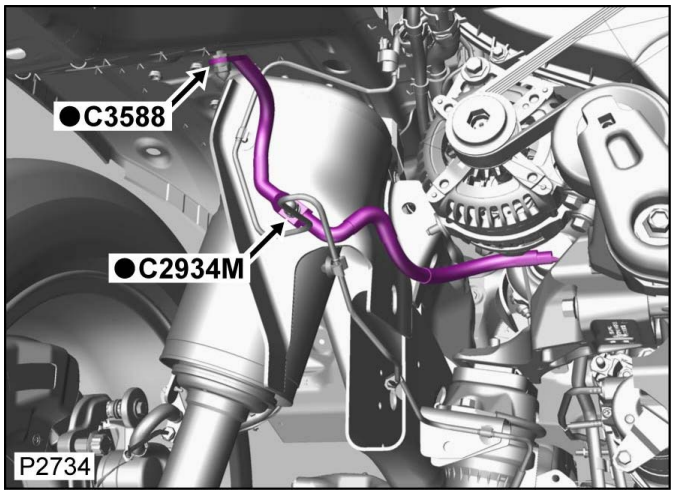


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	37.0	BRAID	499	C2934M

Click here to print

Connector: C3589

CONNECTOR HOUSING NOT SERVICEABLE

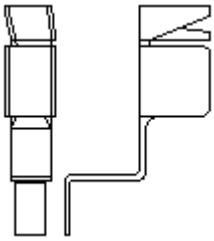

Part No.: YPG800860

Colour: TIN PLATED


Cavities: 1WY

Harness: BATTERY MONITOR RHD HARNESS

Description: Ground point

Location: Rear LH side of engine compartment

Qualifier:

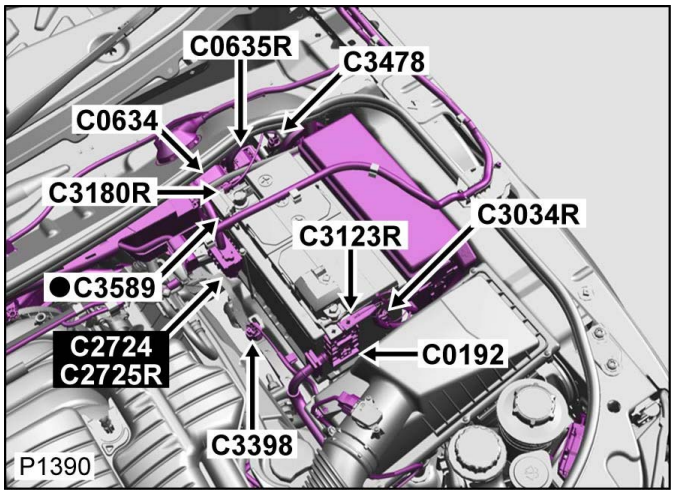


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0	B	ALL	C1661

Click here to print

Connector: C3589

CONNECTOR HOUSING NOT SERVICEABLE

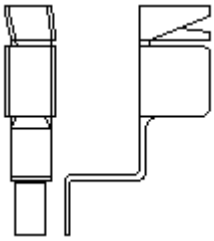

Part No.: YPG800860

Colour: TIN PLATED


Cavities: 1WY

Harness: BATTERY MONITOR LHD HARNESS

Description: Ground point

Location: Rear RH side of engine compartment

Qualifier:

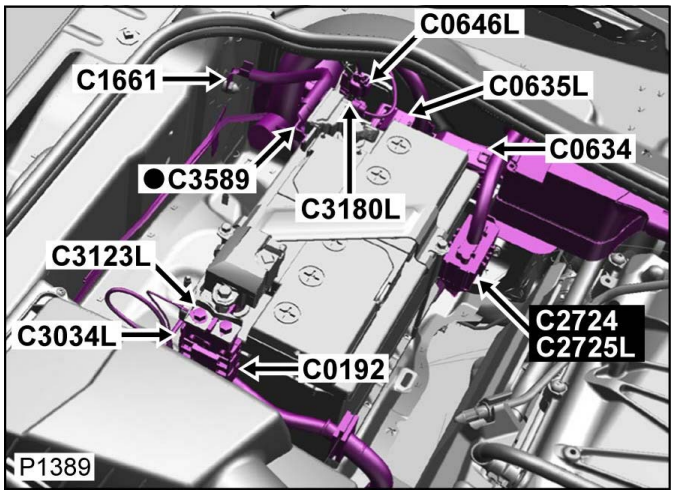


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0	B	ALL	C1661

Click here to print

Connector: C3608

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG101610

Colour: TIN PLATED


Cavities: 1WY

Harness: RFI SUPPRESSION LEAD HARNESS

Description: Ground point

Location: Rear of engine compartment - center

Qualifier:

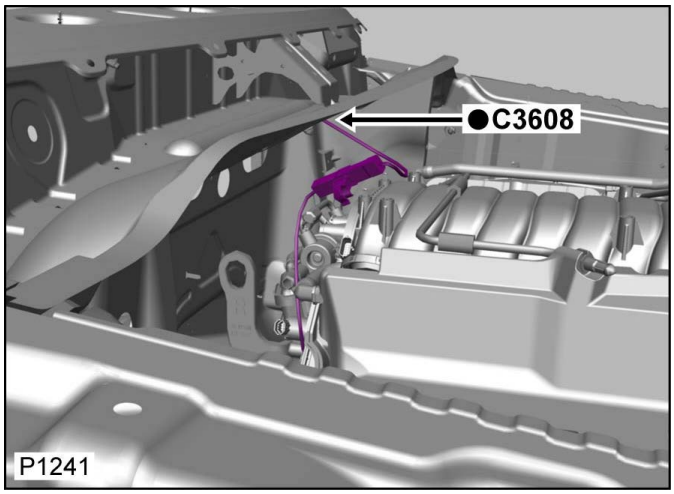


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	6.0	B	282	C3306

Click here to print

Connector: C3609

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPG801400

Colour: TIN PLATED


Cavities: 1WY

Harness: RFI SUPPRESSION LEAD HARNESS

Description: Ground point

Location: Rear of engine - Center

Qualifier:

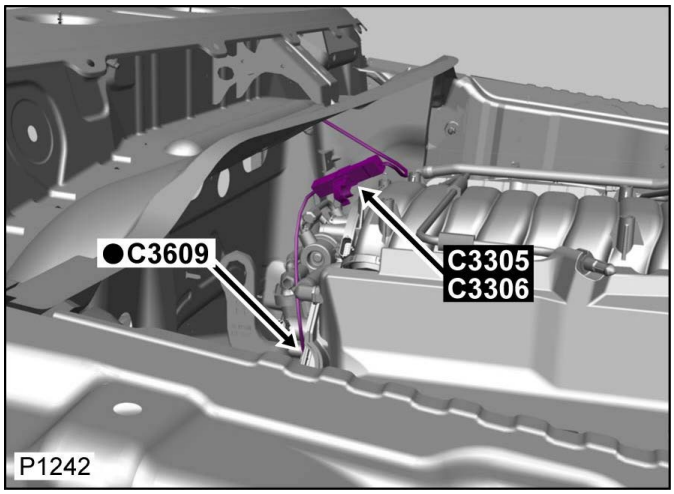


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	6.0	B	282	C3305

Click here to print

Connector: C3615

CONNECTOR HOUSING NOT SERVICEABLE

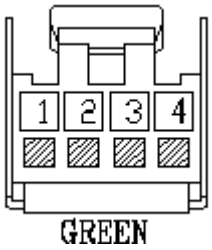

Part No.: YPC108210

Colour: GREEN


Cavities: 4WY

Harness: ARM REST LINK HARNESS

Description: Docking station Remote control-Rear entertainment

Location: Behind rear seat armrest

Qualifier:

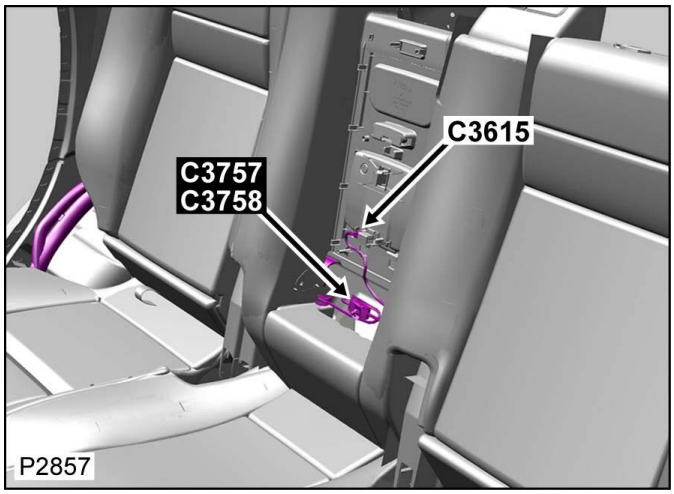

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	YO	499	C3758	418-587-02	-	418-116A	418-117	-	418-112	418-107
2	0.35	N	499	C3758	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.35	G	499	C3758	418-587-02	-	418-116A	418-117	-	418-112	418-107
4	0.5	B	499	C3758	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C3646


CONNECTOR HOUSING NOT SERVICEABLE

Description: Front door harness to main harness

Location: RH 'A' post

Qualifier:



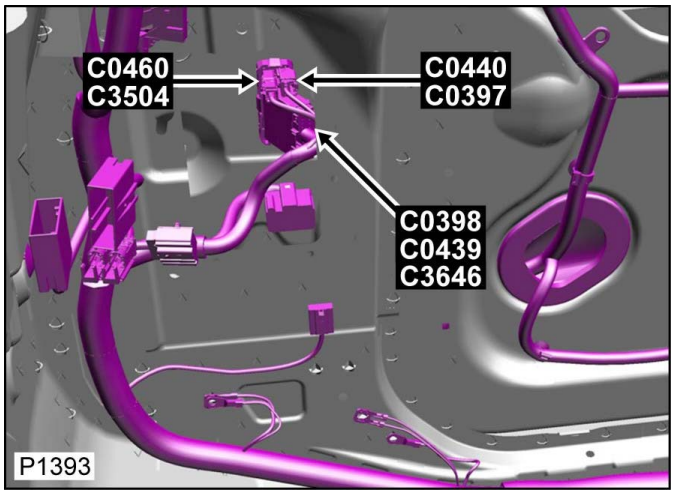

Part No.: YPC803300

Colour: GREY

Cavities: 24WY

Harness: DOORS FRONT HARNESS

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	B	673	C2016	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
1	2.5	B	674	C2271	418-411-16	-	418-116A	418-117	418-104	418-113	418-108
2	0.5	B	673	C0441	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.5	B	674	C3560	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	674	C0441	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.5	B	788	S/JOINT SJ19	418-411-47	-	418-116A	418-117	-	418-112	418-107
5	0.5	B	827R	C3472	418-411-47	-	418-116A	418-117	-	418-112	418-107
6	0.5	B	812	C2312	418-411-47	-	418-116A	418-117	-	418-112	418-107
7	0.5	B	788	C3560	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	1.5	PS	478R	C0369	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
9	1.5	YS	478R	C0369	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
10	1.5	B	812	C2312	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
11	1.5	PO	478R	C0531	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
12	1.5	YO	478R	C0531	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
13	4.0	B	788	S/JOINT SJ840	418-587-05	-	418-116A	418-117	-	418-114	418-109
14	0.35	RU	812	C2299	-	-	-	-	-	-	-
15	0.35	RG	812	C2299	-	-	-	-	-	-	-
16	0.35	G	812	C2299	-	-	-	-	-	-	-
17	0.35	W	812	C2299	-	-	-	-	-	-	-
18	0.5	B	207R	C3560	418-411-47	-	418-116A	418-117	-	418-112	418-107

19	0.35	B	673	C2057	-	-	-	-	-	-	-
19	0.5	B	674	C3507	418-411-47	-	418-116A	418-117	-	418-112	418-107
20	0.35	B	673	C2057	-	-	-	-	-	-	-
20	0.5	B	674	C3507	418-411-47	-	418-116A	418-117	-	418-112	418-107
21	1.5	G	478R	C0688	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
22	1.5	GW	478R	C0688	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
23	1.5	B	812	C2312	418-411-65	-	418-116A	418-117	418-104	418-112	418-107
24	0.35	R	812	C2299	418-411-15	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C3714T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Rear seat entertainment module

Location: Behind luggage compartment carpet RH side

Qualifier:

ASSEMBLY

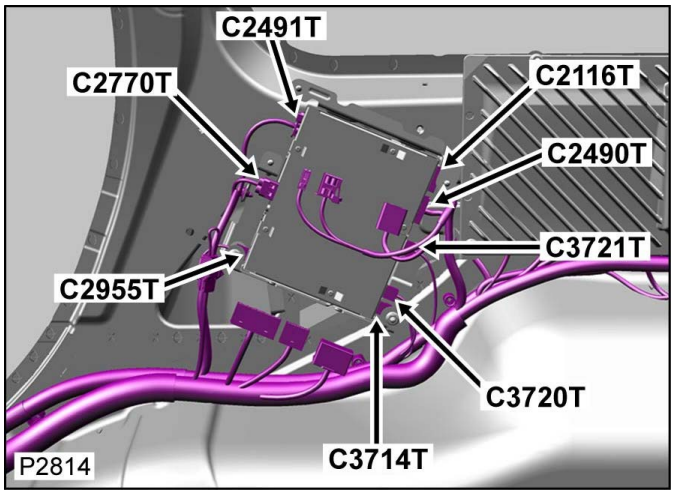

Part No.: XUD815490

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.08	N	514T	C2951
2	0.08	P	514T	C2951
3	SCR	SCR	514T	C2951

Click here to print


Connector: C3715


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Headphone

Location: Behind Center headlining

Qualifier:

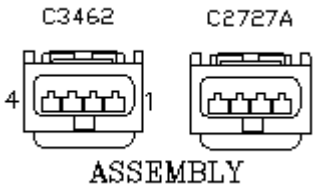

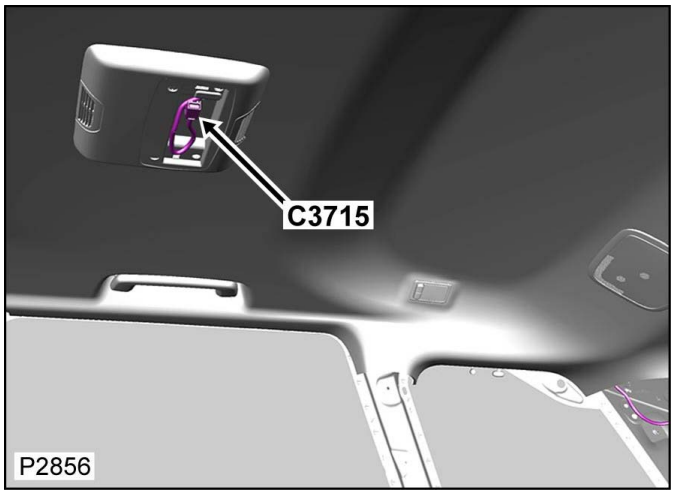

Part No.: XUD815350

Colour: NO COLOUR

Cavities: 4WY

Harness: WHITEFIRE LINK HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	499S	C3826S
1	0.5	R	499T	C3826T
2	0.5	N	499S	C3826S
2	0.5	N	499T	C3826T
3	0.5	P	499S	C3826S
3	0.5	P	499T	C3826T
4	0.5	B	499S	C3826S
4	0.5	B	499T	C3826T
5	0.5	SCR	499S	C3826S
5	0.5	SCR	499T	C3826T

Click here to print


Connector: C3716

CONNECTOR HOUSING NOT SERVICEABLE

Description: Audio head unit

Location: Behind front touch screen display

Qualifier:

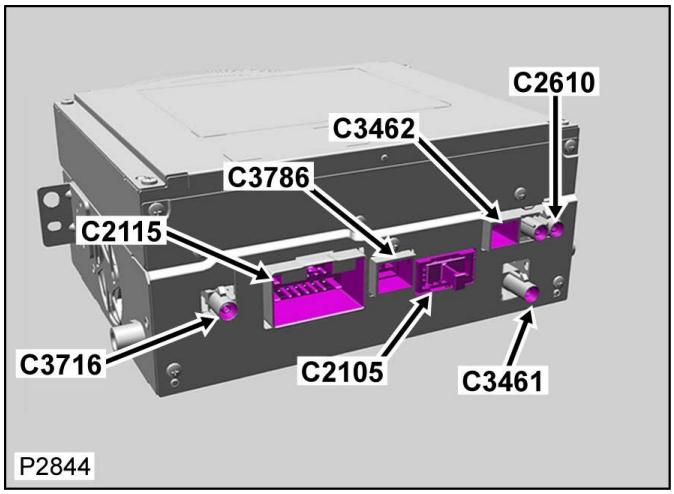

ASSEMBLY

Part No.: XUD812180

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE LINK HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1S	0.5	SCR	124	C2822
1	0.5	B	124	C2822

Click here to print

Connector: C3717


CONNECTOR HOUSING NOT SERVICEABLE

Description: Receiver-Television

Location: Beneath RH Front seat

Qualifier:

ASSEMBLY

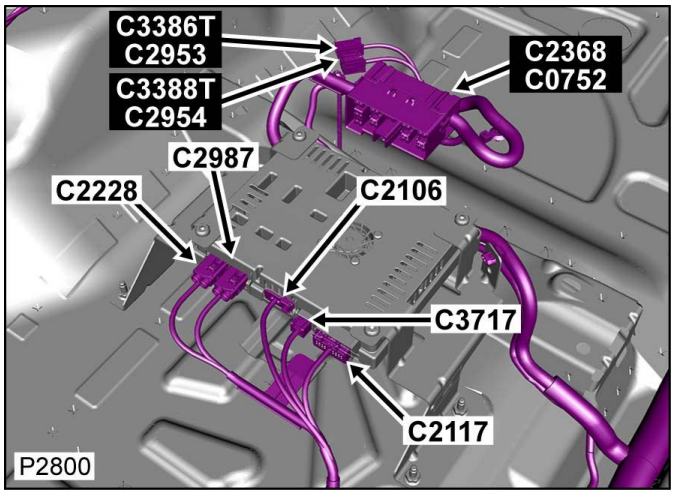

Part No.: XUD815310

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	N	706S	C2955S
1	0.35	N	706T	C2955T
2	0.35	P	706S	C2955S
2	0.35	P	706T	C2955T
3	SCR	SCR	706S	C2955S
3	SCR	SCR	706T	C2955T

Click here to print

Connector: C3720T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Rear seat entertainment module

Location: Behind luggage compartment carpet RH side

Qualifier:

ASSEMBLY

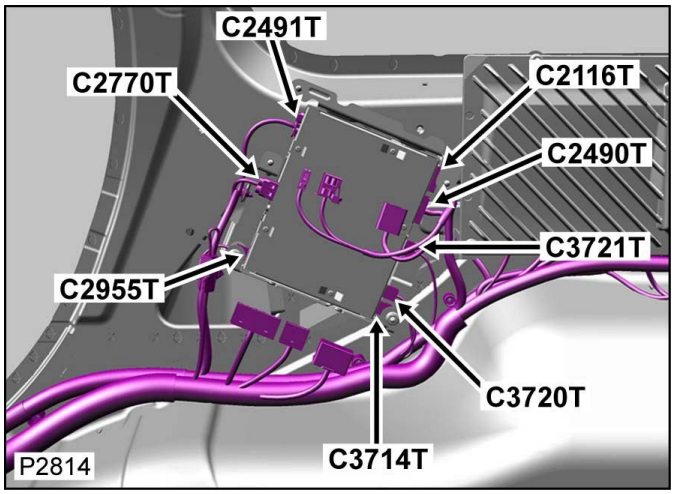

Part No.: XUD815500

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.08	N	514T	C3386T
2	0.08	P	514T	C3386T
3	SCR	SCR	514T	C3386T

Click here to print

Connector: C3721T


CONNECTOR HOUSING NOT SERVICEABLE

Description: Rear seat entertainment module

Location: Behind luggage compartment carpet RH side

Qualifier:

No connector face
Geen connector-vooraanzicht
Pas de face de connecteur
Kein diagramm
Senza faccia connettore
Sem imagen dos pinos da ficha
No hay cara de conector

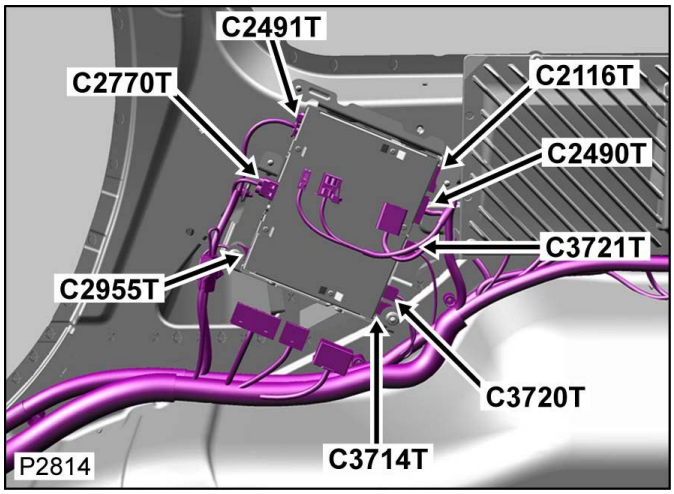

Part No.: XUD815550

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	514T	C2314
2	0.5	P	514T	C2314
3	0.5	N	514T	C2314
4	0.5	B	514T	C2314
5	SCR	SCR	514T	C2314

Click here to print

Connector: C3733

CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Powered tailgate

Location: Center of taildoor, behind trim panel

Qualifier:




Part No.: YPC910190

Colour: LIGHT GREY

Cavities: 14WY

Harness: TAILGATE HARNESS

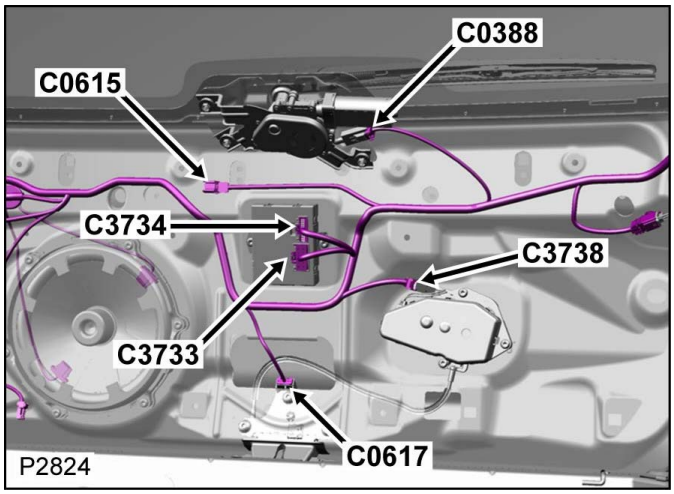

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	B	499	C0384	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	PO	799	C3735	-	-	-	-	-	-	-
5	1.5	PO	799	C3736	-	-	-	-	-	-	-
7	1.5	B	499	C3738	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
8	2.5	B	499	S/JOINT SJ628	418-411-17	-	418-116A	418-117	418-104	418-113	418-108
10	1.5	GW	799	C3735	-	-	-	-	-	-	-
12	1.5	GW	799	C3736	-	-	-	-	-	-	-
14	1.5	B	499	C3738	418-411-17	-	418-116A	418-117	418-104	418-113	418-108

Click here to print


Connector: C3734


CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Powered tailgate

Location: Center of taildoor, behind trim panel

Qualifier:

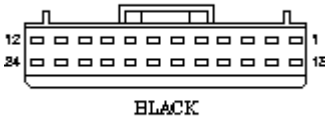

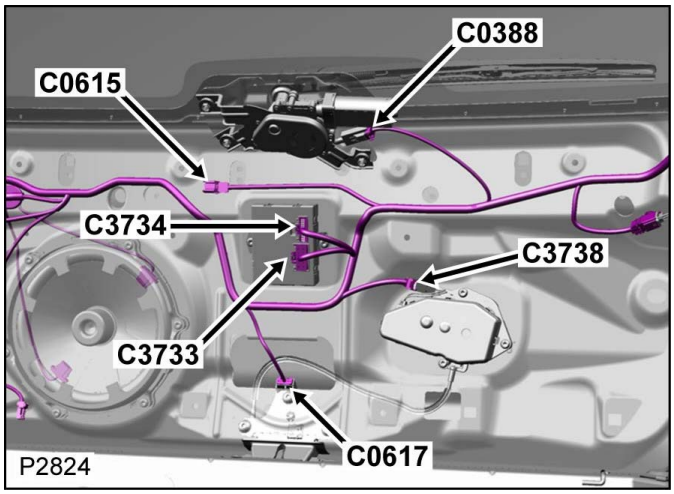

Part No.: YPC908640

Colour: BLACK

Cavities: 24WY

Harness: TAILGATE HARNESS


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
4	0.5	B	499	C3738	418-411-45	-	418-116A	418-117	-	418-112	418-107
5	0.5	B	499	C0617	418-411-45	-	418-116A	418-117	-	418-112	418-107
6	0.5	UW	799	C3735	418-411-45	-	418-116A	418-117	-	418-112	418-107
7	0.5	B	799	C3735	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.5	UW	799	C3736	418-411-45	-	418-116A	418-117	-	418-112	418-107
9	0.5	B	799	C3736	418-411-45	-	418-116A	418-117	-	418-112	418-107
12	0.5	B	499	S/JOINT SJ2	418-411-45	-	418-116A	418-117	-	418-112	418-107
18	0.5	B	799	C3735	418-411-45	-	418-116A	418-117	-	418-112	418-107
19	0.5	YP	799	C3735	418-411-45	-	418-116A	418-117	-	418-112	418-107
20	0.5	YN	799	C3736	418-411-45	-	418-116A	418-117	-	418-112	418-107
21	0.5	B	799	C3736	418-411-45	-	418-116A	418-117	-	418-112	418-107
23	0.5	B	799	C3737	418-411-45	-	418-116A	418-117	-	418-112	418-107
24	0.5	B	499	S/JOINT SJ1	418-411-45	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C3735

CONNECTOR HOUSING NOT SERVICEABLE

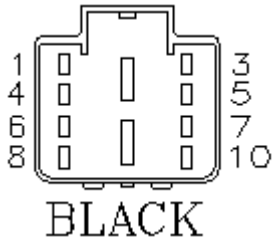

Part No.: YPC913030

Colour: BLACK


Cavities: 10WY

Harness: TAILGATE HARNESS

Description: Strut-Powered tailgate-LH

Location: LH side of taildoor, behind trim panel

Qualifier:

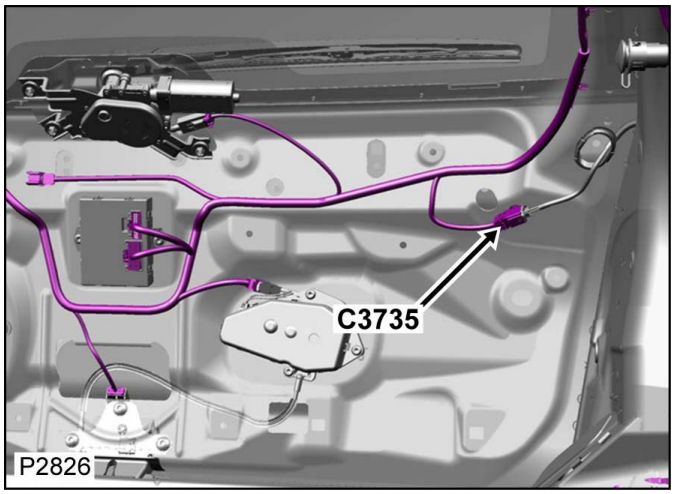


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	YP	799	C3734
2	1.5	GW	799	C3733
4	0.5	UW	799	C3734
6	0.5	B	799	C3734
8	0.5	B	799	C3734
9	1.5	PO	799	C3733

Click here to print

Connector: C3736

CONNECTOR HOUSING NOT SERVICEABLE

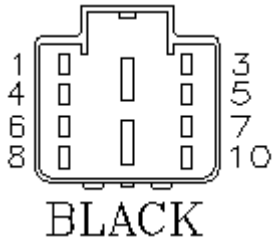

Part No.: YPC913030

Colour: BLACK


Cavities: 10WY

Harness: TAILGATE HARNESS

Description: Strut-Powered tailgate-RH

Location: RH side of taildoor, behind trim panel

Qualifier:

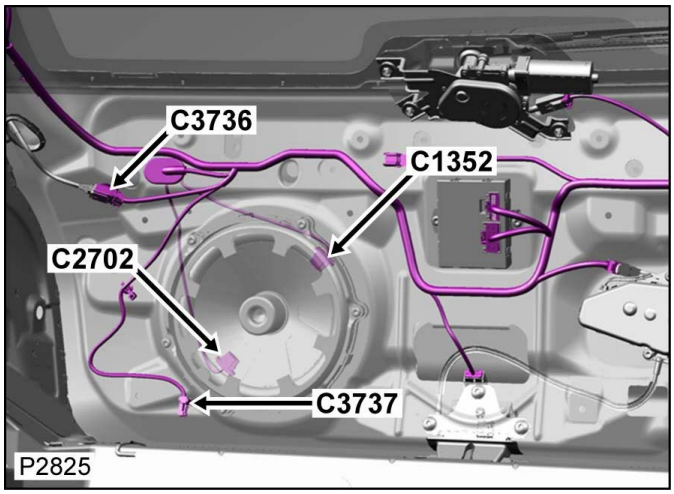


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	YN	799	C3734
2	1.5	GW	799	C3733
4	0.5	UW	799	C3734
6	0.5	B	799	C3734
8	0.5	B	799	C3734
9	1.5	PO	799	C3733

Click here to print

Connector: C3737

CONNECTOR HOUSING NOT SERVICEABLE

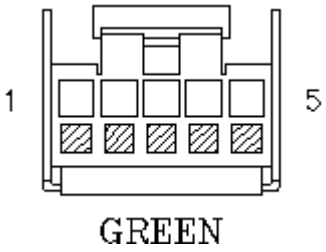

Part No.: YPC10182

Colour: GREEN


Cavities: 5WY

Harness: TAILGATE HARNESS

Description: Switch-Override-Inertia switch

Location: RH side of taildoor, behind trim panel

Qualifier:

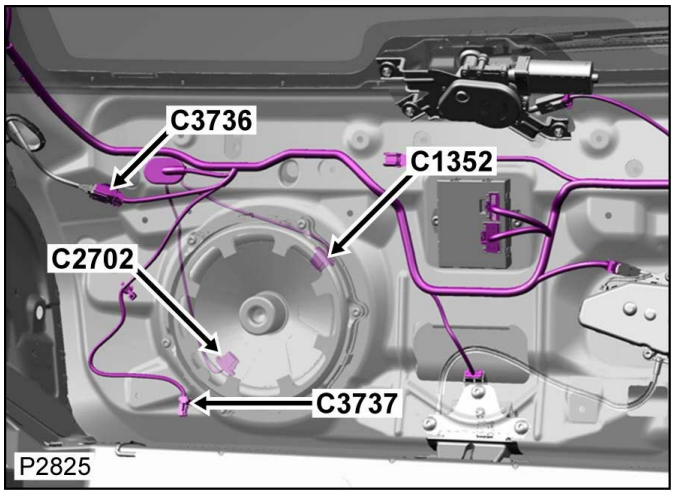

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	B	799	C3734	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	B	799	S/JOINT SJ628	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	B	799	C2740	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C3738

CONNECTOR HOUSING NOT SERVICEABLE



LIGHT GREY

Part No.: YPC803320

Colour: LIGHT GREY


Cavities: 4WY

Harness: TAILGATE HARNESS

Description: Module-Power close

Location: Center of taildoor, behind trim panel

Qualifier:

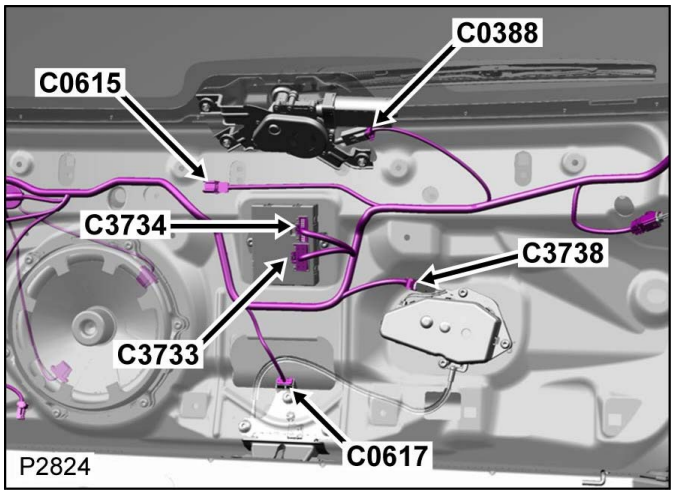

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	B	499	C3733	-	-	-	-	-	-	-
2	1.5	B	499	C3733	-	-	-	-	-	-	-
3	0.5	B	499	C3734	-	-	-	-	-	-	-
4	0.75	B	499	S/JOINT SJ628	418-411-13	-	418-116A	418-117	418-104	418-112	418-107

Click here to print


Connector: C3740

CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Navigation system-Japan

Location: Beneath LH Front seat

Qualifier:

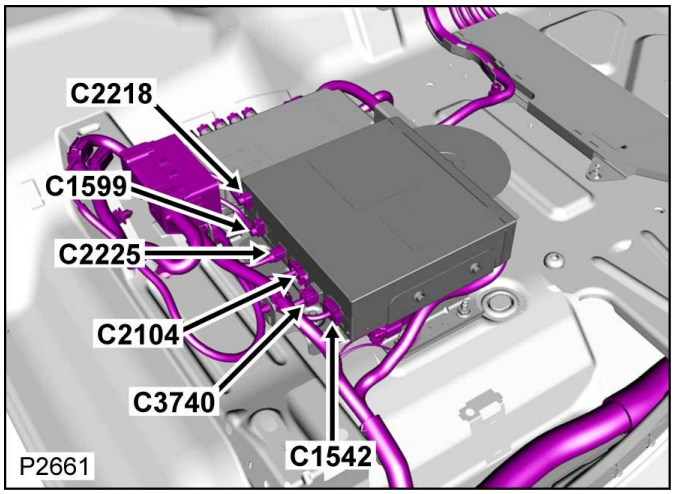

ASSEMBLY

Part No.: XUD815410

Colour: NO COLOUR

Cavities: 2WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	568S	C2731S
1	0.5	R	568T	C2731T
2	0.5	Y	568S	C2731S
2	0.5	Y	568T	C2731T
3	SCR	SCR	568S	C2731S
3	SCR	SCR	568T	C2731T

Click here to print

Connector: **C3741**

CONNECTOR HOUSING NOT SERVICEABLE

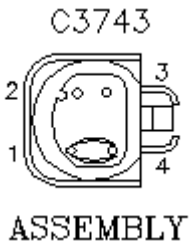

Part No.: XUD815610

Colour: NO COLOUR


Cavities: 4WY

Harness: TAILGATE HARNESS

Description: Tailgate harness to main harness

Location: Rear of headlining

Qualifier:

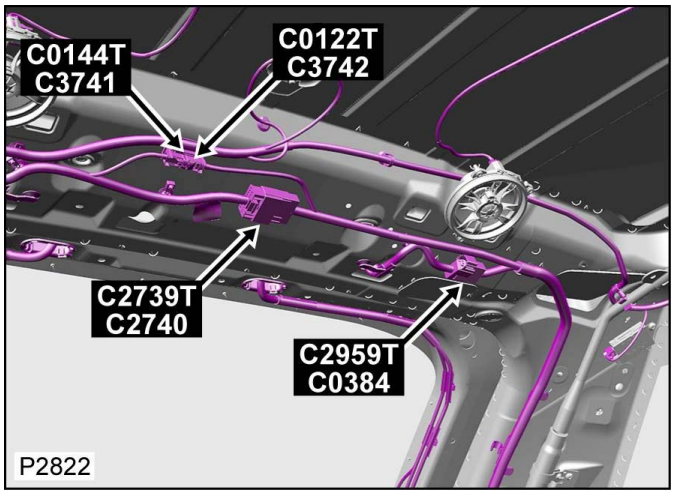


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	510T	C3743
4	SCR	SCR	510T	C3743

Click here to print

Connector: C3742

CONNECTOR HOUSING NOT SERVICEABLE

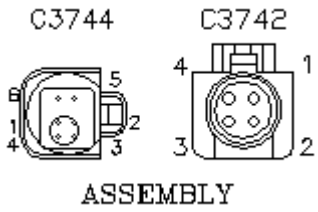

Part No.: XUD815600

Colour: NO COLOUR


Cavities: 4WY

Harness: TAILGATE HARNESS

Description: Tailgate harness to main harness

Location: Rear of headlining

Qualifier:

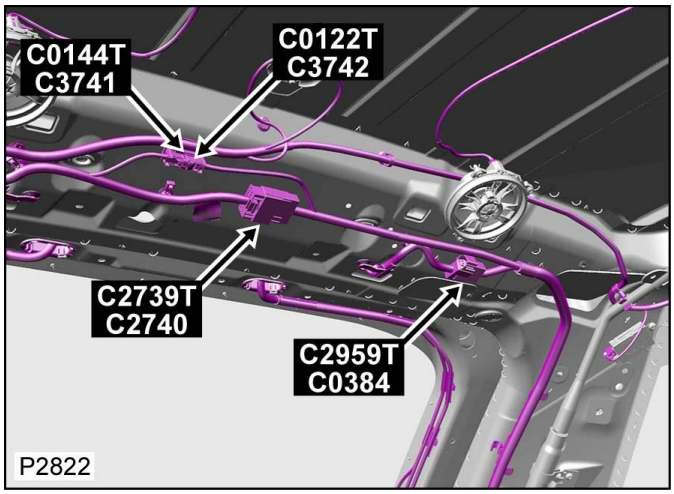


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	BP	784T	C3744
2	0.5	BK	784T	C3744
3	0.5	BP	784T	C3744
4	0.5	BK	784T	C3744

Click here to print

Connector: **C3743**

CONNECTOR HOUSING NOT SERVICEABLE

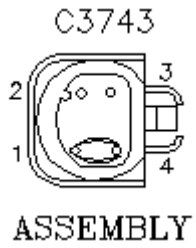

Part No.: XUD815610

Colour: NO COLOUR


Cavities: 4WY

Harness: TAILGATE HARNESS

Description: Camera-Rear view

Location: Top of taildoor

Qualifier:

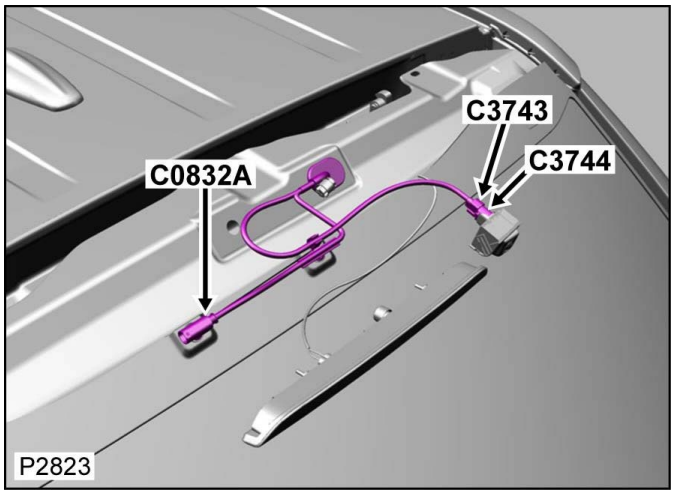


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	U	510T	C3741
2	0.5	B	510T	C2740
3	0.5	G	510T	C2740
4	SCR	SCR	510T	C3741

Click here to print

Connector: C3744

CONNECTOR HOUSING NOT SERVICEABLE

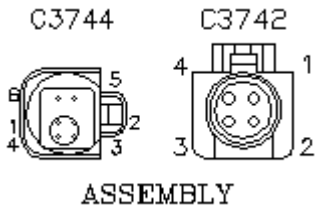

Part No.: XUD815600

Colour: NO COLOUR


Cavities: 4WY

Harness: TAILGATE HARNESS

Description: Lamp-High mounted stop

Location: Top of taildoor

Qualifier:

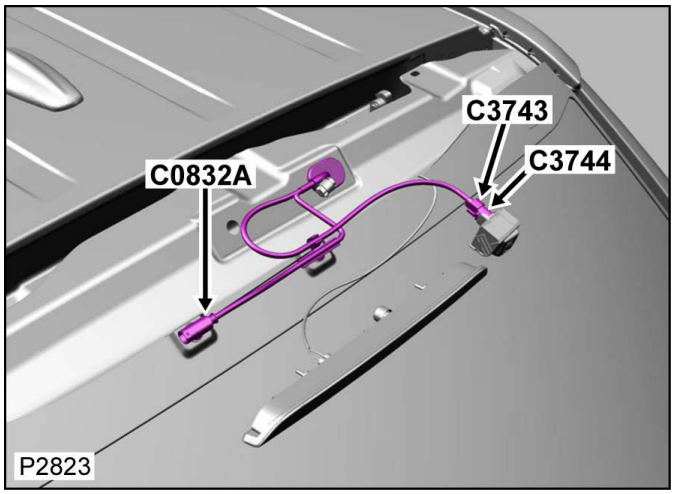


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	BP	784T	C3742
2	0.5	BK	784T	C3742
3	0.5	BP	784T	C3742
4	0.5	BK	784T	C3742

Click here to print

Connector: C3755T

CONNECTOR HOUSING NOT SERVICEABLE

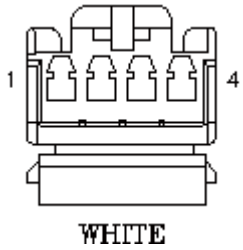

Part No.: YPC10204

Colour: WHITE


Cavities: 4WY

Harness: ICE/NAVIGATION HARNESS

Description: ICE harness to link harness

Location: Beneath rear seat

Qualifier:

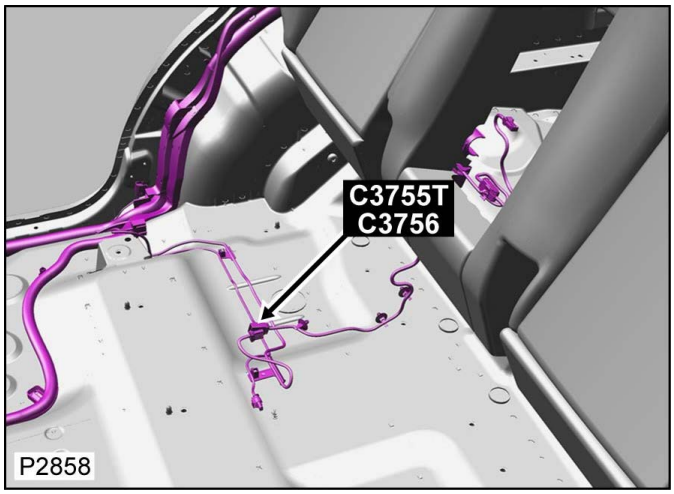


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	YO	514T	C2116T	418-549-62	-	418-116A	-	418-104	418-112	418-107
2	0.35	N	514T	C2490T	418-549-62	-	418-116A	-	418-104	418-112	418-107
3	0.35	G	514T	C2490T	418-549-62	-	418-116A	-	418-104	418-112	418-107
4	0.5	B	514T	C2116T	418-549-62	-	418-116A	-	418-104	418-112	418-107

Click here to print

Connector: C3756

CONNECTOR HOUSING NOT SERVICEABLE

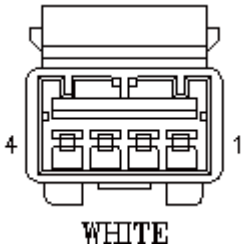

Part No.: YPC10207

Colour: WHITE


Cavities: 4WY

Harness: SEAT REAR HARNESS

Description: Link harness to ICE harness

Location: Beneath rear seat

Qualifier:

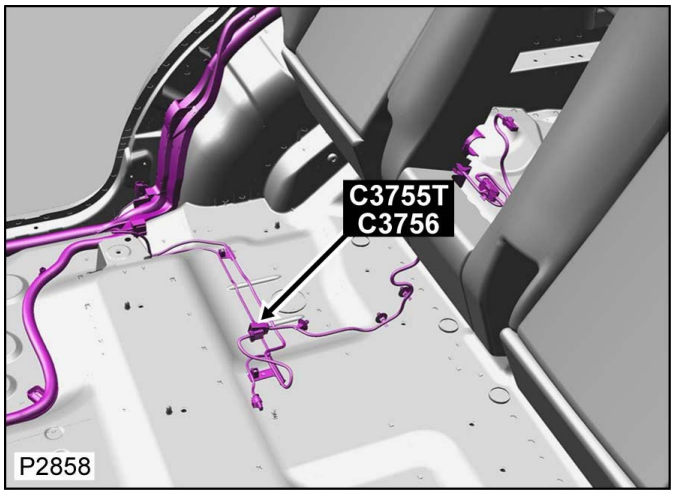


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	YO	499	C3757	418-549-64	-	418-116A	-	418-104	418-112	418-107
2	0.35	N	499	C3757	418-549-64	-	418-116A	-	418-104	418-112	418-107
3	0.35	G	499	C3757	418-549-64	-	418-116A	-	418-104	418-112	418-107
4	0.5	B	499	C3757	418-549-64	-	418-116A	-	418-104	418-112	418-107

Click here to print

Connector: C3757

CONNECTOR HOUSING NOT SERVICEABLE

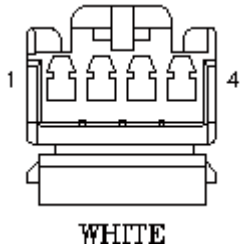

Part No.: YPC10204

Colour: WHITE


Cavities: 4WY

Harness: SEAT REAR HARNESS

Description: Link harness to link harness

Location: Behind rear seat armrest

Qualifier:

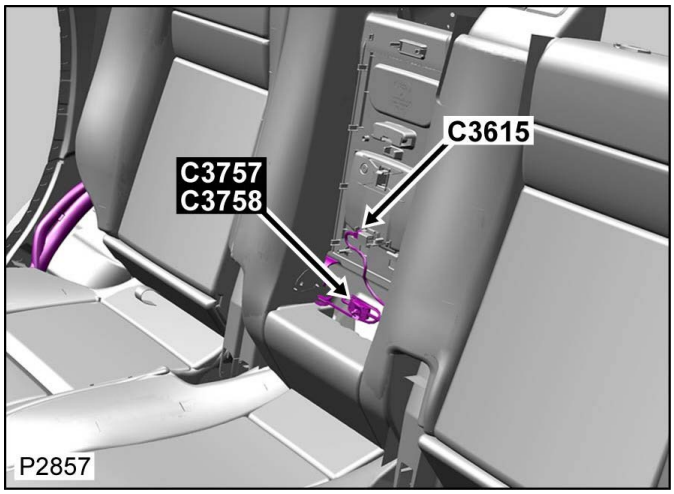


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	YO	499	C3756	418-549-62	-	418-116A	-	418-104	418-112	418-107
2	0.35	N	499	C3756	418-549-62	-	418-116A	-	418-104	418-112	418-107
3	0.35	G	499	C3756	418-549-62	-	418-116A	-	418-104	418-112	418-107
4	0.5	B	499	C3756	418-549-62	-	418-116A	-	418-104	418-112	418-107

Click here to print

Connector: C3758

CONNECTOR HOUSING NOT SERVICEABLE

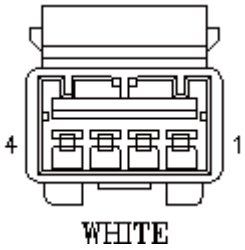

Part No.: YPC10207

Colour: WHITE


Cavities: 4WY

Harness: ARM REST LINK HARNESS

Description: Link harness to link harness

Location: Behind rear seat armrest

Qualifier:

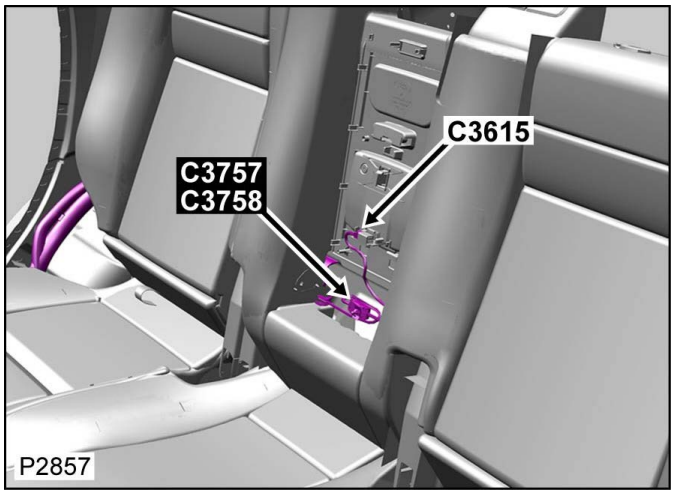

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	YO	499	C3615	418-549-64	-	418-116A	-	418-104	418-112	418-107
2	0.35	N	499	C3615	418-549-64	-	418-116A	-	418-104	418-112	418-107
3	0.35	G	499	C3615	418-549-64	-	418-116A	-	418-104	418-112	418-107
4	0.5	B	499	C3615	418-549-64	-	418-116A	-	418-104	418-112	418-107

Click here to print


Connector: C3759T

CONNECTOR HOUSING NOT SERVICEABLE

Description: Module-Tuner-DAB

Location: Behind luggage compartment carpet RH side

Qualifier:

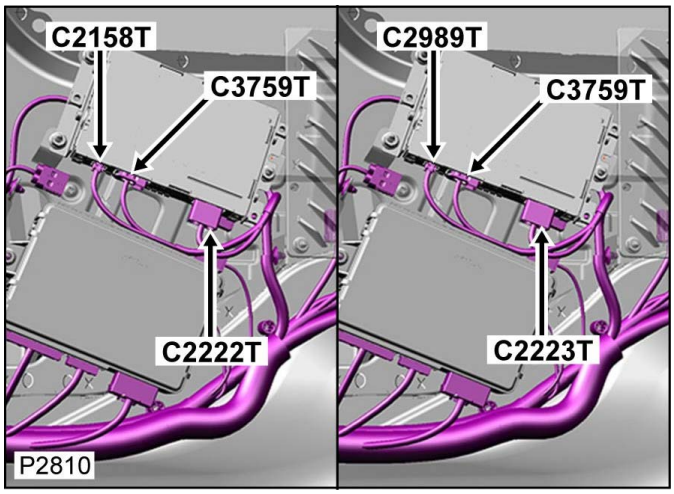

ASSEMBLY

Part No.: XUD812750

Colour: NO COLOUR

Cavities: 1WY

Harness: ICE/NAVIGATION HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	POF	O	658T	C2102T
1	POF	O	866T	C2102T
1	POF	O	662T	C2102T
1	POF	O	869T	C2102T
2	POF	O	658T	C2972T
2	POF	O	866T	C2106
2	POF	O	662T	C2491T
2	POF	O	869T	C2491T

Click here to print


Connector: **C3760T**

CONNECTOR HOUSING SERVICEABLE

Description: **Main harness to telematics harness**

Location: **Behind luggage compartment carpet RH side**

Qualifier:

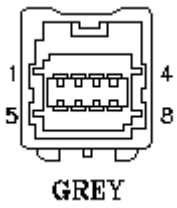


Part No.: **YPC800310**

Colour: **GREY**

Cavities: **8WY**

Harness: **CABIN HARNESS**

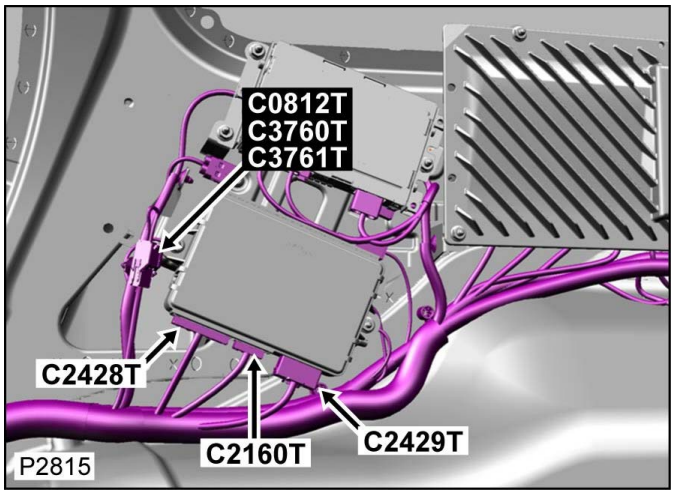

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	YW	478T	S/JOINT SJ2000	-	-	-	-	-	-	-
2	0.5	UG	478TL	C1166L	418-411-47	-	418-116A	418-117	-	418-112	418-107
2	0.5	UG	478TR	C1166R	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.5	YO	478TL	C1166L	418-411-47	-	418-116A	418-117	-	418-112	418-107
3	0.5	YO	478TR	C1166R	418-411-47	-	418-116A	418-117	-	418-112	418-107
4	0.35	YW	478T	S/JOINT SJ2002	-	-	-	-	-	-	-
5	0.35	YU	478T	S/JOINT SJ2001	-	-	-	-	-	-	-
6	0.5	WG	478TL	C1166L	418-411-47	-	418-116A	418-117	-	418-112	418-107
6	0.5	WG	478TR	C1166R	418-411-47	-	418-116A	418-117	-	418-112	418-107
8	0.35	YU	478T	S/JOINT SJ2003	-	-	-	-	-	-	-

Click here to print

Connector: **C3761T**

CONNECTOR HOUSING SERVICEABLE

Description: **Telematics harness to main harness**

Location: **Behind luggage compartment carpet RH side**

Qualifier:




Part No.: **YPC905670**

Colour: **GREY**

Cavities: **8WY**

Harness: **ICE/NAVIGATION HARNESS**

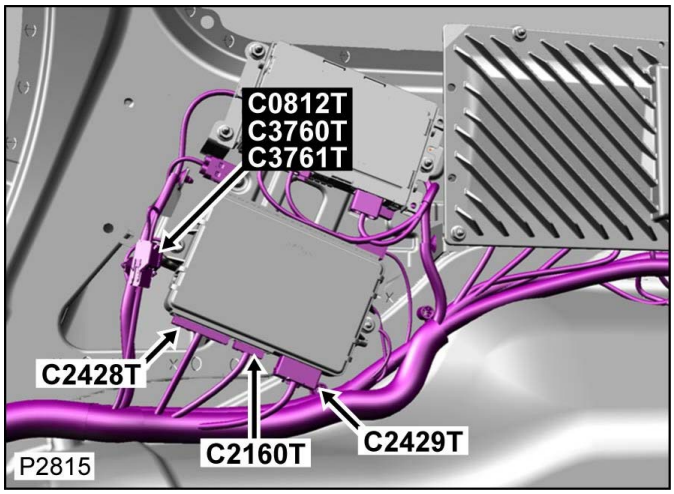

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.35	YW	1011T	S/JOINT SJ2	-	-	-	-	-	-	-
2	0.5	UG	1011T	C0897	418-411-45	-	418-116A	418-117	-	418-112	418-107
3	0.5	YO	1011T	C0897	418-411-45	-	418-116A	418-117	-	418-112	418-107
4	0.35	YW	1011T	S/JOINT SJ2	-	-	-	-	-	-	-
5	0.35	YU	1011T	S/JOINT SJ3	-	-	-	-	-	-	-
6	0.5	WG	1011T	C0897	418-411-45	-	418-116A	418-117	-	418-112	418-107
8	0.35	YU	1011T	S/JOINT SJ3	-	-	-	-	-	-	-

Click here to print

Connector: C3770


CONNECTOR HOUSING NOT SERVICEABLE

Description: AV input panel

Location: Floor console lid

Qualifier:

ASSEMBLY

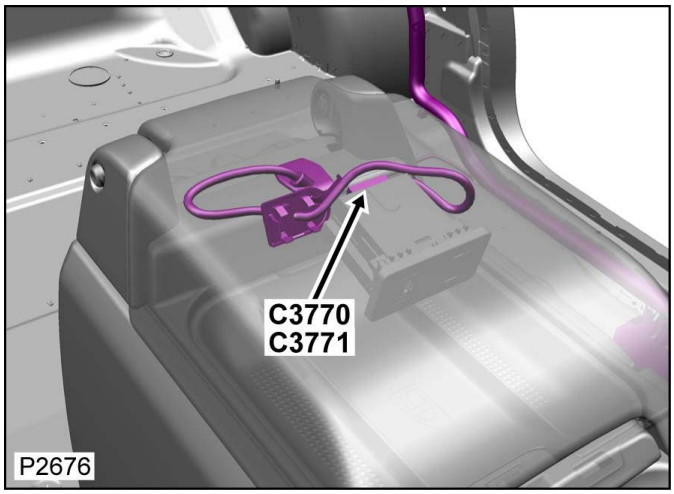

Part No.: XUD815390

Colour: NO COLOUR

Cavities: 4WY

Harness: USB CABLE HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	1020	C3824
2	0.5	N	1020	C3824
3	0.5	P	1020	C3824
4	0.5	B	1020	C3824
5	0.5	SCR	1020	C3824

Click here to print


Connector: C3771


CONNECTOR HOUSING NOT SERVICEABLE

Description: AV input panel

Location: Floor console lid

Qualifier:

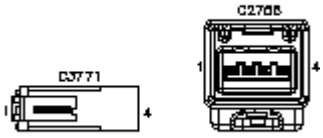

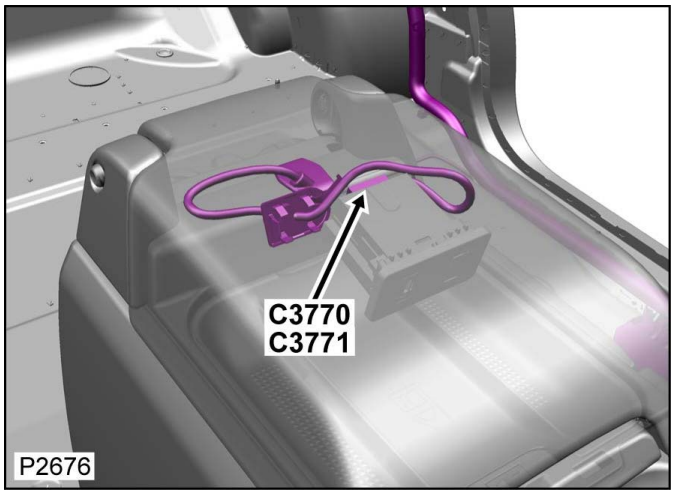

Part No.: XUD815560

Colour: NO COLOUR

Cavities: 1WY

Harness: USB CABLE HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	1021	C3824
2	0.5	N	1021	C3824
3	0.5	P	1021	C3824
4	0.5	B	1021	C3824
5	0.5	SCR	1021	C3824

Click here to print

Connector: C3775L

CONNECTOR HOUSING NOT SERVICEABLE

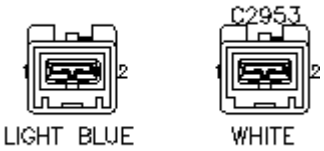

Part No.: XUD816140

Colour: NO COLOUR


Cavities: 1WY

Harness: FRONT SEAT RSE CABLE ASSY HARNESS

Description: Seat link harness to seat harness

Location: Beneath front seat

Qualifier: LH side illustrated RH side similar

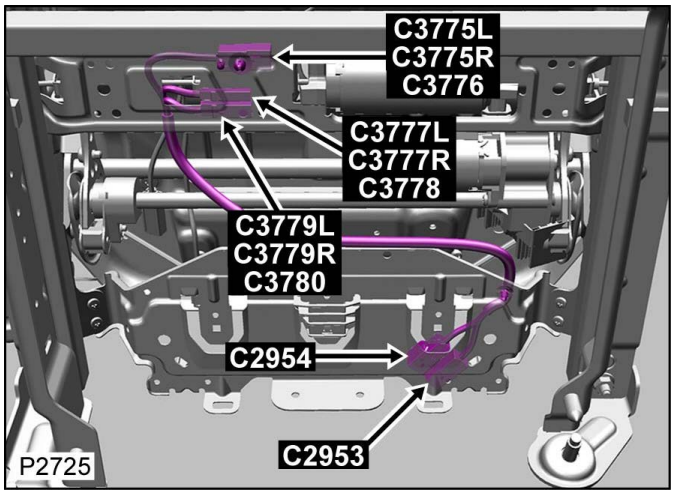


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.08	N	790L	C2953
2	0.08	P	790L	C2953
3	SCR	SCR	790L	C2953

Click here to print

Connector: C3775R

CONNECTOR HOUSING NOT SERVICEABLE

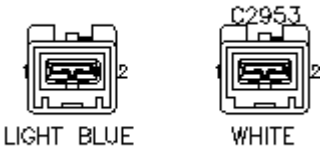

Part No.: XUD816150

Colour: NO COLOUR


Cavities: 1WY

Harness: FRONT SEAT RSE CABLE ASSY HARNESS

Description: Seat harness to seat link harness

Location: Beneath front seat

Qualifier: LH side illustrated RH side similar

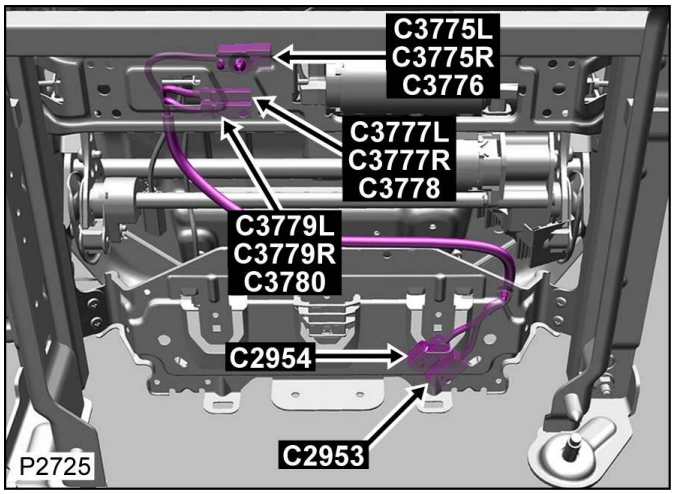

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.08	N	790R	C2953
2	0.08	P	790R	C2953
3	SCR	SCR	790R	C2953

Click here to print


Connector: C3776

CONNECTOR HOUSING NOT SERVICEABLE

Description: Seat harness to seat link harness

Location: Beneath front seat

Qualifier: LH side illustrated RH side similar

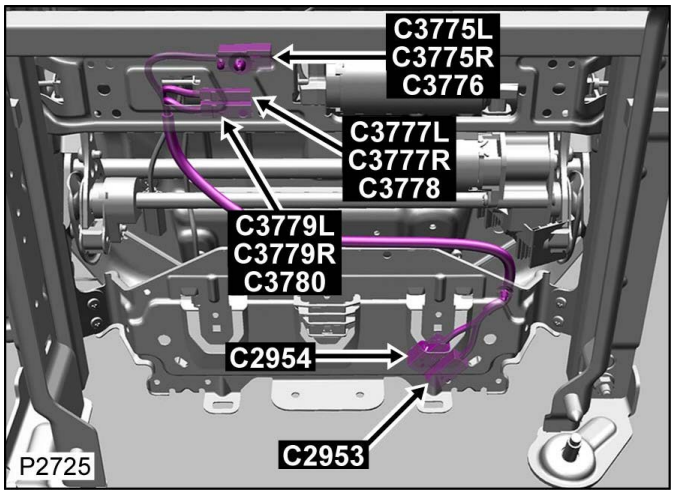

ASSEMBLY

Part No.: CASSY

Colour: NO COLOUR

Cavities: 1WY

Harness: SEAT ASSEMBLIES HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.08	N	425	C2771
2	0.08	P	425	C2771
3	0.08	SCR	425	C2771

Click here to print

Connector: C3777L

CONNECTOR HOUSING NOT SERVICEABLE

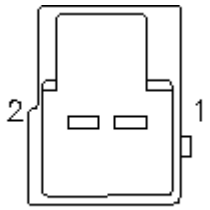

GREEN

Part No.: YPC913870

Colour: GREEN


Cavities: 2WY

Harness: FRONT SEAT RSE CABLE ASSY HARNESS

Description: Seat link harness to seat harness

Location: Beneath front seat

Qualifier: LH side illustrated RH side similar

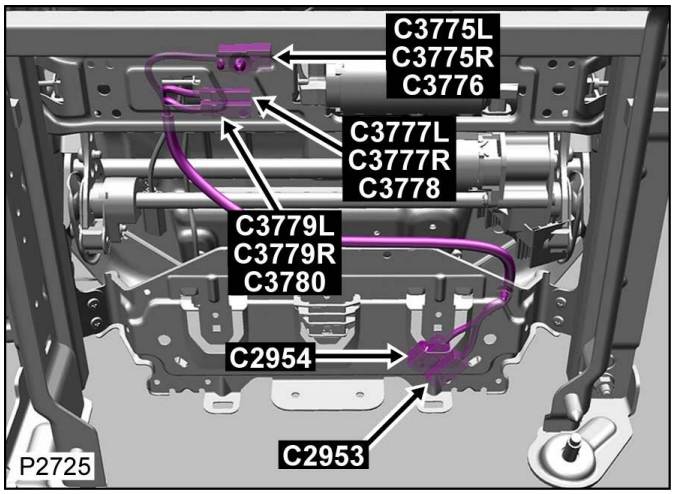


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	NU	790L	C2954
2	0.35	NW	790L	C2954

Click here to print

Connector: C3777R

CONNECTOR HOUSING NOT SERVICEABLE

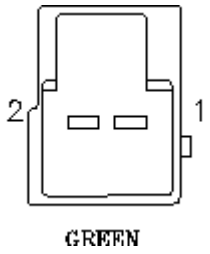

GREEN

Part No.: YPC913870

Colour: GREEN


Cavities: 2WY

Harness: FRONT SEAT RSE CABLE ASSY HARNESS

Description: Seat link harness to seat harness

Location: Beneath front seat

Qualifier: LH side illustrated RH side similar

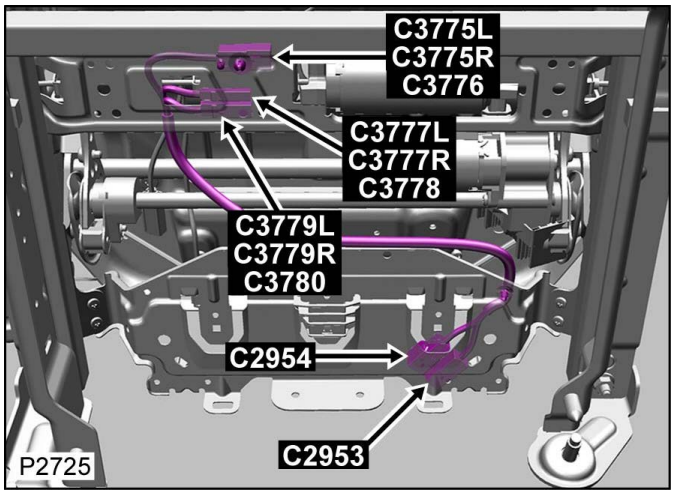

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	NU	790R	C2954
2	0.35	NW	790R	C2954

Click here to print


Connector: C3778

CONNECTOR HOUSING NOT SERVICEABLE

Description: Seat harness to link harness

Location: Beneath front seat

Qualifier: LH side illustrated RH side similar

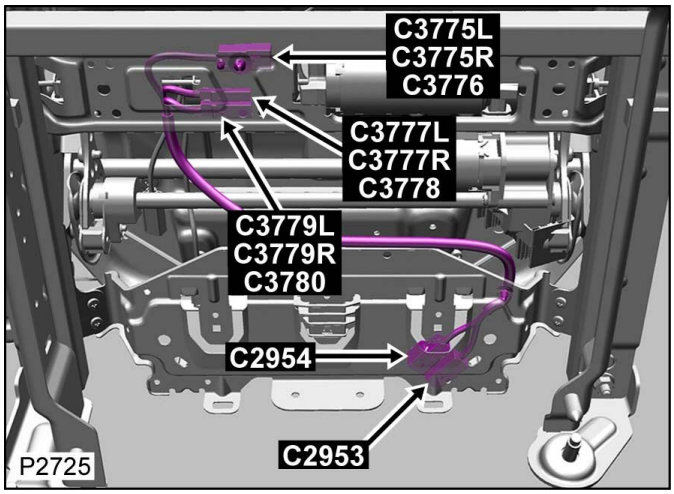

ASSEMBLY

Part No.: CASSY

Colour: NO COLOUR

Cavities: 1WY

Harness: SEAT ASSEMBLIES HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	NU	425	C2772
2	0.35	NU	425	C2772

Click here to print

Connector: C3779L

CONNECTOR HOUSING NOT SERVICEABLE

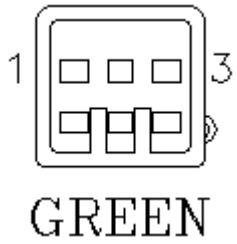

Part No.: YPC913880

Colour: GREEN


Cavities: 3WY

Harness: FRONT SEAT RSE CABLE ASSY HARNESS

Description: Display link harness to seat link harness

Location: Beneath front seat

Qualifier: LH side illustrated RH side similar

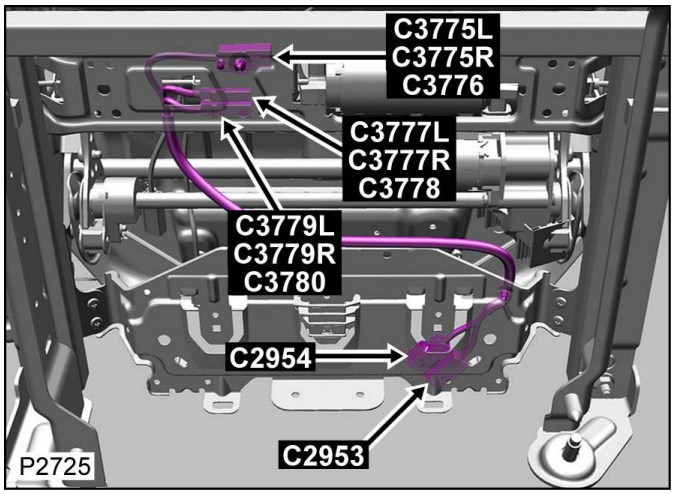


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	WG	790L	C2954
2	0.35	WN	790L	C2954
3	0.35	YS	790L	C2954

Click here to print

Connector: C3779R

CONNECTOR HOUSING NOT SERVICEABLE

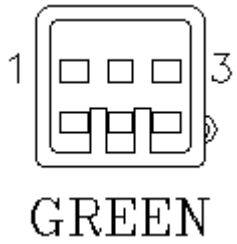

Part No.: YPC913880

Colour: GREEN


Cavities: 3WY

Harness: FRONT SEAT RSE CABLE ASSY HARNESS

Description: Seat link harness to seat harness

Location: Beneath front seat

Qualifier: LH side illustrated RH side similar

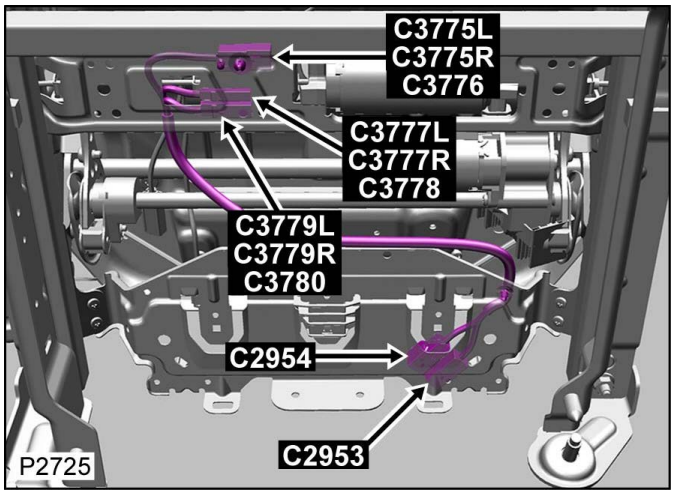

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	WG	790R	C2954
2	0.35	WN	790R	C2954
3	0.35	YS	790R	C2954

Click here to print


Connector: C3780

CONNECTOR HOUSING NOT SERVICEABLE

Description: Seat harness to seat link harness

Location: Beneath front seat

Qualifier: LH side illustrated RH side similar

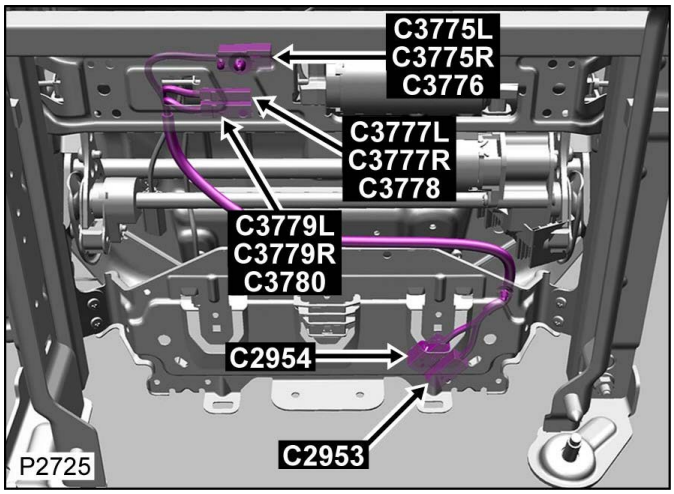

ASSEMBLY

Part No.: CASSY

Colour: NO COLOUR

Cavities: 1WY

Harness: SEAT ASSEMBLIES HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.35	WG	425	C2772
2	0.35	WN	425	C2772
3	0.35	YS	425	C2772

Click here to print


Connector: C3786


CONNECTOR HOUSING NOT SERVICEABLE

Description: Audio head unit

Location: Behind front touch screen display

Qualifier:

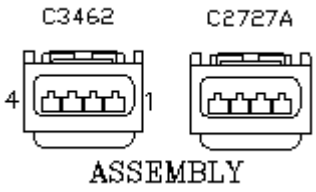

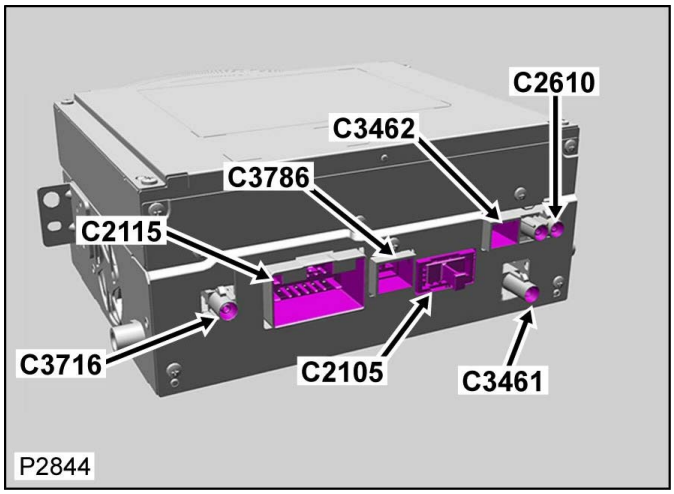

Part No.: XUD815330

Colour: NO COLOUR

Cavities: 4WY

Harness: ICE LINK HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	1021	C3823
2	0.5	P	1021	C3823
3	0.5	N	1021	C3823
4	0.5	B	1021	C3823
5	0.5	SCR	1021	C3823

Click here to print


Connector: C3823


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE link harness to USB link harness

Location: Beneath center console LH side

Qualifier:

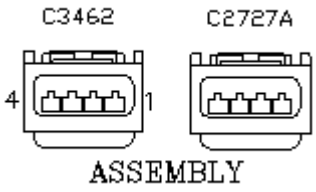

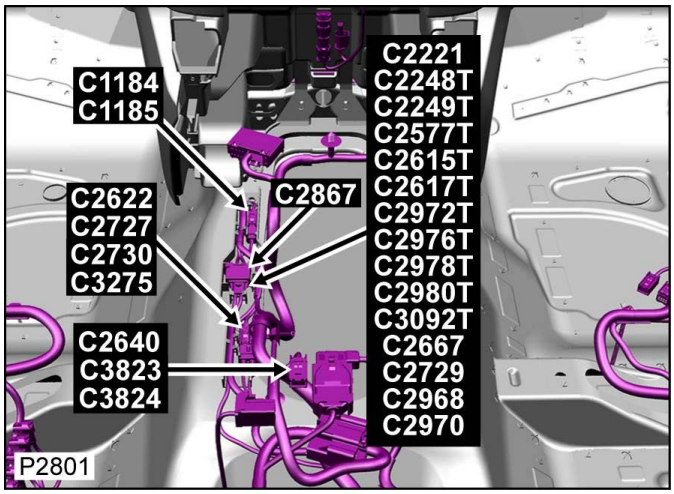

Part No.: XUD815330

Colour: NO COLOUR

Cavities: 4WY

Harness: ICE LINK HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	1021	C3786
2	0.5	P	1021	C3786
3	0.5	N	1021	C3786
4	0.5	B	1021	C3786
5	0.5	SCR	1021	C3786

Click here to print

Connector: C3825T


CONNECTOR HOUSING NOT SERVICEABLE

Description: ICE harness to wireless headset harness

Location: RH 'D' post

Qualifier:

ASSEMBLY

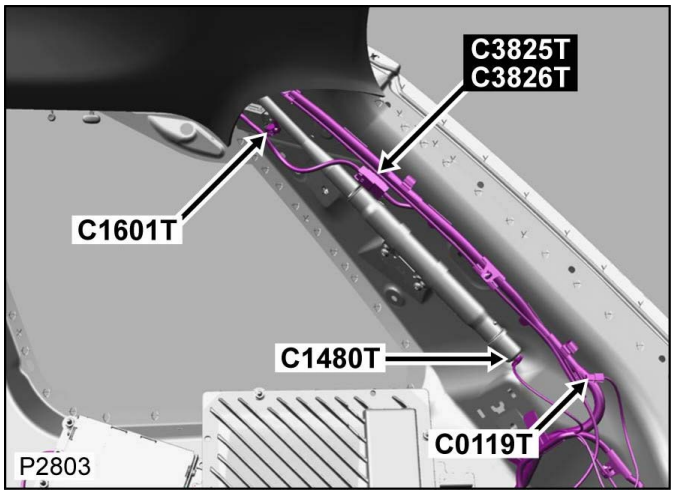

Part No.: XUD815360

Colour: NO COLOUR

Cavities: 4WY

Harness: ICE/NAVIGATION HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	514T	C0493T
2	0.13	N	514T	C0493T
3	0.13	P	514T	C0493T
4	0.5	B	514T	C0493T
5	SCR	SCR	514T	C0493T

Click here to print

Connector: **C3826T**

CONNECTOR HOUSING NOT SERVICEABLE

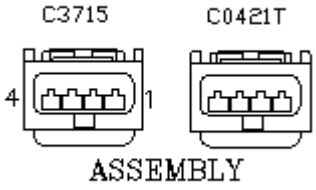

Part No.: XUD815370

Colour: NO COLOUR


Cavities: 4WY

Harness: WHITEFIRE LINK HARNESS

Description: Wireless headset harness to ICE harness

Location: RH 'D' post

Qualifier:

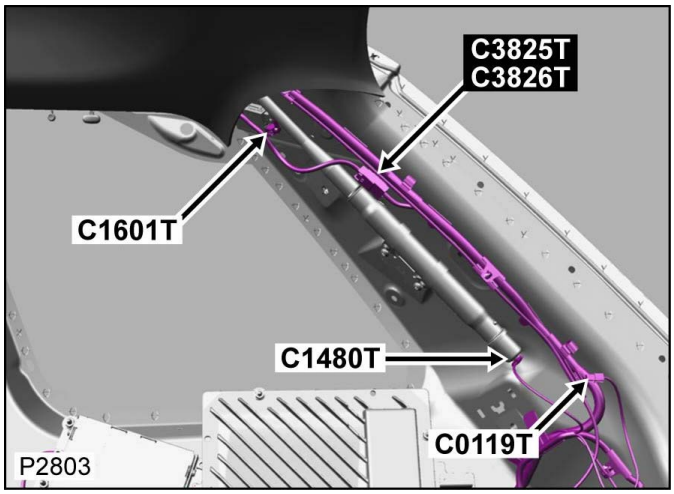

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	0.5	R	499T	C3715
2	0.5	N	499T	C3715
3	0.5	P	499T	C3715
4	0.5	B	499T	C3715
5	0.5	SCR	499T	C3715

Click here to print


Connector: C0056


CONNECTOR HOUSING NOT SERVICEABLE

Description: Motor-Blower-Front

Location: Behind passenger side of Instrument panel

Qualifier: LHD condition illustrated

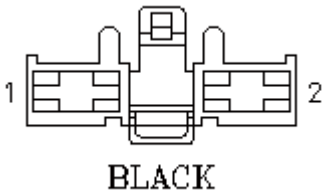

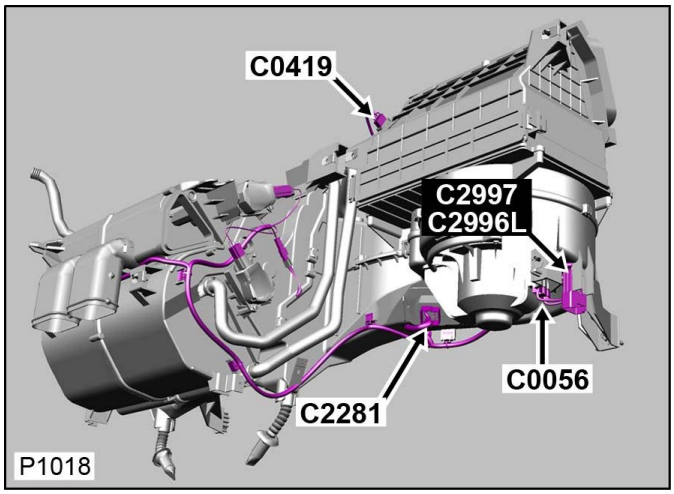

Part No.: YPC909270

Colour: BLACK

Cavities: 2WY

Harness: ATC LHD HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	B	499	C2281
2	4.0	W	499	C2997

Click here to print

Connector: C0178L

CONNECTOR HOUSING NOT SERVICEABLE

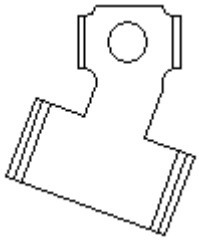

Part No.: YPG800830

Colour: TIN PLATED


Cavities: 1WY

Harness: BATTERY POSITIVE PETROL V8 LHD HARNESS

Description: Starter motor - PV8

Location: RH side of engine

Qualifier:

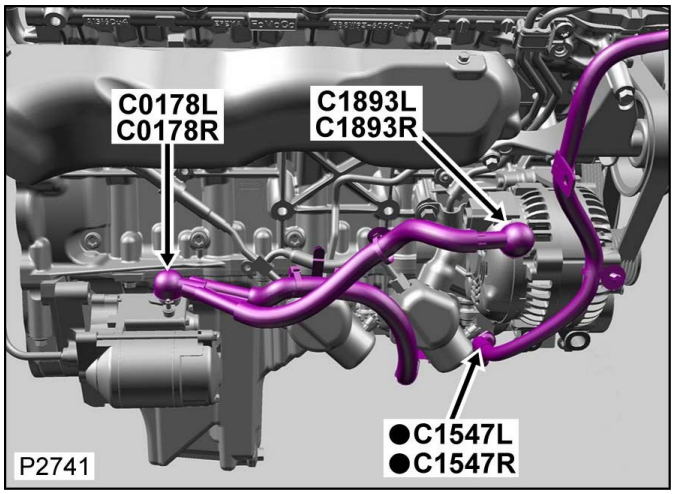


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0	R	ALL	C0192L
1	35.0	R	ALL	C1893L

Click here to print

Connector: C0178M

CONNECTOR HOUSING NOT SERVICEABLE

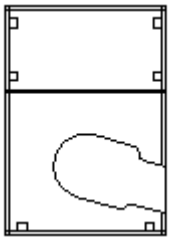

Part No.: YPG800820

Colour: TIN PLATED


Cavities: 1WY

Harness: BATTERY POSITIVE DIESEL V6 3.0L LHD HARNESS

Description: Starter motor - DV6

Location: RH side of engine

Qualifier:

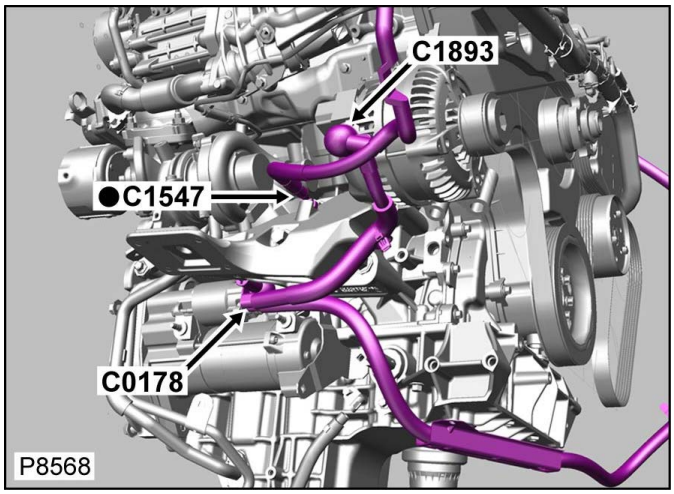

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0T	R	ALL	C0192M
1	35.0T	R	ALL	C1893M

Click here to print


Connector: **C0192L**


CONNECTOR HOUSING NOT SERVICEABLE

Description: Battery - PV8

Location: Passenger side of engine compartment

Qualifier:

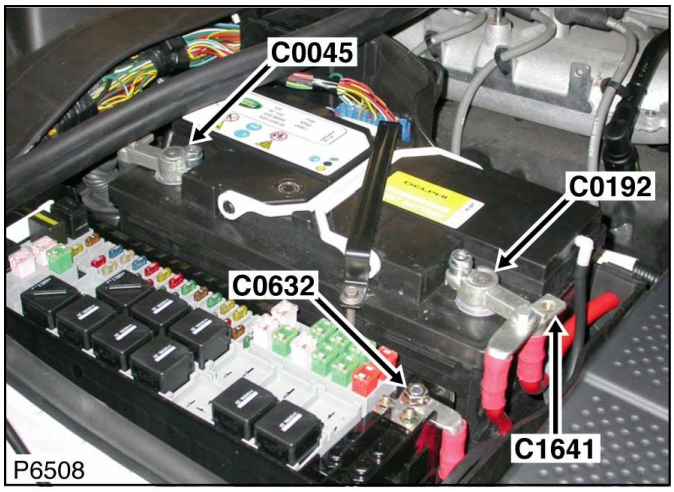

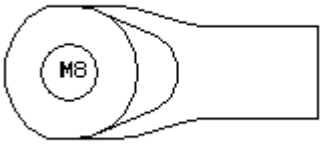

Part No.: YPG800200

Colour: TIN PLATED

Cavities: 1WY

Harness: BATTERY POSITIVE PETROL V8 LHD HARNESS

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0	R	ALL	C0178L

Click here to print


Connector: C0192M


CONNECTOR HOUSING NOT SERVICEABLE

Description: Battery - DV6

Location: Passenger side of engine compartment

Qualifier:

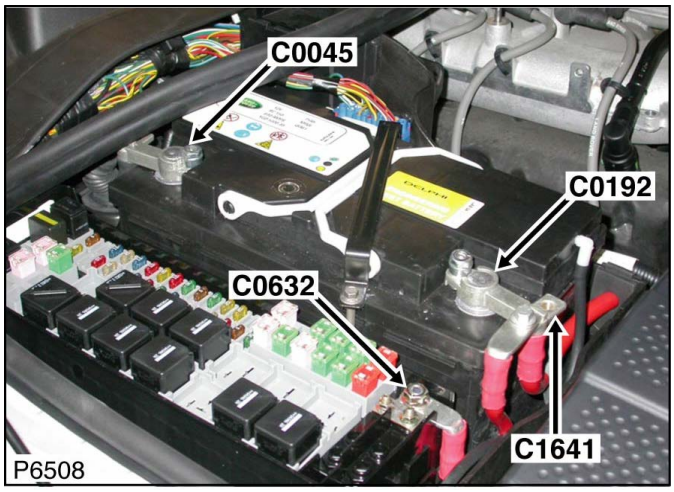

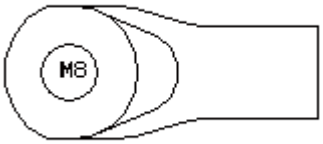

Part No.: YPG800200

Colour: TIN PLATED

Cavities: 1WY

Harness: BATTERY POSITIVE DIESEL V6 3.0L LHD HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	50.0T	R	ALL	C0178M

Click here to print

Connector: **C0417**

CONNECTOR HOUSING NOT SERVICEABLE

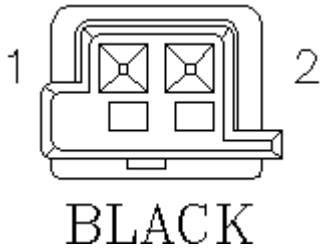

Part No.: YPC801180

Colour: BLACK


Cavities: 2WY

Harness: ATC LHD HARNESS

Description: Sensor-Temperature-Evaporator

Location: Climate control assembly-Passenger side

Qualifier: LHD condition illustrated

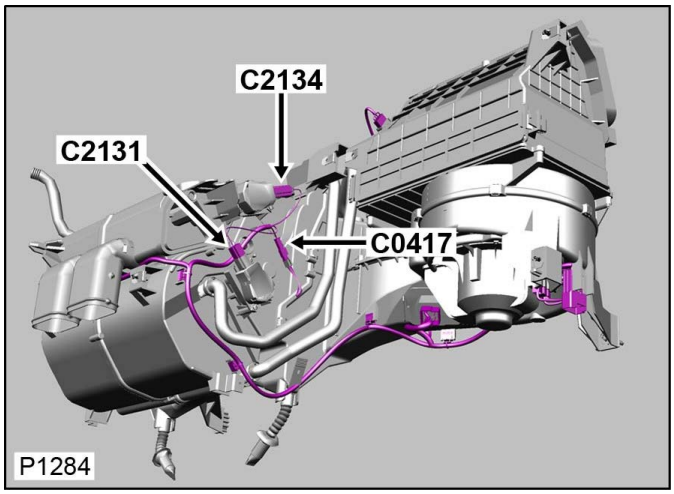

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	NB	499	C3471	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
2	0.5	P	499	S/JOINT SJ3	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print


Connector: C0419

CONNECTOR HOUSING NOT SERVICEABLE

Description: Intake air door motor

Location: Behind passenger side of Instrument panel

Qualifier: LHD condition illustrated

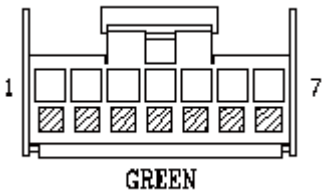


Part No.: YPC106450

Colour: GREEN

Cavities: 7WY

Harness: ATC LHD HARNESS

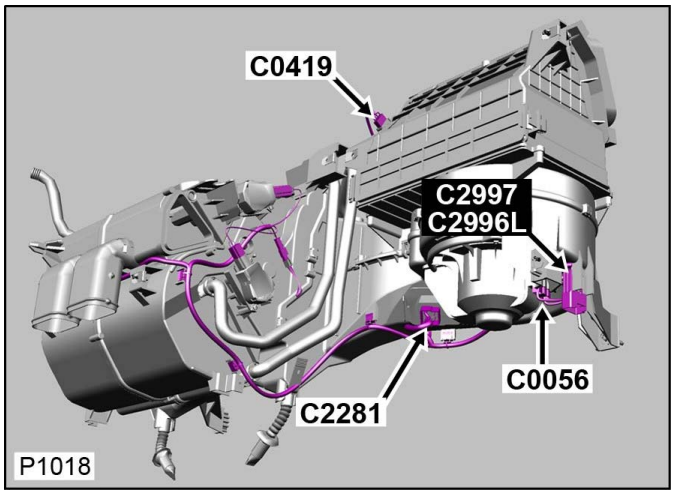


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	P	499	S/JOINT SJ3	418-587-02	-	418-116A	418-117	-	418-112	418-107
3	0.5	N	499	C3471	418-587-02	-	418-116A	418-117	-	418-112	418-107
5	0.5	YB	499	C3471	418-587-02	-	418-116A	418-117	-	418-112	418-107
6	0.5	RW	499	C3471	418-587-02	-	418-116A	418-117	-	418-112	418-107
7	0.5	GB	499	C3471	418-587-02	-	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C0499

CONNECTOR HOUSING NOT SERVICEABLE

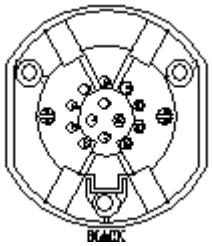

Part No.: XUD800200

Colour: NO COLOUR


Cavities: 1WY

Harness: TOWING SOCKET 13 PIN HARNESS

Description: Trailer pick-up (Europe 13-pin)

Location: Behind Center of rear bumper

Qualifier:

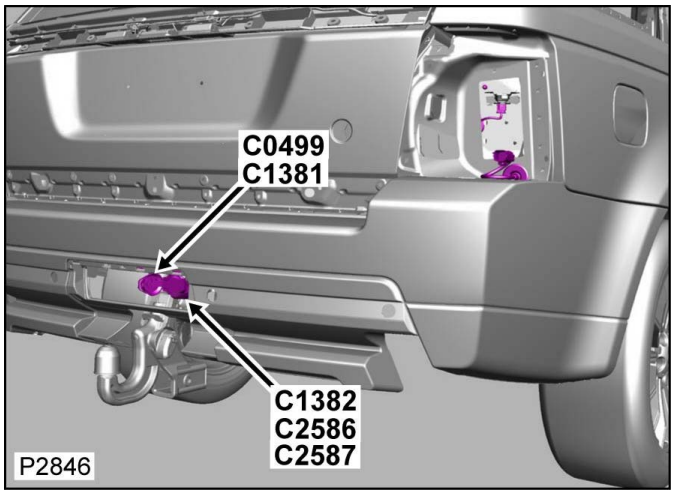

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	Y	ALL	C1414
2	1.5	U	ALL	C1415
3	2.5	W	ALL	C1414
4	2.5	G	ALL	C1414
5	1.5	N	ALL	C1415
6	1.5	R	ALL	C1415
7	1.5	B	ALL	C1415
8	1.5	YN	ALL	C1416
9	2.5	UK	ALL	C1416
10	2.5	RW	ALL	C1416
11	2.5	W	ALL	C1416
13	2.5	W	ALL	C1416

Click here to print

Connector: C0632


CONNECTOR HOUSING NOT SERVICEABLE

Description: Junction-box engine

Location: Passenger side of engine compartment

Qualifier: RHD condition illustrated



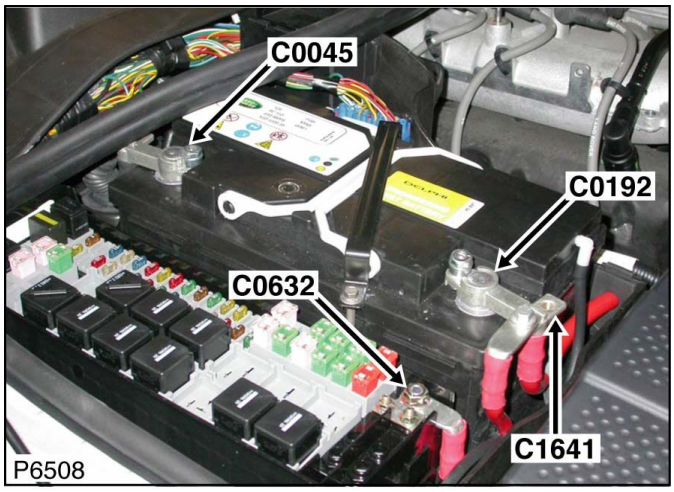

Part No.: YPG800330

Colour: TIN PLATED

Cavities: 1WY

Harness: BATTERY TO FUSEBOX LHD HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	35.0	R	499	C1641

Click here to print

Connector: C0797

CONNECTOR HOUSING NOT SERVICEABLE

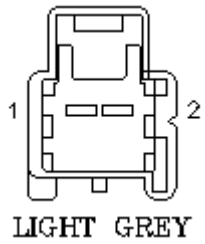

Part No.: YPC903740

Colour: LIGHT GREY


Cavities: 2WY

Harness: ATC LHD HARNESS

Description: Air conditioning (A/C) harness to instrument panel harness

Location: Behind LH side of Instrument panel

Qualifier:

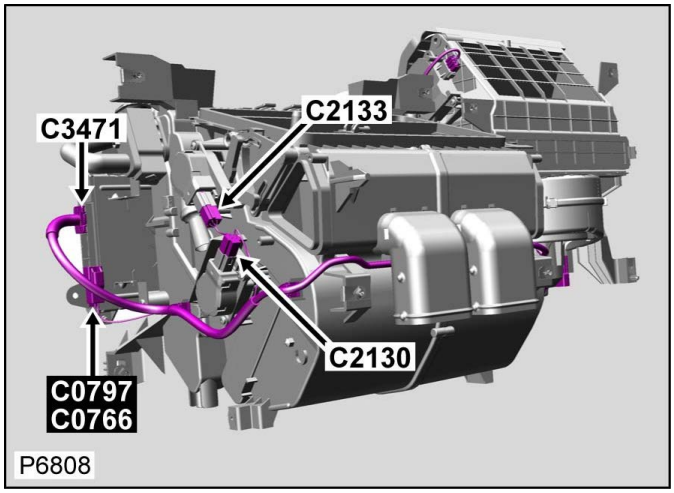

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	WU	499	C3471	418-411-12	-	418-116A	418-117	418-104	418-112	418-107
2	0.5	RY	499	S/JOINT SJ4	418-411-12	-	418-116A	418-117	418-104	418-112	418-107

Click here to print

Connector: C1414

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC800050

Colour: DARK GREY


Cavities: 4WY

Harness: TOWING SOCKET NAS 7 PIN HARNESS

Description: Trailer harness to main harness

Location: Behind LH side of rear bumper

Qualifier:

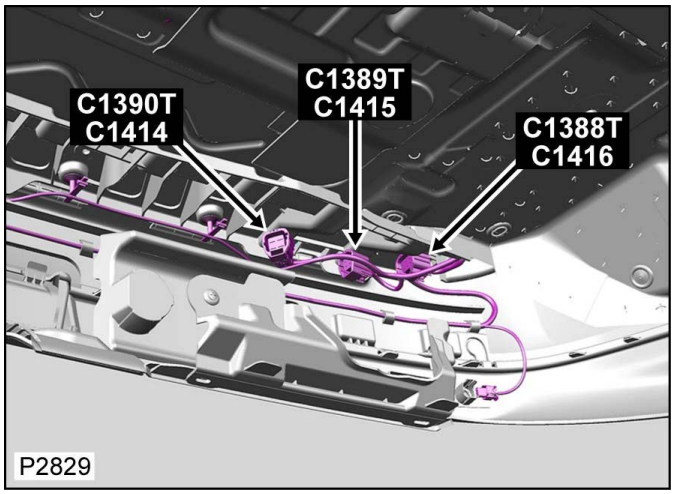

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	O	ALL	C2586
2	6.0	W	ALL	C2586
3	2.5	U	ALL	C2586

Click here to print

Connector: C1414

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC800050

Colour: DARK GREY


Cavities: 4WY

Harness: TOWING SOCKET 13 PIN HARNESS

Description: Trailer harness to main harness

Location: Behind LH side of rear bumper

Qualifier:

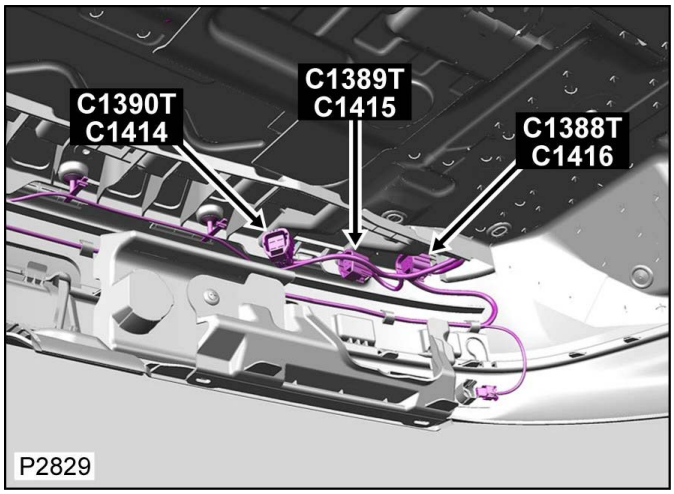


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	W	ALL	C0499
2	2.5	Y	ALL	C0499
3	2.5	G	ALL	C0499

Click here to print

Connector: C1415

CONNECTOR HOUSING NOT SERVICEABLE

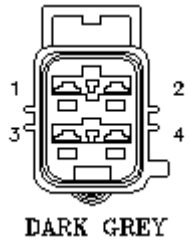

DARK GREY

Part No.: YPC900130

Colour: DARK GREY


Cavities: 4WY

Harness: TOWING SOCKET NAS 7 PIN HARNESS

Description: Trailer harness to main harness

Location: Behind LH side of rear bumper

Qualifier:

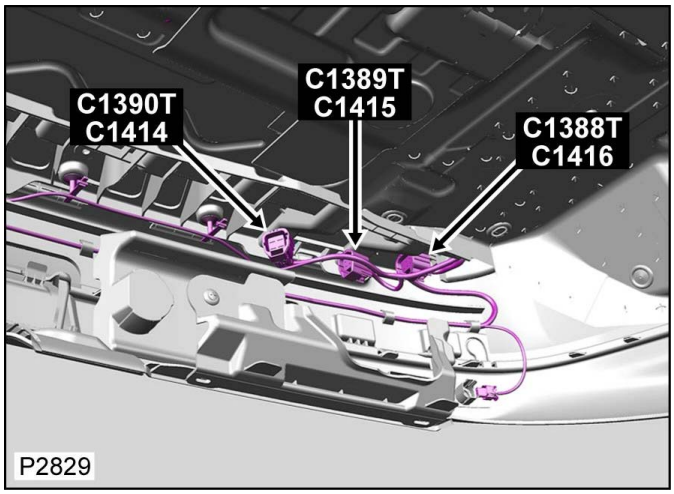


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	BG	ALL	C2586	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
2	2.5	Y	ALL	C2586	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
3	2.5	G	ALL	C2586	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
4	1.5	NW	ALL	C2586	418-411-18	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C1415

CONNECTOR HOUSING NOT SERVICEABLE

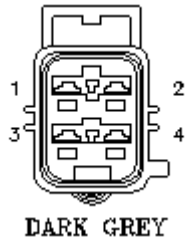

DARK GREY

Part No.: YPC900130

Colour: DARK GREY


Cavities: 4WY

Harness: TOWING SOCKET 13 PIN HARNESS

Description: Trailer harness to main harness

Location: Behind LH side of rear bumper

Qualifier:

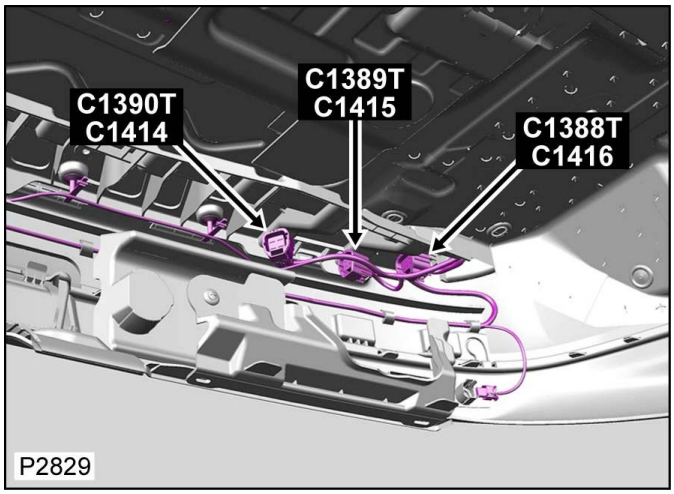

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	1.5	R	ALL	C0499	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
2	1.5	U	ALL	C0499	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	N	ALL	C0499	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
4	1.5	B	ALL	C0499	418-411-18	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: **C1416**

CONNECTOR HOUSING SERVICEABLE



Part No.: YPC900900

Colour: DARK GREY


Cavities: 6WY

Harness: TOWING SOCKET 13 PIN HARNESS

Description: Trailer harness to main harness

Location: Behind LH side of rear bumper

Qualifier:

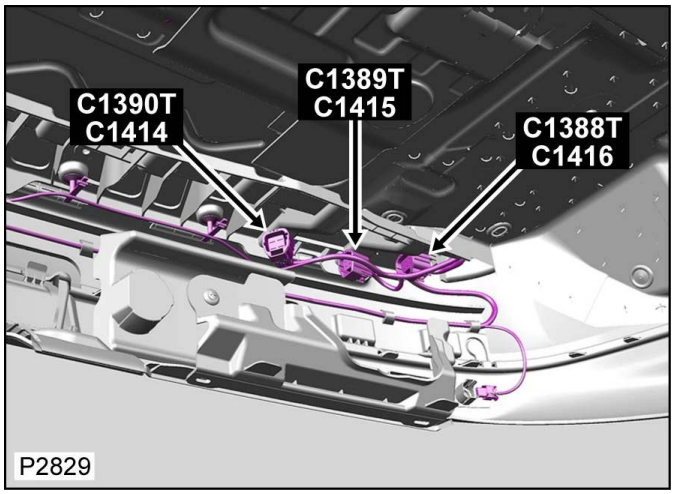

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	2.5	RW	ALL	C0499	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
3	1.5	YN	ALL	C0499	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
4	2.5	UK	ALL	C0499	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
5	2.5	W	ALL	C0499	418-411-18	-	418-116A	418-117	418-104	418-113	418-108
6	2.5	W	ALL	C0499	418-411-18	-	418-116A	418-117	418-104	418-113	418-108

Click here to print

Connector: C1641


CONNECTOR HOUSING NOT SERVICEABLE

Description: Battery

Location: Passenger side of engine compartment

Qualifier: RHD condition illustrated



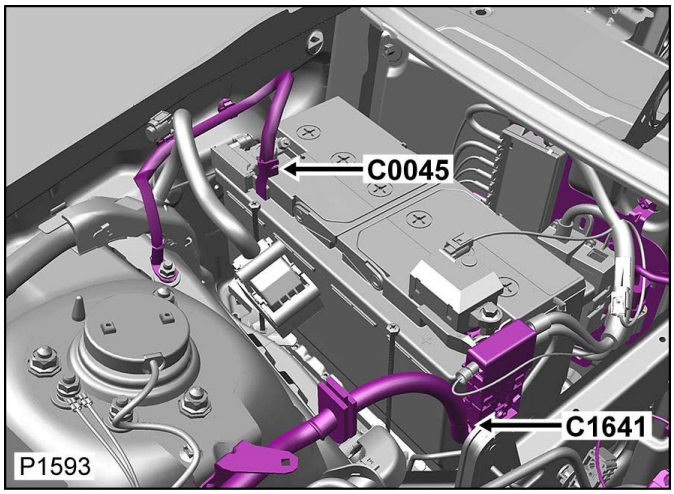

Part No.: YPG800330

Colour: TIN PLATED

Cavities: 1WY

Harness: BATTERY TO FUSEBOX LHD HARNESS


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	35.0	R	499	C0632

Click here to print

Connector: C1893L

CONNECTOR HOUSING NOT SERVICEABLE

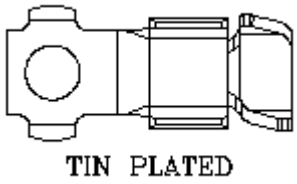

Part No.: YPG900020

Colour: TIN PLATED


Cavities: 1WY

Harness: BATTERY POSITIVE PETROL V8 LHD HARNESS

Description: Alternator-generator - PV8

Location: RH side of engine

Qualifier:

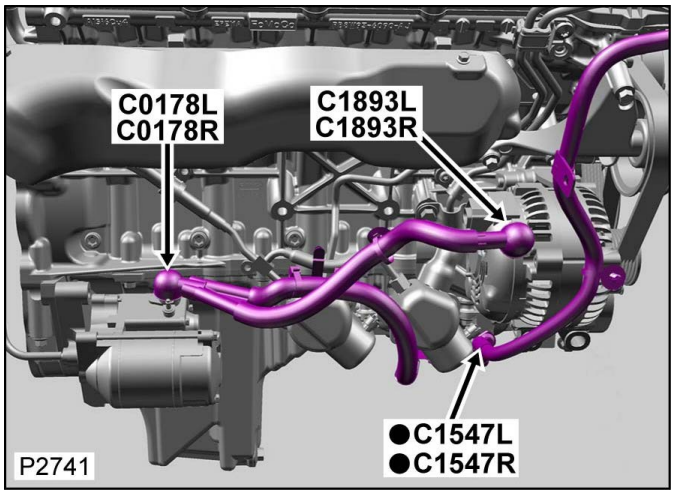


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	35.0	R	ALL	C0178L

Click here to print

Connector: C1893M

CONNECTOR HOUSING NOT SERVICEABLE

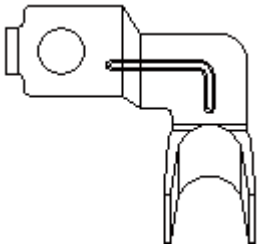

Part No.: YPG800150

Colour: TIN PLATED


Cavities: 1WY

Harness: BATTERY POSITIVE DIESEL V6 3.0L LHD HARNESS

Description: Alternator-generator - DV6 (3.0L)

Location: RH side of engine

Qualifier:

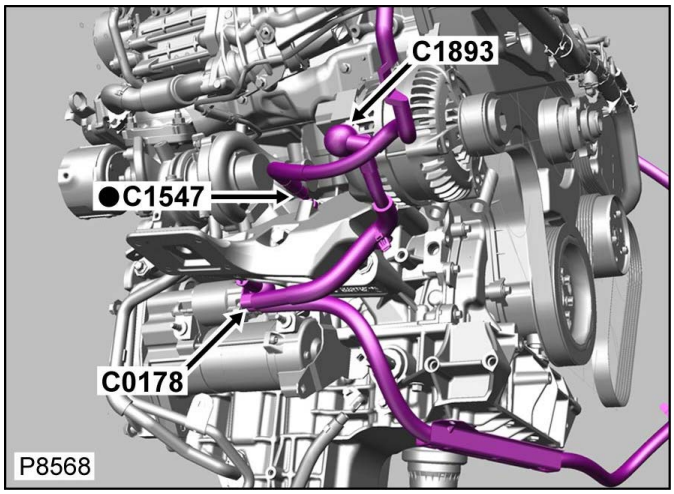


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	35.0T	R	ALL	C0178M

Click here to print

Connector: C2130

CONNECTOR HOUSING NOT SERVICEABLE

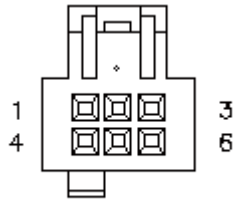

BLUE

Part No.: YPH900970

Colour: BLUE


Cavities: 6WY

Harness: ATC LHD HARNESS

Description: LH air temperature door motor

Location: Behind LH side of Instrument panel

Qualifier:

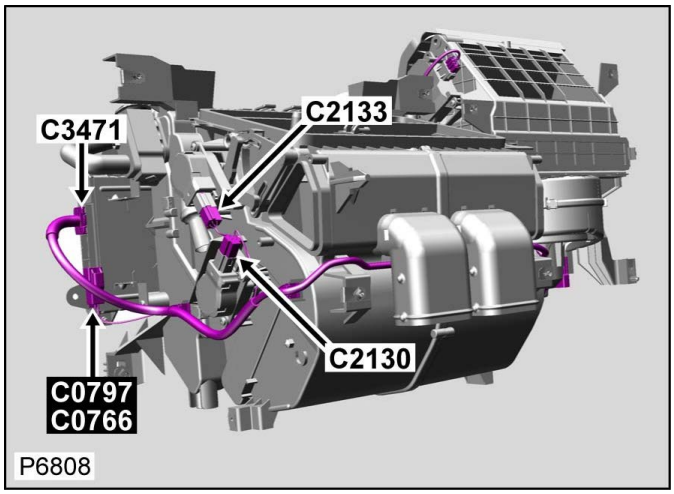


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	0.5	Y	499	C2131	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.5	GY	499	S/JOINT SJ1	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
5	0.5	U	499	C2133	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
6	0.5	O	499	S/JOINT SJ2	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2131

CONNECTOR HOUSING NOT SERVICEABLE

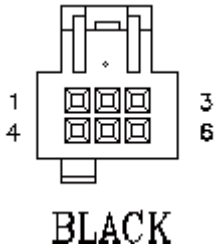

BLACK

Part No.: YPH900960

Colour: BLACK


Cavities: 6WY

Harness: ATC LHD HARNESS

Description: RH air temperature door motor

Location: Climate control assembly-Passenger side

Qualifier: LHD condition illustrated

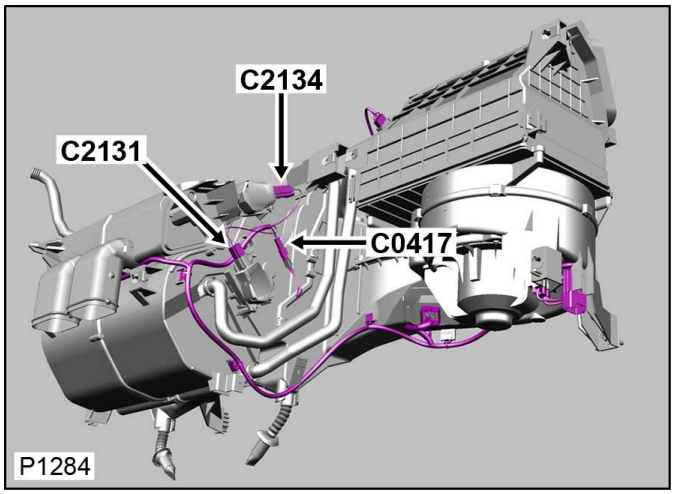


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	0.5	RG	499	C2134	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.5	GY	499	S/JOINT SJ1	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
5	0.5	Y	499	C2130	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
6	0.5	O	499	S/JOINT SJ2	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2133

CONNECTOR HOUSING NOT SERVICEABLE

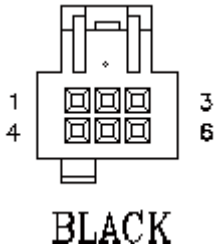

BLACK

Part No.: YPH900960

Colour: BLACK


Cavities: 6WY

Harness: ATC LHD HARNESS

Description: Motor-air distribution-Feet / face

Location: Behind LH side of Instrument panel

Qualifier:

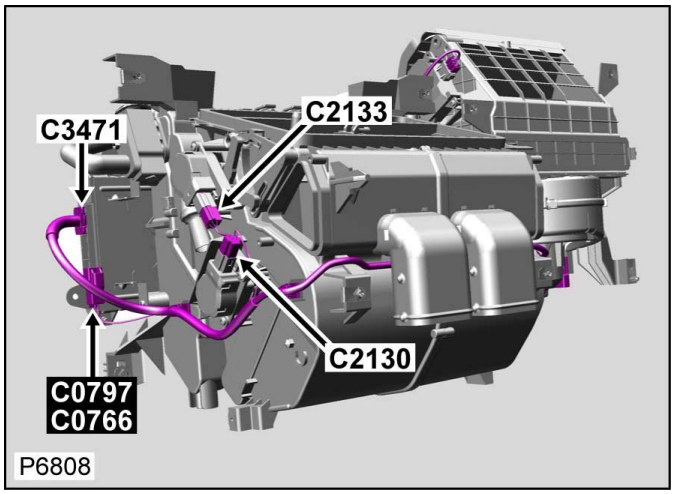


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	0.5	U	499	C2130	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.5	GY	499	S/JOINT SJ1	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
6	0.5	O	499	S/JOINT SJ2	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2134

CONNECTOR HOUSING NOT SERVICEABLE

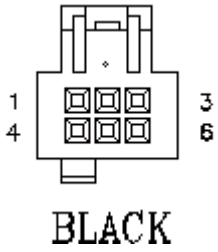

BLACK

Part No.: YPH900960

Colour: BLACK


Cavities: 6WY

Harness: ATC LHD HARNESS

Description: Screen air distribution door motor

Location: Climate control assembly-Passenger side

Qualifier: LHD condition illustrated

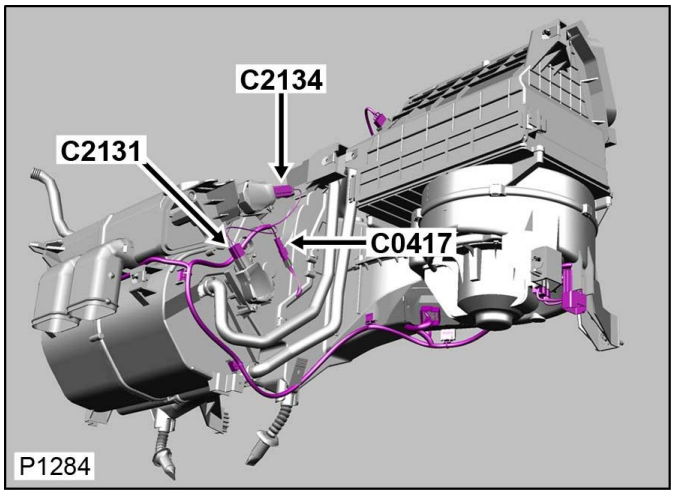


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
2	0.5	RY	499	S/JOINT SJ4	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
4	0.5	GY	499	S/JOINT SJ1	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
5	0.5	RG	499	C2131	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107
6	0.5	O	499	S/JOINT SJ2	418-549-04	418-616 418-595	418-116A	418-117	-	418-112	418-107

Click here to print

Connector: C2281

CONNECTOR HOUSING NOT SERVICEABLE

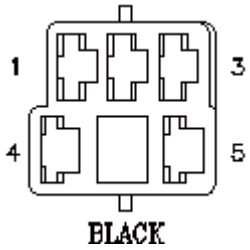

Part No.: YPC119190

Colour: BLACK


Cavities: 5WY

Harness: ATC LHD HARNESS

Description: Module-Blower-motor control-Front

Location: Behind passenger side of Instrument panel

Qualifier: LHD condition illustrated

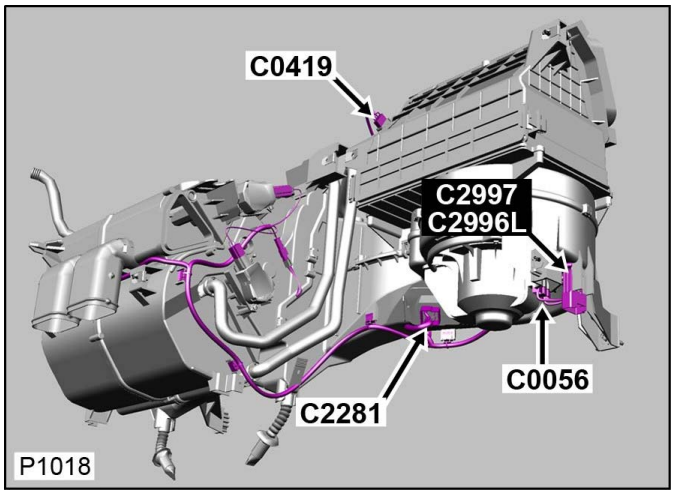


Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	LGB	499	C3471	418-549-51	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	G	499	C3471	418-549-51	-	418-116A	418-117	418-104	418-112	418-107
4	4.0	R	499	C2997	-	-	-	-	-	-	-
5	4.0	B	499	C0056	-	-	-	-	-	-	-

Click here to print

Connector: C2586

CONNECTOR HOUSING NOT SERVICEABLE

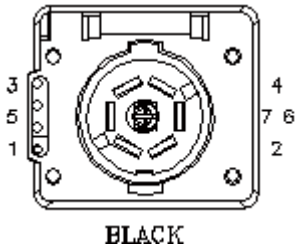

BLACK

Part No.: YPC906350

Colour: BLACK


Cavities: 7WY

Harness: TOWING SOCKET NAS 7 PIN HARNESS

Description: Trailer pick-up (NAS 7-pin)

Location: Behind Center of rear bumper

Qualifier:

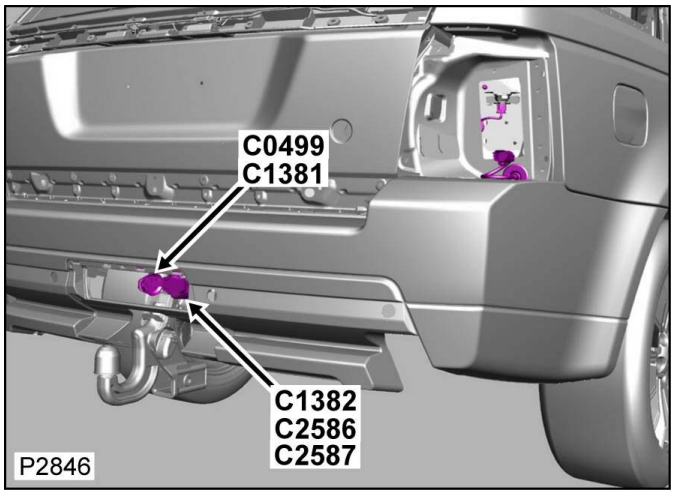


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	6.0	W	ALL	C1414
2	2.5	U	ALL	C1414
3	1.5	NW	ALL	C1415
4	4.0	O	ALL	C1414
5	2.5	Y	ALL	C1415
6	2.5	G	ALL	C1415
7	1.5	BG	ALL	C1415

Click here to print

Connector: C2586

CONNECTOR HOUSING NOT SERVICEABLE

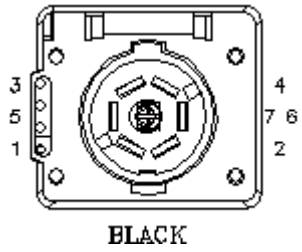

BLACK

Part No.: YPC906350

Colour: BLACK


Cavities: 7WY

Harness: LINK TRAILER NAS 7 PIN + 4 PIN HARNESS

Description: Trailer pick-up (NAS 7-pin)

Location: Behind Center of rear bumper

Qualifier:

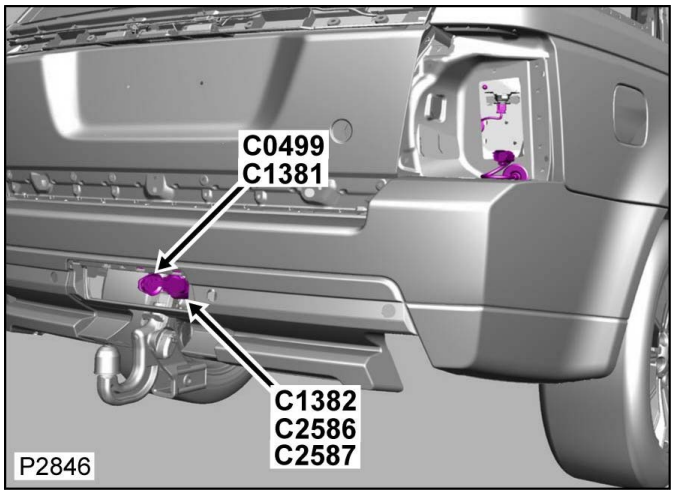


Wire Chart

CAV	CSA	COL	CCT	DESTN
1	6.0	W	-	C2587
3	1.5	R	-	C2587
5	2.5	Y	-	C2587
6	2.5	G	-	C2587

Click here to print

Connector: C2587

CONNECTOR HOUSING NOT SERVICEABLE

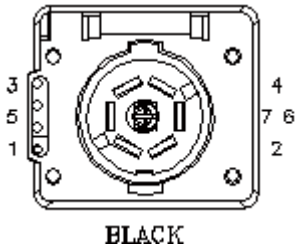

BLACK

Part No.: YPC906350

Colour: BLACK


Cavities: 7WY

Harness: LINK TRAILER NAS 7 PIN + 4 PIN HARNESS

Description: Trailer pick-up (NAS 7-pin)

Location: Behind Center of rear bumper

Qualifier:

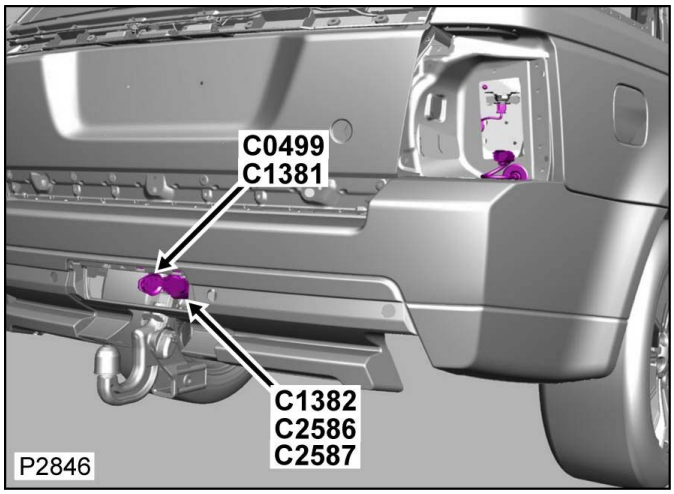

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	2.5	G	-	C2586
2	2.5	Y	-	C2586
3	1.5	R	-	C2586
4	6.0	W	-	C2586

Click here to print

Connector: C2997

CONNECTOR HOUSING NOT SERVICEABLE



Part No.: YPC119010

Colour: NATURAL


Cavities: 2WY

Harness: ATC LHD HARNESS

Description: Air conditioning (A/C) harness to engine compartment harness

Location: Behind passenger side of Instrument panel

Qualifier: LHD condition illustrated

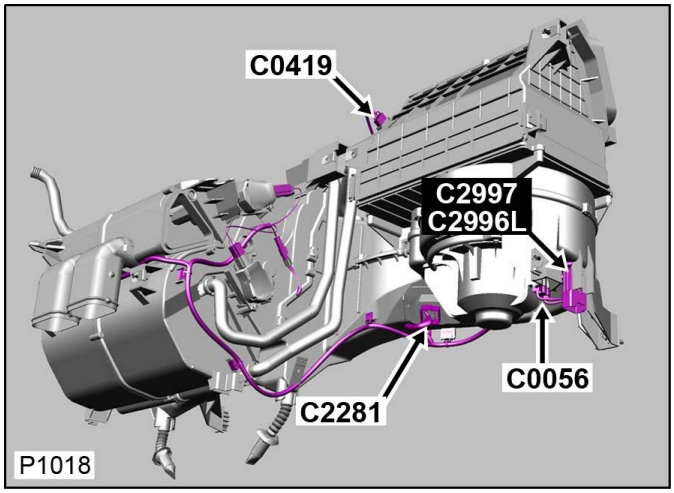

Wire Chart

CAV	CSA	COL	CCT	DESTN
1	4.0	R	499	C2281
2	4.0	W	499	C0056

Click here to print

Connector: C3471

CONNECTOR HOUSING NOT SERVICEABLE



NATURAL

Part No.: YPC909490

Colour: NATURAL


Cavities: 30WY

Harness: ATC LHD HARNESS

Description: Module-Climate Control

Location: Climate control assembly-Driver side

Qualifier:

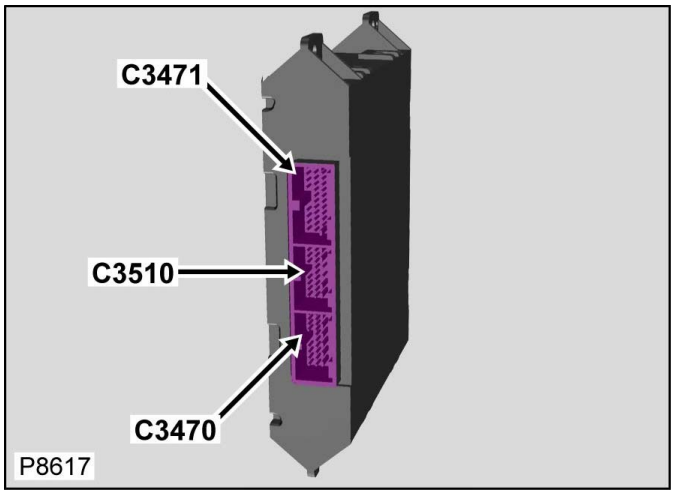

Wire Chart and Service Repair Kit Information

CAV	CSA	COL	CCT	DESTN	Pre-Terminated Lead	Extract Tool	Crimpers	Wire Stripper	Heat Shrink Sleeve	Ident Sleeve	Splice
1	0.5	GY	499	S/JOINT SJ1	418-411-33	-	418-116A	418-117	418-104	418-112	418-107
3	0.5	N	499	C0419	-	-	-	-	-	-	-
5	0.5	NB	499	C0417	-	-	-	-	-	-	-
7	0.5	LGB	499	C2281	-	-	-	-	-	-	-
9	0.5	GB	499	C0419	-	-	-	-	-	-	-
11	0.5	RY	499	S/JOINT SJ4	-	-	-	-	-	-	-
13	0.5	WU	499	C0797	-	-	-	-	-	-	-
17	0.5	YB	499	C0419	-	-	-	-	-	-	-
19	0.5	G	499	C2281	-	-	-	-	-	-	-
21	0.5	RW	499	C0419	-	-	-	-	-	-	-
25	0.5	O	499	S/JOINT SJ2	-	-	-	-	-	-	-
26	0.5	P	499	S/JOINT SJ3	-	-	-	-	-	-	-